

## **Industrial Automation Headquarters**

Delta Electronics, Inc. Taoyuan Technology Center No.18, Xinglong Rd., Taoyuan District, Taoyuan City 33068, Taiwan TEL: 886-3-362-6301 / FAX: 886-3-371-6301

## Asia

Delta Electronics (Shanghai) Co., Ltd. No.182 Minyu Rd., Pudong Shanghai, P.R.C. Post code : 201209 TEL: 86-21-6872-3988 / FAX: 86-21-6872-3996 Customer Service: 400-820-9595

### Delta Electronics (Japan), Inc.

Tokyo Office Industrial Automation Sales Department 2-1-14 Shibadaimon, Minato-ku Tokyo, Japan 105-0012 TEL: 81-3-5733-1155 / FAX: 81-3-5733-1255

## Delta Electronics (Korea), Inc.

Seoul Office 1511, 219, Gasan Digital 1-Ro., Geumcheon-gu, Seoul, 08501 South Korea TEL: 82-2-515-5305 / FAX: 82-2-515-5302

**Delta Energy Systems (Singapore) Pte Ltd.** 4 Kaki Bukit Avenue 1, #05-04, Singapore 417939 TEL: 65-6747-5155 / FAX: 65-6744-9228

Delta Electronics (India) Pvt. Ltd. Plot No.43, Sector 35, HSIIDC Gurgaon, PIN 122001, Haryana, India TEL: 91-124-4874900 / FAX : 91-124-4874945

Delta Electronics (Thailand) PCL. 909 Soi 9, Moo 4, Bangpoo Industrial Estate (E.P.Z), Pattana 1 Rd., T.Phraksa, A.Muang, Samutprakarn 10280, Thailand TEL: 66-2709-2800 / FAX : 662-709-2827

Delta Electronics (Australia) Pty Ltd. Unit 20-21/45 Normanby Rd., Notting Hill Vic 3168, Australia TEL: 61-3-9543-3720

Americas Delta Electronics (Americas) Ltd. Raleigh Office P.O. Box 12173, 5101 Davis Drive, Research Triangle Park, NC 27709, U.S.A. TEL: 1-919-767-3813 / FAX: 1-919-767-3969

#### Delta Greentech (Brasil) S/A

São Paulo Office Rua Itapeva, 26 – 3° Andar - Bela Vista CEP: 01332-000 – São Paulo – SP - Brasil TEL: 55-11-3530-8643 / 55-11-3530-8640

#### Delta Electronics International Mexico S.A. de C.V. Mexico Office Gustavo Baz No. 309 Edificio E PB 103

Colonia La Loma, CP 54060 Tlalnepantla, Estado de México TEL: 52-55-3603-9200

## EMEA

## Headquarters: Delta Electronics (Netherlands) B.V.

Sales: Sales.IA.EMEA@deltaww.com Marketing: Marketing.IA.EMEA@deltaww.com Technical Support: iatechnicalsupport@deltaww.com Customer Support: Customer-Support@deltaww.com Service: Service.IA.emea@deltaww.com TEL: +31(0)40 800 3900

### BENELUX: Delta Electronics (Netherlands) B.V.

De Witbogt 20,5652 AG Eindhoven, The Netherlands Mail: Sales.IA.Benelux@deltaww.com TEL: +31(0)40 800 3900

#### **DACH: Delta Electronics (Netherlands) B.V.** Coesterweg 45, D-59494 Soest, Germany

Mail: Sales.IA.DACH@deltaww.com TEL: +49(0)2921 987 0

## France: Delta Electronics (France) S.A.

ZI du bois Challand 2,15 rue des Pyrénées, Lisses, 91090 Evry Cedex, France Mail: Sales.IA.FR@deltaww.com TEL: +33(0)1 69 77 82 60

#### Iberia: Delta Electronics Solutions (Spain) S.L.U

Ctra. De Villaverde a Vallecas, 265 1º Dcha Ed. Hormigueras – P.I. de Vallecas 28031 Madrid TEL: +34(0)91 223 74 20 Carrer Llacuna 166, 08018 Barcelona, Spain

## Italy: Delta Electronics (Italy) S.r.l.

Via Meda 2–22060 Novedrate(CO) Piazza Grazioli 18 00186 Roma Italy Mail: Sales.IA.Italy@deltaww.com TEL: +39 039 8900365

Mail: Sales.IA.Iberia@deltaww.com

#### Russia: Delta Energy System LLC

Vereyskaya Plaza II, office 112 Vereyskaya str. 17 121357 Moscow Russia Mail: Sales.IA.RU@deltaww.com TEL: +7 495 644 3240

### Turkey: Delta Greentech Elektronik San. Ltd. Sti. (Turkey)

Şerifali Mah. Hendem Cad. Kule Sok. No:16-A 34775 Ümraniye – İstanbul Mail: Sales.IA.Turkey@deltaww.com TEL: + 90 216 499 9910

## GCC: Delta Energy Systems AG (Dubai BR)

P.O. Box 185668, Gate 7, 3rd Floor, Hamarain Centre Dubai, United Arab Emirates Mail: Sales.IA.MEA@deltaww.com TEL: +971(0)4 2690148

#### Egypt + North Africa: Delta Electronics

Unit 318, 3rd Floor, Trivium Business Complex, North 90 street, New Cairo, Cairo, Egypt Mail: Sales.IA.MEA@deltaww.com





# AS500C Series Motion Controller Operation Manual

AS-0242720-02 www.deltaww.com



# AS500C Series Motion Controller Operation Manual

Chapte	er 1 Preface	1-1
1.1	Explanation of Symbols in This Manual	1-2
1.2	Revision History	1-2
Chapte	er 2 Overview	2-1
2.1	Product Description	2-2
2.2	Functions	2-2
2.3	Profile and Components	2-3
Chapte	er 3 Specifications	3-1
3.1	Function Specifications	3-2
3.1	1.1 Specifications	.3-2
	1.2 Devices and Data Types	
	3.1.2.1 Devices	
	3.1.2.2 Valid Ranges of Devices	
	3.1.2.3 Latched Devices	
3	3.1.2.4 Data Types and Valid Ranges Supported	.3-7
3.2	Electrical Specifications	3-8
Chapte	er 4 System Architecture	4-1
4.1	System Constitution	4-2
4.2	Power Supply	4-2
4.3	Right-side Extension	4-2
4.3	3.1 Connectable Right-side Extension Modules	.4-2
4.3	Allocation of Right-side Extension Module Addresses	.4-5
4.4	Connectable Servo Drives	4-5
4.5	SD Memory Card	4-7
4.5	5.1 Model and Specification	. 4-7
Chapte	er 5 Installation	5-1
5.1	Dimensions	5-2
5.1		
5.1	1.2 Dimensions of Right-side Extension Module	.5-2
Б 1	.3 Connecting to the Right-side Extension Module	5-3

5.1.4	Installing and Removing the SD Card	5-4
5.1.5	Installing and Replacing the Button Cell Battery	5-5
5.2 In	stalling the Module in the Control Cabinet	5-8
5.2.1	Installing the Module to DIN rail	5-8
5.2.2	Illustration of Installation Inside the Control Cabinet	5-8
5.2.3	Environmental Temperature in the Control Cabinet	5-9
5.2.4	Actions for Anti-interference	5-9
5.2.5	Dimension Requirement in the Control Cabinet	5-9

# Chapter 6 Wiring, Communication Setting and Network Construction 6-1

6.1 Wi	iring	6-3
6.1.1	Power Supply	6-3
6.1.2	Safety Circuit Wiring	6-4
6.2 In	put Point and Output Point Wiring	6-6
6.2.1	Function that Input Points Support	
6.2.2	Input Point Wiring	6-6
6.2.3	Output Point Wiring	6-9
6.3 RS	-485 Communication Port	6-10
6.3.1	Function that RS-485 Port Supports	6-10
6.3.2	Definitions of RS-485 Port Pins	6-10
6.3.3	RS-485 Hardware Connection	6-10
6.3.4	Supported Function Codes and Exception Codes	6-11
6.4 RS	-232 Communication Port	
6.4.1	Function that RS-232 Port Supports	6-13
6.4.2	Definitions of RS-232 Port Pins	6-13
6.4.3	RS-232 Hardware Connection	
6.4.4	Supported Function Codes and Exception Codes	6-14
6.5 SS	I Absolute Encoder Port	
6.5.1	Function of SSI Absolute Encoder	
6.5.2	Definitions of SSI Port Pins	
6.5.3	SSI Absolute Encoder Hardware Connection	6-15
6.6 In	cremental Encoders	
6.6.1	Function of Incremental Encoder	
6.6.2	Definition of Incremental Encoder Port Pins	
6.6.3	Incremental Encoder Hardware Connection	6-18
6.7 Et	hernet Communication Port	6-19
6.7.1	Function that Ethernet Communication Port Supports	
6.7.2	Pins of Ethernet Communication Port	
6.7.3	Network Connection of Ethernet Communication Port	
6.7.4	Function Codes that Ethernet Communication Port Supports	6-20

6.8 Mo	tion Communication Port
6.8.1	Function that Motion Communication Port Supports
6.8.2	Pins of Motion Communication Port
6.8.3	Motion Network Connection
6.8.4	Communication Speed and Communication Distance
6.9 CA	Nopen Communication Port 6-24
6.9.1	Functions that CANopen Communication Port Supports
6.9.2	Pins of CANopen Communication Port
6.9.3	PDO Mapping at CANopen Communication Port
6.9.4	Network Connection at CANopen Communication Port
6.9.5	CANopen Communication Rate and Communication Distance6-26
Chapter 7	Execution Principle
7.1 Ta	sks
7.1.1	Task Types7-2
7.1.2	Priority levels of Tasks
7.1.3	Watchdog for a Task
7.1.4	Motion and Communication Instructions for Each Task Type7-7
7.2 Th	e Impact of PLC RUN or STOP on Variables and Devices 7-10
7.3 Re	ationship between Motion Program and Motion Bus 7-10
7.4 Sy	nchronization Cycle Period Setting7-11
Chapter 8	Logic Instructions 8-1
8.1 Ta	ble of Logic Instructions
8.2 Ex	planation of Logic Instructions
8.2.1	EN and ENO
8.3 Se	guence Input /Output Instructions
8.3.1	R_TRIG
8.3.2	
	F_TRIG
8.3.3	RS
8.3.3 8.3.4	RS
8.3.3 8.3.4 8.3.5	RS
8.3.3 8.3.4 8.3.5 <b>8.4 Se</b>	RS
8.3.3 8.3.4 8.3.5	RS
8.3.3 8.3.4 8.3.5 <b>8.4 Se</b> 8.4.1 <b>8.5 Da</b>	RS.       .8-15         SR.       .8-17         SEMA.       .8-19         quence Control Instructions       .8-21         JMP       .8-21         ta Movement Instructions       .8-22
8.3.3 8.3.4 8.3.5 <b>8.4 Se</b> 8.4.1 <b>8.5 Da</b> 8.5.1	RS.       8-15         SR.       8-17         SEMA.       8-19         quence Control Instructions       8-21         JMP       8-21         ta Movement Instructions       8-22         MOVE       8-22
8.3.3 8.3.4 8.3.5 <b>8.4 Se</b> 8.4.1 <b>8.5 Da</b> 8.5.1 8.5.2	RS.       8-15         SR.       8-17         SEMA.       8-19         quence Control Instructions       8-21         JMP       8-21         ta Movement Instructions       8-22         MOVE       8-22         MoveBit       8-23
8.3.3 8.3.4 8.3.5 <b>8.4 Se</b> 8.4.1 <b>8.5 Da</b> 8.5.1	RS.       8-15         SR.       8-17         SEMA.       8-19         quence Control Instructions       8-21         JMP       8-21         ta Movement Instructions       8-22         MOVE       8-22

8.5.6	Swap	8-31
8.6.1 8.6.2 8.6.3 8.6.4 8.6.5 8.6.6	mparison Instructions LT LE GT GE EQ NE	8-33 8-35 8-37 8-39 8-41 8-43
8.7 Tin 8.7.1	<b>ner Instructions</b> TON	
8.7.2	TOF	8-47
8.7.3	ТР	
8.7.4	Sys_ReadTime	
8.7.5	Sys_ReadTotalWorkTime	
8.7.6	Sys_ReadPowerOnTime	
8.7.7	Sys_WdgStatus	
	unter Instructions	
8.8.1	CTU	
8.8.2 8.8.3	CTD CTUD	
8.9 Ma	hth Instructions ADD	
8.9.2	SUB	
8.9.3	MUL	
8.9.4	DIV	
8.9.5	MOD	
8.9.6	MODREAL	8-77
8.9.7	MODTURNS	8-79
8.9.8	MODABS	8-81
8.9.9	ABS	
8.9.10	5	
8.9.11	RadToDeg	
	SIN	
	COS TAN	
	ASIN	
8.9.16		
	ATAN	
	LN	
	LOG	
	SQRT	
8.9.21	EXP	3-108

8.9.22	EXPT	8-110
8.9.23	RAND	8-112
8.9.24	TRUNC	8-114
8.9.26	FRACTION	8-118
8.10 Bit	String Instructions	. 8-120
	AND	
8.10.2	OR	8-123
8.10.3	NOT	8-126
8.10.4	XOR	8-128
8.10.5	XORN	8-131
8.11 Sh	ift Instructions	. 8-134
8.11.1	SHL	8-134
8.11.2	SHR	8-136
8.11.3	ROL	8-138
8.11.4	ROR	8-140
8.12 Se	lection Instructions	8-142
8.12.1	MAX	8-142
8.12.2	MIN	8-144
8.12.3	SEL	8-146
8.12.4	MUX	8-148
8.12.5	LIMIT	8-150
	BAND	
8.12.7	ZONE	8-155
8.13 Da	ta Type Conversion Instructions	. 8-158
8.13.1	BOOL_TO_***	8-158
	Bit strings_TO_***	
	Integers_TO_***	
	Real numbers_TO_***	
	Times,dates_TO_***	
8.13.6	Strings_TO_***	8-182
8.14 Co	mmunication Instructions	. 8-185
8.14.1	CANopen Communication Instructions	8-185
8.14.	— — — —	
8.14.		
	Ethernet Instructions	
8.14.		
8.14.	5	
8.14.		
8.14.	5 1	
8.14.	.2.5 ETH_Link_Config_Ext	8-210

	8.14.2.6	ETH_SetServerlinkkeeptime	8-212
	8.14.2.7	ETH_Socket_Manage	8-213
	8.14.2.8	ETH_Socket_Config	8-215
	8.14.2.9	ETH_Socket_Open	8-218
	8.14.2.10	ETH_Socket_Send	8-220
	8.14.2.11	ETH_Socket_Receive	8-224
	8.14.2.12	ETH_Socket_Close	8-228
	8.14.2.13	ETH_Socket_Status	8-230
	8.14.2.14	Ethernet Free Protocol Example	8-233
	8.14.3 RS4	85 Communication Instructions	8-238
	8.14.3.1	RS485_Link_Manage	8-238
	8.14.3.2	RS485_Link_Config	8-240
	8.14.3.3	RS485_Link_Status	8-244
	8.14.3.4	RS485 Data Exchange Example	8-247
	8.14.3.5	RS485_RS	8-250
	8.14.3.6	RS485 Free Protocol Example	8-256
	8.14.3.7	RS485_SetDelayTime	8-259
	8.14.4 RS2	32 Communication Instructions	8-261
	8.14.4.1	RS232_Link_Manage	8-261
	8.14.4.2	RS232_Link_Config	8-263
	8.14.4.3	RS232_Link_Status	8-268
	8.14.4.4	RS232 Data Exchange Example	8-271
	8.14.4.5	RS232_RS	
	8.14.4.6	RS232 Free Protocol Example	8-280
	8.14.4.7	RS232_SetDelayTime	8-283
8	.15 String F	Processing Instructions	8-285
		ICAT	
	8.15.2 DELI	ЕТЕ	8-287
	8.15.3 INSE	ERT	8-289
	8.15.4 LEFT	Г / RIGHT	8-291
	8.15.5 MID		8-293
	8.15.6 REPI	LACE	8-295
	8.15.7 LEN		8-297
	8.15.8 FINE	Ο	8-298
8	16 Immed	iate Refresh Instructions	8-300
U		M	
		nediateInput	
		nediateOutput	
~		•	
8		ated Instructions	
		///	
	8.17.2 GPW	/M	8-323

8.18 Address Instruction 8.18.1 ADR	
8.19 Network Diagnosis	
8.19.1 Motion Diagnosis 8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)	
8.19.1.2 CANmotion_System Diagnosis)	
8.19.2 CANopen Diagnosis	
8.19.2.1 CANopen_SysDiag	
8.19.2.2 CANopen_NodeDiag	
8.19.2.3 CANopen_State	. 8-335
8.20 Read and Write Offset Bit Value	8-337
8.20.1 SetBitOffsetValue	
8.20.2 GetBitOffsetValue	8-339
8.21 FCS Instructions	
8.21.1 CRC16	
8.21.2 LRC	
8.22 Right-Side Extension Module Instructions	
8.22.1 AS02PU and AS04PU Related Instructions	8-345
8.22.1.1 Application Conditions of AS02PU and AS04PU Related Instructions	8-345
8.22.1.2 AS02PU and AS04PU Related Instructions	
Chapter 9 Introductions of Axis Parameters	9-1
9.1 Description of Axis Parameters	9-2
Chapter 10 Motion Control Function	10-1
10.1 EN and ENO	10-2
10.2 Relation among Velocity, Acceleration and Jerk	10-3
10.3 Introduction of BufferMode	10-6
10.4 The State Machine	. 10-32
Chapter 11 Motion Control Instructions	11-1
11.1 Table of Motion Control Instructions	11-4
11.2 About Motion Control Instructions	11-6
11.2.1 Composition of A Motion Control Instruction	11-6
11.2.2 Program Languages that Motion Control Instructions Suppor	
11.2.3 Configuration of Motion Control Instructions	
11.3 Single-axis Instructions	
11.3.1 MC_Power	11-/
11.3.2 MC Home	. 11-17

11.3.3 MC_MoveVelocity	
11.3.4 MC_Halt	
11.3.5 MC_Stop	
11.3.6 MC_MoveRelative	
11.3.7 MC_MoveAdditive	
11.3.8 MC_MoveAbsolute	
11.3.9 MC_MoveSuperimposed	
11.3.10MC_HaltSuperimposed	
11.3.11MC_SetPosition	
11.3.12MC_SetOverride	
11.3.13MC_Reset	
11.3.14DMC_SetTorque	
11.3.15MC_ReadAxisError	11-100
11.3.16MC_ReadActualPosition	11-102
11.3.17MC_ReadStatus	11-107
11.3.18MC_ReadMotionState	11-112
11.3.19DMC_ReadParameter_Motion	11-117
11.3.20DMC_WriteParameter_Motion	11-122
11.3.21 DMC_TouchProbe	11-126
11.3.22DMC_TouchProbeCyclically	11-136
11.3.23 DMC_Jog	11-140
11.3.24 DMC_MoveVelocityStopByPos	11-142
11.3.25 DMC_MoveVelocityStopByLinePos	11-146
11.3.26 DMC_ReadPositionLagStatus	11-150
11.3.27 DMC_WritePositionLagSetting	11-153
11.3.28 DMC_ChangeMechanismGearRatio	11-155
11.3.29DMC_TorqueControl	11-157
11.3.30DMC_MoveVelocity	11-162
11.3.31DMC_SwitchSoftLimit	11-163
11.4 Multi-axis Instructions	11-165
11.4.1 MC_GearIn	
11.4.2 MC GearOut	
11.4.3 MC CombineAxes	
11.4.4 Introduction of Electronic Cam	
11.4.5 MC_CamIn	
11.4.6 MC_CamOut	
11.4.7 DMC_CamReadPoint	
11.4.8 DMC_CamWritePoint	
11.4.9 DMC_CamSet	
11.4.10DMC_CamReadTappetStatus	
11.4.11 DMC_CamReadTappetValue	
11.4.12DMC_CamWriteTappetValue	
11.4.13DMC_CamAddTappet	

11.4.14DMC_	_CamDeleteTappet	11-239
11.5 Applicati	ion Instructions	11-242
11.5.1 Rotar	y Cut Technology	11-242
11.5.2 Rotar	y Cut Parameters	11-243
11.5.3 Contr	ol Feature of Rotary Cut Function	11-244
11.5.4 Introd	duction to Cam Curve with Rotary Cut Function	11-245
11.5.5 Rotar	y-cut Instructions	11-249
11.5.5.1 A	APF_RotaryCut_Init	11-249
11.5.5.2	APF_RotaryCut_In	11-252
11.5.5.3 A	APF_RotaryCut_Out	11-254
11.5.6 Applic	cation Example of Rotary Cut Instructions	11-256
11.6 G Code I	nstructions	11-260
11.6.1 CNC I	Introduction	11-260
11.6.2 G Coo	de Input Format	11-260
11.6.3 Expla	nation of G Code Formats	11-261
11.6.4 G Coo	de Functions	11-262
	G90 (Absolute Mode)	
11.6.4.2 (	G91 (Relative Mode)	11-263
11.6.4.3 (	GO (Rapid Positioning)	11-264
11.6.4.4 (	G1 (Linear Interpolation)	11-267
11.6.4.5 (	G2 (Clockwise Circular/ Helical Interpolation)	11-271
	G3 (Anticlockwise Circular /Helical Interpolation)	
11.6.4.7 (	G17/G18/G19 (Specify Circular Interpolation Plane)	11-284
11.6.4.8 (	G4 (Dwell Instruction)	11-285
11.6.4.9 (	G50 (Precise Stop)	11-285
11.6.4.10 (	G51 (Round path transition)	11-286
11.6.4.11 (	G52 (Smooth path transition)	11-287
11.6.4.12 M	VI Code	11-289
11.6.5 G Coo	de Instructions	11-291
11.6.5.1 [	DMC_CartesianCoordinate	11-291
11.6.5.2 [	DMC_ReadMFunction	11-297
11.6.5.3 [	DMC_ResetMFunction	11-300
	DMC_SetG0Para	11-303
	DMC_SetG1Para	
11.6.5.6 [	DMC_SetStartPosition	11-309
	oup Instructions	
	_AddAxisToGroup	
	_RemoveAxisFromGroup	
	UngroupAllAxes	
	_GroupEnable	
	_GroupStop	
11.7.6 DMC_	_GroupInterrupt	11-327

11	.7.7 DMC_GroupContinue	11-332
11	.7.8 DMC_MoveDirectAbsolute	11-334
	.7.9 DMC_MoveDirectRelative	
	.7.10DMC_MoveLinearAbsolute	
	.7.11 DMC_MoveLinearRelative	
	.7.12DMC_MoveCircularAbsolute	
	.7.13DMC_MoveCircularRelative	
	.7.14DMC_GroupSetOverride	
	.7.15DMC_GroupReadActualPosition	
	Coordination Instructions	
	.8.1 DMC_ControlAxisByPos	
	er 12 Troubleshooting	
	Explanation of LED Indicators	
12.2	2 Table of Error IDs in Motion Instructions	12-8
12.3	System Trouble Diagnosis through System Error Codes	s12-20
Apper	ndix A Modbus Communication	A-1
A.1	Message Format in ASCII Mode	A-2
A.2	Message Format in RTU Mode	A-5
A.3	Modbus Function Codes Supported	A-7
A.4	Modbus Exception Response Code Supported	A-7
A.5	Introduction to Modbus Function Codes	A-8
A.6	Table of Registers and Corresponding Modbus address	es A-15
Apper	ndix B Modbus TCP Communication	B-1
B.1	Modbus TCP Message Structure	В-2
B.2	Modbus Function Codes Supported in Modbus TCP	В-2
B.3	Exception Response Code in Modbus TCP	В-3
B.4	Modbus Function Codes in Modbus TCP	В-3
B.5	Registers and Corresponding Modbus Addresses	B-12
Apper	ndix C CANopen Protocol	C-1
C.1	Node States	C-4
C.2	Network Management (NMT)	C-6
C.3	PDO (Process Data Object)	C-6
C.4	SDO (Service Data Object)	C-8

Appendix D Explanation of Homing ModesD		D-1
D.1	Explanation of Homing Modes	D-2
Appendix E List of Accessories		. E-1
E.1	Accessories for CANopen Communication	. E-2
E.2	Accessories for DeviceNet Communication	E-4

# **▲** Caution

- This manual provides an introduction to product functions, specifications, installation, basic operations and settings.
- This product is an OPEN TYPE device and therefore should be installed in an enclosure free of airborne dust, humidity, electric shock and vibration. The enclosure should prevent non-maintenance staff from operating the device (e.g. key or specific tools are required for operating the enclosure) in case that danger and damage on the device may occur.
- Be sure to read the manual carefully and follow the instructions herein so as to avoid injuries to personnel and damage to products.

# 1

# Chapter 1 Preface

1.1	Explanation of Symbols in This Manual	1-2
1.2	Revision History	1-2

Thank you for purchasing AS500C series motion controller which is created on the basis of motion control and we are providing you with a high-end motion control system.

This manual describes the product specifications, functions, system architecture, installation, wiring, execution principle, logic instructions and motion control instructions, trouble-shooting, communication protocols, homing modes and other relevant information.

Make sure that you have well known about the motion control system configuration and product operation before using the motion controller.

# 1.1 Explanation of Symbols in This Manual

## • Precautions before operation

Before operation, please read relevant safety instructions carefully so as to prevent an injury to personnel and damage to products.

⚠ Danger	indicates the highly potential hazards. Severe personal injury or even death <b>will</b> result if you do not follow the instructions.
⚠ Warning	indicates the potential hazards. Minor personal injury or even death <b>may</b> result if you do not follow the instructions.
▲ Caution	indicates much attention should be paid. A bad accident can occur if you do not follow the instructions.

# 1.2 Revision History

Version	Revision	Release Date
1 <sup>st</sup>	The first version was published.	Dec. 6, 2019
2 <sup>nd</sup>	<ol> <li>Added Write_FunCode inputs of Config instructions in section 8.14 and related description.</li> <li>Added section 8.22 Right-side Extension Module Instructions.</li> </ol>	Feb. 5, 2021



# Chapter 2 Overview

2.1	Product Description	2-2
2.2	Functions	2-2
2.3	Profile and Components	2-3

## 2.1 Product Description

AS500C series motion controllers are multi-axis motion controllers researched and produced by Delta autonomously on the basis of CANopen field bus. It complies with CANopen DS301 basic communication protocol and DSP402 motion control protocol.

In addition, it also supports standard instruction libraries defined by international organizations for motion control. It brings great convenience to user to learn and develop projects quickly. Multiple axes can be controlled by means of Motion port. The single-axis motion instructions including velocity, position, torque and homing instructions as well as multi-axis instructions such as electronic gear, electronic cam, rotary cut and G code are supported.

Multiple communication ports are built in the motion controller. And thus various communication functions can be realized without adding modules. The motion controller supports the right-side extension. AS series right-side modules can be added to its right side.


The communication system adopts highly reliable CAN bus as the main line and hence users just need simple cables for wiring. Thanks to the high-speed reliable motion control system, The motion controller can be widely applied to a variety of automation control industries such as packaging, printing, encapsulating, wire cutting, drug manufacturing and so on.

AS500C series motion controller only includes AS524C-B model currently.

## 2.2 Functions

- Control up to 24 real axes (with axis No. ranging from 1 to 32).
- The virtual axis and encoder axis can be built inside the motion controller (with the axis No. ranging from 1 to 32, which can not be the same as that of real axes).
- Equipped with 1GHz high-speed floating-point operation processor; supporting 64-bit floating point (LREAL) and capable to meet various complicated motion control.
- With two built-in incremental encoder ports and one SSI absolute encoder port.
- With two Ethernet ports, one USB port, one RS232 port and one RS485 port built in the controller.
- With one built-in CAN port serving as CANopen master or slave.
- Supports powerful field network (as Ethernet master or slave and CANopen master or slave) for construction of a function-complicated control system.
- With a variety of I/O extensions (Digital modules, analog modules, temperature modules and etc.).
- The total number of digital modules and special modules connectable to the right side of the controller is up to 32, among which the number of special modules such as analog modules, temperature modules and etc. is up to 16.
- The total number of digital input and output points is up to 1024, including that of digital points built in the controller.
- Using the easy-to-use software interface with the features of complete function and convenient application.
- Providing standard bus cables for the easy and convenient plug-and-play wiring.

2

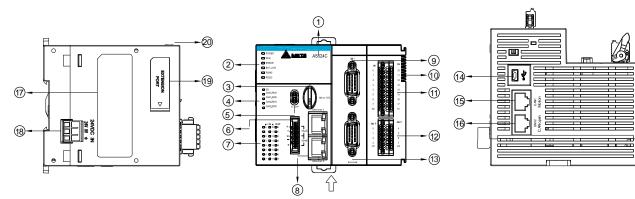

# 2.3 Profile and Components

(1)	Model name	1	Input terminals
2	State indicators	12	Output terminals
3	SD card slot	13	Encoder communication port
(4)	SD/CAN state indicators	14	USB communication port
5	RUN/STOP switch	13	Motion communication port
6	RS-232/ RS-485 port	10	CANopen communication port
7	I/O indicators	$\bigcirc$	Nameplate
8	Ethernet communication port	18	Power input port
9	SSI communication port	19	Function switch
0	Extension module slot	Ø	Battery holder (no battery comes with the product you purchase)

MEMO

# 3

# Chapter 3 Specifications

3.1 Function Specifications	3-2
3.1.1 Specifications	3-2
3.1.2 Devices and Data Types	3-4
3.1.2.1 Devices	3-4
3.1.2.2 Valid Ranges of Devices	3-5
3.1.2.3 Latched Devices	3-6
3.1.2.4 Data Types and Valid Ranges Supported	3-7
3.2 Electrical Specifications	3-8

# 3.1 Function Specifications

# 3.1.1 Specifications


	lt	em	Specification	
		Size		20M
	Program capacity	Quantity	Number of POU definitions	1024
	Memory	Retained	Size	128K
Programming	capacity for variables	Non-retained	Size	20M
	G code	One single G code program	Size	256K
		G code programs	Quantity	64
	Number of	Max. number of single-axis contr		Real axes: 1~24, virtual axes: 1~32 Real axes can not be the same as virtual axes in axis number.
Motion	controlled axes	Max. number of linear interpolation		8
control		Max. number of circular interpola		3
	Number of cams	Size	Quantity	64
	Cam key points	Key points of one single cam	Quantity	2048
		CAN	Quantity	<ul> <li>2; one CAN port supports the standard CANopen protocol and the other is used for Motion network.</li> <li>For more details, refer to CANopen Communication Port and Motion</li> <li>Communication Port in Chapter 6 Wiring, Communication and Network Construction.</li> </ul>
		Ethernet	Quantity	2; two independent Ethernet ports For more details, refer to Ethernet Communication Port in Chapter 6 Wiring, Communication and Network Construction.
Built-in por contro		USB	Quantity	1; standard USB2.0 interface used as a slave or for the programs upload and download.
		RS-232	Quantity	1; used as a master or slave
		RS-485	Quantity	1; used as a master or slave As a master, it can connect up to 24 slaves.
		Incremental encoder	Quantity	2; builds an encoder axis. Z signal can trigger an interrupt program.
		SSI absolute encoder	Quantity	1; builds an encoder axis
		Input points	Quantity	16 points; supports external interrupt trigger
		Output points	Quantity	8 points

lt	em	Specification	
	Right-side extension port		1; connects AS series special module
	Special modules	Quantity	Up to16 AS series special modules
Right-side extension	Digital points	Number of points	A total of 1024 input points plus output point including local digital IO points
	Special modules and digital modules	Quantity	32 AS series modules
RTC (Real-time clock)	Battery	Number of points	1, users need to have one CR1620 3V battery which can be bought from the market inside the motion controller. The RTC can not work unless the battery supplies power normally,

## 3.1.2 Devices and Data Types

## 3.1.2.1 Devices

• Device Name Explanation

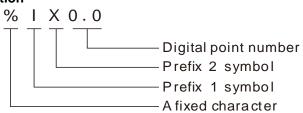

## • Relevant Devices of the Motion Controller Used in the Software

No.	Item	Content									
1	Prefix 1 symbol	I	Q	М							
2	Prefix 1 name	Input device	Output device	Intermediate device							
3	Prefix 2 symbol	Х	В	W	D	L					
4	Data type of prefix 2	BIT	BYTE	WORD	DWORD	QWORD					
5		%IX0.0	%IB0	%IW0	%ID0	%IL0					
6	Device example	%QX0.0	%QB0	%QW0	%QD0	%QL0					
7		%MX0.0	%MB0	%MW0	%MD0	%ML0					

## • The Corresponding Relationships of Devices

%ML0 includes %MB0~%MB7, %MD0 includes %MB0~%MB3 and %MW0 includes %MB0~%MB1 as shown in the following table.

		Corresponding relationships																							
Device	The 1 <sup>st</sup> WORD						The 2 <sup>nd</sup> WORD						The 3 <sup>rd</sup> WORD						The 4 <sup>th</sup> WORD						
name	Bit		Bit	Bit		Bit	Bit		Bit	Bit		Bit	Bit		Bit	Bit		Bit	Bit		Bit	Bit		Bit	
	0		7	8	•••	15	0		7	8		15	0		7	8		15	0		7	8	•••	15	
%MX	%M)	X0.0	~0.7	%M	X1.0	~1.7	%MX2.0~2.7 %MX3.0~3.7						%MX4.0~4.7 %MX5.0~5.7						%MX6.0~6.7 %MX7.0~7.					~7.7	
%MB	%	бMВ	0	%	ы́МВ	1	%MB2 %MB3					%MB4 %MB5					%	6MB	6	%MB7					
%MW			%N	W0					%M	IW1			%MW2 %MW3												
%MD	%MD0										%MD1														
%ML												%N	1L0												

%ML1 includes %MB8~%MB15, %MD2 includes %MB8~%MB11, %MW4 includes %MB8~%MB9 and %MB8 includes %MX8.0~8.7 as shown in the following table.

		Corresponding relationships																						
Device	The 5 <sup>th</sup> WORD The 6 <sup>th</sup> WORD								The	ə 7 <sup>th</sup>	WO	RD		The 8 <sup>th</sup> WORD										
name	Bit 0		Bit 7	Bit 8		Bit 15	Bit 0		Bit 7	Bit 8		Bit 15	Bit 0		Bit 7	Bit 8		Bit 15	Bit 0		Bit 7	Bit 8		Bit 15
%MX	%MX8.0~8.7 %MX9.0~9.7					~9.7	%MX10.0~10. %MX11.0~11. 7 7					%MX12.0~12. %MX13.0~13. 7 7					%MX14.0~14. %MX15.0~ 7 7					~15.		
%MB	%	6MB	8	%	6MB	9	%MB10 %MB11					%MB12 %MB13					%MB14 %MB15					5		
%MW			%N	IW4					%N	W5			%MW6 %MW7											
%MD	%MD2										%MD3													
%ML												%№	1L1											

## 3.1.2.2 Valid Ranges of Devices

• The table of valid ranges of the devices in the motion controller

Device name	Expression	Range
%IX	%IX0.0~%IX0.7	%IX0.0~%IX127.7
%QX	%QX0.0~%QX0.7	%QX0.0~%QX127.7
%MX	%MX0.0	%MX0.0~%MX131071.7
%IB	%IB0	%IB0~%IB127
%QB	%QB0	%QB0~%QB127
%MB	%MB0	%MB0~%MB131071
%IW	%IW0	%IW0~%IW63
%QW	%QW0	%QW0~%QW63
%MW	%MW0	%MW0~%MW65535
%ID	%ID0	%ID0~%ID31
%QD	%QD0	%QD0~%QD31
%MD	%MD0	%MD0~%MD32767
%IL	%IL0	%IL0~%IL15
%QL	%QL0	%QL0~%QL15
%ML	%ML0	%ML0~%ML16383

## • The table of Modbus device addresses

The Modbus addresses which are within the range of 16#0000~16#FFFF can be accessed via the standard MODBUS function code 01, 02, 03, 05, 06, 16#0F and 16#10. When a MODBUS function code is used to access bit devices, please access QX and IX bit devices. If MX bit devices need be accessed, the MW device is accessed and then the values in the MX bit devices can be got through the MW device. See Section 3.1.2.1 for details on the correponding relationship between MW and MX devices.

Device area	Device type	Range	Modbus address	Modbus address type
		%IX0.0~%IX0.7	16#6000~16#6007	
	Bit	%IX1.0~%IX1.7	16#6008~16#600F	
(Input)	DIL			
(Input)		%IX127.0~%IX127.7	16#63F8~16#63FF	
	Word	%IW0~%IW63	16#8000~16#803F	Standard Modbus
		%QX0.0~%QX0.7	16#A000~16#A007	address
	Bit	%QX1.0~%QX1.7	16#A008~16#A00F	
Q (Output)	DIL			
(Output)		%QX127.0~%QX127.7	16#A3F8~16#A3FF	
	Word	%QW0~%QW63	16#A000~16#A03F	
M (Register)	Word	%MW0~%MW32767	16#0000~16#7FFF	

## 3.1.2.3 Latched Devices

The %MW0~%MW999 devices are latched devices in which data are retained when power off. Besides, the variables defined in the software can select Retain as its property. The capacity of latched devices is 128K bytes.

## 3.1.2.4 Data Types and Valid Ranges Supported

The data types and valid ranges of the variables in the software that the motion controller uses are shown in the following table.

No.	Data type	Valid range	Initial value	
1	BOOL	TRUE or FALSE	FALSE	
2	BYTE	16#00 ~ FF	16#00	
3	WORD	16#0000 ~ FFFF	16#0000	
4	DWORD	16#0000000 ~ FFFFFF	16#0000000	
5	LWORD	16#000000000000000 ~ FFFFFFFFFFFFFFFFF	16#000000000000000000	
6	USINT	0 ~ +255	0	
7	UINT	0 ~ +65535	0	
8	UDINT	0 ~ +4294967295	0	
9	ULINT	0 ~ +18446744073709551615	0	
10	SINT	-128 ~ +127	0	
11	INT	-32768 ~ +32767	0	
12	DINT	-2147483648 ~ +2147483647	0	
13	LINT	-9223372036854775808 ~ +9223372036854775807	0	
14 REAL		-3.402823e+38 ~ -1.175495e-38, 0, +1.175495e-38 ~ +3.402823e+38	0.0	
15	LREAL	-1.79769313486231e+308 ~ -2.22507385850721e- 308, 0, +2.22507385850721e-308 ~ +1.79769313486231e+308,	0.0	
16	TIME	T#XXXXXXdXXhXXmXXsXXXms · Unit: ns. Range:T#0ms~213503d23h34m33s709.551ms	T#0ms	
17	DATE	D#Y-M-D. Range: D#1970-01-01~D#2106-02-07. Unit: s.	D#1970-01-01	
18	TOD	TOD#00:00:00		
19	DT	DT#Y-M-D-H-M-S. Range: DT#1970-01-01-0:0:0~2106- 02-07-6:28:15. Unit: s.	DT#1970-01-01-0:0:0	
20	STRING	0~32000 characters	()	

# 3.2 Electrical Specifications

## Electrical specification

Item	Content							
Power voltage	24 VDC							
Fuse capacity	3 A/30 VDC, Polyswitch							
Isolation voltage	500 VAC (Secondary-PE)							
Consumption	Max 8W							
Consumption power at the right- side extension port	Max. output power	Max. output power 36W at the right-side extension port						
Operating temperature	-20~55°C							
Storage temperature	-40~80°C							
Battery requirement	The allowed ambie inverse current mu	•	the battery must be at least 10	00 °C, and the				
Operating humidity	5~95% No condensation							
Storage humidity	5~95% No condensation							
Work environment	No corrosive gas							
Pollution degree	2							
Vibration resistance								
Shock resistance	Shock resistanceTested with : Half-sine wave : Strength of shock 15 g peak value · 11 ms duration ; Shock direction : The shocks in each in direction per axis · on 3 mutually perpendicular axes ( total of 18 shocks ) International Standard: IEC 61131-2 & IEC 60068-2-27 ( TEST Ea )							
	Port	Frequency Range	Level (Normative)	Reference Standard				
EMI	Enclosure port (radiated) (measured at a distance of 10	30-230 MHz 230-1000 MHz	40 dB (μV/m) quasi-peak 47 dB (μV/m) quasi-peak	IEC 61000-6-4				
	meters) AC power port	0.15-0.5 MHz	79 dB (μV) quasi-peak	IEC 61000-6-4				

Item	Content							
	(conducted)	cted)		average				
			73 dB (μV) quasi-peak		-			
		0.5-30 MHz	60 dB (µV) average					
	Environmental Phenomenon	Reference Standard	Test		Test Level			
	Electrostatic	IEC 61000-4-2	Contact		±4kV			
	Discharge	IEC 01000-4-2	Air		±8kV			
	Radio			2.0-2.7 GHz	1 V/m			
EMS	Frequency		80%AM,	1.4-2.0 GHz	3 V/m			
	Electromagnetic Field Amplitude Modulated	IEC 61000-4-3	1kHz sinusoidal	80-1000MHz	10 V/m			
	Power		60 Hz		30 A/m			
	Frequency Magnetic Field	IEC 61000-4-8	50 Hz		30 A/m			
Weight	405g							

## • Electrical specification for input points

Item	Content			
Number of input channels	6 channels			
Channel type	High-speed digital input type for the 16 channels			
Input terminals	Terminal I0~I7 · I10~I17			
Common terminal for input points	Terminal S0/S1			
Input type	Sink or Source mode			
Input delay	2.5μS (OFF ->ON), 5 μS (ON -> OFF)			
Input current	current 24 VDC, 5mA			
Max. cable length	The shielded cable: 500m ;			
	The unshielded cable: 300m			

## • Electrical specification for output points

Item	Content		
Number of output channels	8 transistors for output (N-MOS)		
Channel type	High-speed digital output type for 8 channels		
Output terminals	Terminal Q0~Q7		
Common terminal for output points	Terminal C0/C0 (for connecting to the cathode of supply power)		
Power voltage for output points	24 VDC		
Output delay	2μS ( OFF -> ON ) , 3μS ( ON -> OFF )		
Max. switch frequency	1KHZ		
	Resistance: 0.2A/1point		
Max. loading	Inductance: 13W ( 24VDC )		
	Bulb: 2.5W(24VDC)		

Item	Content			
Max. cable length	The shielded cable: 500m			
	The unshielded cable: 300m			




# Chapter 4 System Architecture

4.1	Sy	stem Constitution	4-2
4.2	Ро	wer Supply	4-2
4.3	Riç	ght-side Extension	4-2
	_	Connectable Right-side Extension Modules	
4.3	.2	Allocation of Right-side Extension Module Addresses	4-5
4.4	Со	nnectable Servo Drives	4-5
4.5	SD	Memory Card	4-7
4.5	.1	Model and Specification	4-7

# 4.1 System Constitution

A multi-layer industrial network can be built by means of the motion controller. By using the motion controller, the network can consist of top-layer Ethernet, middle-layer CANopen and Profibus bus as well as bottom-layer RS-485 bus which supports Modbus as follows.

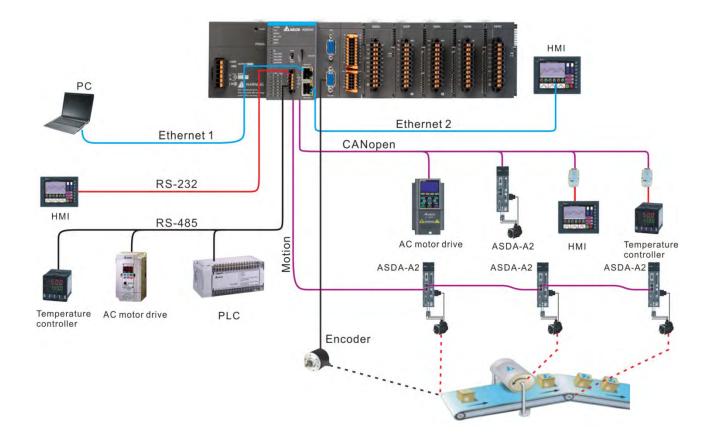

The figure above illustrates the peripheral devices which are connected to various ports of the motion controller in the entire system. Refer to chapter 6 for details on the functions of communication ports.

# 4.2 Power Supply

Delta power modules are recommended as the power supply for the motion controller. The information of Delta power modules is shown in the following table.

No.	Module name	Input voltage	Output voltage	Power	Output current	International Standard
1	AS-PS02		24VDC (For internal use in PLC)	48W	2A	
	AS-PS02A	100~240VAC 50/60Hz	24VDC (For internal use in PLC)	36W	1.5A	
2	A3-F302A		24VDC (For external use)	12W	0.5A	

# 4.3 Right-side Extension

## 4.3.1 Connectable Right-side Extension Modules

The AS series extension modules including digital modules, analog modules and temperature modules can be connected to the right side of the motion controller. The total number of digital modules and special modules

connectable to the right side of the motion controller can be up to 32, among which the number of special modules such as analog modules, temperature modules and etc. is up to 16 and the total number of their input points and output points is up to 992.

See the connectable right-side extension modules in the following table.

No.	Module name	Input length	Output length	Extension type
1	AS08AM10N-A	8 bits	-	
2	AS16AM10N-A	16 bits		
3	AS32AM10N-A	32 bits		Input point extension
4	AS64AM10N-A	64 bits	-	
5	AS08AN01T-A	-	8 bits	
6	AS08AN01P-A		8 bits	
7	AS08AN01R-A	-	8 bits	
8	AS16AN01T-A		16 bits	
9	AS16AN01P-A		16 bits	Output point extension
10	AS16AN01R-A		16 bits	
11	AS32AN02T-A		32 bits	
12	AS64AN02T-A	-	64 bits	
13	AS16AP11T-A	8 bits	8 bits	
14	AS16AP11P-A	8 bits	8 bits	Input extension and output extension
15	AS16AP11R-A	8 bits	8 bits	
16	AS04AD-A	10 words	-	4-channel analog input module Hardware resolution: 16 bits Rated input: 0–10V, 0/1–5V, -5 to +5V, -10 ~ +10V, 0/4–20mA, -20 ~ +20mA Conversion time: 2 ms/channel
17	AS08AD-B	18 words	-	8-channel analog input module Hardware resolution: 16 bits Rated input: 0 to +10V, 0/1–5V, -5V to +5V, -10V ~ +10V Conversion time: 2 ms/channel
18	AS08AD-C	18 words	-	8-channel analog input module Hardware resolution: 16 bits Rated input: 0/4–20mA, -20mA ~ +20mA Conversion time: 2 ms/channel
19	AS04DA-A	2 words	8 words	4-channel analog output module Hardware resolution: 12 bits Rated output: -10 ~ +10V, 0~20mA, 4~20mA Conversion time: 2 ms/channel
20	AS06XA-A	10 words	4 words	4-channel analog input Hardware resolution: 16 bits 0 ~10V, 0/1~5V, -5 ~ +5V, -10 ~ +10V, 0/4 ~ 20mA, - 20 ~ +20mA Conversion time: 2 ms/channel 2-channel analog output

No.	Module name	Input length	Output length	Extension type
				Hardware resolution: 12 bits -10 ~ +10V, 0 ~ 20mA, 4~20mA
				Conversion time: 2 ms/channel
21	AS04RTD-A	10 words	-	4-channe, 2-wire/3-wire RTD Sensor type: Pt100 / Ni100 / Pt1000 / Ni1000 / JPt100 / LG-Ni1000 / Cu50 / Cu100 / 0-300 $\Omega$ / 0- 3000 $\Omega$ input impedance Resolution: 0.1°C/0.1°F (16 bits) Conversion time: 200ms/channel
22	AS06RTD-A	14 words	-	6-channe, 2-wire/3-wire RTD Sensor type: Pt100 / Ni100 / Pt1000 / Ni1000 / JPt100 / LG-Ni1000 / Cu50 / Cu100 / 0-300 $\Omega$ / 0- 3000 $\Omega$ input impedance, Resolution: 0.1°C/0.1°F (16 bits) Conversion time: 200ms/channel
23	AS04TC-A	10 words	-	4-channel thermocouple Sensor type: J, K, R, S, T, E, N, B and -100 ~ +100mV Resolution: 0.1°C/0.1°F (24 bits) Conversion time: 200ms/channel
24	AS08TC-A	18 words	-	8-channel thermocouple Sensor type: J, K, R, S, T, E, N, B and -100 ~ +100mV Resolution: 0.1°C/0.1°F (24 bits) Conversion time: 200ms/channel
25	AS02LC-A	7 words	1 word	2-channel, 4-wire/6-wire load cell sensor Eigenvalues for a load cell: 1, 2, 4, 6, 20, 40, 80 mV/V Highest precision 1/10000 @ 50ms of conversion time ADC Resolution: 4 bits Conversion time: 2.5 ~ 400ms (nine options to choose from)
26	AS02PU-A	15 words	-	<ul> <li>2-axis positioning control</li> <li>5-24 VDC, 1 (A/B/Z phase) differential input, hardware maximum bandwidth for input: 200 kHz</li> <li>24 VDC, 5 mA, 5 external inputs, hardware maximum bandwidth for input: 1 kHz;</li> <li>5 VDC, 2-axis (4 points) high-speed differential outputs, maximum bandwidth for output: 200 kHz;</li> </ul>
27	AS04PU-A	20 words	-	<ul> <li>4-axis positioning control</li> <li>24 VDC, 5mA, 6 inputs, hardware maximum</li> <li>bandwidth for input: 1 kHz;</li> <li>5-30 VDC, 0.1A, 4-axis (8 points) NPN output,</li> <li>maximum bandwidth for output: 100 kHz</li> </ul>

## 4.3.2 Allocation of Right-side Extension Module Addresses

## • Digital point numbers of right-side digital extension modules

- 1. The right-side digital modules can be configured in the software and the software will automatically assign the input and output devices for the digital modules.
- 2. The digital point number of the digital extension modules connected to the right of the motion controller starts from 2.0. For example, the input point for the first digital module starts from %IX2.0 and the output point starts from %QX2.0. It is counted as 16 points if the number is less than 16.
- Digital input points and output points are numbered in decimal system as below. Input point number: %IX2.0 ~%IX2.7,....., %IX8.0 ~%IX8.7,....., %IX127.0 ~ %IX127.7 Output point number: %QX2.0 ~ %QX2.7,....., %QX8.0 ~ %QX8.7,....., %QX127.0 ~ %QX127.7

## • About the right-side special module and serial number


- 1. The right-side extension modules such as analog modules and temperature modules are regarded as special modules.
- 2. The right-side digital modules can be configured in the software and the software will automatically assign the input and output devices for the digital modules.
- 3. The serial number of the first special module to the right side of the motion controller is 1; the serial number of the second one is 2, and so on. Maximum 16 special modules can be connected. The start address for input of the right-side special module is %MW10000 and the start address for output of the right-side special module is %MW10500.

# 4.4 Connectable Servo Drives

There are many models for ASDA-A2, ASDA-B3 and ASDA-A3-series servo drives. ASDA-A2-XXXX-M, ASDA-A2-XXXX-MN, ASDA-B3-XXXX-M and ASDA-A3-XXXX-M models support CANopen communication. Only these models of servo drives can be used to build CANopen motion control network through the connection to the Motion port of the motion controller.

The connection between AS500C series motion controller and the servo drive can be made with UC-CMC003-01A or UC-CMC005-01A cable through CN6 port.

## • Illustration of the servo drive model

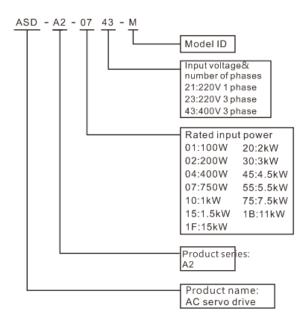


• Relevant servo parameter settings are shown in the following table when the motion controller and the servo drive are connected.


## AS500C Series Motion Controller Operation Manual

Parameter	Explanation	Setting value	Explanation
P1-01	Setting the control mode of the servo	X0B*1	Set as CANopen mode
P3-00	Setting a node ID	Setting range: 1~24	The setting of this parameter corresponds to the node address of the servo in the CANopen network
P3-01	Baud rate	0403	The baud rate that the parameter value corresponds to must be consistent with that of the motion controller. 0403: CANopen baud rate is 1Mbps 0203: CANopen baud rate is 500Kbps

\*1 : The output directions of the torque are illustrated as below when the value of X is 0 and 1 respectively.

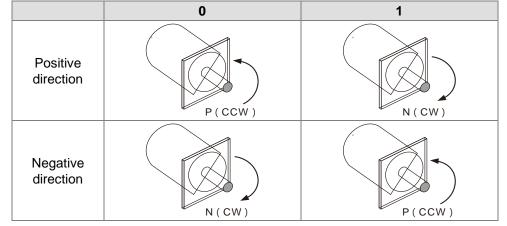

• The wiring figure of the motion controller and ASDA-A2-XXXX-M-series servo drives

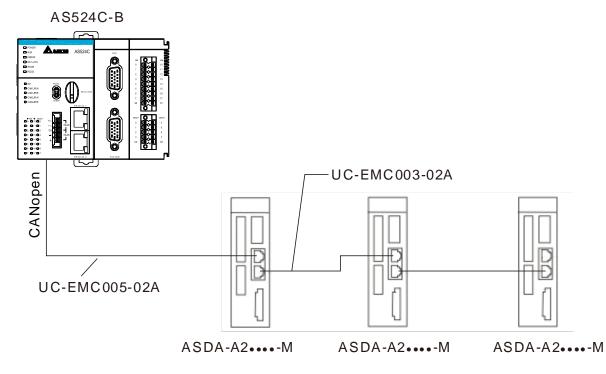

Notes:

- 1. Please refer to the servo user manual for the wiring of ASDA-A2-XXXX-M-series servo drives, servo motors and encoders.
- Choose UC-CMC003-01A or UC-CMC005-01A or UC-CMC010-01A communication cable according to the field status.
- There is one 120Ω terminal resistor embedded at Motion port. In the CANopen network consisting of Motion port and servos, the other end of the network must be connected with a terminal resistor TAP-TR01 which could be found in the packing box of the motion controller.

# 4.5 SD Memory Card

## 4.5.1 Model and Specification

## • Model and Appearance

The motion controller only supports the following Micro SD.



## • Specification

The following table shows the SD card family members. There are many specifications of SD cards on current markets. The controller only supports the category of SDHC card of the file system FAT32 and the Micro SDHC size (15mm X 11mm X 1mm). Please make sure to purchase the right-specification SD card that the controller supports.

Category	SD	SDHC			SDXC	
Capacity	32MB~2GB	4GB~32GB			32GB~2TB	
File system	FAT16/FAT32	FAT32			exFAT(FAT64)	
Size	SD	SDHC	Mini SDHC	Micro SDHC	SDXC	Micro SDXC
SD speed level	N/A	CLASS 2 (Min. 2MB/Sec.) CLASS 4 (Min. 4MB/Sec.) CLASS 6 (Min. 6MB/Sec.) CLASS 10 (Min. 10MB/Sec.)			CLASS 2 (Min. 2MB/Sec.) CLASS 4 (Min. 4MB/Sec.) CLASS 6 (Min. 6MB/Sec.) CLASS 10 (Min. 10MB/Sec.)	

## • SD card classification

ΜΕΜΟ



# 5


# Chapter 5 Installation

# Table of Contents

5.1 Di	mensions	5-2
5.1.1	Profile and Dimensions	5-2
5.1.2	Dimensions of Right-side Extension Module	5-2
5.1.3	Connecting to the Right-side Extension Module	5-3
5.1.4	Installing and Removing the SD Card	5-4
5.1.5	Installing and Replacing the Button Cell Battery	5-5
5.2 In	stalling the Module in the Control Cabinet	5-8
5.2.1	Installing the Module to DIN rail	5-8
5.2.2	Illustration of Installation Inside the Control Cabinet	5-8
5.2.3	Environmental Temperature in the Control Cabinet	5-9
5.2.4	Actions for Anti-interference	5-9
5.2.5	Dimension Requirement in the Control Cabinet	5-9

# 5.1 Dimensions


# 5.1.1 Profile and Dimensions

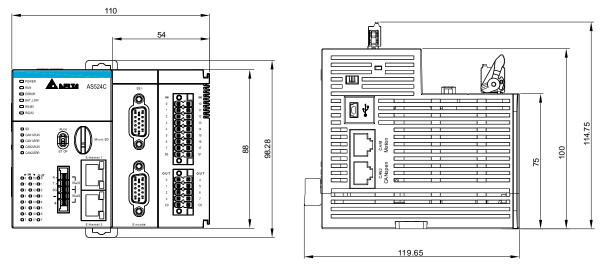

Unit: mm

# 5.1.2 Dimensions of Right-side Extension Module

• See the following dimension figure of a right-side extension module by taking AS04AD-A for example. The length, width and height of all right-side modules are the same as that of AS04AD-A.

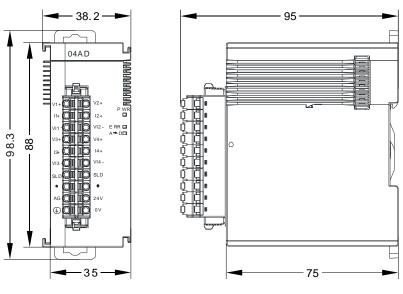



Unit: mm

# 5.1.3 Connecting to the Right-side Extension Module

- Installing the motion controller and AS04AD-A into DIN rail
  - Push the DIN fixing clip on the rear of the motion controller in the direction indicated by arrow ① until a click sound is heared. Then make the groove on the rear of the module aimed at the rail and push the module unitl a click sound is heared. It means that the module has been connected to the rail.
  - For the installation of the second module AS04AD-A, push the DIN fixing clip of AS04AD-A in the direction indicated by arrow ①. Then make the left groove of AS04AD-A aimed at the right groove of the motion controller and insert AS04AD-A to the motion controller. After that, push the module in the direction indicated by arrow ② to fix it on the rail. When a click sound is heared, it means that the module has been fixed on the rail and the connection with the motion controller has been done.

Using the same way, connect IO modules on the right side of the motion controller one by one and fix them on the rail.

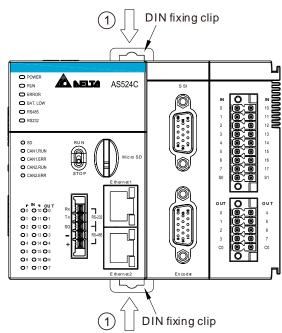


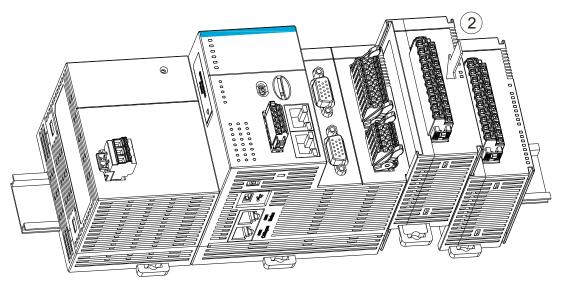

# 5.1.4 Installing and Removing the SD Card


• The SD memory card slot of the motion controller

The memory card slot is located on the right side of the front of the motion controller as illustrated below.

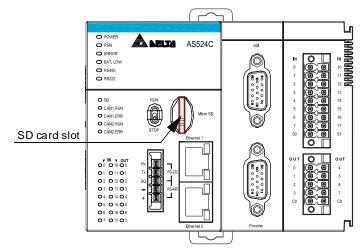


#### Installing SD card

Insert an SD card to the memory card slot directly and push it to the end of the slot until hearing a click. After the installation is finished, the SD card should be fixed tightly. If the SD card inserted to the slot is loose, the installation is unsuccessful. In addition, the SD card has a fool-proofing design. If the direction in which SD card is inserted is wrong, the card will fail to reach the end of the slot. In this case, do not force to push the SD card toward the end of the slot in order to avoid the damage to the module and SD card. Follow the instructions in the figures below to insert the SD card in the right direction.

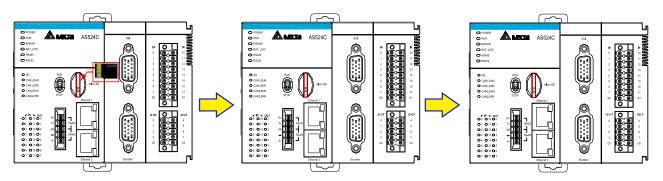


#### Removing SD card

Just push the SD card to the end of the slot so that the SD card will loosen and rebound from inside the slot. And then remove the SD card out of the slot easily.

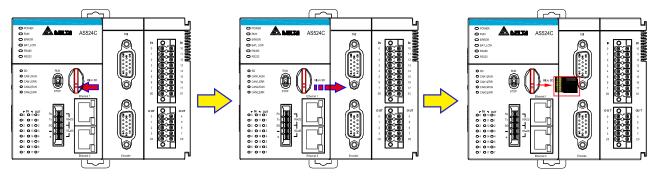

# 5.1.5 Installing and Replacing the Button Cell Battery

Installation

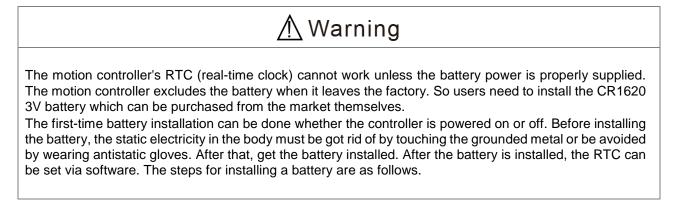

1. Pull out the battery holder in the motion controller with the tip of a screwdriver at the concave part of the battery compartment as shown in Figure 5.1.5.1.

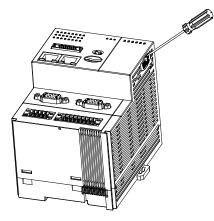


Figure 5.1.5.1

2. Put the CR1620 3V battery in the battery holder in the direction indicated by the arrow as below.

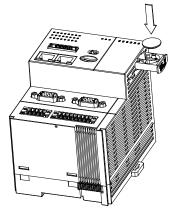


Figure 5.1.5.2

3. After the battery is laid flat in the battery holder, push the battery holder back into the motion controller as shown in figure 5.1.5.3.

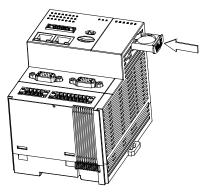


Figure 5.1.5.3

Replacement

# <u>∧</u> Warning

When no battery is installed yet or the battery voltage is low, the BAT LOW indicator of the motion controller is red, which indicates that the controller needs to have a battery installed inside it or the old battery needs to be replaced with a new one.

We recommend replacing the battery as the controller is powered on, since real-time clock data will be lost if you replace the batter while the controller is powered off. Before replacing the battery, the static electricity in the body must be got rid of by touching the grounded metal or be avoided by wearing antistatic gloves. After that, get the battery replaced.

1. Pull out the battery holder in the motion controller with the tip of a screwdriver at the concave part of the battery compartment as shown in Figure 5.1.5.4.

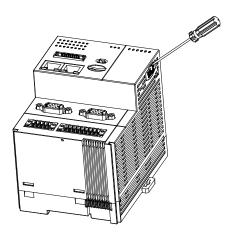


Figure 5.1.5.4

2. Take the CR1620 3V battery out of the battery holder in the direction indicated by the arrow as below.

5-6

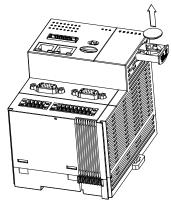


Figure 5.1.5.5

3. After the battery is removed, put in a new one and push the battery holder back into the motion controller as shown in figure 5.1.5.6.


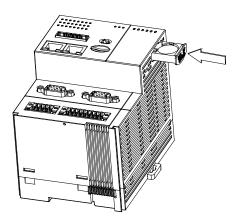


Figure 5.1.5.6


# 5.2 Installing the Module in the Control Cabinet

# 5.2.1 Installing the Module to DIN rail

Pull out the clips at the rear of the motion controller. Then stick the horizontal slots at the rear of the module on the DIN rail. Finally, push in the clips to fix the module inside the control cabinet.

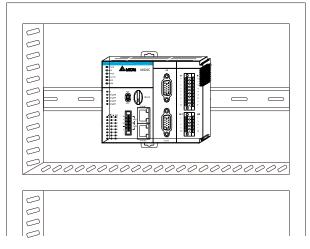



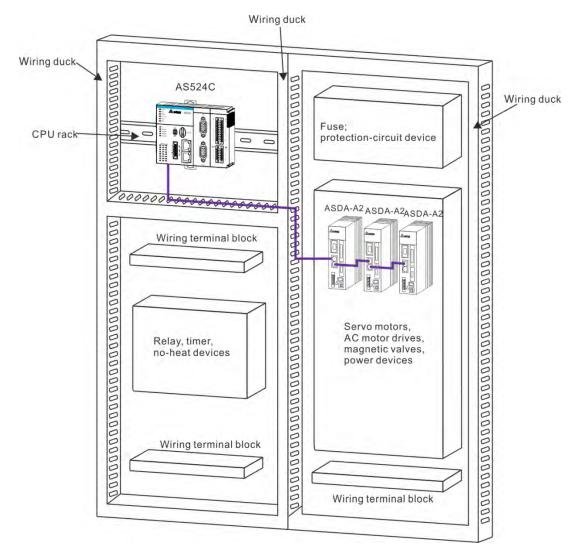

# 5.2.3 Environmental Temperature in the Control Cabinet

#### Requirements

# <u>∧</u> Warning

- The ambient temperature of the motion controller inside the control cabinet is -20~55°C and the humidity is 5 ~ 95%.
- Please avoid making the installation near the high-temperature equipment.
- Keep enough space for air ventilation.
- The fan or air conditioner must be installed if the environment temperature exceeds 60°C.
- The motion controller is for indoor use only.
- The control cabinet which is 1.0m~2.0m in height is easier for installation and operation.
- Keep the installation away from the high-voltage equipment and power equipment.
- The power supply in the control cabinet must be cut off before installation.

## 5.2.4 Actions for Anti-interference


# <u>∧</u> Warning

- Do not install the controller in the control cabinet which contains high-voltage equipment.
- Please keep at least 200mm far away from the power wire for the installation.
- There should be a grounding wire for the control cabinet.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

# 5.2.5 Dimension Requirement in the Control Cabinet

• Installation Figure

The motion controller has to be installed in an enclosure. In order to ensure that the controller radiates heat normally, the space between the controller and the enclosure has to be larger than 50 millimeters. (D > 50mm)

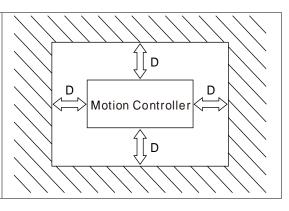

MEMO

6

# Chapter 6 Wiring, Communication Setting and Network Construction

# **Table of Contents**

<b>6.1 Wi</b> 6.1.1 6.1.2	iring. Power Supply Safety Circuit Wiring	.6-3
<b>6.2</b> In 6.2.1 6.2.2 6.2.3	put Point and Output Point Wiring Function that Input Points Support Input Point Wiring Output Point Wiring	.6-6 .6-6
6.3 RS 6.3.1 6.3.2 6.3.3 6.3.4	<b>5-485 Communication Port</b>	6-10 6-10 6-10
6.4 RS 6.4.1 6.4.2 6.4.3 6.4.4	<b>5-232 Communication Port</b>	6-13 6-13 6-13
<b>6.5 SS</b> 6.5.1 6.5.2 6.5.3	Absolute Encoder Port       6         Function of SSI Absolute Encoder       6         Definitions of SSI Port Pins       6         SSI Absolute Encoder Hardware Connection       6	6-15 6-15
<b>6.6 In</b> 6.6.1 6.6.2 6.6.3	<b>cremental Encoders</b>	6-16 6-16
<b>6.7 Ett</b> 6.7.1 6.7.2 6.7.3 6.7.4	hernet Communication Port	6-19 6-20 6-20

otion Communication Port6-2	2
Function that Motion Communication Port Supports	2
Pins of Motion Communication Port	2
Motion Network Connection 6-2	2
Communication Speed and Communication Distance	3
ANopen Communication Port6-2	4
Functions that CANopen Communication Port Supports	4
Pins of CANopen Communication Port	5
PDO Mapping at CANopen Communication Port	5
Network Connection at CANopen Communication Port	5
CANopen Communication Rate and Communication Distance 6-2	6
	Function that Motion Communication Port Supports       6-2         Pins of Motion Communication Port       6-2         Motion Network Connection       6-2         Communication Speed and Communication Distance       6-2         ANopen Communication Port       6-2         Functions that CANopen Communication Port Supports       6-2


# 6.1 Wiring

# 6.1.1 Power Supply

The power input of the motion controller is 24V DC. Please notice the following points during use.



- Connect the supply power to the two terminals, 24V and 0V and the grounding terminal to the earth. Be cautious that the motion controller may be damaged if the positive and negative polarities of the supply power are connected reversely.
- Please be sure to use certified power supply with SELV output or certified power supply providing double insulation evaluated by UL60950, or UL61010-1 and UL61010-2-201 standards
- Use copper conductors as power wires only. The diameter of power wires must be between 12 and 28AWG and the rated temperature should be greater than 70°C. The power terminal block plug wiring torque is 4.5 in-lbs.
- Separate the supply power for the controller, the external supply power for input and output points of the controller and the supply power for other loads. The controller uses an individual supply power.
- Add a noise filter and an isolation transformer before the controller's supply power. The isolation transformer is installed between the supply power and the noise filter. The transformer secondary side need not be earthed. See the wiring diagram below.
- The isolation transformer effectively reduces interference from the ground, electrical surge noise and etc. The power wires between the isolation transformer and the controller should be tightly twisted. The shorter the distance between them is, the better effect is produced. Be sure to keep away from the power lines and high voltage lines.
- The noise filter can effectively reduce interference. The incoming cable and the outgoing cable of the filter should be arranged separately to avoid coupling the interference before the noise filter to the cable after the noise filter.
- The long power shutdown or power voltage drop will stop the motion controller from running and the controller will stop communicating with the servo drive when all outputs are FALSE. The motion controller will resume the connection with the servo drive when the power supply returns to normal.

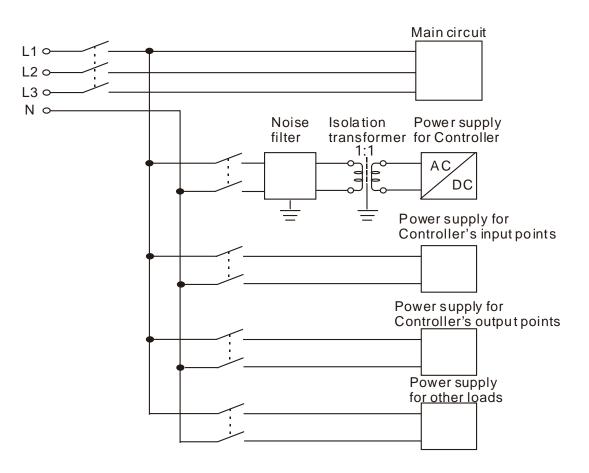


## 6.1.2 Safety Circuit Wiring

\_6

The action of any device inside the motion controller may affect the behavior of the external equipment under the motion controller's control over the servo drive. Therefore, any device trouble may cause the entire automatic control system to lose control and even result in injuries and death of personnel. For these reasons, we suggest the following safety device should be included in the power input circuit.

▲ Warning

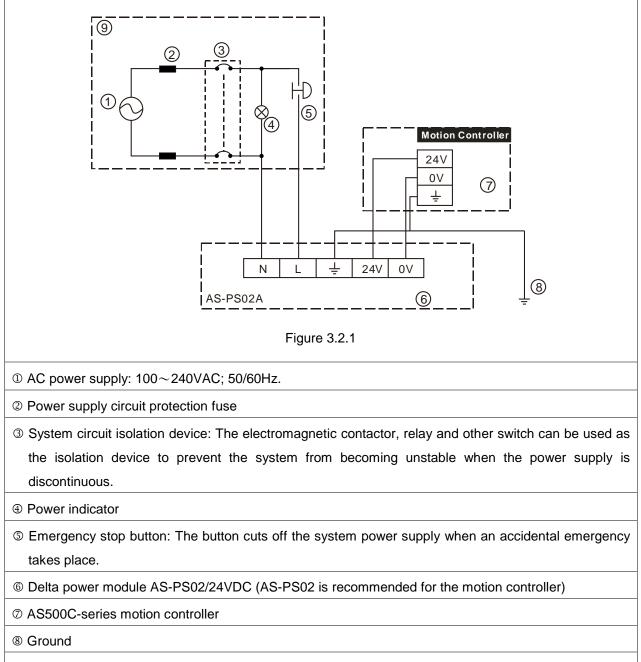

Safety circuit

# 6.2 Input Point and Output Point Wiring

# 6.2.1 Function that Input Points Support

There are 16 input points which support external interrupt and filter functions in the motion controller. In addition, the input points can be used to capture the encoder position.

Refer to the explanation of the DMC\_TouchProbe instruction for details on position capture.

#### • The work principle of the input filter

The input filter filters short pulse signals via the 16 I points I0~I7 and I10~I17 to reduce the influence of the input interference signals. Increasing the filter value can decrease the vibration of input signals or the influence from external interference.

Input filter time: t=31us \* (0~255). So the filter time is a multiple of 31us and 0 is the default value. The input filter time can be set through the software.

#### • When there is the set filter:

When the filter time is set to t (us), the signal is valid if the ON or OFF time of the input signal is greater than t (us). If the ON or OFF time of input signal is less than t (us), the signal will be eliminated. The input signal left after being filtered will be input after being delayed by t (us).

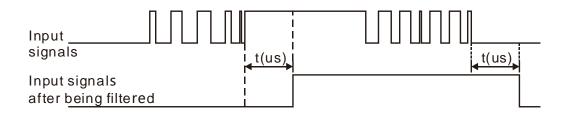


Figure 6.2.1.1

#### When there is no filter set:

The input signals have no change when no filter time is set.

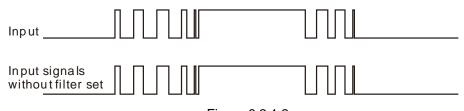



Figure 6.2.1.2

## 6.2.2 Input Point Wiring

There are two types of DC inputs, SINK and SOURCE. See the details for the wiring in the following two modes.

#### • Sink Mode


Under Sink mode, the simplified model is shown below and the current flows into the common ports S0 and S1.

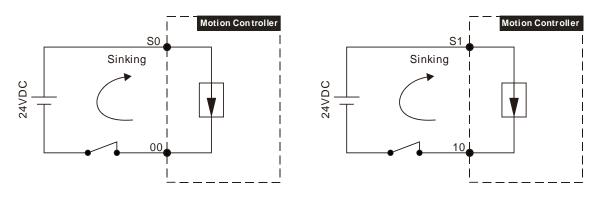




See the relevant wiring circuit in the following figures.

1. The input points of the motion controller, 00~07 correspond to S0 as shown below.

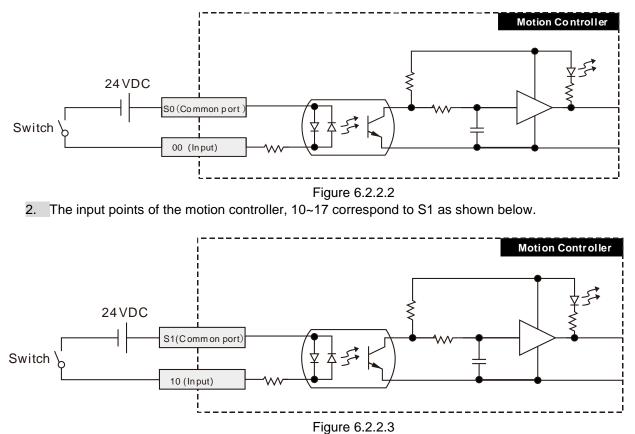

#### • Source Mode

Under Source mode, the simplified model is illustrated below and the current flows into the common ports S0 and S1.

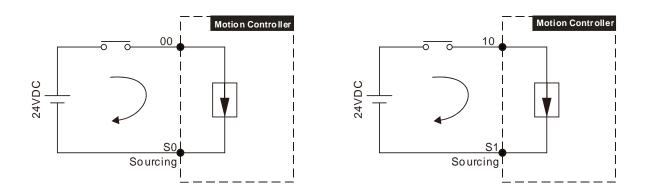



See the wiring circuit below

■ The input points of the motion controller, 00~07 correspond to S0 as shown below.


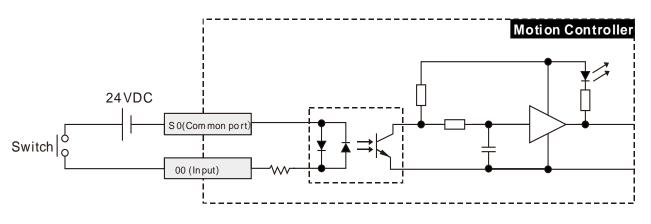



Figure 6.2.2.5

■ The input points of the motion controller, 10~17 correspond to S1 as shown below.

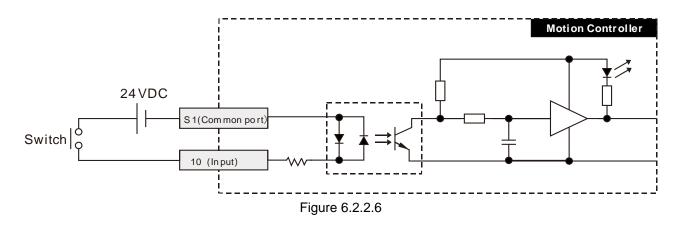

# 6.2.3 Output Point Wiring

All local output points of the motion controller are of transistor output. The wiring circuit is shown as below.

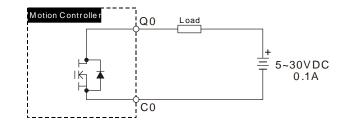

# 6.3 RS-485 Communication Port

# 6.3.1 Function that RS-485 Port Supports

The RS-485 communication port of the motion controller can function as Modbus master or slave. HMI, PLC or other Modbus master device can read and write data in the devices inside the motion controller. The interval time when the Modbus master accesses the motion controller should exceed 5ms.

The progrom can not be downloaded via RS-485 port. RS-485 supports Modbus protocol, ASCII as well as RTU mode. The function codes which RS-485 port supports include 16#01, 16#02, 16#03, 16#05, 16#06, 16#0F and 16#10. The station addresses that RS-485 port supports are 1~255. The broadcast function is not supported.

Refer to appendix A for details on Modbus communication and Modbus device addresses.

# 6.3.2 Definitions of RS-485 Port Pins


Pin No.	Signal	Definition	sg 📶 🦳
+	D+	RS-485 positive pole	- 3 - RS-485 + 3
-	D-	RS-485 negative pole	
SG	SG	RS-485 signal ground	

See the table below for definitions of respective RS-485 communication port pins.

# 6.3.3 RS-485 Hardware Connection


## • Example on Connection of the Motion Controller into Modbus Network

AS500C-Series controller is connected to Modbus network via RS-485 as illustrated below.

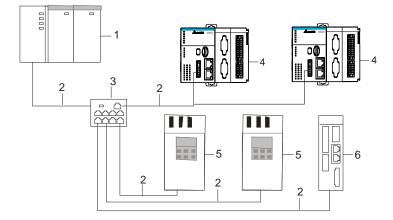

Device No.	1	2	3	4	5	6
Device name	Modbus master	Commun ication cable	VFD-CM08	Motion controller	AC motor drive	Servo drive

• RS-485 Wiring:

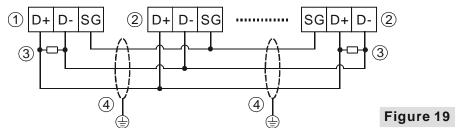

#### Explanation of numbers

1	2	3	4
Master	Slave	Terminal resistor	Shielded cable

Notes:

- 1. Terminal resistors with the value of  $120\Omega$  are recommended to connect to both ends of the bus.
- 2. To ensure high communication quality, please use the shielded twisted pair cable (20AWG).
- 3. When the internal voltages of two devices are different, make SG (Signal Ground) of the two devices connected with each other to balance their SG voltages and make the communication more stable.

#### • Communication Format that RS-485 Supports

RS-485 communication port supports ASCII or RTU communication formats and the supported baud rate can be up to 115200bps.

Baud rate	9600, 19200, 38400, 57600, 115200					
Mode	ASCII RTU					
Communication format	7,E,1	7,E,2	7,N,1	7,N,2	8,E,1	8,E,2
	7,0,1	7,0,2	8,E,1	8,E,2	8,N,1	8,N,2
	8,N,1	8,N,2	8,O,1	8,O,2	8,O,1	8,O,2

## 6.3.4 Supported Function Codes and Exception Codes

#### • Modbus Function Codes:

1. The function codes that RS-485 port of the motion controller supports are listed in the following table.

Function code	Indication	Whether to broadcast (Y/N)	Max. number of writable/readable registers	Available register
16#01	6#01 Read output bit register values.		256	Bit register
16#02	Read bit register values.	N	256	Bit register
16#03	6#03 Read one single or multiple word register values.		100	Word register
16#05	6#05 Write one single bit register value.		1	Bit register
16#06	Write one single word register value.	Y	1	Word register
16#0F	16#0F Write multiple bit register values.		256	Bit register

## AS500C Series Motion Controller Operation Manual

Function code	Indication	Whether to broadcast (Y/N)	Max. number of writable/readable registers	Available register
16#10	Write multiple word register values.	Y	100	Word register

2. The exception codes that RS-485 port of the motion controller supports are listed in the following table.

Exception response code	Indication
16#01	Unsupportive function code
16#02	Unsupportive Modbus address
16#03	The data length is out of the valid range.

# 6.4 RS-232 Communication Port

# 6.4.1 Function that RS-232 Port Supports

The RS-232 communication port of the motion controller can function as Modbus master or slave. HMI, PLC or other Modbus device can read and write data in the devices inside the motion controller. The progrom can not be downloaded through RS-232 port. RS-232 supports Modbus protocol, ASCII mode as well as RTU mode. The function codes which RS-232 port supports include 16#01, 16#02, 16#03, 16#05, 16#06, 16#0F and 16#10. The station addresses that RS-232 port supports are 1~255. The broadcast function is not supported.


Refer to appendix A for details on Modbus communication and Modbus device addresses.

## 6.4.2 Definitions of RS-232 Port Pins

The motion controller's SSI port consists of 15 pins. See the table below for definitions of respective RS-232 communication port pins.

Pin No.	Signal	Definition	
Rx	Rx	Receiving data	
Тх	Тх	Transmitting data	Tx 3 1 RS-232 SG 1 1 1
SG	GND	Signal ground	

## 6.4.3 RS-232 Hardware Connection

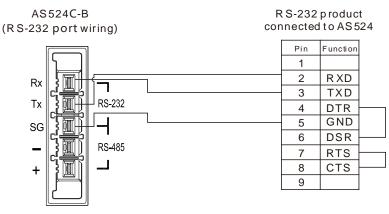

• RS-232 port is connected to HMI when the motion controller functions as a slave.

AS524C-B



• The communication format that RS-232 supports

Baud rate	9600, 19200, 38400, 57600, 115200						
Mode	ASCII RTU						
	7,E,1	7,E,2	7,N,1	7,N,2	8,E,1	8,E,2	
Communication format	7,O,1	7,0,2	8,E,1	8,E,2	8,N,1	8,N,2	
	8,N,1	8,N,2	8,O,1	8,O,2	8,O,1	8,O,2	

# 6.4.4 Supported Function Codes and Exception Codes

## • Modbus Function Codes:

1. The function codes that RS-232 port of the motion controller supports are listed in the following table.

Function code	Indication	Max. number of writable/readable registers	Available register
16#01	Read output bit register values.	256	Bit register
16#02	Read bit register values.	256	Bit register
16#03	Read one single or multiple word register values.	100	Word register
16#05	Write one single bit register value.	1	Bit register
16#06	Write one single word register value.	1	Word register
16#0F	Write multiple bit register values.	256	Bit register
16#10	Write multiple word register values.	100	Word register

2. The exception codes that RS-232 port of the motion controller supports are listed in the following table.

Exception code	Indication
16#01	Unsupportive function code
16#02	Unsupportive Modbus address
16#03	The data length is out of the valid range.

# 6.5 SSI Absolute Encoder Port

# 6.5.1 Function of SSI Absolute Encoder

The motion controller's SSI port is a 15-pin D-SUB interface which can be used to connect SSI encoder. In addition, the port also includes the 5V (400mA) power output which provides the power supply to the encoder. You can use the SSI encoder axis to control the motion of slave axes according to the number of pulses received via the encoder port.


# 6.5.2 Definitions of SSI Port Pins

The motion controller's SSI port is a 15-pin D-SUB interface. See the table below for definitions of respective SSI communication port pins.

Pin No.	Signal	Definition	
1	DATA+	Positive pole of absolute encoder data	
2	DATA-	Negative pole of absolute encoder data	
6	CLK+	Positive pole of absolute encoder clock	
14	CLK-	Negative pole of absolute encoder clock	
8	GND	Power ground of the absolute encoder	
15	5V	Absolute encoder power	SSI

# 6.5.3 SSI Absolute Encoder Hardware Connection

Illustration of SSI Absolute Encoder Wiring

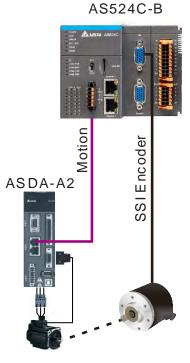

 Specification for SSI Absolute Encoder Interface Wiring SSI encoder interface of the motion controller and the wiring method are shown below.

	524C-B SSI	SSI enco
Pin	Function	Function
1	DATA+	DATA+
2	DATA-	DATA-
6	CLK+	CLK+
14	CLK-	CLK-
15	5V	VCC
8	GND	0V

**Note:** The power supply for SSI port of the motion controller is 5V power.

When VCC = 5V, connect the power voltage VCC of SSI encoder to pin 15 of SSI interface and 0V of SSI encoder to pin 8 of SSI interface.

When VCC  $\pm$  5V, please supply the power to SSI encoder separately according to the actual power voltage of the SSI encoder which is connected.

• Specification for SSI Absolute Encoder Communication Cable Please use the shielded pair-twisted cable for CLK+, CLK-, DATA+ and DATA- signal transmission.

# 6.6 Incremental Encoders

## 6.6.1 Function of Incremental Encoder

The motion controller's incremental encoder port is a 15-pin D-SUB interface which can connect two independent incremental encoders. Both of the two encoder ports support differential signal input with maximum work frequency of 1MHz ( $250Kx \ 4 = 1MHz$ ) per one. Additionally, the port integrates two 5V (400mA) power outputs to supply power to the two encoders. You can create an incremental encoder axis for either of the two encoders to control the motion of slave axes according to the number of pulses received at the encoder port.


## 6.6.2 Definition of Incremental Encoder Port Pins

The motion controller's incremental encoder port is a 15-pin interface. See the table below for definitions of respective encoder communication port pins.

Pin No.	Signal	Definition	
1	A1+		
2	A1-		
10	B1+	Differential signals of the first	
11	B1-	incremental encoder	
4	Z1+		
5	Z1-		
15	+5V	Power supply for the first encoder	
3	A2+	Differential signals of the second incremental encoder	
9	A2-		
6	B2+		
12	B2-		
13	Z2+		Encoder
14	Z2-		
7	+5V	Power supply for the second encoder	
8	0V	0V shared by the two encoders	
Outer shell		Shielding layer	

# 6.6.3 Incremental Encoder Hardware Connection

Illustration of Incremental Encoder Wiring

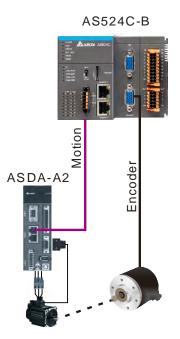

• Specification for Incremental Encoder Port Wiring The incremental encoder interface of the motion controller and the wiring method are shown below.

	24C-B coder	Encode
Pin	Function	Function
1	A1+	A
2	A1-	Ā
10	B1+	В
11	B1-	Ē
4	Z1+	Ζ
5	Z1-	Ī
15	+5V	Vcc
8	GND	OV

Note: The power supply for Encoder port of the motion controller is 5V power.

When VCC = 5V, connect the power voltage VCC of an encoder to pin 15 of the motion controller's Encoder interface and 0V of the encoder to pin 8 of Encoder interface. When VCC  $\neq$  5V, the power is supplied to the encoder alone according to the actual power voltage of

When VCC  $\neq$  5V, the power is supplied to the encoder alone according to the actual power voltage of the encoder which is connected.

# 6.7 Ethernet Communication Port

# 6.7.1 Function that Ethernet Communication Port Supports

There are two independent Ethernet communication ports: Ethernet1 and Ethernet2 in the motion controller, and their IP addresses need be set individually.

Both of the two Ethernet ports can be used to download configuration files, execution files and CAM files. They also support automatic jumper function and users do not need to additionally select wire jumper when one of Ethernet ports is connected to the computer or switchboard. Besides, they can automatically detect the transmission speed of 10Mbps and 100 Mbps as well.

HMI, PLC or other Modbus TCP master device can read and write data in the devices inside the motion controller via the two Ethernet ports. For details on Modbus TCP communication, refer to appendix B.

Both of the two Ethernet ports support Modbus TCP protocol. Ethernet1 port can work as a slave only and Ethernet2 port can work as a master or a slave. Ethernet2 port supports EtherNet/IP slave function and Socket function. For more details on the two ports, see the following table.

Item			Ethernet1	Ethernet2
Communication protocol		MODBUS TCP	MODBUS TCP, Socket, EtherNet/IP	
MODBUS TCP	Connections (Server)		16	- 16
	Connections	(Client)	0	10
Socket	TCP connect	ons	0	8
Sockei	UDP connect	ions	0	0
	Device type		Adapter	Adapter
		CIP connections		8
	CIP_IO Connection	TCP connections	Unsupported	16
		Interval time for sending messages (RPI)		5ms~1000ms
		Maximum data size per message		200bytes
EtherNet/IP		Class 3 (Connected Type)		8
		UCMM (Non-Connected Type)		16
	CIP_Explicit Message	Supports CIP objects	Unsupported	Identity, Message Router, Assembly, Connection Manager, Port, TCP/IP interface, Ethernet link, Vendor specific

When the controller serves as the EtherNet/IP slave, IO connections correspond to default start devices as shown in the following table.

Start device	Default start device for receiving data from the master	Default start device for sending data to the master
Connection 1	%MW11000	%MW12000

Start device IO Connection	Default start device for receiving data from the master	Default start device for sending data to the master
Connection 2	%MW11100	%MW12100
Connection 3	%MW11200	%MW12200
Connection 4	%MW11300	%MW12300
Connection 5	%MW11400	%MW12400
Connection 6	%MW11500	%MW12500
Connection 7	%MW11600	%MW12600
Connection 8	%MW11700	%MW12700

# 6.7.2 Pins of Ethernet Communication Port

The motion controller has two independant Ethernet ports, Ethernet1 and Ethernet2 supporting Modbus TCP protocol with the pins shown in the following table. The two Ethernet ports are independant and their IP addresses need be set seperately. The default IP address for Ethernet1 is 192.168.0.1 and the default IP address for Ethernet2 is 192.168.1.1.

Pin No.	Signal	Definition	E themet 1
1	Tx+	Positive pole for transmiting data	876
2	Tx-	Negative pole for transmitting data	
3	Rx+	Positive pole for receiving data	
4	Reserved	Reserved	
5	Reserved	Reserved	
6	Rx-	Negative pole for receiving data	
7	Reserved	Reserved	
8	Reserved	Reserved	E themet 2

# 6.7.3 Network Connection of Ethernet Communication Port



# 6.7.4 Function Codes that Ethernet Communication Port Supports

Below is the list of the function codes and exception response codes which are supported when the motion controller's communication ports, Ethernet1 and Ethernet2 use Modbus TCP protocol.

Function code	unction code Indication		Available register
16#01	Read output bit register values.	256	Bit register
16#02	Read bit register values.	256	Bit register
16#03	Read one single or multiple word register values.	100	Word register
16#05	Write one single bit register value.	1	Bit register
16#06	Write one single word register value.	1	Word register
16#0F	Write multiple bit register values.	256	Bit register
16#10 Write multiple word register values.		100	Word register

Exception response code	Indication
16#01	Unsupportive function code
16#02	Unsupportive Modbus address
16#03	The data length is out of the valid range.

# 6.8 Motion Communication Port

# 6.8.1 Function that Motion Communication Port Supports


Motion (CAN1) communication port is used for motion control. Motion instructions control a servo via the communication port. SDO command can be sent out through the communication port. But the PDO configuration can not be carried out through the communication port.

## 6.8.2 Pins of Motion Communication Port

The following table lists the pins of Motion communication port (CAN1) which is used for the motion control.

Pin No.	Signal	Definition	
1	CAN_H	Signal+	
2	CAN_L	Signal-	
3	CAN_GND	0 VDC	CAN1 Motion
4	Reserved	Reserved	
5	Reserved	Reserved	
6	Reserved	Reserved	
7	CAN_GND	0 VDC	
8	Reserved	Reserved	

## 6.8.3 Motion Network Connection

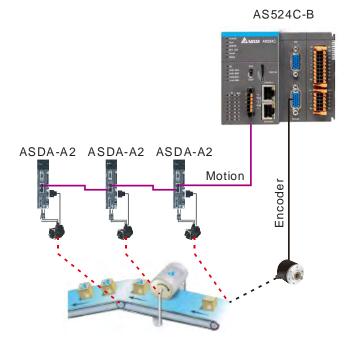

- 1. The motion controller has one 120 Ohm terminal resistor embedded in its Motion interface (CAN1).
- 2. Please use Delta cables as CANopen cables. For specifications of Delta cables, refer to Appendix E.

# 6.8.4 Communication Speed and Communication Distance

The transmission distance of the Motion (CAN1) bus network depends on the transmission speed of Motion (CAN1) bus. Below is the table where the maximum communication distances correspond to different transmission speeds.

Transmission speed (Bit/second)	500K	1M
Max. communication distance (Meter)	100	25

# 6.9 CANopen Communication Port

# 6.9.1 Functions that CANopen Communication Port Supports

CANopen (CAN2) communication port can be used as CANopen network master or as a slave of other master.

- As a master, CAN1 communication port supports following functions.
  - Standard CANopen protocol DS301V4.02;
  - NMT (Network Management Object) Master service;
  - NMT Error control; NMT error control is used to watch if some slave is offline. NMT error control includes Heartbeat and Node Guarding. The module supports Heartbeat function.
  - Connects max. 32 slaves.
  - PDO (Process Data Object) service.

The number of RxPDOs: max. 200, data length: max. 1000 bytes

The number of TxPDOs: max. 200, data length: max. 1000 bytes

Maximum 8 TxPDOs and 8 RxPDOs are configured for each slave.

PDO transmission type: supporting event trigger, time trigger, synchronous and cyclic, synchronous and acyclic

PDO mapping: every PDO can map 32 parameters at most.

The data type that CAN communication port supports

Storage capacity	Data type	
1bit	BOOL	
8bit	SINT, USINT,BYTE	
16bit	INT, UINT, WORD	
32bit	DINT, UDINT, REAL, DWORD	
64bit	LINT, ULINT, LREAL, LWORD	

Supports SDO service

Supports standard expedited SDO transmission mode; Supports Auto SDO function; capable of sending a maximum of 30 Auto SDOs to each slave; Supports reading and writing of slave data by using SDO service in PLC ladder diagram program.

- Supports SYNC producer, range 0-65535ms
   Multiple devices perform an action synchronously through SYNC message.
- Supports the CANopen communication speeds: 20K, 50K, 125K, 250K, 500K, 1Mbps
- As a slave, CAN1 communication port supports following functions.
  - Standard CANopen protocol DS301V4.02
  - NMT slave service
- NMT Error control Supporting Heartbeat Protocol error control instead of Node Guarding error control
  - PDO service The number of RxPDOs: max. 8, data length: max. 64 bytes The number of TxPDOs: max .8, data length: max. 64 bytes
  - PDO transmission type: event trigger, time trigger, synchronous and cyclic, synchronous and acyclic
  - SDO service Supporting standard expedited SDO transmission mode.

# 6.9.2 Pins of CANopen Communication Port

The motion controller's CANopen communication port (CAN2) is used in the standard CANopen communication and its pin descriptions are listed in the following table.

Pin No.	Signal	Definition	
1	CAN_H	Signal+	
2	CAN_L	Signal-	
3	CAN_GND	0 VDC	ge ~ /²
4	Reserved	Reserved	ANOPE
5	Reserved	Reserved	S ⊂ I E E
6	Reserved	Reserved	
7	CAN_GND	0 VDC	
8	Reserved	Reserved	

# 6.9.3 PDO Mapping at CANopen Communication Port


The input mapping area is %MW5000~%MW5499 and output mapping area is %MW5500~%MW5999 when the motion controller works as CANopen master.

The input mapping area is %MW5000~%MW5031 and output mapping area is %MW5500~%MW5531 when the motion controller works as CANopen slave.


## 6.9.4 Network Connection at CANopen Communication Port

### • CANopen Bus Terminals and Network Topology

Both of the two ends of a CANopen network need be connected with the terminal resistors of  $120\Omega$  to enhance the stability of CANopen communication. See the illustration of a basic CANopen network topology below.

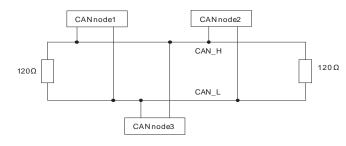

# CANopen Bus Network Topology

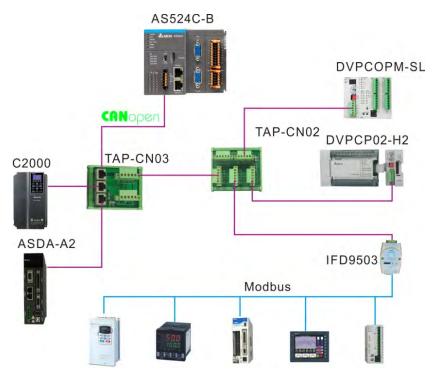

- 1> Delta's standard cables such as UC-DN01Z-01A thick cable, UC-DN01Z-02A thin cable and UC-CMC010-01A thin cable are recommended to use in construction of a CANopen network. The communication cable must keep away from the power cable.
- 2> The terminal resistor of 120Ω should be connected between CAN\_H and CAN\_L of each end of the network. You can purchase Delta terminal resistor, TAP-TR01.

\_6

# 6.9.5 CANopen Communication Rate and Communication Distance

The transmission distance of CANopen bus network depends on the transmission speed of CANopen bus. Below is the table where the maximum communication distances correspond to different transmission speeds.

Transmission speed (Bit/second)	20K	50K	125K	250K	500K	1M
Max. communication distance (Meter)	2500	1000	500	250	100	25



# Chapter 7 Execution Principle

# Table of Contents

7.1	Tas	sks	7-2
7.1	.1	Task Types	7-2
7.1	.2	Priority levels of Tasks	7-4
7.1	.3	Watchdog for a Task	7-6
7.1	.4	Motion and Communication Instructions for Each Task Type	7-7
7.2	The	e Impact of PLC RUN or STOP on Variables and Devices	7-10
7.3	Re	lationship between Motion Program and Motion Bus	7-10
7.4	Syr	nchronization Cycle Period Setting	7-11

# 7.1 Tasks

- Tasks are a series of functions of processing specified execution conditions and execution sequences for I/O refresh and user program execution.
- A task is defined with a name, priority level and type. Tasks can be classified into three types, the cyclic task, freewheeling task and event-triggered task.
- For every task, a group of POUs which are triggered by the task can be specified. If the task is executed in current period, the POUs will be processed within a period of time.
- The priority level and task type determine the execution sequence of the task.
- A watchdog can be assigned for every task.

# 7.1.1 Task Types

### • Three task types that the motion controller supports


- 1. Cyclic
- 2. Freewheeling
- 3. Triggered by event

### • Maximum 24 tasks that the motion controller supports are respectively described below.

### Cyclic task

The cyclic task will be executed cyclically according to the set time interval.

### > The way the cyclic task is executed

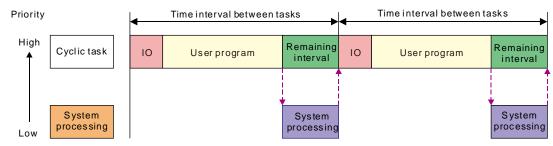

- IO: IO means I/O refresh. I/O includes local I/O points and right-side extension module data and CANopen data. The data can be specified to refresh before the set task is executed. If not specified, the data will be refreshed during the system processing.
- **User Program:** User Program stands for user program execution which is based on the execution sequences of programs assigned in a task.

### Remaining interval:

When the controller is to perform system processing, the low-priority task is executed first if any and then the system processing is performed.

### System processing:

The controller will perform the system processing which includes Ethernet, RS232 and RS485 communication processing after all task requests are completed.


The four terms mentioned above have the same meanings as those in the following sections.

**Note:** If the cycle set for a cyclic task is too short, after the user program execution is finished, the task execution will be repeated immediately and no low-priority task or no system processing will be executed. In this case, the execution of all tasks will be affected. If the watchdog is set for the task, the watchdog timeout will occur, the controller will enter Error status and user program execution will stop. If the watchdog is not set for the task, the controller will not be able to perform system processing and the problems such as communication timeout will take place.

# Freewheeling task

*Freewheeling task* : The task will be handled as soon as the program running starts. The task will be restarted automatically in the next cycle after one execution cycle ends.

## > The way a freewheeling task is executed

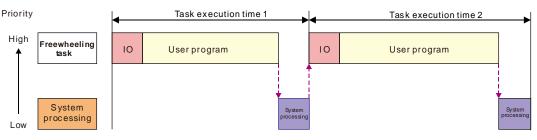


**Note:** There is no fixed execution time for the freewheeling task. So the values of task execution time 1 and task execution time 2 may not be equal in the above figure.

## Task triggered by event

**Event task**: An event task is executed once just when the specified event happens. The timing for execution of an event task depends on the timing for occurring of the event and the priority level of the event task.

### > The way an event task is executed

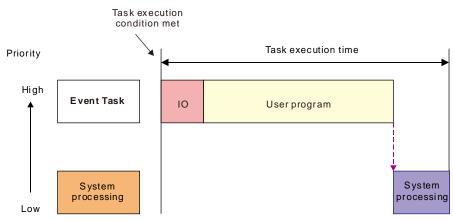

### > The event tasks for option contain following few types.

- Motion event (Motion control task)
- Rising edge or falling edge of local input points (I0~I7 and I10~I17)
- CANopen SYNC signal
- Z pulse rising edge of incremental encoder 1 or encoder 2

The condition for the second-time execution is ignored when the condition required for execution of the event task is met again before the event task is completed. The period before an event task is completed is the course while the event task is being executed or is waiting to be executed.

### Motion Event

Motion port of the controller sends out SYNC signal and the task is triggered.

**Note:** The motion task is set to priority 1 by default. The priority level can be modified. However, make sure that there is enough time for execution of the motion task within CANopen SYNC period.

SYNC cycle setting should meet following conditions.

- > There must be enough time for execution of the program defined in a motion task.
- There must be sufficient time for PDO and SDO data exchange between the controller and servo drive.

Insufficient SYNC period time will result in the controlled device to fail to receive SYNC signal and unpredictable operations. Refer to section 7.3 for SYNC period setting.

## Rising edge or falling edge of local input points (I0~I7 · I10~I17)

The task is triggered when rising edge or falling edge of input point signal is detected. The response time of input points can be set through the filter function.

## • CANopen bus SYNC message

The task is triggered when SYNC signal is produced at CANopen port of the controller.

### • Z pulse rising edge for incremental encoder 1

The task is triggered when the rising edge of Z signal of the first encoder is detected at Encoder port of the controller.

## • Z pulse rising edge for incremental encoder 2


The task is triggered when the rising edge of Z signal of the second encoder is detected at Encoder port of the controller.

# 7.1.2 Priority levels of Tasks

The controller can not perform multiple tasks simultaneously. Every task must be given a priority level and they are executed according to preset priorities. Priority level can be set within the range of 1 to 24. (1 is the highest priority and 24 is the lowest priority.) The priority level of each task must be unique. The task with higher priority takes priority to perform. The high-priority task can interrupt the low-priority task. We recommend that the task which has a high requirement of real time should be given a high priority and the task which has a low requirement of real time should be given a low priority of the default motion control task built in the CANopen Builder software is 1 by default.


# • The principle for multi-task execution

When the execution conditions of two tasks are met simultaneously (Cyclic task and freewheeling task)

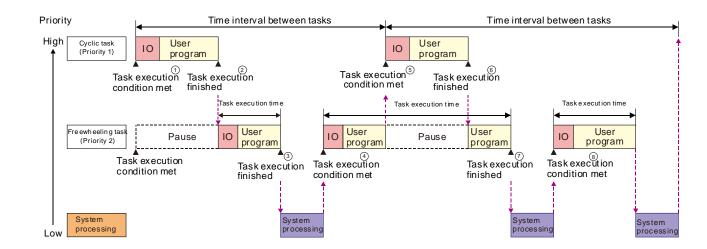

- (1) The execution conditions for the cyclic task and freewheeling task are met at the same time. The cyclic task is executed first because of its higher priority.
- (2) When the cyclic task execution is finished, the freewheeling task execution starts.

- (3) The controller will execute the system processing if there is no other task after the execution of the freewheeling task is completed.
- (4) The execution of the freewheeling task continues since the high-priority cyclic task request has not arrived.
- (5) The cyclic task interrupts the freewheeling task execution and the controller executes the cyclic task because of the arrival of the high-priority cyclic task request during the execution of the freewheeling task.
- (6) The controller continues to execute the part of the low-priority freewheeling task, which has not been executed yet when the execution of the cyclic task is completed.
- ⑦ When the execution of the freewheeling task is completed, the controller executes the system processing due to no other task request.
- (8) When the system processing is completed, the execution of the freewheeling task continues due to no high-priority cyclic task request.
- When three tasks are executed in mixture (Event task, Cyclic task and Freewheeling task)

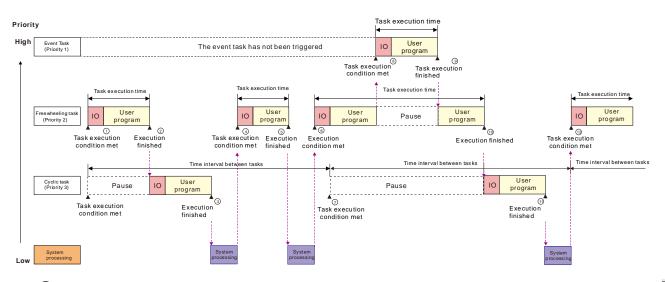

- (1) When the conditions for execution of the freewheeling task and cyclic task are both met, the freewheeling task is executed first because the priority of the freewheeling task is higher.
- (2) The cyclic task execution starts when the freewheeling task execution is completed.
- (3) When the cyclic task execution is completed, the controller executes the system processing due to no other task request.
- (4) The freewheeling task is executed when the system processing is completed.
- (5) When the freewheeling task execution is completed, the controller executes the system processing due to no other task request.
- (6) The freewheeling task is executed when the system processing is completed.
- (7) The freewheeling task execution continues because the freewheeling task has a higher priority than the cyclic task although the execution condition for the cyclic task is met. And the cyclic task waits to execute.
- (8) The event task interrupts the freewheeling task execution because the event task has the highest priority and the execution condition for the event task is met.

7-5

- (9) The controller continues to execute the part of the low-priority freewheeling task, which has not been executed yet when the event task execution is completed.
- 1 The freewheeling task execution is completed. The controller executes the cyclic task since the cyclic task request in 7 is not responded yet.
- ① The cyclic task execution is completed. The controller executes the system processing due to no other task request.

# 7.1.3 Watchdog for a Task

Every task can be given a watchdog. When the task execution time exceeds the set watchdog time, the controller will enter Error state and the user program execution will stop.

Watchdog time: The longest time allowed for the execution of a task

# 7.1.4 Motion and Communication Instructions for Each Task Type

Here is the table of motion instructions for different task types. "V" means the motion instruction can be executed for the task type and "--" means the motion instruction can not be executed for the task type.

			Task type			
Classification	Instruction name	Cyclic	Freewheeling		riggered isk	
			Motion task	Motion task		
	MC_Power	-	-	V	-	
	MC_Home	-	-	V	-	
	MC_MoveVelocity	-	-	V	-	
	MC_Halt	-	-	V	-	
	MC_Stop	-	-	V	-	
	MC_MoveRelative	-	-	V	-	
	MC_MoveAdditive	-	-	V	-	
	MC_MoveAbsolute	-	-	V	-	
	MC_MoveSuperimposed	-	-	V	-	
	MC_Haltsuperimposed	-	-	V	-	
	MC_SetPosition	-	-	V	-	
	MC_SetOverride	-	-	V	-	
	MC_Reset	-	-	V	-	
	DMC_SetTorque	-	-	V	-	
	MC_ReadAxisError	V	V	V	V	
Single-axis instructions	MC_ReadActualPosition	V	V	V	V	
	MC_ReadStatus	V	V	V	V	
	MC_ReadMotionState	V	V	V	V	
	DMC_ReadParameter_Motion	V	V	V	V	
	DMC_WriteParameter_Motion	V	V	V	V	
	DMC_TouchProbe	-	-	V	-	
	DMC_ChangeMechanismGearRatio	-	-	V	-	
	DMC_Jog	-	-	V	-	
	DMC_MoveVelocity	-	-	V	-	
	DMC_MoveVelocityStopByPos	-	-	V	-	
	DMC_MoveVelocityStopByLinePos	-	-	V	-	
	DMC_ReadPositionLagStatus	V	V	V	V	
	DMC_SwitchSoftLimit	V	V	V	V	
	DMC_TorqueControl	-	-	V	-	
	DMC_TouchProbeCyclically	-	-	V	-	
	DMC_WritePositionLagSetting	V	V	V	V	
Multi-axis	MC_GearIn	-	-	V	-	

			Task ty	ре	
Classification	Instruction name	Cyclic	Freewheeling	Event-triggered task	
		task	task	Motion task	Motion task
instructions	MC_GearOut	-	-	V	-
	MC_CombineAxes	-	-	V	-
	MC_CamIn	-	-	V	-
	MC_CamOut	-	-	V	-
	DMC_CamAddTappet	V	V	V	V
	DMC_CamDeleteTappet	V	V	V	V
	DMC_CamReadPoint	V	V	V	V
	DMC_CamWritePoint	V	V	V	V
	DMC_CamSet	-	-	V	-
	DMC_CamReadTappetStatus	V	V	V	V
	DMC_CamReadTappetValue	V	V	V	V
	DMC_CamWriteTappetValue	V	V	V	V
	APF_RotaryCut_Init	-	-	V	-
Application	APF_RotaryCut_In	-	-	V	-
instructions	APF_RotaryCut_Out	-	-	V	-
	DMC_CartesianCoordinate	-	-	V	-
	DMC_ReadMFunction	V	V	V	V
G code	DMC_ResetMFunction	V	V	V	V
instructions	DMC_SetG0Para	V	V	V	V
	DMC_SetG1Para	V	V	V	V
	DMC_SetStartPosition	V	V	V	V
	DMC_AddAxisToGroup	-	-	V	-
	DMC_RemoveAxisFromGroup	-	-	V	-
	DMC_UngroupAllAxes	-	-	V	-
	DMC_ GroupEnable	-	-	V	-
	DMC_GroupStop	-	-	V	
	DMC_GroupInterrupt	-	-	V	-
Axes group	DMC_GroupContinue	-	-	V	
instructions	DMC_MoveDirectAbsolute	-	-	V	
	DMC_MoveDirectRelative	-		V	-
	DMC_MoveLinearAbsolute	-	-	V	
	DMC_MoveLinearRelative		-	V	
	DMC_MoveCircularAbsolute		-	V	
	DMC_MoveCircularRelative		-	V	
	DMC_GroupSetOverride			V	

			Task ty	pe	
Classification	Instruction name	Cyclic	Freewheeling	Event-triggered task	
		task	task	Motion task	Motion task
	DMC_GroupReadActualPosition	V	V	V	V
Coordination	DMC_ControlAxisByPos	-	-	V	-
Instructions	DMC_NC	-	-	V	-
	DMC_ReadParameter_CANopen	V	V	V	V
	DMC_WriteParameter_CANopen	V	V	V	V
	ETH_Link_Config	V	V	V	V
	ETH_Link_Manage	V	V	V	V
	ETH_Link_Status	V	V	V	V
	ETH_Link_Config_Ext	V	V	V	V
	ETH_ SetServerlinkkeeptime	V	V	V	V
	ETH_Socket_Manage	V	V	V	V
	ETH_Socket_Config	V	V	V	V
	ETH_Socket_Open	V	V	V	V
	ETH_Socket_Send	V	V	V	V
Communication	ETH_Socket_Receive	V	V	V	V
instructions	ETH_Socket_Close	V	V	V	V
	ETH_Socket_Status	V	V	V	V
	RS485_Link_Manage	V	V	V	V
	RS485_Link_Config	V	V	V	V
	RS485_Link_Status	V	V	V	V
	RS485_RS	V	V	V	V
	RS485_SetDelayTime	V	V	V	V
	RS232_Link_Manage	V	V	V	V
	RS232_Link_Config	V	V	V	V
	RS232_Link_Status	V	V	V	V
	RS232_RS	V	V	V	V
	RS232_SetDelayTime	V	V	V	V

# 7.2 The Impact of PLC RUN or STOP on Variables and Devices

When the motion controller is switched from RUN to STOP, variables and devices keep current values. When the motion controller is switched from STOP to RUN, users can select one option that the values of variables and non-latched devices are cleared or retained as below.

The values of variables and non-latched devices are cleared.


When the motion controller is switched from STOP to RUN, the values of variables and non-latched devices are cleared and restored to the initial values. If variables and non-latched devices have no initial values, the values of variables and non-latched areas will be restored to the default value 0.

The values of variables and devices are retained.
 When the motion controller is switched from STOP to RUN, variables and devices keep current values.

# 7.3 Relationship between Motion Program and Motion Bus

The motion controller makes the synchronization achieved through issuing SYNC signal in the method of broadcasting while more than one servo is connected with the motion controller. The servo drives receive the control data sent by the motion controller. But the control data received will not be effective right away until the SYNC signal comes to the servos so as to realize the synchronization of multiple servos.

In the following figure, the motion controller is connected with 4 servo drives and T is the synchronization period. The four servo drives receive control data at different time (t1, t2, t3 and t4) but the control data received are not effective at once. As the servo drives receive SYNC signal, the control data will go effective immediately.

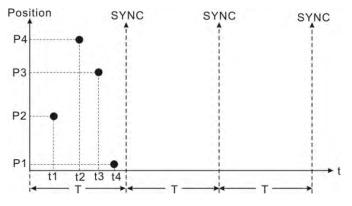

# 7.4 Synchronization Cycle Period Setting

The synchronization cycle is a very important parameter for the bus motion control. If the synchronization period is not set properly, the servo may display AL303/AL302/AL301 fault alarm in communication or the servo could not run normally.

Let's introduce the constitution of the synchronization period first.

The motion control program is scanned at the very beginning of the synchronization period, and then the control messages got through calculation are sent to all axes. So we can regard the synchronization period as the time for execution of motion control program plus the time for communication between the motion controller and all servos.

The time for execution of motion control program is the maximum execution time of motion event tasks with the unit:  $\mu$ s (microsecond) which can be viewed by double clicks on **Task** on the CANopen Builder software interface. 1000 $\mu$ s (microseconds) are 1ms (millisecond).

The value is rounded up to an integer in the actual application. For example, the maximum time for program execution is  $2567\mu$ s=2.5ms, in this case, we can regard 3ms as the time for program execution. It is about 0.5ms for the communication between the motion controller and a servo.

We recommend that the value is rounded up to an integer in application. For example, 5 servos are configured in an application. And the communication time is 5\*0.5ms=2.5ms. In this case, we can regard 3ms as the time for communication.

Therefore, we can get the formula: a synchronization time (ms) = an integer obtained by rounding up the value of maximum program execution time (ms) + time for the communication between the motion controller and all servos (ms) + 1 (time reserved for a program change) (ms).

If the running time of the program is increased too much after the program changes, the preset synchronization time will not fit any more. So the reserved time should be set to 1~2ms.

For example, the maximum program execution time is 1634µs and there are totally 5 servos in the application. The reserved time for a program change is 1ms.

A synchronization cycle period= 2ms (obtained by rounding up the maximum program execution time,  $1634\mu s$ ) + 3ms (obtained by rounding up 5\*0.5) + 1ms (reserved for a program change)=6ms

### Note:

The above method is used for getting an estimated time, which is suitable for most applications. If you need a more precise synchronization cycle period, the actual time can be recalculated by omitting the reserved time after the application development is completed.

MEMO



# Chapter 8 Logic Instructions

# Table of Contents

8.1 Ta	ble of Logic Instructions
<b>8.2 Ex</b> 8.2.1	Planation of Logic Instructions
8.3 Se 8.3.1 8.3.2 8.3.3 8.3.4 8.3.5	equence Input /Output Instructions.       8-11         R_TRIG.       8-11         F_TRIG.       8-13         RS.       8-15         SR.       8-17         SEMA.       8-19
<b>8.4 Se</b> 8.4.1	equence Control Instructions
8.5 Da 8.5.1 8.5.2 8.5.3 8.5.4 8.5.5 8.5.6	Ata Movement Instructions8-22MOVE8-22MoveBit8-23TransBit8-25MoveDigit8-27Exchange8-29Swap8-31
8.6 Co 8.6.1 8.6.2 8.6.3 8.6.4 8.6.5 8.6.6	Second structions         8-33           LT         8-33           LE         8-35           GT         8-37           GE         8-39           EQ         8-41           NE         8-43
8.7 Tir 8.7.1 8.7.2 8.7.3 8.7.4 8.7.5 8.7.6	mer Instructions         8-45           TON         8-45           TOF         8-47           TP         8-49           Sys_ReadTime         8-51           Sys_ReadTotalWorkTime         8-52           Sys_ReadPowerOnTime         8-53

8.7.7	Sys_WdgStatus 8-54
8.8 Co	unter Instructions8-56
8.8.1	CTU
8.8.2	CTD
8.8.3	CTUD
8.9 Ma	th Instructions8-63
8.9.1	ADD
8.9.2	SUB
8.9.3	MUL
8.9.4	DIV
8.9.5	MOD 8-75
8.9.6	MODREAL
8.9.7	MODTURNS
8.9.8	MODABS
8.9.9	ABS
8.9.10	DegToRad8-85
8.9.11	RadToDeg
	SIN
8.9.13	COS
8.9.14	TAN
	ASIN
	ACOS
	ATAN
	LN
	LOG
	SQRT
	EXP
0.7.22	EXPT
	RAND
	TRUNC
	FLOOR
	FRACTION
	String Instructions
	AND
	OR
	NOT
	XOR
	XORN
	ift Instructions8-134
	SHL
	SHR
8.11.3	ROL8-138

8.11.4 ROR		8-140
8.12.1 MAX 8.12.2 MIN 8.12.3 SEL 8.12.4 MUX 8.12.5 LIMI 8.12.6 BANI	T D E	8-142 8-144 8-146 8-146 8-148 8-148 8-150 8-152
8.13.1 BOO 8.13.2 Bit s 8.13.3 Integ 8.13.4 Real 8.13.5 Time	pe Conversion Instructions L_TO_*** trings_TO_*** gers_TO_*** numbers_TO_*** es,dates_TO_***	8-158 8-161 8-168 8-168 8-177 8-180
8.14.1 CAN 8.14.1.1 8.14.1.2 8.14.2 Ethe	nication Instructions open Communication Instructions DMC_ReadParameter_CANopen DMC_WriteParameter_CANopen rnet Instructions ETH_Link_Config	8-185 8-185 8-190 8-194
8.14.2.2 8.14.2.3 8.14.2.4 8.14.2.5 8.14.2.6	ETH_Link_Manage ETH_Link_Status MODBUS TCP Data Exchange Example ETH_Link_Config_Ext ETH_SetServerlinkkeeptime	8-199 8-201 8-203 8-203 8-210 8-212
8.14.2.8 8.14.2.9 8.14.2.10 8.14.2.11	ETH_Socket_Manage ETH_Socket_Config ETH_Socket_Open ETH_Socket_Send ETH_Socket_Receive ETH_Socket_Close	8-215 8-218 8-220 8-224
8.14.2.13 8.14.2.14	ETH_Socket_Status ETH_Socket_Status Ethernet Free Protocol Example 35 Communication Instructions RS485_Link_Manage RS485_Link_Config	8-230 8-233 8-238 8-238 8-238
8.14.3.3 8.14.3.4 8.14.3.5 8.14.3.6	RS485_Link_Status RS485 Data Exchange Example RS485_RS RS485 Free Protocol Example	8-244 8-247 8-250

8.14.3.7 RS485_SetDelayTime 8.14.4 RS232 Communication Instructions	
8.14.4.1 RS232_Link_Manage	
8.14.4.2 RS232_Link_Config	
8.14.4.3 RS232_Link_Status	
8.14.4.4 RS232 Data Exchange Example	8-271
8.14.4.5 RS232_RS	
8.14.4.6 RS232 Free Protocol Example	
8.14.4.7 RS232_SetDelayTime	
8.15 String Processing Instructions	
8.15.1 CONCAT	
8.15.3 INSERT	
8.15.4 LEFT / RIGHT	
8.15.5 MID	
8.15.6 REPLACE	8-295
8.15.7 LEN	8-297
8.15.8 FIND	8-298
8.16 Immediate Refresh Instructions	
8.16.1 FROM	
8.16.2 TO	
8.16.3 ImmediateInput	
8.16.4 ImmediateOutput	
8.17 PID-related Instructions	
8.17.1 PID 8.17.2 GPWM	
0.17.2 OF WW	0-525
0.10 Address Instruction	0 225
8.18 Address Instruction	
8.18.1 ADR	8-325
	8-325 <b>8-327</b>
8.18.1 ADR	8-325 <b>8-327</b> 8-327
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> </ul>	8-325 8-327 8-327 8-327 8-329
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> </ul>	8-325 8-327 8-327 8-327 8-329 8-331
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> </ul>	8-325 8-327 8-327 8-327 8-329 8-331 8-331
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> </ul>	8-325 8-327 8-327 8-329 8-331 8-333
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> <li>8.19.2.3 CANopen_State</li> </ul>	8-325 8-327 8-327 8-327 8-329 8-331 8-333 8-333
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> <li>8.19.2.3 CANopen_State</li> </ul> 8.20 Read and Write Offset Bit Value	8-325 8-327 8-327 8-327 8-329 8-331 8-331 8-333 8-335 8-335
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> <li>8.19.2.3 CANopen_State</li> </ul> 8.20 Read and Write Offset Bit Value	8-325 8-327 8-327 8-327 8-329 8-331 8-333 8-335 8-335 8-337
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> <li>8.19.2.3 CANopen_State</li> </ul> 8.20 Read and Write Offset Bit Value <ul> <li>8.20.1 SetBitOffsetValue</li> <li>8.20.2 GetBitOffsetValue</li> </ul>	8-325 8-327 8-327 8-327 8-329 8-331 8-333 8-333 8-335 8-337 8-337 8-339
<ul> <li>8.18.1 ADR</li> <li>8.19 Network Diagnosis</li> <li>8.19.1 Motion Diagnosis</li> <li>8.19.1.1 CANmotion_SysDiag (Motion System Diagnosis)</li> <li>8.19.1.2 CANmotion_NodeDiag (Motion Axis Diagnosis)</li> <li>8.19.2 CANopen Diagnosis</li> <li>8.19.2.1 CANopen_SysDiag</li> <li>8.19.2.2 CANopen_NodeDiag</li> <li>8.19.2.3 CANopen_State</li> </ul> 8.20 Read and Write Offset Bit Value	8-325 8-327 8-327 8-327 8-327 8-331 8-331 8-333 8-335 8-335 8-337 8-337 8-339 8-341

8.21.2 LRC		8-343
8.22 Right-S	ide Extension Module Instructions	8-345
8.22.1 AS0	2PU and AS04PU Related Instructions	
8.22.1.1	Application Conditions of AS02PU and AS04PU	J Related
Instruction	าร	8-345
8.22.1.2	AS02PU and AS04PU Related Instructions	

8

# 8.1 Table of Logic Instructions

Instruction set	Instruction code	Function
	<u>R TRIG</u>	Rising Edge Trigger
Sequence	F_TRIG	Falling Edge Trigger
Input/Output	<u>RS</u>	Reset–Priority Instruction
Instructions	<u>SR</u>	SET-Priority Instruction
	<u>SEMA</u>	Claim-Priority Instruction
Sequence Control Instructions	JMP	Jump
	MOVE	Move
	<u>MoveBit</u>	Move One Bit
Data Movement	<u>TransBit</u>	Move Bits
Instructions	<u>MoveDigit</u>	Move Digits
	Exchange	Data Exchange
	<u>Swap</u>	Swap Bytes
	LT	Less Than
	LE	Less Than or Equal to
Comparison	<u>GT</u>	Greater Than
Instructions	<u>GE</u>	Greater Than or Equal to
	<u>EQ</u>	Equal to
	NE	Not Equal to
	TON	On-Delay Timer
	TOF	Off-Delay Timer
	<u>TP</u>	Pulse-type Timer
Timer Instructions	Sys_ReadTime	Read Real-Time Clock's Time
	Sys ReadTotalWorkTime	Read Total Work Time
	Sys ReadPowerOnTime	Read Power-On Time
	Sys_WdgStatus	Read Task Timeout Status
	<u>CTU</u>	Up-Counter
Counter Instructions	CTD	Down-Counter
	CTUD	Up-Down Counter
	ADD	Addition
Math Instructions	<u>SUB</u>	Subtraction

Instruction set	Instruction code	Function
	DIV	Division
	MOD	Integer Modulo Division to Get the Remainder
	MODREAL	Real-Number Modulo Division to Get the Remainder
	MODTURNS	Real-Number Modulo Division to Get Signed Integral Part
	MODABS	Real-Number Modulo Division to Get the Unsigned Modulo Value
	ABS	Absolute value
	<u>DegToRad</u>	Degrees to Radians
	RadToDeg	Radians to Degrees
	SIN	Sine
	COS	Cosine
	TAN	Tangent
	ASIN	Arc sine
	ACOS	Arc cosine
	ATAN	Arc tangent
	LN	Natural Logarithm
	LOG	Base-10 Logarithm
	<u>SQRT</u>	Square Root
	EXP	Natural Exponential Operation
	<u>EXPT</u>	Exponentiation
	RAND	Random Number
	TRUNC	Truncate
	FLOOR	Real-Number Floor
	FRACTION	Real-Number Fraction
	AND	Logical AND
	OR	Logical OR
Bit String Instructions	NOT	Bit Reversal
	XOR	Logical Exclusive OR
	XORN	Logical Exclusive NOR
	SHL	Shift Bits Left
Shift Instructions	<u>SHR</u>	Shift Bits Right
	ROL	Rotate Bits Left

Instruction set	Instruction code	Function				
	ROR	Rotate Bits Right				
	MAX	Maximum				
	MIN	Minimum				
	<u>SEL</u>	Selection				
Selection Instructions	MUX	Multiplexer				
	LIMIT	Limiter				
	BAND	Deadband Control				
	ZONE	Dead Zone Control				
	BOOL TO ***	Bool Conversion Group				
	Bit strings TO ***	Bit String Conversion Group				
Data Type Conversion	Integers_TO_***	Integer Conversion Group				
Instructions	Real numbers_TO_***	Real Number Conversion Group				
	Times,dates TO ***	Time and Data Conversion Group				
	Text strings_TO_***	String Conversion Group				
	DMC_ReadParameter_CANopen	Read a parameter value				
	DMC_WriteParameter_CANopen	Write a parameter value				
	ETH Link Config	Configure MODBUS TCP data exchange				
	ETH Link Manage	Enable/disable MODBUS TCP data exchange				
	ETH_Link_Status	Watch MODBUS TCP data exchange status				
	ETH Link Config Ext	Configure the extension parameters for MODBUS TCP exchange				
	ETH_ SetServerlinkkeeptime	Set the connection duration time as the controller works as a slave				
Communication Instructions	ETH_Socket_Manage	Manage Socket TCP/UDP				
matuctions	ETH_Socket_Config	Configure Socket data exchange parameters				
	ETH Socket Open	Enable Socket				
	ETH_Socket_Send	Send Socket data				
	ETH_Socket_Receive	Receive Socket data				
	ETH_Socket_Close	Disable Socket				
	ETH_Socket_Status	Read Socket status				
	RS485_Link_Manage	Manage RS485 communication				
	RS485_Link_Config	Configure RS485 communication parameters				

Instruction set	Instruction code	Function					
	RS485_Link_Status	Watch RS485 communication status					
	<u>RS485 RS</u>	Configure RS485 free protocol parameters					
	RS485_SetDelayTime	Set RS485 communication response dela time					
	RS232_Link_Manage	Manage RS232 communication					
	RS232_Link_Config	Configure RS232 communication parameters					
	RS232_Link_Status	Watch RS232 communication status					
	<u>RS232_RS</u>	Configure RS232 free protocol parameters					
	RS232_SetDelayTime	Set RS232 communication response delay time					
	<u>CONCAT</u>	Concatenate String					
	DELETE	Delete String					
	INSERT	Insert String					
String Processing	LEFT / RIGHT	Get String Left/Right					
Instructions	MID	Get String					
	REPLACE	Replace String					
	LEN	String Length					
	<u>FIND</u>	Find String					
	FROM	Read CR value					
Immediate Refresh	<u>TO</u>	Write Value to CR					
Instructions	ImmediateInput	Immediate Refresh of Input Points					
	ImmediateOutput	Immediate Refresh of Output Points					
PID-related	PID	PID operation					
Instructions	<u>GPWM</u>	Basic pulse width tuning					
Address Instruction	ADR	Get the Address					
	CANmotion SysDiag	Motion system diagnosis					
	CANmotion_NodeDiag	Motion axis diagnosis					
Network Diagnosis	CANopen_SysDiag	CANopen system diagnosis					
	CANopen NodeDiag	CANopen Slave Diagnosis					
	CANopen State	CANopen Master Diagnosis					
Read and Write Offset	<u>SetBitOffsetValue</u>	Set the value of the specified bit					
Bit Value	GetBitOffsetValue	Read the value of the specified bit					

# AS500C Series Motion Controller Operation Manual

Instruction set	Instruction code	Function
	<u>LRC</u>	Calculate LRC Value
	PUCONF	Setting output control parameters for a PU module
	PUSTAT	Reading PU module output state
Right-Side Extension	PUPLS	PU module pulse output without acceleration and deceleration
Module Instructions	PUDRI	Relative position output of PU module
	PUDRA	Absolute position output of PU module
	PUZRN	PU module homing
	PUCNT	High-speed counter function of PU module

# 8.2 Explanation of Logic Instructions

# 8.2.1 EN and ENO

If the used instruction has EN and ENO input parameters and the value of EN is FALSE (0), the function of the instruction will not be performed and the output of the instruction will not be updated. However, if the value of EN of the instruction is TRUE (1), the function of the instruction will be performed and the output will be updated.


The output state of ENO is consistent with that of EN. When EN is TRUE, ENO changes to TRUE. When EN is FALSE, ENO changes to FALSE.

When the instruction is a function block (FB) and its EN changes from TRUE to FALSE after the FB instruction is executed, the execution of the FB instruction will continue, but the output values of the FB instruction will not be updated.

# 8.3 Sequence Input /Output Instructions

# 8.3.1 R\_TRIG

F	B/FC	Explanation	Applicable model
	FB	R_TRIG is used for the rising edge trigger.	AS524C-B

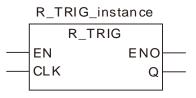

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
CLK	Input signal	Input	Rising edge trigger signal	TRUE or FALSE
Q	Output signal	Output	Output for a period	TRUE or FALSE

	Boolean		Bit s	string	1				Inte	eger					eal nber	-	Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CLK																				
Q	•																			

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

When CLK of R\_TRIG changes from FALSE to TRUE, Q output is TRUE for only one period. In other circumstances, Q is FALSE.

# • Precautions for Correct Use


Q will have no output until the rising edge signal at CLK is detected.




# Programming Example

# The variable table and program

Variable name	Data type	Initial value
R_TRG	R_TRIG	
R_TRG_EN	BOOL	FALSE
R_TRG_CLK	BOOL	FALSE
R_TRG_Q	BOOL	

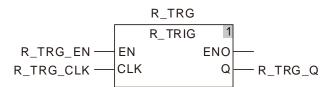


# **Timing Chart:**

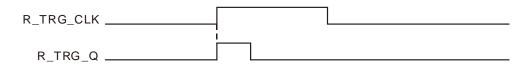

# 8.3.2 F\_TRIG

FB/FC	Explanation	Applicable model
FB	F_TRIG is used for the falling edge trigger.	AS524C-B
	F_TRIG_instance	
	F_TRIG	

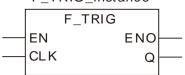

## Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
CLK	Input signal	Input	Falling edge trigger signal	TRUE or FALSE
Q	Output signal	Output	Output for a period	TRUE or FALSE

	Boolean		Bits	string	l				Inte	eger					eal nber		Time	, date	9	String
	BOOL	вүте	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CLK																				
Q	•																			

## Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### **Function Explanation** •

When CLK of F\_TRIG changes from TRUE to FALSE, Q output is TRUE for only one period. In other circumstances. Q is FALSE.


#### Precautions for Correct Use

Q will have no output until the falling edge signal at CLK is detected.


# Programming Example

#### The variable table and program

Variable name	Data type	Initial value
F_TRG	F_TRIG	
F_TRG_EN	BOOL	FALSE
F_TRG_CLK	BOOL	FALSE
F_TRG_Q	BOOL	

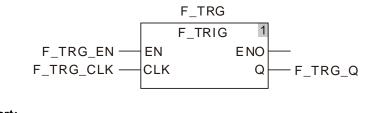


# ■ Timing Chart:

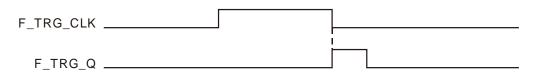

# 8.3.3 RS

FB/FC	Explanation	Applicable model
FB	RS is used for giving priority to the <i>Reset</i> input.	AS524C-B
	RS_instance	
	RS	

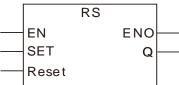

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
SET	Input signal	Input	SET signal	TRUE or FALSE
Reset	Input signal	Input	Reset signal	TRUE or FALSE
Q	Output signal	Output	Output signal	TRUE or FALSE

	Boolean		Bit s	string					Inte	eger					eal nber	-	Time,	date	)	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	Ę	STRING
SET	•																			
Reset	•																			
Q	•																			

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.


# • Function Explanation

When the SET and Reset inputs of RS are both TRUE, Reset is given the priority.


# Programming Example

# The variable table and program

Variable name	Data type	Initial value
RS1	RS	
RS1_EN	BOOL	FALSE
RS1_SET	BOOL	FALSE
RS1_Reset	BOOL	FALSE
RS1_Q	BOOL	

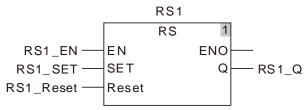


## ■ Timing Chart:

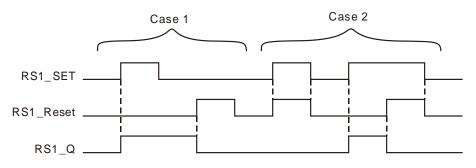

- Case 1 : When RS1\_SET is TRUE, the output RS1\_Q is TRUE. If RS1\_Reset is TRUE, RS1\_Q is FALSE.
- **Case 2** : When RS1\_Reset is TRUE, RS1\_Q is always FALSE.

# 8.3.4 SR

FB/FC		Explanation	Applicable model
FB	SR is used for giving priority to the	ne <i>Set</i> input.	AS524C-B
		SR_instance	
		SR	

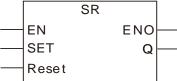

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
SET	Input signal	Input	SET signal	TRUE or FALSE
Reset	Input signal	Input	Reset signal	TRUE or FALSE
Q	Output signal	Output	Output signal	TRUE or FALSE

	Boolean		Bit s	string					Inte	eger					eal nber	-	Time,	date	;	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	7 T	STRING
SET	•																			
Reset	•																			
Q	•																			

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.


# • Function Explanation

When the SET and Reset inputs of RS are both TRUE, SET is given the priority.


# Programming Example

# The variable table and program

Variable name	Data type	Initial value
SR1	SR	
SR1_EN	BOOL	FALSE
SR1_SET	BOOL	FALSE
SR1_Reset	BOOL	FALSE
SR1_Q	BOOL	

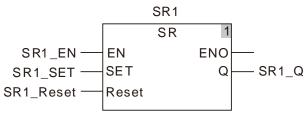


## ■ Timing Chart:

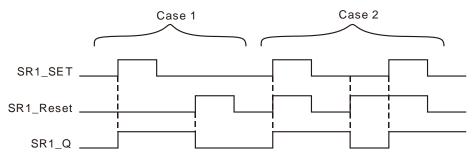

**Case 1**: When SR1\_SET is TRUE, SR1\_Q is TRUE. When SR1\_Reset is TRUE, SR1\_Q is FALSE. **Case 2**: SR1\_SET is given the priority when SR1\_SET and SR1\_Reset are both TRUE.

# 8.3.5 SEMA

FB/FC	Explanation	Applicable model
FB	SEMA is used for giving priority to CLAIM. (The output will be valid in the second period.)	AS524C-B
	SEMA instance	

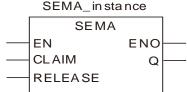

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
CLAIM	Input signal	Input	Set signal	TRUE or FALSE
RELEASE	Input signal	Input	Reset signal	TRUE or FALSE
Q	Output signal	Output	Output signal	TRUE or FALSE

	Boolean		Bit s	string				Inte	eger					eal nber		Time	, date	Э	String
	BOOL	7/11	WORD	DWORD	 USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CLAIM	•																		
RELEASE																			
Q																			

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# Function Explanation

When *CLAIM* of SEMA is TRUE, Q is TRUE. When *RELEASE* is TRUE, Q is FALSE. When *CLAIM* and *RELEASE* are both TRUE, Q is TRUE.


# • Precautions for Correct Use

When *CLAIM* is TRUE, Q will be TRUE in the second period.


# Programming Example

## The variable table and program

Variable name	Data type	Initial value
SEMA1	SEMA	
SEMA1_EN	BOOL	FALSE
SEMA1_CLAIM	BOOL	FALSE
SEMA1_RELEASE	BOOL	FALSE
SEMA1_Q	BOOL	

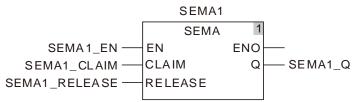

### ■ Timing Chart:

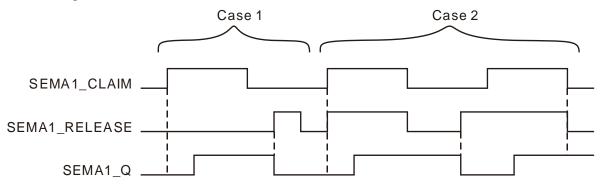

- **Case 1**: When SEMA1\_CLAIM is TRUE, SEMA1\_Q is TRUE in the second period. When SEMA1\_RELEASE is TRUE, SEMA1\_Q changes to FALSE immediately.
- **Case 2**: When SEMA1\_CLAIM is TRUE, SEMA1\_Q is TRUE in the second period no matter whether SEMA1\_RELEASE is TRUE or FALSE.

# 8.4 Sequence Control Instructions

# 8.4.1 JMP

FB/I	=C	Explanation	Applicable model
FC	;	JMP is used for jumping to any position specified by a label in the LD program.	AS524C-B



## • Function Explanation

JMP is used for jumping to any position specified by a label in the LD program.

# Precautions for Correct Use


- Label is any string.
- A key word can not be specified as a label.
- JMP can be used for an upward jump.
- More than one JMP instruction can jump to the same label.
- The label positions to which JMP instructions jump must be in the same POU in the LD program. Otherwise, the jump will not take effect.

# Programming Example

## Variable table

Variable name	Data type	Current value
Start	BOOL	TRUE
Start1	BOOL	TRUE
Out1	BOOL	FALSE
Start2	BOOL	TRUE
Out2	BOOL	TRUE

### > Program

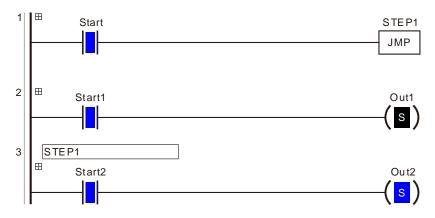


**STEP1** is taken as the jump label of JMP instruction in the program above. When **Start** changes to TRUE, JMP instruction will jump to the position of STEP1 label and the program of network 3 will be executed.

When **Start2** changes to TRUE, **Out2** will also change to TRUE; the program of network 2 will not be executed. When **Start** changes to FALSE, the programs from network 1 to network 3 will all be executed.

# 8.5 Data Movement Instructions

# 8.5.1 MOVE

FB/FC	Explanation	Applicable mode			
FC	Move is used for moving data.	AS524C-B			

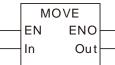

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Input signal	Input	Move Source	Depends on the data type of the variable that the input parameter is connected to.
Out	Output signal	Output	Move destination	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bits	string	J		Integer									Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In				•		•				•					•					
Out	$\bullet$	$\bullet$		•	•		•			•				•	•	•		•		$\bullet$

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- The Move instruction moves the value of move source *In* to move destination *Out*.
- The instruction supports the transmission of the values of array elements.


# • Precautions for Correct Use

The data type of *Out* must be the same as that of *In*. Otherwise, an error will occur in the compiling of the software.

# Programming Example


## The variable table and program

Variable name	Data type	Current value
MOVE_EN	BOOL	TRUE
MOVE_In	INT	200
Out1	INT	200

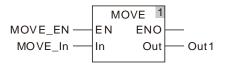

# 8.5.2 MoveBit

FB/FC	Explanation	Applicable mode				
FC	MoveBit is used for sending one bit in a string.	AS524C-B				
10	MoveBit	A03240 D				

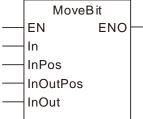

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Input signal	Input	Move source	Depends on the data type of the variable that the input parameter is connected to.
InPos	Input signal	Input	Move source bit	Depends on the data type of the variable that the input parameter is connected to.
InOutPos	Input signal	Input	Move destination bit	Depends on the data type of the variable that the input parameter is connected to.
InOut	Input signal	Input	Move destination	Depends on the data type of the variable that the input parameter is connected to.

	Boolean		Bit s	string			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•											
InPos							•													
InOutPos							•													
InOut																				

## Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

MoveBit moves one bit value from the bit position *InPos* in move source *In* to the bit position *InOutPos* in move destination *InOut*.

# • Precautions for Correct Use


- The instruction has no ouput but input.
- If the value of *InPos* exceeds the range of the data type of *In*, the movement of one bit is not performed.

■ If the value of *InOutPos* exceeds the range of the data type of *InOut*, the movement of one bit is not performed.


# Programming Example

# The variable table and program

Variable name	Data type	Current value
MovBit_EN	BOOL	TRUE
MovBit_In	USINT	31
MovBit_Inpos	UINT	2
MovBit_InOutPos	UINT	3
MovBit_Inout	USINT	8

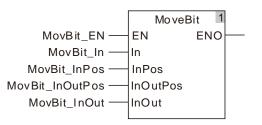

# Move Figure

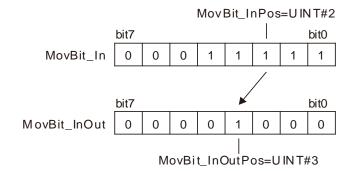

8

# FB/FC Explanation Applicable model FC TransBit is used for sending one or more bits in a bit string. AS524C-B

Size InOut

# 8.5.3 TransBit

# • Parameters

- i al allioto									
Parameter name	Meaning	Input/ Output	Description	Valid range					
In	Input signal	Input	Move source	Depends on the data type of the variable that the input parameter is connected to.					
InPos	Input signal	Input	Move source bit	Depends on the data type of the variabl that the input parameter is connected to					
InOutPos	Input signal	Input	Move destination bit	Depends on the data type of the variable that the input parameter is connected to.					
Size	Input signal	Input	Number of bits to move	Depends on the data type of the variable that the input parameter is connected to.					
InOut	Input signal	Input	Move destination	Depends on the data type of the variable that the input parameter is connected to.					

	Boolean		Bits	string	ļ				Int	eger					eal nber	-	Time	, date	Э	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	TNI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•											
InPos							•													
InOutPos							•													
Size							•													
							•													

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

TransBit moves data of *Size* bits from the bit *InPos* in move source *In* to the bit *InOutPos* in move destination *InOut*.

# • Precautions for Correct Use


The instruction has no output but input.

- The movement can not be performed if the value of *Size* is 0.
- If the value of *InPos* exceeds the range of the data type of *In*, the movement is not performed.
- If the value of *InOutPos* exceeds the range of the data type of *InOut*, the movement is not performed.
- If the value of *Size* exceeds the range, the movement is not performed.


# Programming Example

# The variable table and program

Variable name	Data type	Current value
TrsBit_EN	BOOL	TRUE
TrsBit_In	USINT	63
TrsBit_InPos	UINT	1
TrsBit_InOutPos	UINT	2
TrsBit_Size	UINT	2
TrsBit_Inout	USINT	12

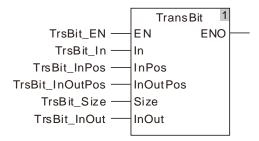


# Move Figure

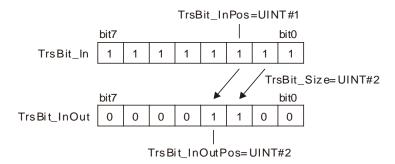

# 8.5.4 MoveDigit

FB/FC	Explanation	Applicable model
FC	MoveDigit is used for moving digits.	AS524C-B
	MoveDigit	

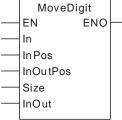

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Input signal	Input	Move source	Depends on the data type of the variable that the input parameter is connected to.
InPos	Input signal	Input	Position of digit in <i>In</i> to move	Depends on the data type of the variable that the input parameter is connected to.
InOutPos	Input signal	Input	Position of digit in <i>Out</i> to receive the digit	Depends on the data type of the variable that the input parameter is connected to.
Size	Input signal	Input	Number of digits to move	Depends on the data type of the variable that the input parameter is connected to.
InOut	nOut Input Input Mc		Move destination	Depends on the data type of the variable that the input parameter is connected to.

	Boolean		Bits	string					Inte	eger					eal nber	-	Time	date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•		•	•	•	•											
InPos							•													
InOutPos							•													
Size							•													
InOut																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

MoveDigit moves Size digits from InPos of move source In to InOutPos of move destination InOut.

# • Precautions for Correct Use


- The instruction has no output but input parameter.
- The move can not be performed if the value of *Size* is 0.
- If the value of *InPos* exceeds the range of the data type of *In*, the move will not be performed.

- If the value of InOutPos exceeds the range of the data type of InOut, the movement is not performed.
- If the value of *Size* exceeds the range, the movement is not performed.


# Programming Example

# The variable table and program

Variable name	Data type	Current value
MovDigt_EN	BOOL	TRUE
MovDigt_In	UDINT	16#1234
MovDigt_InPos	UINT	1
MovDigt_InOutPos	UINT	2
MovDigt_Size	UINT	2
MovDigt_Inout	UDINT	16#2300

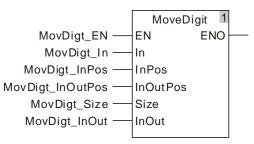

# Move Figure

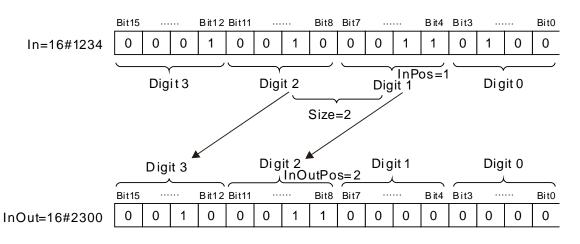

8

# 8.5.5 Exchange

FB/FC	Explanation	Applicable model
FC	Exchange is used for the data exchange.	AS524C-B



# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Input signal	Input	Data to exchange	Depends on the data type of the variable that the input parameter is connected to.
In2	Input signal	Input	Data to exchange	Depends on the data type of the variable that the input parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber		Time	e, dat	e	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
ln1					•						•		•					•	•	$\bullet$
In2															•				•	$\bullet$

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

The Exchange instruction exchanges the values of *In1* and *In2*.


# • Precautions for Correct Use

- The data types of *In1* and *In2* must be same.
- The instruction has no output but two input parameters.


# Programming Example

# The variable table and program

Variable name	Data type	Current value
Exchg_EN	BOOL	TRUE
Exchg_In1	INT	30
Exchg_In2	INT	10

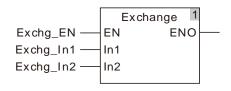

# Exchange Figure

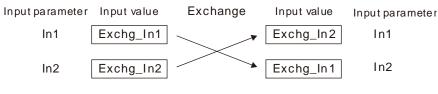


The values of ln1 and ln2 are exchanged.

While the Exchange instruction is executed, the values of Exchg\_In1 and Exchg\_In2 are always exchanged.

# 8.5.6 Swap

FB/FC	Explanation	Applicable model
FC	Swap is used for swapping the high byte and low byte of a 16-bit value.	AS524C-B

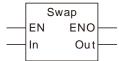

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Input signal	Input	Data to swap	0~65535 for word data type
Out	Output signal	Output	Result	0~65535 for word data type

	Boolean		Bits	string	I	Integer						eal nber	Time, date				String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	LINT DINT INT SINT ULINT UDINT				REAL	LREAL	TIME	DATE	TOD	DT	STRING		
In																			
Out																			

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.


# • Function Explanation

The Swap instruction exchanges the high byte and low byte of the value of *In* and the result is output to *Out*.

# Programming Example


# The variable table and program

Variable name	Data type	Current value
Swap_EN	BOOL	TRUE
Swap_In	UINT	32768
Out1	UINT	128

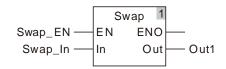

8


# ■ Swap Figure

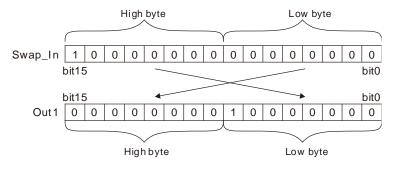

# 8.6 Comparison Instructions

# 8.6.1 LT

FB/FC	Explanation	Applicable model
FC	LT is used for a less-than comparison of two or more variables or constants.	AS524C-B

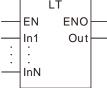

# Parameters

	-			
Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Comparison data	Input	The number of comparison data can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2~8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit string						Inte	eger					eal nber		Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•
Out	•																			

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- LT is used for a less-than comparison of two or more variables or constants. if *In1<In2<...<InN, Out* is TRUE. Otherwise, *Out* is FALSE.
- The input parameters In1~InN are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters In1~InN are all required to be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur in the compiling of the software.

# Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

The data types of LT\_In1, LT\_In2 and LT\_In3 are INT, UINT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of LT\_In1, LT\_In2 and LT\_In3 are -10, 50 and 100 respectively and LT\_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of LT\_In1, LT\_In2 and LT\_In3 are 20, 10 and 100 respectively and LT\_EN changes to TRUE as shown in Variable 2.


#### Variable 1

Variable name	Data type	Current value
LT_EN	BOOL	TRUE
LT_In1	INT	-10
LT_In2	UINT	50
LT_In3	DINT	100
Out1	BOOL	TRUE

#### > Variable 2

Variable name	Data type	Current value
LT_EN	BOOL	TRUE
LT_In1	INT	20
LT_In2	UINT	10
LT_In3	DINT	100
Out1	BOOL	FALSE

The Program

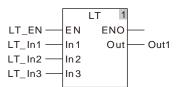


# ■ The data types of LT\_In1 and LT\_In2 are both TIME and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of LT\_In1 and LT\_In2 are T#1ms and T#50ms respectively and LT\_EN is TRUE.


# > The variable table and program

Variable name	Data type	Current value
LT_EN	BOOL	TRUE
LT_In1	TIME	T#1ms
LT_In2	TIME	T#50ms
Out1	BOOL	TRUE

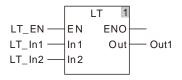

# 8.6.2 LE

FB/FC	Explanation	Applicable model
FC	LE is used for a less- than or equal comparison of two or more variables or constants.	AS524C-B
	EN ENO	

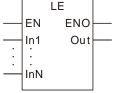

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Comparison data	Input	The number of comparison data can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber	,	Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	먹	STRING
In1 to InN	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	
Out	•																			

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- LE is used for a less than or equal comparison of two or more variables or constants. if  $In1 \le In2 \le ... \le InN$ , Out is TRUE. Otherwise, Out is FALSE.
- The input parameters In1~InN are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters In1~InN are all required to be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur in the compiling of the software.

# • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

The data types of LE\_In1, LE\_In2 and LE\_In3 are INT, UINT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of LE\_In1, LE\_In2 and LE\_In3 are -10, 50 and 50 respectively and LE\_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of LE\_In1, LE\_In2 and LE\_In3 are 20, 10 and 100 respectively and LE\_EN changes to TRUE as shown in Variable 2.


#### > Variable 1

Variable name	Data type	Current value
LE_EN	BOOL	TRUE
LE_In1	INT	-10
LE_In2	UINT	50
LE_In3	DINT	50
Out1	BOOL	TRUE

#### > Variable 2

Variable name	Data type	Current value
LE_EN	BOOL	TRUE
LE_In1	INT	20
LE_In2	UINT	10
LE_In3	DINT	100
Out1	BOOL	FALSE

> The Program

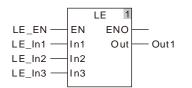


# The data types of LE\_In1 and LE\_In2 are both TIME and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of LE\_In1 and LE\_In2 are T#1ms and T#50ms respectively and LE\_EN is TRUE.


#### The variable table and program

Variable name	Data type	Current value
LE_EN	BOOL	TRUE
LE_In1	TIME	T#1ms
LE_In2	TIME	T#50ms
Out1	BOOL	TRUE

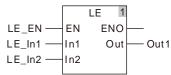

# 8.6.3 GT

FB/FC	Explanation	Applicable model
FC	GT is used for a greater-than comparison of two or more variables or constants.	AS524C-B
	GT EN ENO	

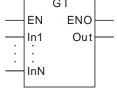

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Comparison data	Input	The number of comparison data can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	먹	STRING
In1 to InN	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•
Out																				

Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- LE is used for a greater than comparison of two or more variables or constants. if *In1>In2>...>InN*, *Out* is TRUE. Otherwise, *Out* is FALSE.
- The input parameters In1~InN are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters In1~InN are all required to be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur in the compiling of the software.

# • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

The data types of GT\_In1, GT\_In2 and GT\_In3 are INT, UINT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of GT\_In1, GT\_In2 and GT\_In3 are 100, 50 and 10 respectively and GT\_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of GT\_In1, GT\_In2 and GT\_In3 are 20, 10 and 100 respectively and GT\_EN changes to TRUE as shown in Variable 2.


#### Variable 1

Variable name	Data type	Current value
GT_EN	BOOL	TRUE
GT _ln1	INT	100
GT_In2	UINT	50
GT _ln3	DINT	10
Out1	BOOL	TRUE

#### > Variable 2

Variable name	Data type	Current value
GT_EN	BOOL	TRUE
GT _ln1	INT	20
GT _ln2	UINT	10
GT_ln3	DINT	100
Out1	BOOL	FALSE


#### The Program

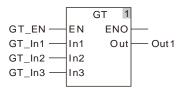

# ■ The data types of GT\_In1 and GT\_In2 are both TIME and the data type of Out1 is BOOL. Out1 changes to TRUE when the values of GT\_In1 and GT\_In2 are T#100ms and T#50ms respectively and GT\_EN changes to TRUE.


# > The variable table and program

Variable name	Data type	Current value
GT_EN	BOOL	TRUE
GT _ln1	TIME	T#100ms
GT _ln2	TIME	T#50ms
Out1	BOOL	TRUE

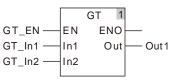

# 8.6.4 GE

FB/FC	Explanation	Applicable model
FC	GE is used for a greater- than or equal comparison of two or more variables or constants.	AS524C-B
	GE EN ENO	

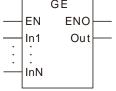

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Comparison data	Input	The number of comparison data can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bits	string					Inte	eger					eal nber		Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•
Out	•																			

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- GE is used for a greater than or equal comparison of two or more variables or constants. if  $In1 \ge In2 \ge ... \ge InN$ , Out is TRUE. Otherwise, Out is FALSE.
- The input parameters In1~InN are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters In1~InN are all required to be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur in the compiling of the software.

# • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

The data types of GE\_In1, GE\_In2 and GE\_In3 are INT, UINT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of GE\_In1, GE\_In2 and GE\_In3 are 100, 50 and 50 respectively and GE\_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of GE\_In1, GE\_In2 and GE\_In3 are 10, 10 and 100 respectively and GE\_EN changes to TRUE as shown in Variable 2.


#### > Variable 1

Variable name	Data type	Current value
GE_EN	BOOL	TRUE
GE_In1	INT	100
GE_In2	UINT	50
GE_In3	DINT	50
Out1	BOOL	TRUE

#### > Variable 2

Variable name	Data type	Current value
GE_EN	BOOL	TRUE
GE_In1	INT	10
GE_In2	UINT	10
GE_In3	DINT	100
Out1	BOOL	FALSE


> The program

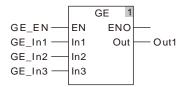

The data types of GE\_In1 and GE\_In2 are both TIME and the data type of Out1 is BOOL. Out1 changes to TRUE when the values of GE\_In1 and GE\_In2 are T#100ms and T#50ms respectively and GE\_EN changes to TRUE.


#### The variable table and program

Variable name	Data type	Current value
GE_EN	BOOL	TRUE
GE_In1	TIME	T#100ms
GE_In2	TIME	T#50ms
Out1	BOOL	TRUE

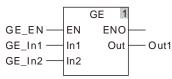

# 8.6.5 EQ

FB/FC	Explanation	Applicable model
FC	EQ is used for an equal comparison of two or more variables and constants.	AS524C-B

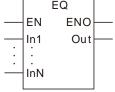

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Comparison data	Input	The number of comparison data can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bits	string					Inte	eger					eal nber		Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•
Out	•																			

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- 1. EQ is used for an equal comparison of two or more variables and constants. If In1 = In2 = ... = InN, Out is TRUE. Otherwise, Out is FALSE.
- 2. The input parameters In1~InN are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters In1~InN are all required to be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur in the compiling of the software.

# • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

The data types of EQ\_In1, EQ\_In2 and EQ\_In3 are INT, UINT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of EQ\_In1, EQ\_In2 and EQ\_In3 are 50, 50 and 50 respectively and EQ\_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of EQ\_In1, EQ\_In2 and EQ\_In3 are 10, 50 and 100 respectively and EQ\_EN changes to TRUE as shown in Variable 2.


#### > Variable 1

Variable name	Data type	Current value
EQ_EN	BOOL	TRUE
EQ _In1	INT	50
EQ _ln2	UINT	50
EQ _In3	DINT	50
Out1	BOOL	TRUE

#### > Variable 2

Variable name	Data type	Current value
EQ_EN	BOOL	TRUE
EQ _In1	INT	10
EQ _ln2	UINT	50
EQ _ln3	DINT	100
Out1	BOOL	FALSE

> The Program

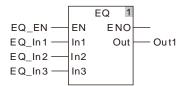


# The data types of EQ\_In1 and EQ\_In2 are both TIME and the data type of Out1 is BOOL. Out1 changes to TRUE when the values of EQ\_In1 and EQ\_In2 are T#50ms and T#50ms

respectively and EQ\_EN changes to TRUE.


#### > The variable table and program

Variable name	Data type	Current value
EQ_EN	BOOL	TRUE
EQ _In1	TIME	T#50ms
EQ _In2	TIME	T#50ms
Out1	BOOL	TRUE

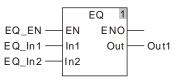

# 8.6.6 NE

FB/FC	Explanation	Applicable model
FC	NE is used for a not-equal comparison of two variables or constants.	AS524C-B
	NE	

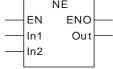

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Comparison data	Input	A value to compare	Depends on the data type of the variable that the input parameter is connected to.
In2	Comparison data	Input	A value to compare	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	Comparison result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bits	string			Integer					Real number Time, date			Ð	String				
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 and In2	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•
Out	•																			

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- NE is used for a not-equal comparison of two variables and constants. *Out* is TRUE if *In1*≠*In2*. Otherwise, *Out* is FALSE.
- The input parameters *In1* and *In2* are allowed to be the variables of different data types in this instruction when the data types of input variables are not BOOL, TIME, DATE, TOD and STRING. When the data type of one input variable is one of BOOL, TIME, DATE, TOD and STRING, input parameters *In1* and *In2* are both required to be of the data type. For example, if the data type of *In1* is TIME, the data type of *In2* must be TIME. Otherwise, an error will occur in the compiling of the software.

# • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The data type of output variables must be BOOL. Otherwise, an error will occur during the compiling of the software.

# Programming Example

# The data types of NE\_In1 and NE\_In2 are INT and DINT respectively and the data type of Out1 is BOOL.

Out1 changes to TRUE when the values of NE\_In1 and NE\_In2 are 100 and 50 respectively and NE \_EN changes to TRUE as shown in Variable 1.

Out1 changes to FALSE when the values of NE\_In1 and NE \_In2 are 100 and 100 respectively and NE\_EN changes to TRUE as shown in Variable 2.


#### Variable 1

Variable name	Data type	Current value
NE_EN	BOOL	TRUE
NE _In1	INT	100
NE _In2	UINT	50
Out1	BOOL	TRUE

# > Variable 2

Variable name	Data type	Current value
NE_EN	BOOL	TRUE
NE _In1	INT	100
NE _In2	UINT	100
Out1	BOOL	FALSE


#### > The Program

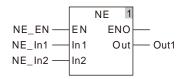

The data types of NE\_In1 and NE\_In2 are both TIME and the data type of Out1 is BOOL. Out1 changes to TRUE when the values of NE\_In1 and NE\_In2 are T#10ms and T#50ms respectively and NE\_EN changes to TRUE.

#### > The variable table and program


Variable name	Data type	Current value
NE_EN	BOOL	TRUE
NE _In1	TIME	T#10ms
NE _In2	TIME	T#50ms
Out1	BOOL	TRUE

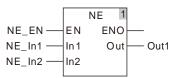

# 8.7 Timer Instructions

# 8.7.1 TON

FB/FC	Explanation	Applicable model
FB	TON is used for the ON delay.	AS524C-B
	TON_instance	

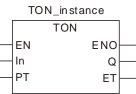

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Timer input	Input	Controls the timer to start or reset	TRUE or FALSE
PT	Set time	Input	Time from when the timer starts until Q changes to TRUE.	
Q	Timer output	Output	Q is TRUE when the set time <i>PT</i> is reached.	TRUE or FALSE
ET	Elapsed time	Output	Elapsed time from the time when the timer starts to current time.	

T#0ms ~ 213503d23h34m33s709.551ms

	Boolean		Bit s	string			Integer						eal nber	Time, date				String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In	•																			
PT																				
Q																				
ET																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation


- The TON instruction is defined as the function of a timer for the ON delay.
- When *In* is TRUE, the timer starts to measure the time and the value of *ET* increases accordingly. When *ET* equals PT, Q is TRUE. When *In* is set to FALSE, the measuring of the time stops and Q and *ET* are both reset.

# • Precautions for Correct Use


When the output value of *ET* reaches the set value of *PT*, the timer stops measuring time. *ET* is reset to 0 (0ms) when *In* changes from TRUE to FALSE.

# Programming Example The variable table and program

Variable name	Data type	Initial value
TON1	TON	
TON1_EN	BOOL	FALSE
TON1_In	BOOL	FALSE
TON1_PT	TIME	
TON1_Q	BOOL	
TON1_ET	TIME	

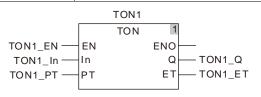


#### **Timing Chart:**

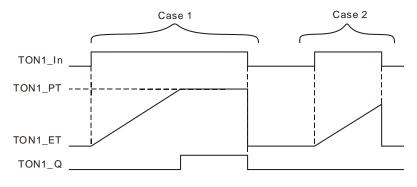

- Case 1 : TON1\_PT is the set time. When TON1\_In is TRUE, the timer starts to measure the time. When the value of TON1\_ET equals the setting value of TON1\_PT, TON1\_Q is TRUE. When the timer stops measuring time, TON1\_In is reset to FALSE and TON1\_ET and TON1\_Q are both reset.
- Case 2 : When the currently measured time of the timer TON1\_ET is less than the set time TON1\_PT and TON1\_In is reset to FALSE, TON1\_ET is reset and the state of TON1\_Q does not change.

# 8.7.2 TOF

FB/FC	Explanation	Applicable model
FB	TOF is used for the off delay.	AS524C-B
	TOF_instance	

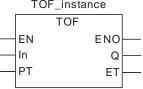

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Timer input	Input	Controls the timer to start or reset	TRUE or FALSE
PT	Set time	Input	Set the time from when the timer starts until Q changes to TRUE	
Q	Timer output	Output	Q is FALSE when the set time <i>PT</i> is reached.	TRUE or FALSE
ET	Elapsed time	Output	Elapsed time from the time when the timer starts to current time.	

T#0ms ~ 213503d23h34m33s709.551ms

	Boolean		Bit s	string			Integer							eal nber	Time, date				String	
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In	•																			
PT																•				
Q	•																			
ET																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation


- The TOF instruction is defined as the function of a timer for the OFF delay.
- When *In* is TRUE, *Q* is TRUE. When *In* changes from TRUE to FALSE, the timer starts to measure the time and the value of *ET* increases accordingly. At the moment, *Q* remains TRUE. When *ET* equals PT, *Q* is FALSE and the timer stops measuring time. When *In* is set to TRUE, ET is reset and *Q* changes to TRUE again.

# • Precautions for Correct Use


When the output value of *ET* reaches the set value of *PT*, the timer stops measuring time. *ET* is reset to 0 (0ms) when *In* changes from FALSE to TRUE.

# Programming Example The variable table and program

- The valiable table and program		
Variable name	Data type	Initial value
TOF1	TOF	
TOF1_EN	BOOL	FALSE
TOF1_In	BOOL	FALSE
TOF1_PT	TIME	
TOF1_Q	BOOL	
TOF1_ET	TIME	

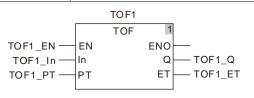


#### **Timing Chart:**

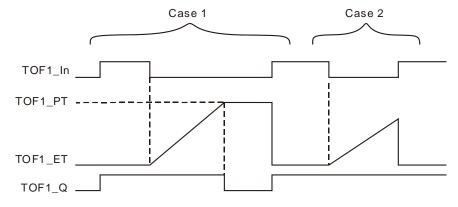

- **Case 1**: TOF1\_PT is the set time for off delay. When TOF1\_In is TRUE, TOF1\_Q is TRUE. When TOF1\_In is FALSE, the timer starts to measure the time. When the value of TOF1\_ET equals the setting value of TOF1\_PT, TOF1\_Q is FALSE and the timer stops timing.
- **Case 3**: When TOF1\_In changes from TRUE to FALSE, the timer starts timing. When current time (TOF1\_ET) is less than the set time (TOF1\_PT) and TOF1\_In is set to TRUE, TOF1\_ET is reset and the state of TOF1\_Q does not change.

# 8.7.3 TP

FB/FC	Explanation	Applicable model
FB	TP is used for the off delay after the input <b>In</b> is TRUE.	AS524C-B
	TP_instance	

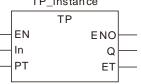

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Timer input	Input	Controls the timer to start or reset	TRUE or FALSE
РТ	Set time	Input	Set the time from when the timer starts until Q changes to TRUE	•
Q	Timer output	Output	Q is FALSE when the set time <i>PT</i> is reached.	TRUE or FALSE
ET	Elapsed time	Output	Elapsed time from the time when the timer starts to current time.	•

T#0ms ~ 213503d23h34m33s709.551ms

	Boolean		Bit s	string			Integer				eal nber	Time, date			String					
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In	•																			
PT																•				
Q	•																			
ET																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation


When *In* is TRUE, Q is TRUE and the timer starts measuring time and the value of *ET* increases accordingly. At the moment, Q remains TRUE. When *ET* equals PT, Q is FALSE and the timer stops measuring time. When *In* changes from TRUE to FALSE, ET is reset.

# • Precautions for Correct Use


When the output value of *ET* reaches the set value of *PT*, the timer stops measuring time. *ET* is reset to 0 (0ms) when *In* changes from TRUE to FALSE.

# Programming Example The variable table and program

Variable name	Data type	Initial value				
TP1	TP					
TP1_EN	BOOL	FALSE				
TP1_In	BOOL	FALSE				
TP1_PT	TIME					
TP1_Q	BOOL					
TP1_ET	TIME					

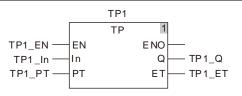

#### **Timing Chart:**

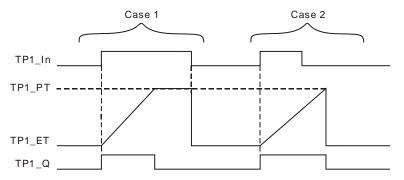

- TP1\_PT sets the time for off delay. When TP1\_In is TRUE, the timer starts to measure Case 1: time and TP1\_Q is TRUE. When the value of TP1\_ET equals the setting value of TP1\_PT, TP1\_Q is FALSE. When TP1\_In is FALSE, TP1\_ET is reset.
- Case 2: TP1 PT sets the time for off delay. When TP1 In is TRUE and the timer starts to measure time, TP1\_Q is TRUE. When TP1\_In is FALSE and the value of TP1\_ET is less than the setting value of TP1\_PT, TP1\_ET keeps timing and TP1\_Q keeps TRUE state. When the value of TP1\_ET equals the setting value of TP1\_PT, TP1\_ET and TP1\_Q are both reset.

FB/FC	Explanation	Applicable model
FB	Sys_ReadTime reads the time of the real-time clock of the controller.	AS524C-B
	Sys_ReadTime_instance	
	Sys_ReadTime	
	Enable Done Year	

Month Day Week Hour Minute Second

# 8.7.4 Sys\_ReadTime

# Input Parameter

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.

# • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Year	Year	UINT	1970~2106
Month	Month	UINT	1~12
Day	Day	UINT	1~ 31
Week	Week	UINT	1~7
Hour	Hour	UINT	0~23
Minute	Minute	UINT	0~59
Second	Second	UINT	0~59

# • Function Explanation

Sys\_ReadTime reads the time of the real-time clock of the controller. When *Enable* is TRUE, the real-time clock information in the controller such as year, month, day, week, hour, minute and second will be read in the specified variables.

# 8.7.5 Sys\_ReadTotalWorkTime

FB/FC	Explanation	Applicable model
FB	Sys_ReadTotalWorkTime reads total work time of the controller.	AS524C-B

Sys\_ReadTotalWorkTime\_instance Sys\_ReadTotalWorkTime Enable Done TotalWorkTime

# Input Parameter

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.

# Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
TotalWorkTime	Shows total work time of the controller.	TIME	

T#0ms ~ 213503d23h34m33s709.551ms

# • Function Explanation

Sys\_ReadTotalWorkTime reads total work time of the controller. When *Enable* is TRUE, the total work time of the controller is read in the variable specified by *TotalWorkTime*. For example, the controller worked for 3 hours yesterday and worked for 2 hours today. So the read total work time of the controller is 5 hours.

# 8.7.6 Sys\_ReadPowerOnTime

FB/FC	Explanation	Applicable model
FB	Sys_ReadPowerOnTime reads power-on time of the controller.	AS524C-B

Sys_	_ReadPov	verOnTime_insta	nce
	Sys_Rea	dPowerOnTime	
	Enable	Done	
		PowerOnTime	

# Input Parameter

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.

# • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
PowerOnTime	Shows total power-on time of the controller.	TIME	


T#0ms ~ 213503d23h34m33s709.551ms

# • Function Explanation

Sys\_ReadPowerOnTime reads total power-on time of the controller. The instruction will restart to measure the power-on time if the controller is repowered after power off. When *Enable* is TRUE, the total power-on time of the controller will be read in the variable specified by *PowerOnTime*.

# 8.7.7 Sys\_WdgStatus

FB/FC	Explanation	Applicable model
FB	The Sys_WdgStatus instruction is used to read whether or not the execution time of the specified task exceeds the allowed setting time (watchdog time).	AS524C-B

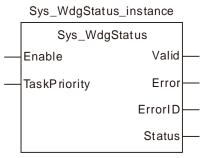

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE
TaskPriority	Set the priority of a task, i.e. to specify the task via its priority.	UINT	1~24 (0)	When <i>Enable</i> changes to TRUE


# • Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	
Status	TRUE when the execution time of the specified task exceeds the allowed setting time (watchdog time).	BOOL	TRUE / FALSE

# Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When Enable changes to TRUE</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
	• When <i>Enable</i> changes to Trole	<ul> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Error	<ul> <li>When the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
Status	<ul> <li>When the execution time of the specified task exceeds the allowed setting time (watchdog time).</li> </ul>	<ul> <li>When the execution time of the specified task does not exceed the allowed setting time (watchdog time).</li> </ul>

# • Output Update Timing Chart

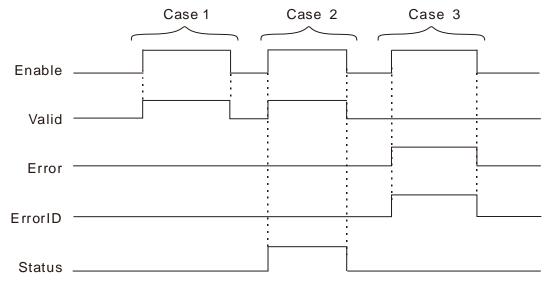

- Case 1 : Valid changes from FALSE to TRUE when Enable changes from FALSE to TRUE.
- **Case 2**: *Valid* changes from FALSE to TRUE when *Enable* changes from FALSE to TRUE. When the task execution time exceeds the watchdog time, *Status* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE and *Status* changes to FALSE.
- **Case 3**: When an error occurs as *Enable* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

# Function

The Sys\_WdgStatus instruction is used to read whether or not the execution time of the specified task *exceeds* the allowed setting time (watchdog time). When this instruction is used, do not place it in the task specified by *TaskPriority*. It should be placed in other different task for execution.

The *Status* output of the instruction changes from FALSE to TRUE, the execution of the task specified by *TaskPriority* stops. *Status* of the instruction can be used to perform related operation in other task by users.

# 8.8 Counter Instructions

# 8.8.1 CTU

FB/FC	Explanation	Applicable model
FB	CTU is used as an up counter.	AS524C-B
	CTU_instance	
	CTU	

Q

сv

CU

ΡV

Reset

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
си	Up-counter input signal	Input	Control the up-counter to start counting up	TRUE or FALSE
Reset	Reset signal	Input	Reset the counter present value	TRUE or FALSE
PV	Preset value	Input	Counter setting value	0 ~ 4294967295
Q	Output signal	Output	Q is TRUE when CV equals PV.	TRUE or FALSE
CV	Counter value	Output	Counter present value	0 ~ 4294967295

	Boolean		Bit string Integer							eal nber		Time	, dat	Ð	String					
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CU	•																			
Reset	•																			
PV								•												
Q	•																			
CV																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- 1. CTU functions as an up counter.
- 2. When *CU* changes from FALSE to TRUE, the counter perfoms the up-counting once and the value of *CV* is increased by 1. When *CV* equals *PV*, *Q* is TRUE. When *Reset* is set to TRUE, *CV* is cleared to 0 and *Q* is reset to FALSE.


# • Precautions for Correct Use

- While *Reset* is TRUE, the counter will not count up.
- When CV equals PV, the counter stops counting.


# Programming Example

# The variable table and program

Variable name	Data type	Initial value
CTU1	СТИ	
CTU1_EN	BOOL	FALSE
CTU1_CU	BOOL	FALSE
CTU1_Reset	BOOL	FALSE
CTU1_PV	UDINT	4
CTU1_Q	BOOL	
CTU1_CV	UDINT	

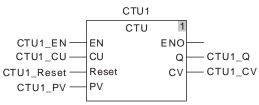


# Timing Chart:

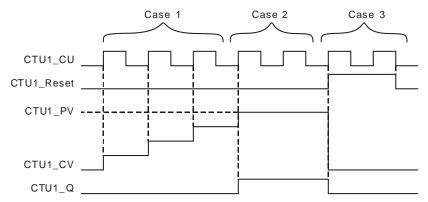

- **Case 1**: If CTU counts up normally, the value of CTU1\_CV is increased by 1 whenever CTU1\_CU is triggered once.
- Case 2 : When CTU1\_CV equals CTU1\_PV, CTU1\_Q is TRUE and CTU stops counting.
- **Case 3**: When CTU1\_Reset is TRUE, CTU1\_CV is cleared to 0, CTU1\_Q is FALSE. And the counter will not count when CTU1\_CU is triggered.

# 8.8.2 CTD

FB/FC	Explanation	Applicable model
FB	CTD is used as a down counter.	AS524C-B
	CTD_instance	

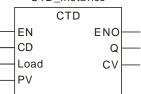

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
CD	Down-counter input signal	Input	Control the counter to start counting down	TRUE or FALSE
Load	Load signal	Input	For writing the down-counter value	TRUE or FALSE
PV	Preset value	Input	Counter setting value	0 ~ 4294967295
Q	Output signal	Output	Q is TRUE when the counter counts down to 0.	TRUE or FALSE
CV	Counter value	Output	Counter present value	0 ~ 4294967295

	Boolean	Bit string				Integer							Real number		Time, date				String	
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CU	•																			
Load																				
PV								•												
Q																				
CV								•												
Note:																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- CTU functions as a down counter.
- When *Load* is reset to FALSE after being set to TRUE, the value of *PV* is written to *CV*. When *CD* changes from FALSE to TRUE, the counter makes the counter value decreased once and the value of *CV* is decreased by 1. When the value of *CV* reaches 0, *Q* is TRUE.


# • Precautions for Correct Use

While Load is TRUE, the counter will not count down.


# Programming Example

# The variable table and program

1 0		
Variable name	Data type	Initial value
CTD1	CTD	
CTD1_EN	BOOL	FALSE
CTD1_CD	BOOL	FALSE
CTD1_Load	BOOL	FALSE
CTD1_PV	UDINT	4
CTD1_Q	BOOL	
CTD1_CV	UDINT	

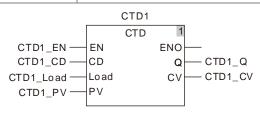


# Timing Chart:

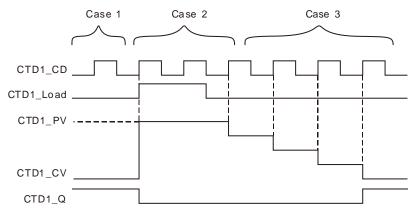

- Case 1: There is no impact on the ouput by triggering CTD1\_CD when the value of CTD1\_CV is 0.
- Case 2: When CTD1\_Load is TRUE and CTD1\_CV equals the set value of CTD1\_PV, CTD1\_Q changes from TRUE to FALSE. At the moment, CTD1\_CV does not count down when CTD1\_CD is triggered.
- **Case 3**: If CTD counts down normally and CTD1\_Load is FALSE, the value of CTD1\_CV is decreased by 1 whenever CTD1\_CD is triggered once. CTD1\_Q is TRUE when the value of CTD1\_CV is decreased to 0.

# 8.8.3 CTUD

FB/FC	Explanation	Applicable model
FB	CTUD is used as an up-down counter.	AS524C-B
	CTUD_instance	
	CTUD	

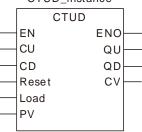

## • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
CU	Up-counter input signal	Input	Control the counter to count up	TRUE or FALSE
CD	Down-counter input signal	Input	Control the counter to count down	TRUE or FALSE
Reset	Reset signal	Input	Reset counter present value	TRUE or FALSE
Load	Load signal	Input	For writing the down-counter value	TRUE or FALSE
PV	Preset value	Input	Counter setting value	0 ~ 4294967295
QU	Output signal	Output	Q is TRUE when CV equals PV.	TRUE or FALSE
QD	Output signal	Output	Q is TRUE when the counter counts down to 0.	TRUE or FALSE
CV	Counter value	Output	Counter present value	0 ~ 4294967295

	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INL	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
CU	•																			
CD	•																			
Reset	•																			
Load	•																			
PV								•												
QU	•																			
QD	•																			
CV																				

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

CTUD is used as an up counter for counting up and a down counter for counting down.


## • Precautions for Correct Use

- The counter will not count down while *Load* is TRUE.
- The counter will not count up while *Reset* is TRUE.


# Programming Example

# The variable table and program

Variable name	Data type	Initial value
CTUD1	CTUD	
CTUD1_EN	BOOL	FALSE
CTUD1_CU	BOOL	FALSE
CTUD1_CD	BOOL	FALSE
CTUD1_Reset	BOOL	FALSE
CTUD1_Load	BOOL	FALSE
CTUD1_PV	UDINT	4
CTUD1_QU	BOOL	
CTUD1_QD	BOOL	
CTUD1_CV	UDINT	

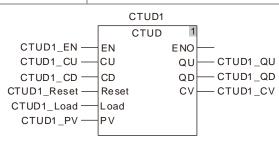

Timing Chart:

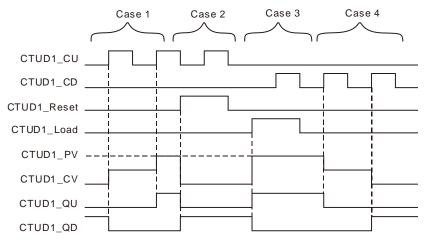


- Case 1 : If CTUD counts up normally, the value of CTUD1\_CV is increased by 1 whenever CTUD1\_CU is triggered once.
- Case 2 : When CTUD1\_Reset is TRUE, CTUD1\_CV is cleared to 0, CTUD1\_QU changes to FALSE and CTUD1\_QD changes to TRUE.
- Case 3 : When CTUD1\_Load is TRUE and CTUD1\_CV equals CTUD1\_PV, CTUD1\_QU changes to TRUE and CTUD1\_QD changes to FALSE. At the moment, if CTUD1\_CD is triggered, the instruction can not count down.
- Case 4 : If the instruction counts down normally, CTUD1\_QU is FALSE when CTUD1\_CD is TRUE. The value of CTUD1\_CV is decreased by 1 whenever CTUD1\_CD is triggered once. CTUD1\_QD is TRUE when the value of CTUD1\_CV is decreased to 0.

# 8.9 Math Instructions

# 8.9.1 ADD

FB/FC	Explanation	Applicable model
FC	ADD is used for the addition operation of two or more variables or constants.	AS524C-B

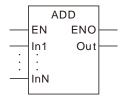

## • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Augend	Input	Augend	Depends on the data type of the variable that the input parameter is connected to.
In2 to InN	Addend	Input	The maximum number of addends is 7, which means that N can be 2~8 and the number can be increased or reduced via the programming software in creating a program.	Depends on the data type of the variable that the input parameter is connected to.
Out	Sum	Output	The addition result of In1 to InN	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring					Inte	ger				Re num	eal ber	-	Time,	date		String
	BOOL	вүте	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	•	
In2 to InN		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•				
Out		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	•	


# Note:

The symbol 

 indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- The instruction is used for the addition of two or more variables or constants. The result is output to Out, that is, Out= In1 + In2 +...+ InN.
- The input parameters *In1~InN* in this instruction are allowed to be the variables of different types among bits, integers and real numbers. When *In1~InN* are the variables of different types, the addition operation will be performed based on the data type which can contain all valid ranges of *In1~InN* values. For example, the data type of *Out* is DINT if the data type of *In1* is INT and *In2* is DINT.

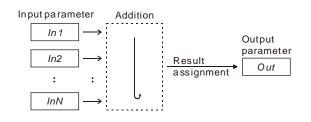

- The input and output variables are allowed to be of different data types among bits, integers and real numbers. When the data types of input and output variables are different, the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software. For example, if the data types of *ln1* and *ln2* are INT and DINT respectively, the data type of *Out* is DINT. There will be an error during the data type of the variable that *Out* is connected to is INT. No error will occur during the compiling of the software if the data type of the variable that *Out* is connected to is LINT.
- For the data type about time and date, following combinations are supported only.
  - 1. In1 is TIME, In2 is TIME and Out is TIME;
  - 2. In1 is TOD (TIME\_OF\_DAY), In2 is TIME and Out is TOD;
  - 3. In1 is DT (DAY\_AND\_TIME), In2 is TIME and Out is DT.

### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The sum of *In1~InN* may be out of the valid range of the data type of *Out*.
- The difference between *In1* and *In2* may be out of the valid range of the data type of *Out*. For example, the data types of "ADD\_In1" and "ADD\_In2" are both INT with their respective values, 32767 and 1. If the data type of the output variable is INT, the output variable value will be -32768 as shown in the following table, variable 1. If the data type of the output variable is set to DINT, the output variable value will be 32768 as shown in the following table, variable 3 shown in the following table.


Variable name	Data type	Current value
ADD_EN	BOOL	TRUE
ADD_In1	INT	32767
ADD_In2	INT	1
Out1	INT	-32768

> Variable 2

Variable 1

Variable name	Data type	Current value
ADD_EN	BOOL	TRUE
ADD_In1	INT	32767
ADD_In2	INT	1
Out1	DINT	32768

The program

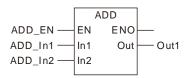

# • Programming Example1

- The data types of variables ADD\_In1, ADD\_In2 and Out1 are all INT. The values of ADD\_In1 and ADD\_In2 are 10 and 50 respectively. The value of Out1 is 60 when ADD\_EN changes to TRUE as shown in Variable 1.
- The data types of variables ADD\_In1, ADD\_In2 and Out1 are all TIME. The values of ADD\_In1 and ADD\_In2 are TIME #1s and TIME #2s respectively. The value of Out1 is TIME #3s when ADD\_EN changes to TRUE as shown in Variable 2.
- The data types of variables ADD\_In1, ADD\_In2 and Out1 are DT, TIME and DT respectively. The values of ADD\_In1 and ADD\_In2 are DT#2016-9-1-8:00:00 and TIME#1H53M34S respectively. The value of Out1 is DT#2016-09-01-09:53:34 when ADD\_EN changes to TRUE as shown in Variable 3.

### > Variable 1

Variable name	Data type	Current value
ADD_EN	BOOL	TRUE
ADD_In1	INT	10
ADD_In2	INT	50
Out1	INT	60


### > Variable 2

Variable name	Data type	Current value
ADD_EN	BOOL	TRUE
ADD_In1	TIME	TIME #1s
ADD_In2	TIME	TIME #2s
Out1	TIME	TIME #3s

#### > Variable 3

Variable name	Data type	Current value
ADD_EN	BOOL	TRUE
ADD_In1	DT	DT#2016-9-1-8:00:00
ADD_In2	TIME	TIME#1H53M34S
Out1	DT	DT#2016-09-01-09:53:34

### > The program

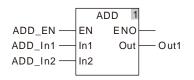

# 8.9.2 SUB

FB/FC	Expla	Applicable model		
FC	SUB is used for the subtraction operat	AS524C-B		
		SUB		
		EN EN	o	
		In1 O	ut —	

ln2

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range					
In1	Minuend	Input	Minuend	Depends on the data type of the variable that the input parameter is connected to.					
In2	Subtrahend	Input	Subtrahend	Depends on the data type of the variable that the input parameter is connected to.					
Out	Difference	Output	The subtraction result of In1 and In2	Depends on the data type of the variable that the output parameter is connected to.					


	Boolean		Bit string Integer							Real number		Time, date			String					
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	
ln2		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	
Out		•	•	•	•	•	• • • • • • • •						•	•	•		•	•		

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- The instruction is used for the subtraction of two or more variables or constants. The result is output to Out, that is, Out = In1 In2.
- The input parameters *In1* and *In2* in this instruction are allowed to be the variables of different data types among bits, integers and real numbers. When *In1* and *In2* are the variables of different types, the subtraction operation will be performed based on the data type which can contain valid ranges of *In1* and *In2* values. For example, the data type of *Out* is DINT if the data type of *In1* is INT and *In2* is DINT.

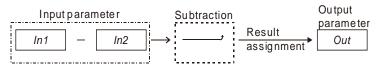

- The input and output variables are allowed to be of different data types among bits, integers and real numbers. When the data types of input and output variables are different, the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software. For example, if the data types of *In1* and *In2* are INT and DINT respectively, the data type of *Out* is DINT. There will be an error during the compiling of the variable that *Out* is connected to is INT. No error will occur during the compiling of the software if the data type of the variable that *Out* is connected to is LINT.
- For the data type of time and date, only following combinations are supported.
  - 1. In1 is TIME, In2 is TIME and Out is TIME;
  - 2. In1 is TOD, In2 is TIME and Out is TOD;
  - 3. In1 is TOD, In2 is TOD and Out is TIME;
  - 4. In1 is DATE, In2 is DATE and Out is TIME;
  - 5. In1 is DT, In2 is DT and Out is TIME;
  - 6. In1 is DT, In2 is TIME and Out is DT.

### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The difference between *In1* and *In2* may be out of the valid range of the data type of *Out*. For example, the data types of "SUB \_In1" and "SUB \_In2" are both INT with their respective values, -32768 and 1. If the data type of the output variable is INT, the output variable value will be 32767 as shown in the following table, variable 1. If the data type of the output variable is set to DINT, the output variable value will be -32769 as shown in the following table, variable 2.


#### > Variable 1

Variable name	Data type	Current value
SUB_EN	BOOL	TRUE
SUB _In1	INT	-32768
SUB _In2	INT	1
Out1	INT	32767

#### > Variable 2

Variable name	Data type	Current value
SUB_EN	BOOL	TRUE
SUB _In1	INT	-32768
SUB _In2	INT	1
Out1	DINT	-32769

### > The Program

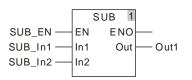

### • Programming Example

- The data types of variables SUB\_In1, SUB\_In2 and Out1 are all INT and the values of SUB\_In1 and SUB\_In2 are 100 and 40 respectively. The value of Out1 is 60 when SUB\_EN changes to TRUE as shown in Variable 1.
- The data types of variables SUB\_In1, SUB\_In2 and Out1 are all TIME and the values of SUB\_In1 and SUB\_In2 are TIME#4s and TIME#1s respectively. The value of Out1 is TIME#3s when SUB\_EN changes to TRUE as shown in Variable 2.

■ The data types of variables *SUB\_In1*, *SUB\_In2* and *Out1* are DATE, DATE and TIME and the values of *SUB\_In1* and *SUB\_In2* are DATE#2016-10-1 and DATE#2016-9-1 respectively. The value of *Out1* is TIME#30D when *SUB\_EN* changes to TRUE as shown in Variable 3.

### > Variable 1

Variable name	Data type	Current value
SUB_EN	BOOL	TRUE
SUB _In1	INT	100
SUB _In2	INT	40
Out1	INT	60

#### > Variable 2

Variable name	Data type	Current value
SUB_EN	BOOL	TRUE
SUB_In1	TIME	TIME#4s
SUB_In2	TIME	TIME#1s
Out1	TIME	TIME#3s

# > Variable 3


Variable name	Data type	Current value
SUB_EN	BOOL	TRUE
SUB_In1	DATE	DATE#2016-10-1
SUB_In2	DATE	DATE#2016-9-1
Out1	TIME	TIME#30D

### > The program

		SUB	1	
SUB_EN	ΕN	E١	10	
SUB_In1	In1	С	ut	— O ut1
SUB_In2	In2			

# 8.9.3 MUL

FB/FC	Explanation	Applicable model
FC	MUL is used for the multiplication of two or more variables or constants.	AS524C-B

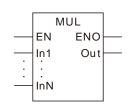

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Multiplicand	Input	Multiplicand	Depends on the data type of the variable that the input parameter is connected to.
In2 to InN	Multiplier	Input	The maximum number of multipliers is 7, which means that N can be 2~8 and the number can be increased or reduced via the programming software in creating a program.	Depends on the data type of the variable that the input parameter is connected to.
Out	Product	Output	The multiplication result of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit string Integer							Real number		Time, date			String					
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	TNI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out		•	•	•	•	•	$\bullet \bullet \bullet \bullet \bullet \bullet \bullet \bullet \bullet$					•	•							

# Note:


The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

■ The instruction is used for the multiplication of two or more variables or constants. The result is output to *Out*, that is, *Out*= In1 \* In2 \* ... \* InN.

8\_

The input parameters  $In1 \sim InN$  are allowed to be the variables of different data types in this instruction. When  $In1 \sim InN$  are the variables of different data types, the multiplication will be performed based on the data type which can contain valid ranges of  $In1 \sim InN$  values. For example, the data type of *Out* is DINT if the data type of *In1* is INT and *In2* is DINT.

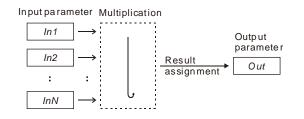

The input and output variables are allowed to be of different data types in this instruction. When the data types of input and output variables are different, the range of the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software. For example, if the data types of *ln1* and *ln2* are INT and DINT respectively, the data type of *Out* is DINT. There will be an error during the compiling of the variable that *Out* is connected to is INT. No error will occur during the compiling of the software if the data type of the variable that *Out* is connected to is LINT.

### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The multiplication result of In1 ~ In2 may be out of the valid range of the data type of Out. For example, the data types of "MUL \_In1" and "MUL \_In2" are both INT with their respective values, 20000 and 2. If the data type of the output variable is INT, the output variable value will be - 25536 as shown in the following table, Variable 1. If the data type of the output variable is set to DINT, the output variable value will be 40000 as shown in the following table, Variable 2.


### > Variable 1

Variable name	Data type	Current value
MUL_EN	BOOL	TRUE
MUL _In1	INT	20000
MUL _In2	INT	2
Out1	INT	-25536

#### > Variable 2

Variable name	Data type	Current value
MUL_EN	BOOL	TRUE
MUL _In1	INT	20000
MUL _In2	INT	2
Out1	DINT	40000


#### > The Program

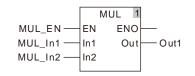

### • Programming Example


The data types of variables MUL \_In1, MUL \_In2 and Out1 are all INT. The values of MUL \_In1 and MUL \_In2 are 10 and 50 respectively. The value of Out1 is 500 when MUL \_EN changes to TRUE. he variable table and program

Variable name	Data type	Initial value
MUL_EN	BOOL	TRUE
MUL _In1	INT	10
MUL_In2	INT	50
Out1	INT	500

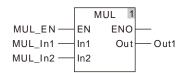

# 8.9.4 DIV

FB/FC	Explanation	Applicable model
FC	DIV is used for the division operation of two variables or constants.	AS524C-B

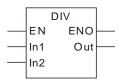

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Dividend	Input	Dividend	Depends on the data type of the variable that the input parameter is connected to.
In2	Divisor	Input	Divisor	Depends on the data type of the variable that the input parameter is connected to. 0 is excluded.
Out	Quotient	Output	The division result of In1 andIn2	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit string Integer									eal nber	Time, date			String				
	BOOL	ВҮТЕ	WORD	DWORD	LWORD	USINT	USINT UNINT USINT				REAL	LREAL	TIME	DATE	TOD	DT	STRING			
In1		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
In2		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out		•	•	•	•	•	• • • • • • •							•	•					

### Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

# Function Explanation

- The instruction is used for the division of two variables or constants. The result is output to Out, that is, Out= In1 / In2.
- The input parameters *In1* and *In2* are allowed to be the variables of different data types in this instruction. When *In1* and *In2* are the variables of different data types, the division will be performed based on the data type which can contain valid ranges of *In1* and *In2*. For example, the data type of *Out* is DINT if the data type of *In1* is INT and *In2* is DINT.

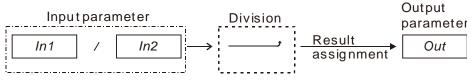

The input and output variables are allowed to be of different data types in this instruction. When the data types of input and output variables are different, the range of the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software. For example, if the data types of *In1* and *In2* are INT and DINT respectively, the data type of *Out* is DINT. There will be an error during the compiling of the type of *Out* is INT. No error will occur during the compiling of the software if the data type of *Out* is LINT.

### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The input value of *In2* can not be 0. In other words, the divisor in the division operation can not be 0. The value of *Out* will be 0 if the value of *In2* is 0.
- The division result of *In1* and *In2* may be out of the valid range of the data type of *Out*. For example, the data types of "DIV \_In1" and "DIV \_In2" are both INT with their respective values, -32768 and -1. If the data type of the output variable is INT, the output variable value will be -32768 as shown in the following table, variable 1. If the data type of the output variable is set to DINT, the output variable value will be 32768 as shown in the following table, variable 2.


### > Variable 1

Variable name	Data type	Current value
DIV_EN	BOOL	TRUE
DIV_In1	INT	-32768
DIV_In2	INT	-1
Out1	INT	-32768

#### Variable 2


Variable name	Data type	Current value
DIV_EN	BOOL	TRUE
DIV_In1	INT	-32768
DIV_In2	INT	-1
Out1	DINT	32768

> The Program

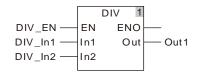


The result is always an integer for the division of two integers. Even if there is a remainder for the division of two integers, the remainder is cut.

For example, the data types of *In1* and *In2* are both INT with their respective values, 10 and 3. And the data type of *Out* is INT and Real and thus its value is 3 and 3.0 respectively as illustrated in the following figure.

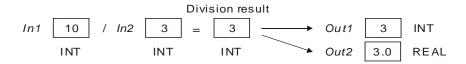

The data type of *Out* is a real number for the division of an integer and a real number or the division of two real numbers. The value of *Out* is shown as below including its fractional part when there is a remainder for this type of division.

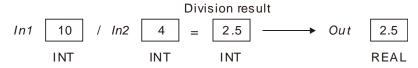


### • Programming Example

The data types of variables DIV\_In1, DIV\_In2 and Out1 are all INT. The values of DIV\_In1 and DIV\_In2 are 100 and 20 respectively. The value of Out1 is 5 when DIV\_EN changes to TRUE.


### The variable table and program

Variable name	Data type	Initial value
DIV_EN	BOOL	TRUE
DIV_In1	INT	100
DIV_In2	INT	20
Out1	INT	5

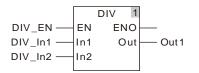

# 8.9.5 MOD

FB/FC	Explanation	Applicable model
FC	MOD finds the remainder for division of two integer variables or constants.	AS524C-B

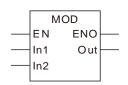

## • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Dividend	Input	Dividend	Depends on the data type of the variable that the input parameter is connected to.
In2 Divisor		Input	Divisor	Depends on the data type of the variable that the input parameter is connected to. 0 is excluded.
Out	Remainder	Output	The remainder got by dividing In1 by In2	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring			Integer								eal nber	Time, date			String	
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	LINT DINT ULINT USINT					REAL	LREAL	TIME	DATE	TOD	DT	STRING		
ln1		•	•	•	•	•	•	•	•	•	•	•	•							
In2		•	•	•	•	•	•	•	•	•	•	•	•							
Out		•	•	•	•	•	• • • • • • •													
<b>ata</b> :																				

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- The instruction is used to get the remainder of the division of two integer variables or constants. The result is output to Out, that is,  $Out = \ln 1 (\ln 1/\ln 2)^{*}\ln 2$ .
- The input variable and input variable or the input variable and output variable are allowed to be of different data types in this instruction. When the data types of input and output variables are different, the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software. For example, if the data types of *ln1* and *ln2* are INT and DINT respectively, the data type of *Out* is DINT. There will be an error during the compiling of the software if the data type of *Out* is INT. No error will occur during the compiling of the software if the data type of *Out* is LINT.

### • Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The input value of *In2* can not be 0. In other words, the divisor in the division operation can not be 0. The value of *Out* will be 0 if the value of *In2* is 0.

### • Programming Example

The data types of variables MOD\_In1, MOD\_In2 and Out1 are all INT. The values of MOD\_In1 and MOD\_In2 are 10 and 4 respectively. The value of Out1 is 2 when MOD\_EN changes to TRUE.


# The Variable and program

Variable name	Data type	Current value
MOD_EN	BOOL	TRUE
MOD _In1	INT	10
MOD _In2	INT	4
Out1	INT	2

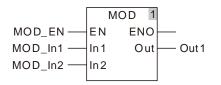

# 8.9.6 MODREAL

FE	B/FC	Explanation	Applicable model
	FC	MODREAL finds the remainder for division of two floating- point variables or	AS524C-B
	FC	constants.	7100240 B

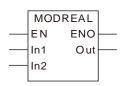

# Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Dividend	Input	Dividend	Depends on the data type of the variable that the input parameter is connected to.
In2	Divisor	Input	Divisor	Depends on the data type of the variable that the input parameter is connected to. 0 is excluded.
Out	Remainder	Output	The remainder got by dividing In1 by In2	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring					Inte	ger				Re num	eal nber		Time	, date	1	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1														•	•					
In2														•	•					
Out														•	•					

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- The instruction is used to find the remainder of the division of two floating- point variables or constants and the result is output to *Out*.
- The input variable and input variable or the input variable and output variable are allowed to be of different data types in this instruction.

# • Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.

- The input value of *In2* can not be 0. In other words, the divisor in the division operation can not be 0. The value of *Out* will be 0 if the value of *In2* is 0.
- Programming Example
  - The data types of variables MODREAL \_In1, MODREAL \_In2 and Out1 are REAL, REAL and LREAL respectively. The values of MODREAL \_In1 and MOD \_In2 are 10.5 and 2.5 respectively. The value of Out1 is 0.5 when MODREAL \_EN changes to TRUE.


The varia	ble table	and	program
-----------	-----------	-----	---------

Variable name	Data type	Current value
MODREAL_EN	BOOL	TRUE
MODREAL _In1	REAL	10.5
MODREAL _In2	REAL	2.5
Out1	LREAL	0.5

	MOD	REAL 1	
MODREAL_EN	EN	ENO-	
MODREAL_In1	ln1	Out	— Out 1
MODREAL_In2 —	ln2		

# 8.9.7 MODTURNS

FB/FC	Explanation	Applicable model
FC	MODTURN finds the signed integral part for modulo division of two floating-	AS524C-B
-	point variables or constants.	7.00240 B

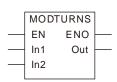

# • Parameters

Parameter name	Meaning	Input/ Output Description		Valid range
In1	Input value	Input	Input value	Depends on the data type of the variable that the input parameter is connected to.
In2	Modulo range	Input	Modulo range	Depends on the data type of the variable that the input parameter is connected to. 0 is excluded.
Out	Number of moduloOutputNumber NumberrotationsOutputNumber		Number of modulo rotations	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring		Integer Real Time.				Time,		9	String							
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1														•	•					
In2														•	•					
Out												•								

## Note:

The symbol 

indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- MODTURN is used to carry out modulo division of two floating-point variables or constants and get the signed integral component. The result is output to *Out*. The number of modulo rotations of an axis can be calculated according to its set absolute position.
- The input variable and input variable or the input variable and output variable are allowed to be of different data types in this instruction.

### • Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The input value of *In2* can not be 0. In other words, the divisor in the division operation can not be 0. The value of *Out* will be 0 if the value of *In2* is 0.

## • Programming Example

■ The data types of variables *MODTURNS\_In1*, *MODTURNS\_In2* are both REAL and *Out1* is DINT. The values of *MODTURNS\_In1* and *MODTURNS\_In2* are 800.23 and 360.0 respectively. The value of *Out1* is 2 when *MODTURNS\_EN* changes to TRUE.


### The variable table and program

Variable name	Data type	Current value
MODTURNS_EN	BOOL	TRUE
MODTURNS _In1	REAL	800.23
MODTURNS _In2	REAL	360.0
Out1	DINT	2

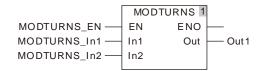

# 8.9.8 MODABS

FB/F	C	Explanation	Applicable model
FC		MODABS finds the unsigned modulo value for modulo division of two	AS524C-B
	floating-point variables or constants.	100240 B	

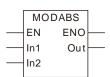

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Input value	Input	Input value	Depends on the data type of the variable that the input parameter is connected to.
In2	Modulo range	Input	Modulo range	Depends on the data type of the variable that the input parameter is connected to. 0 is excluded.
Out	Modulo value	Output	Modulo value	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring					Inte	ger				Re num	eal nber		Time	, date		String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	Π	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1														•	•					
ln2														•	•					
Out															•					

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- MODABS is used to perform modulo division of two floating-point variables or constants and get the unsigned modulo value. The result is output to *Out*. The modulo position can be calculated according to the absolute position of the axis.
- The input variable and input variable or the input variable and output variable are allowed to be of different data types in this instruction.

8\_

### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The input value of *In2* can not be 0. In other words, the divisor in the division operation can not be 0. The value of *Out* will be 0 if the value of *In2* is 0.

### • Programming Example

The data types of variables MODABS\_In1 and MODABS\_In2 are both REAL and the data type of Out1 is LREAL. The values of MODABS\_In1 and MODABS\_In2 are 400.23 and 360.0 respectively. The value of Out1 is 40.2300109863281 when MODABS\_EN changes to TRUE. The values of MODABS\_In1 and MODABS\_In2 are -400.23 and 360.0 respectively. The value of Out1 is 319.769989013672 when MODABS\_EN changes to TRUE.

#### > Variable 1

Variable name	Data type	Current value
MODABS_EN	BOOL	TRUE
MODABS _In1	REAL	400.23
MODABS _In2	REAL	360.0
Out1	LREAL	40.2300109863281

#### > Variable 2


Variable name	Data type	Current value
MODABS_EN	BOOL	TRUE
MODABS _In1	REAL	-400.23
MODABS _In2	REAL	360.0
Out1	LREAL	319.769989013672

The program

	MOD	ABS	
MODABS_EN	EN	ENO	
MODABS_In1	ln1	Out	— O ut1
MODABS_In2	ln2		

# 8.9.9 ABS

FB/FC	Explanation	Applicable model
FC	ABS finds the absolute value of an integer or a real number.	AS524C-B

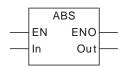

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to.
Out	Absolute value	Output	Absolute value of <i>In</i>	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring					Inte	ger					eal nber		Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out		•	•	•	•	•	•	•	•	•	•	•	•	•	•					

# Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

### Function Explanation

- ABS finds the absolute value of the input parameter *In*. The result is output to *Out*. That is, Out = |In|.
- The input variable and output variable are allowed to be of different data types in this instruction. When the data types of input and output variables are different, the range of the data type of the output variable must include the valid ranges of data types of all input variables. Otherwise, there will be an error during the compiling of the software.

### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

### • Programming Example

■ The data types of variables *ABS\_In* and *Out1* are both INT and the value of *ABS\_In* is -10. The value of *Out1* is 10 when *ABS\_EN* changes to TRUE. The value of *Out1* is 20 as *ABS\_In* is 20.

# > Variable 1

Variable name	Data type	Current value
ABS_EN	BOOL	TRUE
ABS _In	INT	-10
Out1	INT	10

## > Variable 2

Variable name	Data type	Current value
ABS_EN	BOOL	TRUE
ABS _In	INT	20
Out1	INT	20

> The program

		ABS 1	
ABS_EN	ΕN	ENO	
ABS_In —	In	Out	— Out1

# 8.9.10 DegToRad

FB/FC	Explanation	Applicable model
FC	DegToRad is used to convert degrees to radians.	AS524C-B



# • Parameters

Parameter name	Meaning	Input/ Output	Valid range			
In	Degrees	Input	Degrees to convert	Depends on the data type of the variable that the input parameter is connected to.		
Out	Radians	Output	Radians converted from degrees	Depends on the data type of the variable that the output parameter is connected to.		

	Boolean		Bit s	tring			Integer				Re num	eal nber		Time	, date		String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- DegToRad is used to convert the input parameter *In* to a radian and the result is output to *Out*. That is, Out =  $(\ln/180)^* \pi$ .
- The units of *In* and *Out* are degree (°) and radian respectively.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

### • Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variables are allowed to omit.

# • Programming Example

■ The data types of *DegToRad\_In* and *Out1* are INT and LREAL respectively. The value of *Out1* is 0.174532925199433 if the value of *DegToRad\_In* is 10 when *DegToRad\_EN* changes to TRUE. The value of *Out1* is -0.174532925199433 as *DegToRad\_In* is -10.

# > Variable 1

Variable name	Data type	Current value
DegToRad_EN	BOOL	TRUE
DegToRad _In	INT	10
Out1	LREAL	0.174532925199433

### > Variable 2

Variable name	Data type	Current value
DegToRad_EN	BOOL	TRUE
DegToRad _In	INT	-10
Out1	LREAL	-0.174532925199433

# > The program

	DegTo	Rad 1	
DegToRad_EN —	EN	ENO	
DegToRad_In —	In	Out	— Out1

# 8.9.11 RadToDeg

FB/FC	Explanation	Applicable model
FC	DegToRad is used to convert radians to degrees.	AS524C-B



# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range			
In	Radians	Input	Radians to convert	Depends on the data type of the variable that the input parameter is connected to.			
Out	Degrees	Output	Degrees converted from radians	Depends on the data type of the variable that the output parameter is connected to.			

	Boolean		Bit s	tring			Integer				Re num	eal nber		Time	, date		String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

# Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

- RadToDeg is used to convert the input parameter *In* to degrees and the result is output to *Out*. That is, Out =  $(\ln/\pi)^*$  180.
- The units of *In* and *Out* are radian and degree (°) respectively.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

### • Programming Example

The data types of variables RadToDeg\_In and Out1 are INT and LREAL respectively. The value of Out1 is 572. 957795130824 if the value of RadToDeg\_In is 10 when RadToDeg\_EN changes to TRUE. The value of Out1 is -572. 957795130824 as RadToDeg\_In is -10.


### > Variable 1

Variable name	Data type	Current value
RadToDeg _EN	BOOL	TRUE
RadToDeg _In	INT	10
Out1	LREAL	572. 957795130824

### > Variable 2


Variable name	Data type	Current value
RadToDeg_EN	BOOL	TRUE
RadToDeg_In	INT	-10
Out1	LREAL	-572. 957795130824

> The program

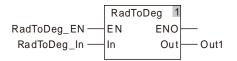

# 8.9.12 SIN

FB/FC	Explanation	Applicable model
FC	SIN is used to find the sine of a number and the result is output to Out. The	AS524C-B
	unit of <i>In</i> is radian.	A00240 B

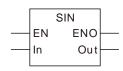

# • Parameters

Parameter name	Meaning	Input/ Output	Valid range				
In	Radians to process Input		Radians to process	Depends on the data type of the variable that the input parameter is connected to.			
Out	Operation result	Output	Operation result	-1.000000000000 ~ 1.000000000000			


	Boolean		Bit s	tring			Integer							Re num	eal nber		String			
	BxOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

## Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

■ SIN is used to calculate the sine of the input parameter *In* and the result is output to *Out*.

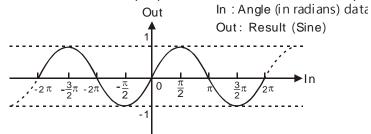

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

### • Precautions for Correct Use

The input variable setting is not allowed to omit. An error will occur during the compiling of the software if any input variable setting is omitted. But the output variable setting is allowed to omit.

### Programming Example

The data types of variables SIN\_In and Out1 are INT and LREAL respectively. The value of Out1 is -0.54402111088937 if the value of SIN\_In is 10 when SIN\_EN changes to TRUE. The value of Out1 is 0.54402111088937 as SIN\_In is -10.


Variable 1

Variable name	Data type	Current value
SIN_EN	BOOL	TRUE
SIN_In	INT	10
Out1	LREAL	-0.54402111088937

#### > Variable 2


Variable name	Data type	Current value
SIN_EN	BOOL	TRUE
SIN_In	INT	-10
Out1	LREAL	0.54402111088937

> The program

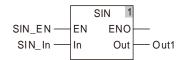

# 8.9.13 COS

FB/FC	Explanation	Applicable model
FC	COS is used to get the cosine of a number and the result is output to Out.	AS524C-B
	The unit of <i>In</i> is radian.	

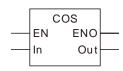

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Radians to process	Input	Radians to process	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Operation result	-1.0000000000000~ 1.0000000000000


	Boolean		Bit s	tring			Integer							Re num	eal nber					
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

COS is used to calculate the cosine of the input parameter *In* and the result is output to *Out*.

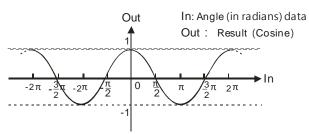

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

### • Programming Example

The data types of variables COS\_In and Out1 are INT and LREAL respectively. The value of Out1 is -0.839071529076452 if the value of COS\_In is 10 when COS\_EN changes to TRUE. The value of Out1 is -0.839071529076452 as COS\_In is -10.


Variable 1

Variable name	Data type	Current value
COS_EN	BOOL	TRUE
COS_In	INT	10
Out1	LREAL	-0.839071529076452

#### > Variable 2

Variable name	Data type	Current value
COS_EN	BOOL	TRUE
COS_In	INT	-10
Out1	LREAL	-0.839071529076452


> The program

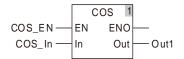

8

# 8.9.14 TAN

FB/FC	Explanation	Applicable model
FC	TAN is used to get the tangent of a number and the result is output to <i>Out</i> .	AS524C-B
	The unit of <i>In</i> is radian.	

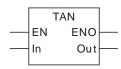

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Radians to process	Input	Radians to process	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Operation result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					


### Note:

The symbol 

indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

■ TAN is used to calculate the tangent of the input parameter *In* and the result is output to *Out*.

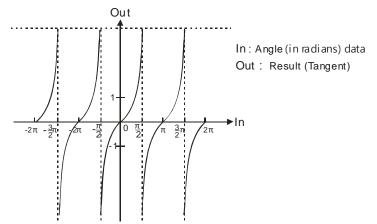

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

#### • Programming Example

The data types of variables TAN\_In and Out1 are INT and LREAL respectively. The value of Out1 is 0.648360827459087 if the value of TAN\_In is 10 when TAN\_EN changes to TRUE. The value of Out1 is -0.648360827459087 as TAN\_In is -10.

$\triangleright$	Variable 1	

Variable name	Data type	Current value
TAN_EN	BOOL	TRUE
TAN_In	INT	10
Out1	LREAL	0.648360827459087

Variable 2


Variable name	Data type	Current value				
TAN_EN	BOOL	TRUE				
TAN_In	INT	-10				
Out1	LREAL	-0.648360827459087				

The program

		TAN	1	
TAN_EN	ΕN	E١	١O	
TAN_In —	In	C	Dut	— Out1

# 8.9.15 ASIN

FB/FC	Explanation	Applicable model			
FC	ASIN is used to get the arc sine of a number and the result is output to Out.	AS524C-B			
FC	The unit of <i>Out</i> is radian.	A00240-D			

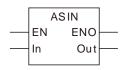

# • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range					
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to.					
Out	Operation result	Output	Operation result	-π/2 ~ π/2					


	Boolean		Bit s	tring		Integer						Renum	eal nber	Time, date				String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

# • Function Explanation

ASIN is used to calculate the arc sine of the input parameter *In* and the result is output to *Out*.

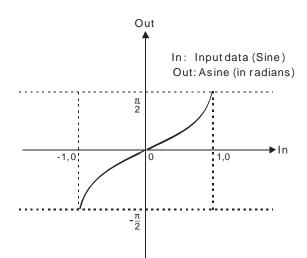


Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The value of *Out* varies between  $-\pi/2$  and  $\pi/2$  when the value of *In* changes between -1.0 and 1.0. The instruction will not go to the error state if the value of *In* is out of  $-1.0 \sim 1.0$  and the value of *Out* is nonnumeric as shown in the following table and program.

#### The variable table and program

Variable name	Data type	Current value
ASIN_EN	BOOL	TRUE
ASIN_In	REAL	2.0
Out1	LREAL	1.#QNAN

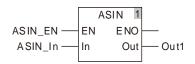

#### • Programming Example

The data types of variables ASIN\_In and Out1 are REAL and LREAL respectively. The value of Out1 is 1.5707963267949 if the value of ASIN\_In is 1.0 when ASIN\_EN changes to TRUE. The value of Out1 is -1.5707963267949 as ASIN\_In is -1.0.


#### Variable 1

Variable name	Data type	Current value
ASIN_EN	BOOL	TRUE
ASIN_In	REAL	1.0
Out1	LREAL	1.5707963267949

#### Variable 2

Variable name	Data type	Current value
ASIN_EN	BOOL	TRUE
ASIN_In	REAL	-1.0
Out1	LREAL	-1.5707963267949

## > The program

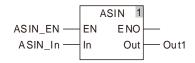

## 8.9.16 ACOS

FB/FC	Explanation	Applicable model
FC	ACOS is used to get the arc cosine of a number and the result is output to	AS524C-B
10	<i>Out</i> . The unit of <i>Out</i> is radian.	A00240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Operation result	0~π


	Boolean		Bit s	tring			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

ACOS is used to calculate the arc cosine of the input parameter *In* and the result is output to *Out*.

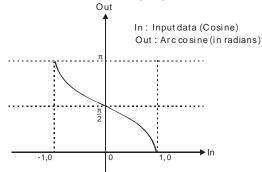

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The value of *Out* varies between 0 and  $\pi$  when the value of *In* changes between -1.0 and 1.0. The instruction will not go to the error state if the value of *In* is out of -1.0 ~1.0 and the value of *Out* is nonnumeric.

#### The variable table and program

Variable name	Data type	Current value
ACOS_EN	BOOL	TRUE
ACOS_In	REAL	2.0
Out1	LREAL	1.#QNAN



#### • Programming Example

The data types of variables ACOS\_In and Out1 are REAL and LREAL respectively. The value of Out1 is 0 if the value of ACOS\_In is 1.0 when ACOS\_EN changes to TRUE. The value of Out1 is 3.14159265358979 as ACOS\_In is -1.0.


#### > Variable

Variable name	Data type	Current value
ACOS_EN	BOOL	TRUE
ACOS_In	REAL	1.0
Out1	LREAL	0

> Variable

Variable name	Data type	Current value
ACOS_EN	BOOL	TRUE
ACOS_In	REAL	-1.0
Out1	LREAL	3.14159265358979

> The program

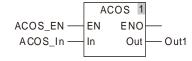

## 8.9.17 ATAN

FB/FC	Explanation	Applicable model
FC	ATAN is used to find the arc tangent of a number and the result is output to	AS524C-B
-	<i>Out</i> . The unit of <i>Out</i> is radian.	A00240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Number to process	Input	· ·	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Operation result	-π/2 ~ π/2


	Boolean		Bit string Integer									eal nber	Time, date				String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INL	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out																				

#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

ATAN is used to calculate the arc tangent of the input parameter *In* and the result is output to *Out*.

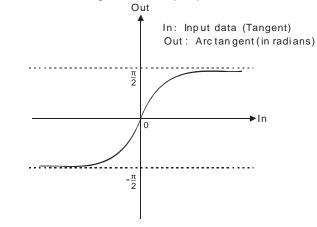

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The output value of *Out* is  $-\pi/2$  if the input value of *In* is  $-\infty$ . The output value of *Out* is  $\pi/2$  if the input value of *In* is  $+\infty$ .

#### • Programming Example

■ The data types of variables *ATAN\_In* and *Out1* are REAL and LREAL respectively. The value of *Out1* is 0.785398163397448 if the value of *ATAN\_In* is 1.0 when *ATAN\_EN* changes to TRUE. The value of *Out1* is -0.785398163397448 as *ATAN\_In* is -1.0.


Variable 1

Variable name	Data type	Current value				
ATAN_EN	BOOL	TRUE				
ATAN_In	REAL	1.0				
Out1	LREAL	0.785398163397448				

#### Variable 2

Variable name	Data type	Current value
ATAN_EN	BOOL	TRUE
ATAN_In	REAL	-1.0
Out1	LREAL	-0.785398163397448

> The program

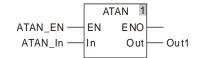

## 8.9.18 LN

FB/FC	Explanation	Applicable model
FC	LN is used to find the natural logarithm of a number and the result is output	AS524C-B
	to Out.	100240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Valid range				
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to.			
Out	Logarithm Output		The natural logarithm of In	Depends on the data type of the variable that the output parameter is connected to.			

	Boolean		Bit s	tring			Integer					Re num	eal nber		Time	date		String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Dut															•					


#### Note:

The symbol 

indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

■ LN is used to calculate the natural logarithm of the input parameter *In*, that is the logarithm with e (e=2.718282) as the base, and the result is output to *Out*.

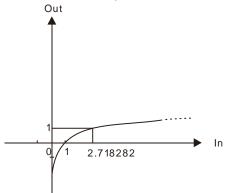


Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The output value of Out is nonnumeric when the input value of In is a non-positive number as shown in the following table.

The variable table and program

Variable name	/ariable name Data type						
LN_EN	BOOL	TRUE					
LN_In	REAL	-2.0					
Out1	LREAL	1.#QNAN					

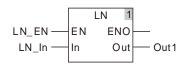

#### • Programming Example

The data types of variables LN\_In and Out1 are INT and LREAL respectively. The value of Out1 is 0.0 if the value of LN\_In is 1 when LN\_EN changes to TRUE. The value of Out1 is 1.00000005734143 as LN\_In is 2.718282.


> Variable 1

Variable name	Data type	Current value
LN_EN	BOOL	TRUE
LN_In	INT	1
Out1	LREAL	0.0

Variable 2

Variable name	Data type	Current value				
LN_EN	BOOL	TRUE				
LN_In	REAL	2.718282				
Out1	LREAL	1.0000005734143				

The program

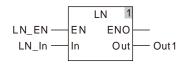

## 8.9.19 LOG

FB/FC	Explanation	Applicable model
FC	LOG is used to find the base-10 logarithm of a number and the result is	AS524C-B
	output to Out.	100240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range				
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to.				
Out	Logarithm	Output	The base-10 logarithm	Depends on the data type of the variable that the output parameter is connected to.				


		Boolean		Bit s	tring			Integer						Re num	eal nber		Time	date		String	
		BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
Ir	٦		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
O																•					

#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

LOG is used to calculate the base-10 logarithm of the input parameter *In* and the result is output to *Out*.

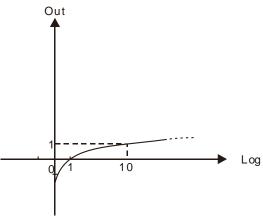


Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The output value of Out is a nonnumeric value when the input value of In is a non-positive number as shown in the following table.

#### The variable table and program

Variable name	Data type	Current value				
LOG_EN	BOOL	TRUE				
LOG_In	REAL	-2.0				
Out1	LREAL	1.#QNAN				

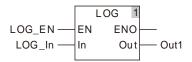

#### • Programming Example

- The data types of variables LOG\_In and Out1 are INT and LREAL respectively. The value of Out1 is 0.0 if the value of LOG\_In is 1 when LOG\_EN changes to TRUE. The value of Out1 is 1.0 as LOG\_In is 10.
  - > Variable 1

Variable name	Data type	Current value
LOG_EN	BOOL	TRUE
LOG_In	INT	1
Out1	LREAL	0.0

#### Variable 2

Variable name	Data type	Current value
LOG_EN	BOOL	TRUE
LOG_In	INT	10
Out1	LREAL	1.0

> The program

## 8.9.20 SQRT

FB/FC	Explanation	Applicable model
FC	SQRT is used to calculate the square root of a number and the result is	AS524C-B
FC	output to Out.	A00240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Number to process	Input	Number to process	Depends on the data type of the variable that the input parameter is connected to. And it is a non-negative number.
Out	Square root	Output	Square root	Depends on the data type of the variable that the output parameter is connected to. And it is a non-negative number.


	Boolean		Bit s	tring			Integer							Re num	eal nber	Time, date				String
	BOOL	вүте	WORD	DWORD	LWORD	USINT	USINT ULINT ULINT USINT							REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out																				

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

SQRT is used to calculate the square root of *In* and the result is output to *Out*.

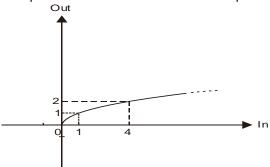


Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- The output value of Out is a nonnumeric value when the input value of In is a negative number.
  The variable table and program

Variable name	Data type	Current value
SQRT_EN	BOOL	TRUE
SQRT_In	REAL	-2.0
Out1	LREAL	1.#QNAN

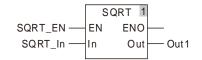

#### • Programming Example

The data types of variables SQRT\_In and Out1 are INT and LREAL respectively. The value of Out1 is 4.0 if the value of SQRT\_In is 16 when SQRT\_EN changes to TRUE. The value of Out1 is 10.0 as SQRT\_In is 100.


$\triangleright$	Variable	1
·	vanabio	•

Variable name	Data type	Current value
SQRT_EN	BOOL	TRUE
SQRT_In	INT	16
Out1	LREAL	4.0

#### Variable 2

Variable name	Data type	Current value
SQRT_EN	BOOL	TRUE
SQRT_In	INT	100
Out1	LREAL	10.0

The program

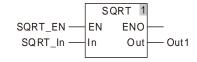

## 8.9.21 EXP

[	FB/FC	Explanation	Applicable model
	FC	EXP is used to perform the operation with e as the base number and <i>In</i> as	AS524C-B
		the exponent. The result is output to <i>Out</i> .	//00240 B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Exponent	Input	Exponent	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Operation result with the base number e and exponent <i>In</i>	Depends on the data type of the variable that the output parameter is connected to. And it is a non-negative number.


	Boolean		Bit s	tring			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	USINT UINT USINT						REAL	LREAL	TIME	DATE	TOD	DT	STRING	
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out																				

#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

■ EXP is used to perform the operation with e (e=2.718282) as the base number and *In* as the exponent. The result is output to *Out*.

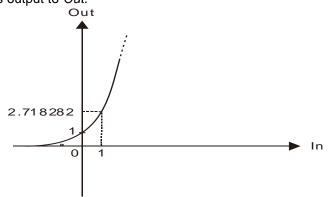

Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

- The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.
- When the value of *In* is  $0, +\infty, -\infty$  and a nonnumeric value, the corresponding output values of *Out* is listed in the following table.

In	Out
0	1.0
+∞	+∞
-∞	0.0
nonnumeric	nonnumeric

#### • Programming Example

The data types of EXP\_In and Out1 are INT and LREAL respectively. The value of Out1 is 1.0 if the value of EXP\_In is 0 when EXP\_EN changes to TRUE. And the value of Out1 is 2.71828182845905 as EXP\_In is 1.


$\succ$	Variable 1	

Variable name	Data type	Current value
EXP_EN	BOOL	TRUE
EXP_In	INT	0
Out1	LREAL	1.0

Variable 2


Variable name	Data type	Current value
EXP_EN	BOOL	TRUE
EXP_In	INT	1
Out1	LREAL	2.71828182845905

> The program

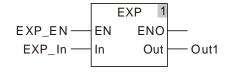

## 8.9.22 EXPT

FB/FC	Explanation	Applicable model
FC	EXPT is used to perform the exponentiation operation with <i>In</i> as the base	AS524C-B
	number and <i>Pwr</i> as the exponent. The result is output to <i>Out</i> .	A00240 B

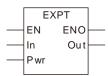

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range			
In	Base number	Input	Base number	Depends on the data type of the variable that the input parameter is connected to.			
Pwr	Exponent	Input	Exponent	Depends on the data type of the variable that the input parameter is connected to.			
Out	Calculation result	Output	Operation result with <i>In</i> as the base number and <i>Pwr as</i> the exponent	Depends on the data type of the variable that the output parameter is connected to.			

	Boolean	Bit string Integer								Real number		Time, date				String				
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Pwr		•	•	•	•	•	•	•	•	•	•	•	•	•	•					
Out															•					

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### Function Explanation

- EXPT is used to perform the exponentiation operation with *In* as the base number and *Pwr* as the exponent. And the result is output to *Out*.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

#### • Programming Example

The data types of variables EXPT\_In and EXPT\_Pwr are both INT with their respective values 10 and 2. The data type of Out1 is LREAL. Then the value of Out1 is 100.0 when EXPT\_EN changes to TRUE. The value of Out1 is 100.0 as the values of EXPT\_In and EXPT\_Pwr are -10 and 2 respectively.


#### Variable 1

Variable name	Data type	Current value
EXPT_EN	BOOL	TRUE
EXPT_In	INT	10
EXPT_Pwr	INT	2
Out1	LREAL	100.0

#### Variable 2

Variable name	Data type	Current value
EXPT_EN	BOOL	TRUE
EXPT_In	INT	-10
EXPT_Pwr	INT	2
Out1	LREAL	100.0


> The program

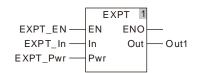

8

## 8.9.23 RAND

FB/FC	Explanation	Applicable model
FC	RAND is used to generate a random number.	AS524C-B

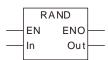

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Reserved	Input	Reserved	Depends on the data type of the variable that the input parameter is connected to.
Out	Random number	Output	Random number	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring					Inte	ger				Re num	eal Iber		Time	date	1	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
ln1								•												
Out												•								

#### Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### Function Explanation

- RAND is used to generate a random number and the result is output to Out, within the range 0<sup>~</sup>32767.
- The input value does not have any effect on the random number to generate. But the value must be input for *In*.
- To get the random number within a specific range, users just need perform the MOD calculation over the generated value and get the remainder. For example, the random number between 0 and10 can be generated by writing the program RAND(0) MOD10.


#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

## • Programming Example

A random number is generated by writing RAND(0) as below. The variable table and program

Variable name	Data type	Current value		
RAND_EN	BOOL	TRUE		
RAND_In	INT	0		
Out1	DINT	256		

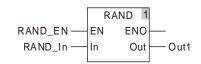

## 8.9.24 TRUNC

FB/FC	Explanation	Applicable model
FC	TRUNC is used to get the integral part of a real number.	AS524C-B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range			
In	Real number to convert	Input	Real number whose integer part is got	Depends on the data type of the variable that the input parameter is connected to.			
Out	Conversion result	Output	Integral part of a real number	Depends on the data type of the variable that the output parameter is connected to.			

	Boolean		Bit s	tring					Inte	ger				Re num			Time,	date		String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In														•	•					
Out													•							

#### Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- TRUNC is used to get the integral part of a real number and the result is output to *Out*.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is only LINT. An error will occur during the compiling of the software if the data type of the output parameter is not LINT.

#### Precautions for Correct Use


The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

#### • Programming Example

The data type of TRUNC \_In is REAL with the value -5.6. The data type of Out1 is LINT. Then the value of Out1 is -5 when TRUNC \_EN changes to TRUE. And the value of Out1 is 10 as the values of TRUNC \_In 10.8.

Variable 1		
Variable name	Data type	Current value
TRUNC_EN	BOOL	TRUE
TRUNC _In	REAL	-5.6
Out1	LINT	-5
Variable 2		
Variable name	Data type	Current value
TRUNC_EN	BOOL	TRUE
TRUNC _In	REAL	10.8
Out1	LINT	10

> The program

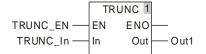

## 8.9.25 FLOOR

FB/FC	Explanation	Applicable model
FC	FLOOR is used to get the integral part of a real number. The output value is the integral part of the real number subtracted by 1 if the input real number is a negative number.	AS524C-B



#### Parameters

Parameter name	Meaning	Input/ Output	Valid range			
In	Real number to convert	Input	Real number whose integer part is got	Depends on the data type of the variable that the input parameter is connected to.		
Out	Conversion result Output		Integer part of a real number	Depends on the data type of the variable that the output parameter is connected to.		

	Boolean		Bit s	tring					Inte	ger				Re num	eal 1ber		Time	, date	9	String
	BOOL	ВҮТЕ	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In														•	•					
Out													•							

#### Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### Function Explanation

- FLOOR is used to get the integral part of a real number and the result is output to *Out*. The output value is the integral part of the real number if the input real number is a positive number. For example, the output value is 3 if the input value is 3.5. The output value is the integral part of the real number subtracted by 1 if the input real number is a negative number. For example, the output value is -3.5.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LINT. An error will occur during the compiling of the software if the data type of the output parameter is not LINT.

#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

#### • Programming Example

■ The data type of variable *FLOOR\_In* is REAL with the value 5.6. The data type of *Out1* is LINT. Then the value of *Out1* is 5 when *FLOOR\_EN* changes to TRUE. And the value of *Out1* is -11 as the values of *FLOOR\_In* -10.2.

Variable name	Data type	Current value
FLOOR_EN	BOOL	TRUE
FLOOR _In	REAL	5.6
Out1	LINT	5

Variable name	Data type	Current value
FLOOR_EN	BOOL	TRUE
FLOOR _In	REAL	-10.2
Out1	LINT	-11


> The program



8

## 8.9.26 FRACTION

FB/FC	Explana	Applicable model	
FC	FRACTION is used to get the fraction pa	rt of a real number.	AS524C-B
	17 19	RACTION N ENO	

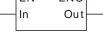

#### Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range		
In	Real number to convert	Input	Real number whose fraction part is got	Depends on the data type of the variable that the input parameter is connected to.		
Out	Conversion result	Output	Fraction part of a real number	Depends on the data type of the variable that the output parameter is connected to.		

	Boolean		Bit s	tring			Integer							Renum	eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In														•	•					
Out																				

#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- FRACTION is used to get the fraction part of a real number and the result is output to *Out*. The sign of the result value should be the same as that of the input value.
- Users can choose different data types for the input parameter in this instruction. But the data type of the output parameter is restricted to LREAL. An error will occur during the compiling of the software if the data type of the output parameter is not LREAL.

#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

#### • Programming Example

The data type of variable FRACTION\_In is REAL with the value -5.6. The data type of Out1 is LREAL. Then the value of Out1 is -0.6 when FRACTION\_EN changes to TRUE. And the value of Out1 is 0.8 as the values of FRACTION\_In 10.8.


#### Variable 1

Variable name	Data type	Current value
FRACTION_EN	BOOL	TRUE
FRACTION _In	REAL	-5.6
Out1	LREAL	-0.6

Variable 2

Variable name	Data type	Current value			
FRACTION_EN	BOOL	TRUE			
FRACTION _In	REAL	10.8			
Out1	LREAL	0.8			

> The program

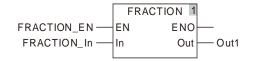


8

## 8.10 Bit String Instructions

## 8.10.1 AND

FB/FC	Explanation	Applicable model
FC	AND is used for performing a logical AND operation of two or more variables or constants.	AS524C-B

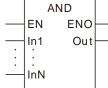

#### • Parameters

Parameter name	Meaning	Meaning Input/ Output Description Va						
In1 to InN	Operands	Input	The number of operands can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.				
Out	Operation result	Output	AND operation result of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.				

	Boolean		Bit s	string			Integer						Real Time, date				)	String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•		•	•	•	•	•	•											
Out	•	•	•	•	•	•		•	•											

Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.


#### • Function Explanation

AND is used for performing a bitwise logical AND operation of two or more variables or constants and the result is output to Out. That is Out = In1 & In2 &...& InN

8

The operational rule:


The corresponding bit of the output variable is TRUE when corresponding bits of input variables are all TRUE as shown below. Otherwise, the corresponding bit of the output variable is FALSE.

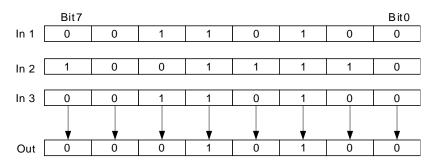

In1~InN are allowed to be the variables of different data types when none of the data types of input variables are BOOL.

When *In1* to *InN* are the variables of different data types, take the data type which can include all ranges of the values of *In1~InN* for the operation.

For example, if the data type of In1 is BYTE and In2 is WORD, the data type of Out is WORD. In operation, the value of In1 is converted from BYTE to WORD as shown in the following figure. Bit8~ Bit 15 are complemented and their values are all 0. And then the logical AND of the bit values of In1 and In2 is conducted as below.

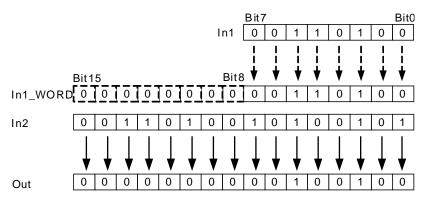

If the data type of an input variable is BOOL, the data types of all input and output variables are required to be BOOL. Otherwise, an error will occur in the compiling of the software.

#### • Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.

#### Programming Example

The data types of AND\_In1, AND\_In2 and Out1 are all BYTE. The values of AND\_In1 and AND\_In2 are 10 and 50 respectively and the value of Out1 is 2 when AND\_EN is TRUE.

#### > The variable table and program


Variable name	Data type	Current value
AND_EN	BOOL	TRUE
AND_In1	BYTE	10
AND_In2	BYTE	50
Out1	BYTE	2

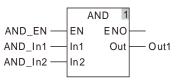

The data types of AND\_In1, AND\_In2 and Out1 are BYTE, WORD and WORD respectively. The values of AND\_In1 and AND\_In2 are 255 and 256 respectively and the value of Out1 is 0 when AND\_EN is TRUE.


#### > The variable table and program

Variable name	Data type	Current value
AND_EN	BOOL	TRUE
AND_In1	BYTE	255
AND_In2	WORD	256
Out1	WORD	0

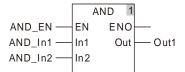

## 8.10.2 OR

FB/FC	Explanation	Applicable model
FC	OR is used for performing a logical OR operation of two or more variables or constants.	AS524C-B

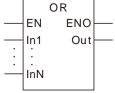

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Operand	Input	The number of operands can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	OR operation result of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit	string					Inte	eger					eal nber		Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•	•											
Out	•	•		•	•	•	•	•	•											

Note:


The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

OR is used for performing a bitwise logical OR operation of two or more variables or constants and the result is output to Out. That is Out= In1 OR In2 OR...OR InN.

#### The operational rule:


When corresponding bits of all input variables are all FALSE, the corresponding bit of the output variable is FALSE. Otherwise, the corresponding bit of the output variable is TRUE.

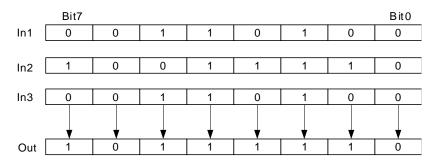

■ *In1~InN* are allowed to be the variables of different data types when none of the data types of input variables are BOOL.

When *In1* to *InN* are the variables of different data types, take the data type which can include all ranges of the values of *In1~InN* for the operation.

For example, if the data type of *In1* is BYTE and *In2* is WORD, the data type of *Out* is WORD. In operation, the value of *In1* is converted from BYTE to WORD as shown in the following figure. Bit8~ Bit 15 are complemented and their values are all 0. And then the logical OR of the bit values of *In1* and *In2* is conducted as below.

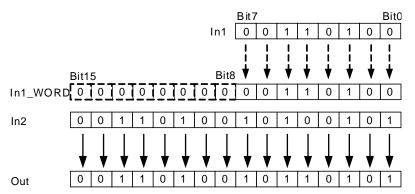

If the data type of an input variable is BOOL, the data types of all input and output variables are required to be BOOL. Otherwise, an error will occur in the compiling of the software.

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.


## Programming Example

 $\triangleright$ 

The data types of OR\_In1, OR\_In2 and Out1 are all BYTE. The values of OR\_In1 and OR\_In2 are 10 and 50 respectively and the value of Out1 is 58 when OR\_EN is TRUE.

#### The variable table and program


Variable name	Data type	Current value				
OR_EN	BOOL	TRUE				
OR_In1	BYTE	10				
OR_In2	BYTE	50				
Out1	BYTE	58				

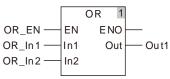

The data types of OR\_In1, OR\_In2 and Out1 are BYTE, WORD and WORD respectively. The values of OR\_In1 and OR\_In2 are 255 and 256 respectively and the value of Out1 is 511 when OR\_EN is TRUE.


#### > The variable table and program

Variable name	Data type	Current value
OR_EN	BOOL	TRUE
OR_In1	BYTE	255
OR_In2	WORD	256
Out1	WORD	511

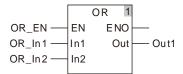

## 8.10.3 NOT

FB/FC	Explanation	Applicable model
FC	NOT is used for the NOT operation taking the inverse of a variable or constant.	AS524C-B

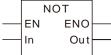

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Operand	Input	Input parameter to take the inverse	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Not operation result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit string				Integer				eal nber		Time	, date	9	String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	ULINT ULINT ULINT		REAL	LREAL	TIME	DATE	TOD	DT	STRING			
In		•	•	•		•	•	•	•									
Out			•			•			•									


#### Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- NOT is used for the bitwise NOT operation taking the inverse of the value of a variable or constant and the result is output to *Out*.
  - The operational rule:

If one bit of the input variable is TRUE, the corresponding bit of the output variable is FALSE. If one bit of the input variable is FALSE, the corresponding bit of the output variable is TRUE.

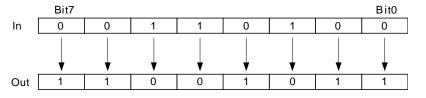

The data type of *Out* must be the same as *In*.

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.

# Programming Example

The data types of NOT \_In and Out1 are both BYTE. The value of In1 is 10 and the value of Out1 is 245 when NOT\_EN is TRUE.


## > The variable table and program

Variable name	Data type	Current value
NOT_EN	BOOL	TRUE
NOT _In	BYTE	10
Out1	BYTE	245
	NOT 1	



## 8.10.4 XOR

FB/FC	Explanation	Applicable model
FC	XOR is used for the XOR operation of two or more variables or constants.	AS524C-B
	EN ENO	

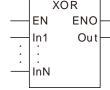

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range		
In1 to InN	Operand	Input	The number of operands can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.		
Out	Operation result	Output	XOR operation result of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.		

	Boolean		Bit string				Integer				eal nber		Time	, date	9	String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UUNT ULINT ULINT				REAL	LREAL	TIME	DATE	TOD	DT	STRING		
In1 to InN	•	•	•	•	•	•	•	•	•										
Out	•	•	•		•	•	•	•	•										


#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation


XOR is used for the bitwise XOR operation of two or more variables or constants and the result is output to *Out*. That is *Out*= *In1* XOR *In2* XOR...XOR *InN*.

The operational rule for XOR of In1 and In2 is shown in the following figure.

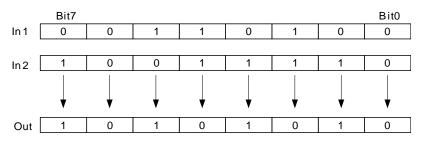

■ The steps for XOR operation when more than 2 input parameters exist are:


The XOR result of In1 and In2 is got first; then the XOR operation of the previous result and In3 is conducted and so on. Finally, the XOR operation of the previous XOR result and InN is processed. The XOR result of In1 and In2 is Out\_Temp and the XOR result of Out\_Temp and In3 is Out as shown below.

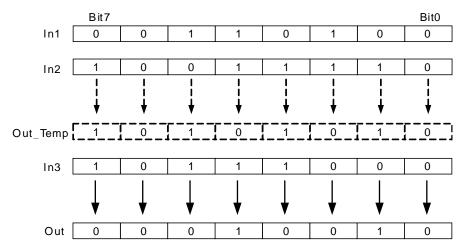

■ *In1~InN* are allowed to be the variables of different data types when none of the data types of input variables are BOOL.

When *In1* to *InN* are the variables of different data types, take the data type which can include all ranges of the values of *In1~InN* for the XOR operation.

For example, if the data type of *In1* is BYTE and *In2* is WORD, the data type of *Out* is WORD. In operation, the value of *In1* is converted from BYTE to WORD as shown in the following figure. (Bit8~ Bit 15 are supplemented and their values are all 0.) And then the logical XOR of the bit values of *In1* and *In2* is conducted as below.

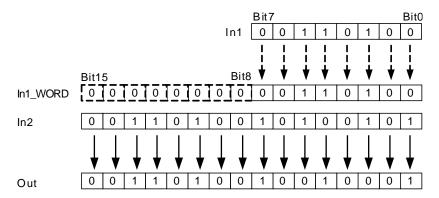

If the data type of an input variable is BOOL, the data types of all input and output variables are required to be BOOL. Otherwise, an error will occur in the compiling of the software.

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.

## Programming Example

The data types of XOR\_In1, XOR\_In2 and Out1 are all BYTE. The values of XOR\_In1 and XOR\_In2 are 10 and 50 and the value of Out1 is 56 when XOR\_EN is TRUE as shown in Variable 1.

The data types of XOR\_In1, XOR\_In2 and Out1 are BYTE, WORD and WORD. The values of XOR\_In1 and XOR\_In2 are 255 and 256 and the value of Out1 is 511 when XOR\_EN is TRUE as shown in Variable 2.


#### > Variable 1

Variable name	Data type	Current value
XOR_EN	BOOL	TRUE
XOR _In1	BYTE	10
XOR _In2	BYTE	50
Out1	BYTE	56

### > Variable 2

Variable name	Data type	Current value
XOR_EN	BOOL	TRUE
XOR_In1	BYTE	255
XOR_In2	WORD	256
Out1	WORD	511

#### > The program

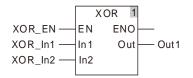

## 8.10.5 XORN

FB/FC	Explanation	Applicable model
FC	XORN is used for an XORN operation of two or more variables or constants.	AS524C-B
	EN ENO In1 Out	

InN

#### **Parameters**

Parameter name	Meaning	Input/ Output	Valid range			
In1 to InN	Operand	Input	The number of operands can be increased or decreased through the programming software. Maximum: 8. Minimum: 2. That is N=2 ~ 8.	Depends on the data type of the variable that the input parameter is connected to.		
Out	Operatio n result	Output	XORN operation result of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.		

	Boolean	Bit string					Integer								Real number		Time, date			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•			•	•	•	•												
Out	•	•	•	•	•		•	•	•											


#### Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### Function Explanation


XORN is used for a bitwise XORN of two or more variables or constants and the result is output to Out. That is Out= In1 XORN In2 XORN...XORN InN.

The operational rule for XORN of In1 and In2 is shown in the following figure.

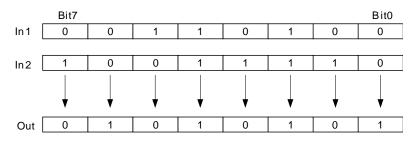

The steps for XORN operation is for when more than 2 input parameters exist: 


The XORN result of In1 and In2 is got first; then the XORN of the previous result and In3 is conducted and so on. Finally, the XORN of the previous XORN result and InN is processed. The XORN result of In1 and In2 is Out\_Temp and the XORN result of Out\_Temp and In3 is Out as shown below.

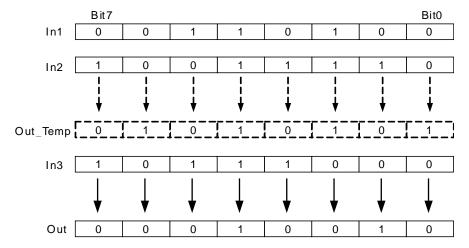

In1~InN are allowed to be the variables of different data types when none of the data types of input variables are BOOL.

When *In1* to *InN* are the variables of different data types, take the data type which can include all ranges of the values of  $In1 \sim InN$  for the operation.

For example, if the data type of *In1* is BYTE and *In2* is WORD, the data type of *Out* is WORD. In operation, the value of *In1* is converted from BYTE to WORD as shown in the following figure. (Bit8~ Bit 15 are supplemented and their values are all 0.) And then the logical XORN of the bit values of *In1* and *In2* is conducted as below.

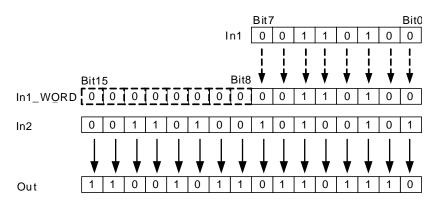

If the data type of an input variable is BOOL, the data types of all input and output variables are required to be BOOL. Otherwise, an error will occur in the compiling of the software.

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.

#### Programming Example

The data types of XORN\_In1, XORN\_In2 and Out1 are all BYTE. The values of XORN\_In1 and XORN\_In2 are 10 and 50 and the value of Out1 is 199 when XORN\_EN is TRUE as shown in Variable 1.

The data types of XORN\_In1, XORN\_In2 and Out1 are BYTE, WORD and WORD. The values of XORN\_In1 and XORN\_In2 are 255 and 256 and the value of Out1 is 65535 when XORN \_EN is TRUE as shown in Variable 2.


### > Variable 1

Variable name	Data type	Current value
XORN_EN	BOOL	TRUE
XORN _In1	BYTE	10
XORN _In2	BYTE	50
Out1	BYTE	199

## > Variable 2

Variable name	Data type	Current value
XORN _EN	BOOL	TRUE
XORN _In1	BYTE	255
XORN _In2	WORD	256
Out1	WORD	65535


## > The program

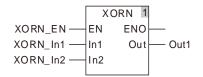

# 8.11 Shift Instructions

# 8.11.1 SHL

FB/FC	Explanation	Applicable model
FC	SHL is used to shift all bits of a variable or constant by the specified number of bits to the left and the result is output to Out.	AS524C-B

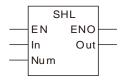

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to shift	Input	The original data to shift to the left	Depends on the data type of the variable that the input parameter is connected to.
Num	Number to shift	Input	The number of bits by which all bits of the original data are shifted to the left	Depends on the data type of the variable that the input parameter is connected to.
Out	Result	Output	Result from shifting all bits of the original data by the number of bits specified by Num to the left	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit	string	)		Integer			Real number		Time, date			String					
	BOOL	RYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In			•	•		•	•	•	•											
Num						•														
Out		The data type of <i>Out</i> must be the same as <i>In</i> .																		


## Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

SHL is used to shift all bits of the value of *In* by the number of bits specified by *Num* to the left and the result is output to *Out*.

When *Num*=2, all bits of the value of *In* are shifted by two bits to the left and the values of Bit0~Bit1 are supplemented with 0 and Bit6~Bit7 are discarded as shown in the following figure.

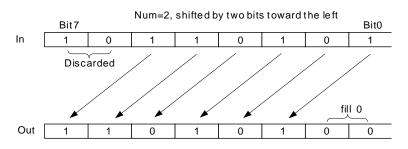

#### • Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The value of *Out* is the same as *In* when the value of *Num* is 0.

# Programming Example


The data types of SHL\_In and SHL\_Num are UINT and USINT respectively and their values are 300 and 3 respectively. The data type of Out1 is BYTE and the value of Out1 is 2400 when SHL\_EN is TRUE.

#### > The variable table and program

Variable name	Data type	Current value
SHL_EN	BOOL	TRUE
SHL_In	UINT	300
SHL_Num	USINT	3
Out1	UINT	2400

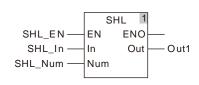


#### Illustration of the example

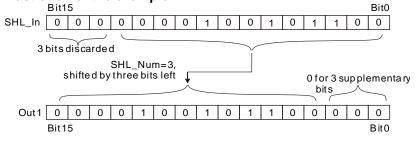


# 8.11.2 SHR

FB/FC	Explanation	Applicable model
FC	SHR is used to shift all bits of a variable or constant by the specified number of bits to the right and the result is output to <i>Out</i> .	AS524C-B
	SHR	

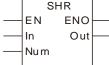

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to shift	Input	The original data to shift to the right	Depends on the data type of the variable that the input parameter is connected to.
Num	Number to shift	Input	The number of bits by which the bits of the original data are shifted to the right	Depends on the data type of the variable that the input parameter is connected to.
Out	Result	Output	Result from shifting all bits of the original data by the number of bits specified by Num to the right	Depends on the data type of the variable that the output parameter is connected to.

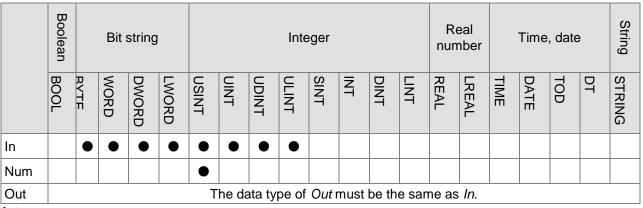


## Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

SHR is used to shift all bits of the value of *In* by the number of bits specified by *Num* to the right and the result is output to *Out*.

When *Num*=2, all bits of the value of *In* are shifted by two bits to the right and Bit0~Bit1 of *In* are discarded and the value of Bit6~Bit7 are supplemented with 0 as shown in the following figure.

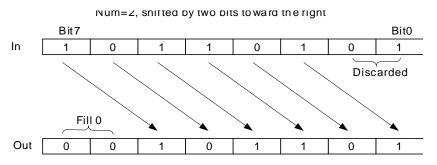

#### Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- When the value of Num is 0, the value of *Out* is the same as *In*.

# Programming Example


The data types of SHR\_In and SHR\_Num are UINT and USINT respectively and their values are 300 and 3 respectively. The data type of Out1 is UINT and the value of Out1 is 37 when SHR\_EN is TRUE.

#### > The variable table and program

Variable name	Data type	Current value
SHR_EN	BOOL	TRUE
SHR_In	UINT	300
SHR_Num	USINT	3
Out1	UINT	37

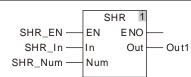

#### > Illustration of the example

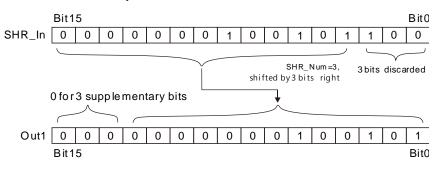


# 8.11.3 ROL

FB/FC	Explanation	Applicable model
FC	ROL is used to rotate left all bits of a variable or constant by the specified number of bits and the result is output to <i>Out</i> .	AS524C-B
	ROL	



### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to rotate	Input	The original data to rotate left	Depends on the data type of the variable that the input parameter is connected to.
Num	Number of bits	Input	The number of bits by which the bits of the original data are rotated to the left	Depends on the data type of the variable that the input parameter is connected to.
Out	Result	Output	Result from rotating all bits of the original data by the number of bits specified by Num to the left	Depends on the data type of the variable that the output parameter is connected to.

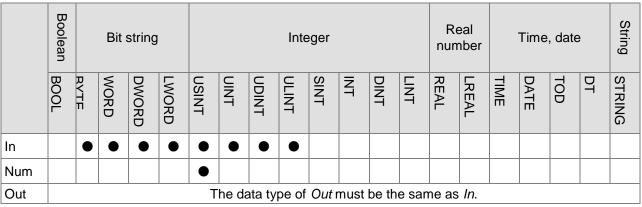


## Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

ROL is used to rotate all bits of the value of *In* by the number of bits specified by *Num* to the left and the result is output to *Out*.

Via ROL, the bits shifted out of the left will shift to the null bits in the right one by one. When *Num*=2, all bits of the value of *In* rotates by two bits to the left. The rotation method is that Bit0~Bit5 are shifted to Bit2~Bit7 respectively, Bit 7 is shifted to Bit1 and Bit 6 is shifted to Bit0.

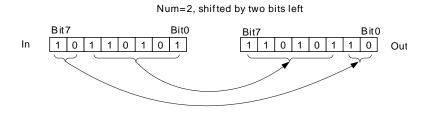

#### • Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The value of *Out* is the same as *In* when the value of *Num* is 0.
- The number of bits by which the bits of original data are rotated left is equal to the value of Num MOD In when the value of *Num* is greater than the number of bits of the value of *In*. For example, if the data type of *In* is BYTE, the value of *out* when Num=USINT#1 is the same for when Num=USINT#9.

# Programming Example


The data types of ROL\_In and ROL\_Num are UINT and USINT respectively and their values are 300 and 3 respectively. The data type of Out1 is BYTE and the value of Out1 is 2400 when ROL\_EN is TRUE.

#### > The variable table and program

Variable name	Data type	Current value
ROL_EN	BOOL	TRUE
ROL_In	UINT	300
ROL_Num	USINT	3
Out1	UINT	2400

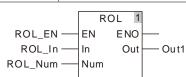


#### > Illustration of the example

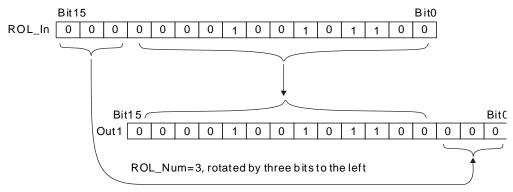

## 8.11.4 ROR

FB/FC	Explanation	Applicable model
FC	ROR is used to rotate all bits of a variable or constant by the specified number of bits to the right and the result is output to <i>Out</i> .	AS524C-B
	ROR	

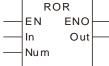

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to rotate	Input	The original data to rotate to the right	Depends on the data type of the variable that the input parameter is connected to.
Num	hits		The number of bits by which the bits of data are rotated to the right	Depends on the data type of the variable that the input parameter is connected to.
Out	Result	Output	Result from rotating all bits of the original data by the number of bits specified by Num to the right	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit	string	3				Inte	eger			eal nber		String					
	BOOL	RVTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In		•	•	•				•	•											
Num																				
Out		The data type of <i>Out</i> must be the same as <i>In</i> .																		


## Note:

The symbol 
indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

ROR is used to rotate all bits of the value of *In* by the number of bits specified by *Num* to the right and the result is output to *Out*.

Via ROR, the bits shifted out of the right will shift to the null bits in the left one by one. When *Num*=2, all bits of the value of *In* rotates by two bits to the right. The rotation method is that Bit2~Bit7 are shifted to Bit0~Bit5 respectively, Bit0 is shifted to Bit6 and Bit1 is shifted to Bit7.

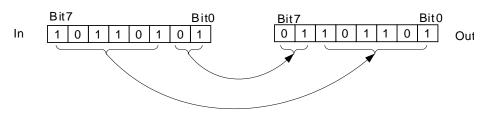

Num=2, shifted by two bits right

#### Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted. But the output variable is allowed to omit.
- The value of *Out* is the same as *In* when the value of *Num* is 0.
- The number of bits by which the bits of data are rotated to the right is equal to the value of Num MOD In when the value of *Num* is greater than the number of bits of the value of *In*. For example, if the data type of *In* is BYTE, the value of *out* when Num=USINT#1 is the same for when Num=USINT#9.

#### Programming Example


The data types of ROR\_In and ROR\_Num are UINT and USINT respectively and their values are 300 and 3 respectively. The data type of Out1 is BYTE and the value of Out1 is 32805 when ROR\_EN is TRUE.

#### > The variable table and program

Variable name	Data type	Current value
ROR_EN	BOOL	TRUE
ROR_In	UINT	300
ROR_Num	USINT	3
Out1	UINT	32805

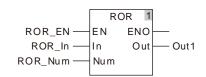

#### Illustration of the example

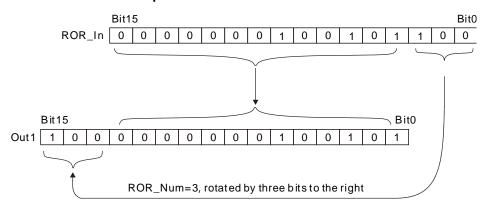

# 8.12 Selection Instructions

# 8.12.1 MAX

FB/FC	Explanation	Applicable model
FC	Max is used for finding the largest value of two or more variables or constants.	AS524C-B



#### • Parameters

Parameter name	Meaning Input/ Output Description		Description	Valid range
In1 to InN	Comparison data	Input	The comparison data can be added or removed while the program is being written. The maximum number of comparison data is 8. N=2~8	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	The largest value of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string											eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•
Out						•	•							•						

#### N

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

The Max instruction finds the largest value of two or more variables or constants and the largest value is output to Out.

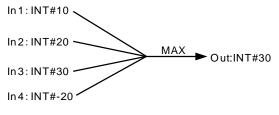

- When the data types of input variables are not BOOL, TIME, DATE, TOD or STRING, the input parameters *In1~InN* are allowed to be the variables of different data types.
- When the data types of input variables are one of BOOL, TIME, DATE, TOD and STRING, all the input variables and output variable should be of the data type. For example, if the data type of *In1* is TIME, the data type of *In2~InN* must be TIME. Otherwise, an error will occur during the compiling of the software.

#### • Precautions for Correct Use


- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- The length of the data type of the output variable must contain the length of all input parameters. Otherwise, an error will occur during the compiling of the software

# Programming Example

The data types of MAX\_In1, MAX\_In2 and MAX\_In3 are INT, UINT and DINT respectively. The data type of Out1 is DINT. If the values of MAX\_In1, MAX\_In2 and MAX\_In3 are -10, 50 and 100 respectively, the value of Out1 is 100 when MAX\_EN is TRUE.

Variable name	Data type	Current value
MAX_EN	BOOL	TRUE
MAX_In1	INT	- 10
MAX_In2	UINT	50
MAX_In3	DINT	100
Out1	DINT	100


#### > The variable table and program

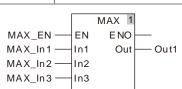

The data types of MAX\_In1 and MAX\_In2 are TIME. The data type of Out1 is TIME. If the values of MAX\_In1 and MAX\_In2 are T#1ms and T#50ms respectively, the value of Out1 is T#50ms when MAX\_EN is TRUE.

#### > The variable table and program


Data type	Current value
BOOL	TRUE
TIME	T#1ms
TIME	T#50ms
TIME	T#50ms
	BOOL TIME TIME

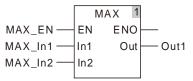

8

## 8.12.2 MIN

FB/FC	Explanation	Applicable model
FC	MIN is used for finding the smallest value of two or more variables or constants.	AS524C-B

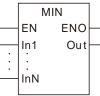

#### • Parameters


Parameter name	Meaning	Meaning Input/ Output Description		Valid range
In1 to InN	Comparison data	Input	The comparison data can be added or removed while the program is being written. The maximum number of comparison data is 8. N=2~8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Comparison result	Output	The smallest value of In1 ~ InN	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•
Out Note:	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•		•

# 8

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type. **Function Explanation** 

The MIN instruction finds the smallest value of two or more variables and constants and the smallest value is output to Out.

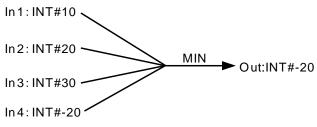

- When the data types of input variables are not BOOL, TIME, DATE, TOD or STRING, the input parameters In1~InN are allowed to be the variables of different data types.
- When the data types of input variables are one of BOOL, TIME, DATE, TOD and STRING, all the input variables and output variable should be of the data type. For example, if the data type of In1 is TIME, the data type of In2~InN must be TIME. Otherwise, an error will occur during the compiling of the software.

#### **Precautions for Correct Use**

- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- The length of the data type of the output variable must contain the length of all input parameters. Otherwise, an error will occur during the compiling of the software.




# Programming Example

The data types of MIN\_In1, MIN\_In2 and MIN\_In3 are INT, UINT and DINT respectively. The data type of Out1 is DINT. If the values of MIN\_In1, MIN\_In2 and MIN\_In3 are -10, 50 and 100 respectively, the value of Out1 is -10 when MIN\_EN is TRUE.

Variable name	Data type	Current value
MIN_EN	BOOL	TRUE
MIN_In1	INT	- 10
MIN_In2	UINT	50
MIN_In3	DINT	100
Out1	DINT	- 10


#### The variable table and program $\triangleright$

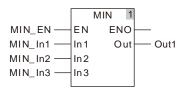

The data types of MIN In1 and MIN In2 are TIME. The data type of Out1 is TIME. If the values of MIN In1 and MIN In2 are T#1ms and T#50ms respectively, the value of Out1 is T#1ms when MIN EN is TRUE.

#### The variable table and program $\triangleright$

Variable name	Data type	Current value				
MIN_EN	BOOL	TRUE				
MIN_In1	TIME	T#1ms				
MIN_In2	TIME	T#50ms				
Out1	TIME	T#1ms				

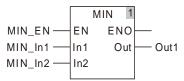

# 8.12.3 SEL

FB/FC	Explanation	Applicable model
FC	SEL is used for selecting one of two variables or constants and the selected value is output to <i>Out</i> .	AS524C-B
	SEI .	



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
G	Gate	Input	In0 is selected when G is FALSE; In1 is selected when G is TRUE.	Depends on the data type of the variable that the input parameter is connected to.
In0 and In1	Selections	Input	Data to be selected	Depends on the data type of the variable that the input parameter is connected to.
Out	Dut Selection Outp		Selection result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string			Integer							eal nber		Time	, date	e	String	
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
G	•																			
In0 and In1	•	•	•	•	•	•	•	•	•		•	•	•	•	•	•		•	•	•
Out	•	•	•	•	•	•	•		•	•	•			•	•	•	•	•	•	•

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

According to the selection condition G, the SEL instruction selects one of two variables or constants and the selection result is output to *Out*.

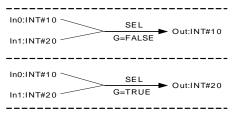

- When the data types of input variables are not BOOL, TIME, DATE, TOD or STRING, the input parameters *In0~In1* are allowed to connect the variables of different data types.
- When the data types of input variables are one of BOOL, TIME, DATE, TOD and STRING, all the input variables and output variable should be of the data type. For example, if the data type of the variable connected to *In0* is TIME, the data types of the variables connected to *In1* and *Out* must be TIME. Otherwise, an error will occur during the compiling of the software.

#### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- The length of the data type of the output variable must contain the length of the variables that the input parameters *In0* and *In1* connect. Otherwise, an error will occur during the compiling of the software.

## Rogramming Example

The data types of SEL\_G, SEL\_In0 and SEL\_In1 are BOOL, UINT and DINT and the data type of Out1 is DINT. When SEL\_EN is TRUE, the value of Out1 is 50 if the values of SEL\_G, SEL\_In0 and SEL\_In1 are FALSE, 50 and 100 respectively as shown in the following table Variable 1. If the values of SEL\_G, SEL\_In0 and SEL\_In1 are TRUE, 50 and 100 respectively, the value of Out1 is 100 as shown in the following table Variable 2.


#### > Variable 1

Variable name	Data type	Current value
SEL_EN	BOOL	TRUE
SEL_G	BOOL	FALSE
SEL_In0	UINT	50
SEL_In1	DINT	100
Out1	DINT	50

#### > Variable 2


Variable name	Data type	Current value
SEL_EN	BOOL	TRUE
SEL_G	BOOL	TRUE
SEL_In0	UINT	50
SEL_In1	DINT	100
Out1	DINT	100

#### The program

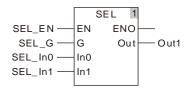

## 8.12.4 MUX

FB/FC	Explanation	Applicable model						
FC	FC MUX is used for selecting one of two or more variables or constants and the result is output to <i>Out</i> .							
	MUX							

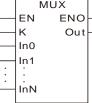

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range			
к	Gate	Input	Gate	Depends on the data type of the variable that the input parameter is connected to.			
In0, In1 to InN	Selections	Input	The selections can be added or removed while the program is being written. The maximum number of selections is 8. N=2~8.	Depends on the data type of the variable that the input parameter is connected to.			
Out	Selection result	Output	Selection result	Depends on the data type of the variable that the output parameter is connected to.			

	Boolean		Bit string Integer Real number					Integer						Time, date				String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
к																				
In0, In1																				
to InN																				
Out			•	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

Based on the selection condition K, the MUX instruction selects one of  $InO \sim InN$  and the selection result is output to *Out*. The value of *Out* corresponds to the value of K as shown in the following table.

The value of K	The value of Out
0	In0
1	In1
2	ln2
3	In3
4	In4
5	ln5
6	In6
7	In7

- When the data types of input variables are not BOOL, TIME, DATE, TOD or STRING, the input parameters In0~InN are allowed to connect the variables of different data types.
- When the data types of input variables are one of BOOL, TIME, DATE, TOD and STRING, all the input variables and output variable should be of the data type. For example, if the data type of In0 is TIME, the data types of the variables connected to In1~InN and Out must be TIME. Otherwise, an error will occur during the compiling of the software.

#### **Precautions for Correct Use**

- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- The length of the data type of the output variable must contain the length of the variables that the input parameters In0 ~ InN connect. Otherwise, an error will occur during the compiling of the software.



# Programming Example

The data types of MUX\_K, MUX\_In0 and MUX\_In1 are UINT, UINT and DINT and the data type of Out1 is DINT. When MUX\_EN is TRUE, the value of Out1 is 50 if the values of MUX\_K, MUX\_In0 and MUX In1 are 0, 50 and 100 as shown in the following table Variable 1. If the values of MUX K, MUX\_In0 and MUX\_In1 are 1, 50 and 100, the value of Out1 is 100 as shown in the following table Variable 2.


#### Variable 1 $\triangleright$

Variable name	Data type	Current value				
MUX_EN	BOOL	TRUE				
MUX_K	USINT	0				
MUX_In0	UINT	50				
MUX_In1	DINT	100				
Out1	DINT	50				

#### Variable 2


Variable name	Data type	Current value				
MUX_EN	BOOL	TRUE				
MUX_K	UINT	1				
MUX_In0	UINT	50				
MUX_In1	DINT	100				
Out1	DINT	100				

#### The program

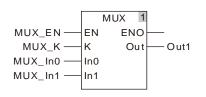

## 8.12.5 LIMIT

FB/FC	Explanation Applicable mo								
	LIMIT is used for limiting the output value within the zone between the specified minimum and maximum values.	AS524C-B							

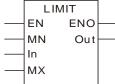

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
MN	Minimum value	Input	Minimum value	Depends on the data type of the variable that the input parameter is connected to.
In	Data to limit	Input	Data to limit	Depends on the data type of the variable that the input parameter is connected to.
мх	Maximum value	Input	Maximum value	Depends on the data type of the variable that the input parameter is connected to.
Out	Processing result	Output	Processing result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string			Integ										eal nber		Time	, date	e	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING		
MN		•	•	•	•		•	•	•		•	•	•	•	•							
In		•	•				•	•	•		•	•	•		•							
MX		•		•	•		$\bullet  \bullet  \bullet  \bullet  \bullet  \bullet  \bullet  \bullet  \bullet  \bullet $															
Out																						

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

## • Function Explanation

LIMIT instruction limits the value within range between MN and MX and the result is output to *Out*.

The value of In	The value of Out
In < MN	MN
$MN\leqslantIn\leqslant\!MX$	In
MX < In	MX

- The instruction allows input parameters MN, In and MX to connect the variables of different data types. When MN, In and MX are the variables of different data types, the calculation is performed with the data type which can contain the range of the values of MN, In and MX. For example, if the data type of MN is INT and the data types of In and MX are DINT, the data type of Out is DINT.
- The instruction allows the input parameters and the output parameter to connect the variables of different data types. But the length of the data type of the output variable must contain the length of the variables that the input parameters InO ~ InN connect. Otherwise, an error will occur during the compiling of the software.

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

# Programming Example

The data types of LIMIT\_MN, LIMIT\_In and LIMIT\_MX are UINT, UINT and DINT and the data type of Out1 is DINT. When LIMIT\_EN is TRUE, the value of Out1 is 50 if the values of LIMIT\_MN, LIMIT\_In and LIMIT\_MX are 1, 50 and 100 as shown in the following table Variable 1. If the values of LIMIT\_MN, LIMIT\_MN, LIMIT\_In and LIMIT\_MX are 2, 200 and 100, the value of Out1 is 100 as shown in the following table Variable 2. If the values of LIMIT\_MN, LIMIT\_In and LIMIT\_MX are 50, 10 and 100, the value of Out1 is 50 as shown in the following table Variable 3.

#### > Variable 1

Variable name	Data type	Current value			
LIMIT_EN	BOOL	TRUE			
LIMIT_MN	UINT	1			
LIMIT_In	UINT	50			
LIMIT_MX	DINT	100			
Out1	DINT	50			


#### > Variable 2

Variable name	Data type	Current value				
LIMIT_EN	BOOL	TRUE				
LIMIT_MN	UINT	2				
LIMIT_In	UINT	200				
LIMIT_MX	DINT	100				
Out1	DINT	100				

#### > Variable 3


Variable name	Data type	Current value				
LIMIT_EN	BOOL	TRUE				
LIMIT_MN	UINT	50				
LIMIT_In	UINT	10				
LIMIT_MX	DINT	100				
Out1	DINT	50				

#### > The program

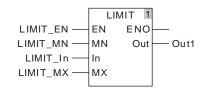

## 8.12.6 BAND

FB/FC	Explanation	Applicable model
FC	BAND performs the deadband control and the processing result is output to <i>Out</i> .	AS524C-B
	RAND	

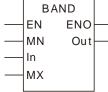

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
MN	Minimum value	Input	Minimum value	Depends on the data type of the variable that the input parameter is connected to.
In	Data to limit	Input	Data to limit	Depends on the data type of the variable that the input parameter is connected to.
мх	Maximum value	Input	Maximum value	Depends on the data type of the variable that the input parameter is connected to.
Out	Processing result	Output	Processing result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string			Integer				eal nber		Time	, date	9	String				
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
MN														•	•					
In														•	•					
MX															•					
Out														•	•					

## Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The BAND instruction performs the dead band control of the value of *In* according to the maximum value, *MX* and the minimum value, *MN* and the processing result is output to *Out*.

The value of In	The value of Out
In < MN	In - MN
MN ≤In ≤MX	0
MX < In	In - MX

- The instruction allows input parameters *MN*, *In* and *MX* to connect the variables of different data types. When *MN*, *In* and *MX* are the variables of different data types, the calculation is performed with the data type which can contain the range of the values of *MN*, *In* and *MX*. For example, if the data type of *MN* is REAL and the data types of *In* and *MX* are LREAL, the data type of *Out* is LREAL.
- The instruction allows the input parameters and the output parameter to connect the variables of different data types. But the length of the data type of the output variable must contain the length of the variables that the input parameters connect. Otherwise, an error will occur during the compiling of the software.

#### • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- When the value of *MN* is greater than that of *MX*, the instruction will still be executed normally and the value of *Out* will be equal to that of *MX*.

# Programming Example

The data types of BAND\_MN, BAND\_In and BAND\_MX are REAL and the data type of Out1 is LREAL. When BAND\_EN is TRUE, the value of Out1 is 0 if the values of BAND\_MN, BAND\_In and BAND\_MX are 1, 50 and 100 as shown in the following table Variable 1. If the values of BAND\_MN, BAND\_In and BAND\_MX are 2, 250 and 100, the value of Out1 is 150 (150=250-100) as shown in the following table Variable 2. If the values of BAND\_MN, BAND\_In and BAND\_MX are 50, 10 and 100, the value of Out1 is - 40 (- 40 = 10 - 50) as shown in the following table Variable 3.

#### Variable 1

Variable name	Data type	Current value
BAND_EN	BOOL	TRUE
BAND_MN	REAL	1
BAND_In	REAL	50
BAND_MX	REAL	100
Out1	LREAL	0

#### Variable 2


Variable name	Data type	Current value
BAND_EN	BOOL	TRUE
BAND_MN	REAL	2
BAND_In	REAL	250
BAND_MX	REAL	100
Out1	LREAL	150

#### Variable 3

Variable name	Data type	Current value
BAND_EN	BOOL	TRUE
BAND_MN	REAL	50


Variable name	Data type	Current value
BAND_In	REAL	10
BAND_MX	REAL	100
Out1	LREAL	-40

## > The program

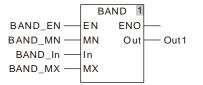

# 8.12.7 ZONE

FB/FC	Explanation	Applicable model
FC	ZONE is used for adding a bias value to the input value and the processing result is output to <i>Out</i> .	AS524C-B
	ZONE	

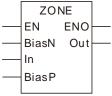

### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
BiasN	Negative bias value	Input	Negative bias	Depends on the data type of the variable that the input parameter is connected to.
In	Data to control	Input	Data to control	Depends on the data type of the variable that the input parameter is connected to.
BiasP	Positive bias value	Input	Positive bias	Depends on the data type of the variable that the input parameter is connected to.
Out	Processing result	Output	Processing result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
Bias N														•	•					
In																				
Bias P														•	•					
Out															•					

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The ZONE instruction adds the set bias value to the value of *In* and the processing result is output to *Out*. When the value of *In* is a negative value, *BiasN* is the bias value. When the value of *In* is a positive value, *BiasP* is the bias value.

The value of In	The value of Out
In<0	In+BiasN
In=0	0
In>0	In+BiasP

- The instruction allows input parameters *BiasN*, *In* and *BiasP* to connect the variables of different data types. When *BiasN*, *In* and *BiasP* are the variables of different data types, the calculation is performed with the data type which can contain the range of the values of *BiasN*, *In* and *BiasP*. For example, if the data type of *BiasN* is INT and the data types of *In* and *BiasP* are DINT, the data type of *Out* is DINT.
- The instruction allows the input parameters and the output parameter to connect the variables of different data types. But the length of the data type of the output variable must contain the length of the variables that the input parameters connect. Otherwise, an error will occur during the compiling of the software.

## • Precautions for Correct Use

- The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.
- When the value of *BiasN* is larger than *BiasP*, the instruction will still be executed normally.

# Programming Example

The data types of ZONE\_BiasN, ZONE\_In and ZONE\_BiasP are INT, INT and DINT and the data type of Out1 is DINT. When ZONE\_EN is TRUE, the value of Out1 is 0 if the values of ZONE\_BiasN, ZONE\_In and ZONE\_BiasP are 1, 0 and 100 as shown in the following table Variable 1. If the values of ZONE\_BiasN, ZONE\_In and ZONE\_BiasN, ZONE\_In and ZONE\_BiasP are 2, 50 and 100, the value of Out1 is 150 (150 = 50 + 100) as shown in the following table Variable 2. If the values of ZONE\_BiasN, ZONE\_BiasP are 50, -10 and 100, the value of Out1 is 40 (40 = - 10 + 50) as shown in the following table Variable 3.

#### > Variable 1

Variable name	Data type	Current value
ZONE_EN	BOOL	TRUE
ZONE_BiasN	INT	1
ZONE_In	INT	0
ZONE_BiasP	DINT	100
Out1	DINT	0

#### > Variable 2


Variable name	Data type	Current value
ZONE_EN	BOOL	TRUE
ZONE_BiasN	INT	2
ZONE_In	INT	50
ZONE_BiasP	DINT	100
Out1	DINT	150

#### Variable 3

Variable name	Data type	Current value
ZONE_EN	BOOL	TRUE
ZONE_BiasN	INT	50

Variable name	Data type	Current value
ZONE_In	INT	- 10
ZONE_BiasP	DINT	100
Out1	DINT	40


# > The program

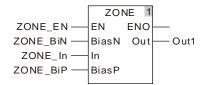

# 8.13 Data Type Conversion Instructions

# 8.13.1 BOOL\_TO\_\*\*\*

FB/FC	Explanation	Applicable model
FC	BOOL_TO_*** instructions convert boolean data into the data of basic data types. "***" can be any basic data type.	AS524C-B

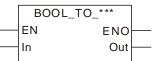

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string			Integer							eal nber	Time, date				String	
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In																				
Out			The data type of <i>Out</i> must be the same as "***" of the instruction name.																	


#### Note:

8

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

### • Function Explanation

- BOOL to Bit String
  - Relevant instructions:

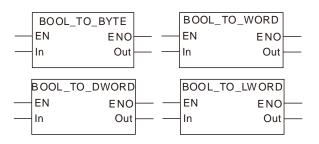


The rule for the conversion from Boolean to Bit-String is shown in the following table. (The format of the bit-string value and the hexadecimal expression are to be confirmed.)

Boolean		Bit String										
Boolean	BYTE	WORD	DWORD	LWORD								
FALSE	16#00	16#0000	16#0000_0000	16#0000_0000_0000_0000								
TRUE	16#01	16#0001	16#0000_0001	16#0000_0000_0000_0001								

## BOOL to Integer

Relevant instructions:

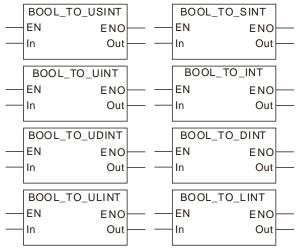


> The rule that Boolean data are converted into Integer data is as the following table shows.

Boolean		Integer													
	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT							
FALSE	0	0	0	0	0	0	0	0							
TRUE	1	1	1	1	1	1	1	1							

#### BOOL to Real number

Relevant instructions:

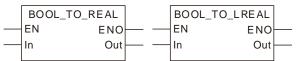


The rule that Boolean data are converted into Real-number data is as the following table shows.

Boolean	F	Real
Boolean	REAL	LREAL
FALSE	0	0
TRUE	1	1

#### BOOL to Time and Date

Relevant instructions:

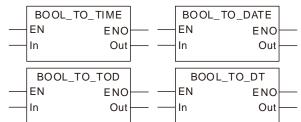

The rule that Boolean data are converted into Time or Date data is as the following table shows.

Boolean	Time and Date										
	TIME	DATE	TOD	DT							
FALSE	T#0ms	D#1970-1-1	TOD#	DT#							
TRUE	T#1ms	D#1970-1-1	TOD#	DT#							

#### BOOL to String

Relevant instructions:



The rule that Boolean data are converted into String data is as the following table shows. (The string format is to be confirmed.)

Boolean	String
Boolean	STRING
FALSE	'FALSE'
TRUE	'TRUE'

#### Precautions for Correct Use

The input variables are not allowed to omit. If the input variables are omitted, an error will occur during the compiling of the software. The output variable is allowed to omit.

# 8.13.2 Bit strings\_TO\_\*\*\*

FB/FC	Explanation	Applicable model
FC	Bit strings_TO_*** instructions convert bit-string data into the data of basic data types. "***" can be any basic data type.	AS524C-B



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string			Integer								eal nber	,	Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	ULINT ULINT ULINT						REAL	LREAL	TIME	DATE	TOD	DT	STRING	
In		•	•	•	•															
Out				The	data	type (	of Ou	<i>t</i> mus	st be	the sa	ame a	as "**	*" of t	he in	struc	tion r	ame	•		

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

## • Function Explanation

- Bit string to BOOL
  - Relevant instructions:

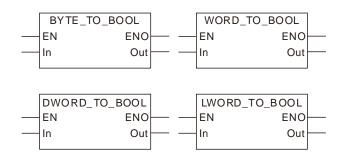

8\_

Data t	уре	The value of <i>In</i> corresponds to the value of <i>Out</i>							
In	Out	In	Out						
BYTE	BOOL	16#00	FALSE						
DIIC	BUUL	16#01~16#FF	TRUE						
WORD	BOOL	16#0000	FALSE						
WORD		16#0001~16#FFFF	TRUE						
DWORD		16#0000_0000	FALSE						
DWORD	BOOL	16#0000_0001~16#FFFF_FFF	TRUE						
		16#0000_0000_0000	FALSE						
LWORD	BOOL	16#0000_0000_00001~ 16#FFFF_FFFF_FFFFF	TRUE						

> The rule that Bit-string data are converted into Boolean data is as the following table shows.

### Bit string to Bit string


Bit-string data can be converted to Bit-string data. And some instructions are shown below.

BYTE_TO_W	ORD		WORD_TO	_BYTE	
 EN	ENO	<u> </u>	 EN	ENO	<u> </u>
 In	Out	<u> </u>	 In	Out	<u> </u>
DWORD_TO_V	VORD		LWORD_TC	BYTE	
 EN	ENO		 EN	ENO	
 In	Out		 In	Out	

There are two kinds of conversion for different types of bit-string data. One is the conversion of the less-length data to the greater-length data. The other is the conversion of the greater-length data to the less-length data.


The less-length data is converted to the greater-length data by writing the values of all bits of the less-length data to corresponding bits of the greater-length data and setting the values of the remaining bits of the greater-length data to 0.

See the following example that the Byte data in *In* is converted to the Word data in *Out*. The values of Bit0~Bit7 of *In* are copied and pasted to Bit0~Bit7 of *Out*. And the values of Bit8~Bit15 of *Out* are set to 0.

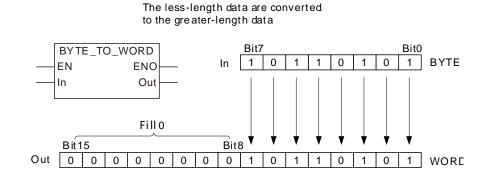

The greater-length data are converted to the less-length data by revising the values of all bits of the less-length data into the values of the corresponding bits of the greater-length data and the values of the remaining bits of the greater-length data are not converted and have no impact on the conversion.

See the following example that the Word data *In* is converted to the Byte data *Out*. The values of Bit0~Bit7 of *In* are copied and pasted to Bit0~Bit7 of *Out*. And the values of Bit8~Bit15 of *In* are not converted and have no impact on the conversion.

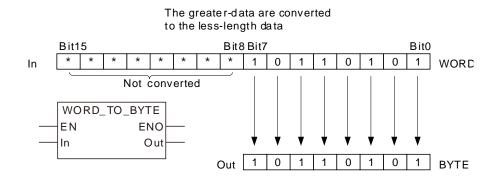


> The Bit-string data are converted into the Bit-string data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In	Out	In	Out	
	WORD	16#00~16#FF	16#0000~16#00FF	
BYTE	DWORD	16#00~16#FF	16#0000_0000~16#0000_00FF	
DITE	LWORD	16#00~16#FF	16#0000_0000_0000~ 16#0000_0000_0000_00FF	
	BYTE	16#**00~16#**FF	16#00~16#FF	
WORD	DWORD	16#0000~16#FFFF	16#0000_0000~16#0000_FFFF	
	LWORD	16#0000~16#FFFF	16#0000_0000_0000_0000~ 16#0000_0000_0000_FFFF	
	BYTE	16#****_**00~16#****_**FF	16#00~16#FF	
DWORD	WORD	16#****_0000~16#****_FFFF	16#0000~16#FFFF	
DWORD	LWORD	16#0000_0000~16#FFFF_FFF	16#0000_0000_0000_0000~ 16#0000_0000_FFFF_FFFF	
	BYTE	16#****_****_****_**00~ 16#****_****_***FF	16#00~16#FF	
LWORD	WORD	16#****_****_****_0000~ 16#****_****_****_FFFF	16#0000~16#FFFF	
	DWORD	16#****_****_0000_0000~ 16#****_****_FFFF_FFF	16#0000_0000~16#FFFF_FFF	

#### Bit string to Integer

The Bit-string data can be converted to the Integer data. And some instructions are shown below.

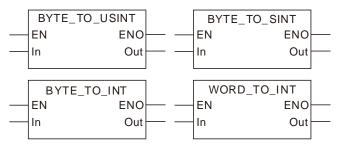

The rule for the conversion of bit-string data into integer data is consistent with that for the conversion of bit-string data into bit-string data.

The less-length data is converted to the greater-length data by writing the values of all bits of the less-length data to corresponding bits of the greater-length data and setting the values of the remaining bits of the greater-length data to 0.

The greater-length data is converted to the less-length data by revising the values of all bits of the less-length data into the values of the corresponding bits of the greater-length data and the values of the remaining bits of the greater-length data are not converted and have no impact on the conversion.

If the lengths of the two data to convert are equal, all values of all bits of *In* are copied and pasted to the corresponding bits of *Out*.


Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In Out		In	Out	
	USINT	16#00~16#FF	0~255	
	UINT	16#00~16#FF	0~255	
	UDINT	16#00~16#FF	0~255	
	ULINT	16#00~16#FF	0~255	
BYTE	OINIT	16#00~16#7F	0~127	
	SINT	16#80~16#FF	-128~-1	
	INT	16#00~16#FF	0~255	
	DINT	16#00~16#FF	0~255	
	LINT	16#00~16#FF	0~255	
	USINT	16#**00~16#**FF	0~255	
	UINT	16#0000~16#FFFF	0~65535	
	UDINT	16#0000~16#FFFF	0~65535	
	ULINT	16#0000~16#FFFF	0~65535	
	OINIT	16#**00~16#**7F	0~127	
WORD	SINT	16#**80~16#**FF	-128~-1	
	INT	16#0000~16#7FFF	0~32767	
		16#8000~16#FFFF	-32768~-1	
	DINT	16#0000~16#FFFF	0~65535	
	LINT	16#0000~16#FFFF	0~65535	
	USINT	16#****_**00~16#****_**FF	0~255	
	UINT	16#****_0000~16#****_FFFF	0~65535	
	UDINT	16#0000_0000~16#FFFF_FFF F	0~4294967295	
	ULINT	16#0000_0000~16#FFFF_FFF F	0~4294967295	
	SINT	16#****_**00~16#****_**7F	0~127	
DWORD	SINT	16#****_**80~16#****_**FF	-128~-1	
DWORD		16#****_0000~16#****_7FFF	0~32767	
	INT	16#****_8000~16#****_FFFF	-32768~-1	
	DINT	16#0000_0000~16#7FFF_FFF F	0~2147483647	
	DINT	16#8000_0000~16#FFFF_FFF F	-2147483648~-1	
	LINT	16#0000_0000~16#FFFF_FFF	0~4294967295	

> The Bit-string data are converted into the Integer data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In	Out	In	Out	
	USINT	16#****_*****_*****_**00~ 16#****_****_****_**FF	0~255	
	UINT	16#****_*****_*****_0000~ 16#****_*****_FFFF	0~65535	
	UDINT	16#****_****_0000_0000~ 16#****_****_FFFF_FFFF	0~4294967295	
	ULINT	16#0000_0000_0000_0000~ 16# FFFF_FFFF_FFFF_FFFF	0~18446744073709551645	
	SINT	16#****_*****_***00~ 16#****_****_***7F	0~127	
LWORD		16#****_*****_***80~ 16#****_****_***FF	-128~-1	
LWORD	INT	16#****_****_****_0000~ 16#****_****_****_7FFF	0~32767	
		16#****_*****_*****_8000~ 16#****_****_*****_FFFF	-32768~-1	
	DINT	16#****_****_0000_0000~ 16#****_****_7FFF_FFF	0~2147483647	
		16#****_****_8000_0000~ 16#***_*****_FFFF_FFFF	-2147483648~-1	
	LINT	16#0000_0000_0000_0000~ 16#7FFF_FFFF_FFFF_FFFF	0~9223372036854775807	
		16#8000_0000_0000_0000~ 16#FFFF_FFF_FFF_FFF	-9223372036854775808~0	

## Bit string to Real number

The Bit-string data can be converted to the Real-number data. And some instructions are shown below.

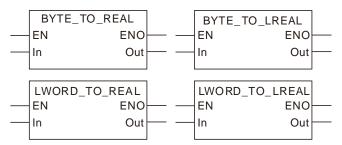


> The Bit-string data are converted into the Real-number data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In	Out	In	Out	
	REAL	16#00~16#FF	0~2.55e+2	
BYTE	LREAL	16#00~16#FF	0~2.55e+2	
WORD	REAL	16#0000~16#FFFF	0~6.5535e+4	
WORD	LREAL	16#0000~16#FFFF	0~6.5535e+4	
DWORD	REAL	16#0000_0000~ 16#FFFF_FFF	0~4.294967e+9	
		16#0000_0000~ 16#FFFF_FFF	0~4.294967295e+9	

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In Out In		Out		
	REAL	16#0000_0000_0000_0000~ 16#FFFF_FFFF_FFFF_FFFF	0~1.844674e+19	
LWORD	LREAL	16#0000_0000_0000_0000~ 16#FFFF_FFFF_FFFFFFFFFFFF	0~1.84467440737095e+19	

#### Bit string to Time and Date

The Bit-string data can be converted to the Time or Date data. And some instructions are shown below.

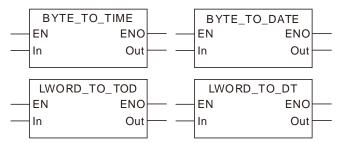

The rule for the conversion of Bit-string data into Time or Date data is the same as that for the conversion of the Bit-string data into unsigned integer data.


> The Bit-string data are converted into the Time and Date data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In	Out	In	Out	
	TIME	16#00~16#FF	T#0ns~T#255ns	
	DATE	16#00~16#FF	D#1970-1-1	
BYTE	TOD	16#00~16#FF	TOD#0:0:0~ TOD#0:0:0.255	
	DT	16#00~16#FF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-0:4:15	
	TIME	16#0000~16#FFFF	T#0ns~T#65us535ns	
	DATE	16#0000~16#FFFF	D#1970-1-1	
WORD	TOD	16#0000~16#FFFF	TOD#0:0:0~ TOD#0:1:5.535	
	DT	16#0000~16#FFFF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-18:12:15	
	TIME	16#0000_0000~16#FFFF_FFF	T#0ns~ T#4s294ms967us295ns	
	DATE	16#0000_0000~16#FFFF_FFF	D#1970-1-1~D#2016-2-7	
	TOD	16#0000_0000~16#0526_5BFF		
DWORD		16#0526_5C00~16#0A4C_B7FF	TOD#0:0:0~ TOD#23:59:59.999	
		16#FC57_9C00~16#FFFF_FFF	TOD#0:0:0~ TOD#17:2:47.295	
	DT	16#0000_0000~16#FFFF_FFF	DT#1970-1-1-0:0:0~ DT#2016- 2-7-6:28:15	
	TIME	16#0000_0000_0000_0000~ 16# FFFF_FFFF_FFFF_FFFF	T#213503d23h34m33s709ms5 51us615ns	
LWORD	DATE	16#****_****_0000_0000~ 16#****_****_FFFF_FFFF	D#1970-1-1~D#2016-2-7	
	TOD	16#****_****_0000_0000~ 16#****_****_0A4C_B7FF	TOD#0:0:0~ TOD#23:59:59.999	
		16#****_****_0526_5C00~		

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In Out		In	Out	
		16#****_****_0A4C_B7FF		
		16#****_****_0000_0000~	TOD#0:0:0~ TOD#17:2:47.29	
		16#****_****_FFFF_FFF	100#0.0.0~ 100#11.2.47.295	
	DT		DT#1970-1-1-0:0:0~ DT#2016- 2-7-6:28:15	

## Bit string to String

The Bit-string data can be converted to the String data. And some instructions are shown below.

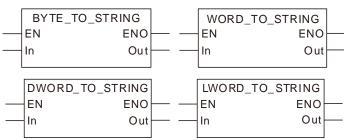

> The Bit-string data are converted into the String data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>		
In	Out	In	Out	
BYTE	STRING	16#00~16#FF	'00'~'FF'	
WORD	STRING	16#0000~16#FFFF	'0000'~'FFFF'	
DWORD	STRING	16#0000_0000~16#FFFF_FFF	'00000000'~'FFFFFFF	
LWORD	STRING		·0000000000000000'~	
		16# FFFF_FFFF_FFF_FFF	'FFFFFFFFFFFFFFFFF	


When the Bit-string data are converted to the String data, the length of the output String data must meet the length of the input parameter. For example, during the use of the BYTE\_TO\_STRING instruction, the output String data must contain more than 2 characters. Otherwise, an error will occur during the compiling of the software.

#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

## 8.13.3 Integers\_TO\_\*\*\*

FB/FC	Explanation	Applicable model
FC	Integers_TO_*** instructions convert integers into the data of basic data types. "***" can be any basic data type.	AS524C-B

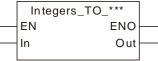

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	9	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In						•	•	•	•	•	•	•	•							
Out	The data type of <i>Out</i> must be the same as "***" of the instruction name.																			

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- Integer to BOOL
  - > Some instructions are shown below.

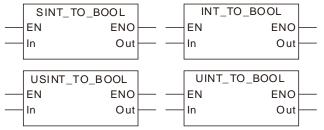


The Integer data are converted into the Boolean data as the following table shows. If the Integer value is 0, the conversion result is FALSE. If not 0, the result is TRUE. For details on the conversion rule, see the table as follows.

Data	type	The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out		
USINT	BOOL	0	FALSE		
03111	BOOL	1~255	TRUE		
UINT	BOOL	0	FALSE		
UINT	BOOL	1~65535	TRUE		
UDINT	BOOL	0	FALSE		
UDINT	BOOL	1~4294967295	TRUE		
ULINT	BOOL	0	FALSE		
ULINI	BOOL	1~18446744073709551645	TRUE		
SINT	BOOL	0	FALSE		
SINT		-128~-1, 1~127	TRUE		
INT	BOOL	0	FALSE		
	BOOL	-32768~-1, 1~32767	TRUE		
DINT	BOOL	0	FALSE		
DINT	BOOL	-2147483648~-1, 1~2147483647	TRUE		
		0	FALSE		
LINT	BOOL	-9223372036854775808~-1, 1~9223372036854775807	TRUE		

#### Integer to Bit string

The Integer data can be converted to the Bit-string data. And some instructions are shown below.

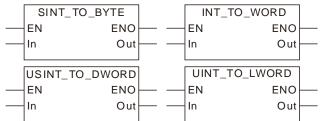

The rule for the conversion of the Integer data into the Bit-string data is the same as that for the conversion of the Bit-string data into the Bit-string data. Refer to section 8.13.2 for details.


> The Integer data are converted into the Bit-string data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out		
	BYTE	16#00~16#FF	16#00~16#FF		
	WORD	16#00~16#FF	16#0000~16#00FF		
USINT	DWORD	16#00~16#FF	16#0000_0000~16#0000_00FF		
	LWORD	16#00~16#FF	16#0000_0000_0000~		
			16#0000_0000_000FF		
	BYTE	16#**00~16#**FF	16#00~16#FF		
	WORD	16#0000~16#FFFF	16#0000~16#FFFF		
UINT	DWORD	16#0000~16#FFFF	16#0000_0000~16#0000_FFFF		
	LWORD	16#0000~16#FFFF	16#0000_0000_0000~		
	LWORD		16#0000_0000_0000_FFFF		

Data type		The value of <i>In</i> corres	The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out			
	BYTE	16#****_**00~16#****_**FF	16#00~16#FF			
	WORD	16#****_0000~16#****_FFFF	16#0000~16#FFFF			
UDINT	DWORD	16#0000_0000~16#FFFF_FFF	16#0000_0000~16#FFFF_FFF			
	LWORD	16#0000_0000~16#FFFF_FFF	16#0000_0000_0000~ 16#0000_0000_FFFF_FFF			
	BYTE	16#****_****_****_**00~ 16#****_****_***	16#00~16#FF			
	WORD	16#****_****_****_0000~ 16#****_****_****_FFFF	16#0000~16#FFFF			
ULINT	DWORD	16#****_****_0000_0000~ 16#****_****_FFFF_FFFF	16#0000_0000~16#FFFF_FFF			
	LWORD	16#0000_0000_0000_0000~ 16#FFFF_FFF_FFF_FFF	16#0000_0000_0000_0000~ 16#FFFF_FFF_FFFF_FFFF			
	BYTE	16#00~16#FF	16#00~16#FF			
	WORD	16#00~16#FF	16#0000~16#00FF			
SINT	DWORD	16#00~16#FF	16#0000_0000~16#0000_00FF			
	LWORD	16#00~16#FF	16#0000_0000_0000_0000~ 16#0000_0000_0000_00FF			
	BYTE	16#**00~16#**FF				
	WORD	16#0000~16#FFFF	16#0000~16#FFFF			
INT	DWORD	16#0000~16#FFFF	16#0000_0000~16#0000_FFFF			
	LWORD	16#0000~16#FFFF	16#0000_0000_0000_0000~ 16#0000_0000_0000_FFFF			
	BYTE	16#****_**00~16#****_**FF	16#00~16#FF			
	WORD	16#****_0000~16#****_FFFF	16#0000~16#FFFF			
DINT	DWORD	16#0000_0000~16#FFFF_FFF	16#0000_0000~16#FFFF_FFF			
	LWORD	16#0000_0000~16#FFFF_FFF	16#0000_0000_0000~ 16#0000_0000_FFFF_FFF			
	BYTE	16#****_****_****_**00~ 16#****_****_****_**FF	16#00~16#FF			
	WORD	16#****_****_****_0000~ 16#****_****_****_FFFF	16#0000~16#FFFF			
LINT	DWORD	16#****_****_0000_0000~ 16#****_****_FFFF_FFFF	16#0000_0000~16#FFFF_FFF			
	LWORD	16#0000_0000_0000_0000~ 16#FFFF_FFF_FFF_FFF	16#0000_0000_0000_0000~ 16#FFFF_FFF_FFFF_FFFF			

#### Integer to Integer

The Integer data can be converted to the Integer data. And some instructions are shown below.

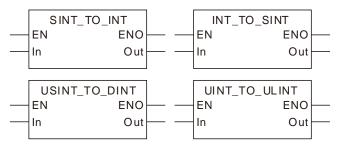

- 1. The rule for the conversion of the Integer data into the Integer data is the same as that for the conversion of the Bit-string data into the Bit-string data.
- 2. The less-length data are converted to the greater-length data by writing the values of all bits of the less-length data to corresponding bits of the greater-length data and setting the values of the remaining bits of the greater-length data to 0.
- 3. The data of greater length is converted to the data of less length by revising the values of all bits of the less-length data into the values of the corresponding bits of the greater-length data and the values of the remaining bits of the greater-length data are not converted and have no impact on the conversion.
- 4. If the lengths of the two data to convert are equal, all values of all bits of *In* are copied and pasted to the corresponding bits of *Out*.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out		
	USINT	16#00~16#FF	0~255		
	UINT	16#00~16#FF	0~255		
	UDINT	16#00~16#FF	0~255		
	ULINT	16#00~16#FF	0~255		
USINT	OINIT	16#00~16#7F	0~127		
	SINT	16#80~16#FF	- 128~ - 1		
	INT	16#00~16#FF	0~255		
	DINT	16#00~16#FF	0~255		
	LINT	16#00~16#FF	0~255		
	USINT	16#**00~16#**FF	0~255		
	UINT	16#0000~16#FFFF	0~65535		
	UDINT	16#0000~16#FFFF	0~65535		
	ULINT	16#0000~16#FFFF	0~65535		
	SINT	16#**00~16#**7F	0~127		
UINT		16#**80~16#**FF	- 128~ -1		
	INT	16#0000~16#7FFF	0~32767		
		16#8000~16#FFFF	- 32768~ -1		
	DINT	16#0000~16#FFFF	0~65535		
	LINT	16#0000~16#FFFF	0~65535		
	USINT	16#****_**00~16#****_**FF	0~255		
	UINT	16#****_0000~16#****_FFFF	0~65535		
	UDINT	16#0000_0000~16#FFFF_FFF	0~4294967295		
	ULINT	16#0000_0000~16#FFFF_FFF	0~4294967295		
	SINT	16#****_**00~16#****_**7F	0~127		
UDINT	SINT	16#****_**80~16#****_**FF	-128~-1		
	INT	16#****_0000~16#****_7FFF	0~32767		
		16#****_8000~16#****_FFFF	-32768~-1		
		16#0000_0000~16#7FFF_FFF	0~2147483647		
	DINT	16#8000_0000~16#FFFF_FFF	-2147483648~-1		
	LINT	16#0000_0000~16#FFFF_FFF	0~4294967295		
	USINT	16#****_****_****_**00~ 16#****_****_***FF	0~255		
ULINT	UINT	16#****_****_****_0000~ 16#****_****_FFFF	0~65535		

> The Bit-string data are converted into the Integer data as the following table shows.


8

In         Out         In         Out           UDINT         16#****_****_000_0000- 0000_0000_0000_0000- 16# FFFF_FFFF         0-4294967295           ULINT         16#****_********************************	Data	type	The value of <i>In</i> correspo	onds to the value of Out
UUINT         16#****_****_FFFF_FFFF         0-4293967295           ULINT         16#0000_0000_0000-0000- 16#FFF_FFFF         0-18446744073709551645           IB         16#****_********************************	In	Out	In	Out
ULINT         16# FFFF_FFFF_FFFF         0-16*440/440/3/09351645           SINT         16#***_****00- 16#***_*********************************		UDINT		0~4294967295
INT         16#************************************		ULINT		0~18446744073709551645
INT			16#****_****_**00~	0~127
INT INT IG#******FFFF 0-32767 IG#******FFFF 327681 IG#******FFFFFFFFF 0-2147483647 IG#******_7FFF_FFFF 0-2147483647 IG#******_FFFF_FFFF 0-21474836481 IG#*****FFFF_FFFF 0-21474836481 IG#****FFFF_FFFF 0-221474836481 IG#00_0000_0000_0000_0000- 16#7FFF_FFFFFFFFFFFFFFFFFFFFFFFFFFFFFFFFF		SINT		-128~-1
INT 16#00-16#FFF 0-255 UINT 16#00-16#FFF 0-255 UINT 16#00-16#FFF 0-255 UINT 16#00-16#FF  0-255 UINT 16#00-16#FFF 0-255 UINT 16#000-16#FFF  0-65535 UINT 16#000-16#FFFF 0-255 UINT 16#0000-16#FFFF 0-24294967295 UINT 16#0000_000-16#FFFFFFFFF		INT	16#****_****_****_7FFF	0~32767
DINT         16#****_7FFF_FFF         0-2147483647           16#****_****_8000_0000- 16#***EFFF         -21474836481           16#0000_0000_0000_0000- 16#FFFF_FFFF         0-9223372036854775807           16#8000_0000_0000_0000- 16#FFFF_FFFF         0-9223372036854775807           16#7FFF_FFFF         0-255           USINT         16#00-16#FF           16#00-16#FF         0-255           UDINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           INT         16#00-16#FF           0-255         0           UNT         16#00-16#FF           0-255         0           UNT         16#000-16#FFF           0-255         0           UNT         16#000-16#FFF           0-255         0           UNT         16#000-16#FFF           0-255         0           UNT         16#000-16#FFF			16#****_****_FFFF	-32768~-1
Inf#****8000_0000- 16#***_****_FFF_FFF         -21474836481           16#0000_0000_0000_0000- 16#FFFF_FFFF         -9223372036854775807           16#76FF_FFFFFFFF         0-9223372036854775807           16#76FF_FFFFFFFFF         -9223372036854775807           16#7FFF_FFFFFFFFFF         0-9223372036854775808-0           16#7FF_FFFFFFFFFFFF         0-9223372036854775808-0           16#7FF         0-255           UINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           ULINT         16#00-16#FF           0-255         0           1NT         16#00-16#FF           0-255         0           1NT         16#00-16#FF           0-255         0           1NT         16#00-16#FF           0-255         0           UNT         16#000-16#FF           0-255         0           UNT         16#000-16#FFF           0-255         0           UNT         16#000-16#FFF           0-255         0           UNT         16#000-16#FFF           0-65535         0           UNT         16#**********************				0~2147483647
LINT         16#7FF_FFF_FFF_FFFF         0-322372036854775808-0           16#8000_0000_0000_0000- 16#FFF_FFFF_FFFF         -9223372036854775808-0           16#00-16#FF         0-255           UINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           UINT         16#00-16#FF         0-255           UINT         16#000-16#FF         0-255           UINT         16#000-16#FFF         0-255           UINT         16#0000-16#FFFF         0-65535           UDINT         16#0000-16#FFFF         0-65535           ULINT         16#0000-16#FFFF         0-32767           16#80-16#FFFF         0-32767         16#80-16#FFFF           INT         16#0000-16#FFFF         0-65535           UNT         16#0000-16#FFFF         0-65535				-2147483648~-1
Ib#8000_0000_0000_0000- 16#FFF_FFFFFF         -9223372036854775808-0           USINT         16#00-16#FF         0-255           UINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           ULINT         16#00-16#FF         0-255           INT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           DINT         16#00-16#FF         0-255           UINT         16#00-16#FF         0-255           UINT         16#000-16#FF         0-255           UINT         16#000-16#FF         0-255           UINT         16#000-16#FFF         0-255           UINT         16#000-16#FFF         0-255           UINT         16#000-16#FFF         0-255           UINT         16#000-16#FFFF         0-255           UINT         16#000-16#FFFF         0-255           UINT         16#000-16#FFFF         0-255           UINT         16#000-16#FFFF         0-257           UINT         16#000-16#FFFF         0-257           UINT         1				0~9223372036854775807
UINT         16#00~16#FF         0~255           UDINT         16#00~16#FF         0~255           ULINT         16#00~16#FF         0~255           ULINT         16#00~16#FF         0~127           16#80~16#FF         -128~1         1           INT         16#00~16#FF         0~255           DINT         16#00~16#FF         0~255           DINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           USINT         16#000-16#FFF         0~255           USINT         16#000-16#FFF         0~255           UINT         16#000-16#FFF         0~255           UINT         16#0000-16#FFFF         0~255           UDINT         16#0000-16#FFFF         0~255           UINT         16#0000-16#FFFF         0~255           ULINT         16#0000-16#FFFF         0~255           ULINT         16#0000-16#FFFF         0~2767           10NT         16#0000-16#FFFF         0~255           LINT         16#0000-16#FFFF         0~255           LINT         16#0000-16#FFFF         0~255           UNT         16#0000-16#FFFF         0~255           UINT         1				-9223372036854775808~0
UDINT         16#00~16#FF         0-255           ULINT         16#00~16#FF         0-255           SINT         16#00~16#FF         0-127           1NT         16#00~16#FF         0-255           DINT         16#00~16#FF         0-255           DINT         16#00~16#FF         0-255           DINT         16#00~16#FF         0-255           LINT         16#000~16#FFF         0-255           USINT         16#*00~16#FFF         0-255           UINT         16#0000~16#FFFF         0-255           UINT         16#0000-16#FFFF         0-65535           UDINT         16#0000-16#FFFF         0-65535           ULINT         16#*00-16#*FFF         0-127           10NT         16#0000-16#FFFF         0-255           UINT         16#*00-16#*FFF         0-65535           ULINT         16#0000-16#FFFF         0-257           NT         16#0000-16#FFFF         0-255           INT         16#0000-16#FFFF         0-253           UNT         16#0000-16#FFFF         0-255           UNT         16#****_**00~16#****_**FF         0-255           UNT         16#****_000-16#FFFF         0-65535 <td< td=""><td></td><td>USINT</td><td>16#00~16#FF</td><td>0~255</td></td<>		USINT	16#00~16#FF	0~255
ULINT         16#00-16#FF         0~255           SINT         16#00-16#FF         -128~-1           INT         16#00-16#FF         0~255           DINT         16#00-16#FF         0~255           LINT         16#00-16#FF         0~255           LINT         16#00-16#FF         0~255           LINT         16#00-16#FF         0~255           USINT         16#**00~16#*FF         0~255           USINT         16#0000-16#FFF         0~255           UINT         16#0000-16#FFF         0~255           UINT         16#0000-16#*FF         0~255           UINT         16#0000-16#FFFF         0~65535           UDINT         16#0000-16#FFFF         0~65535           ULINT         16#0000-16#FFFF         0~127           16#**0-16#**FF         0~2767         16#800-16#FFFF           NT         16#0000-16#FFFF         0~255           LINT         16#0000-16#FFFF         0~255           LINT         16#0000-16#FFFF         0~26535           UINT         16#0000-16#FFFF         0~255           LINT         16#0000-16#FFFF         0~255           UINT         16#0000-16#FFFF         0~255 <t< td=""><td></td><td>UINT</td><td>16#00~16#FF</td><td>0~255</td></t<>		UINT	16#00~16#FF	0~255
SINT         16#00-16#7F         0~127           INT         16#80~16#FF         -128~-1           INT         16#00~16#FF         0~255           DINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           USINT         16#*00~16#*FF         0~255           USINT         16#000~16#FFF         0~255           UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~2767           16#**00~16#FFFF         0~32767         16#8000~16#FFFF           INT         16#0000~16#FFFF         0~255           LINT         16#0000~16#FFFF         0~255           LINT         16#0000~16#FFFF         0~255           DINT         16#0000~16#FFFF         0~255           UINT         16#0000~16#FFFF         0~255           UINT         16#0000~16#FFFF         0~65535           UINT         16#0000~16#FFFF         0~255           UINT         16#0000_0000~16#FFFF         0~255		UDINT	16#00~16#FF	0~255
SINT         16#80~16#FF         -128~1           INT         16#00~16#FF         0~255           DINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           USINT         16#00~16#FF         0~255           USINT         16#000~16#FFF         0~255           USINT         16#0000~16#FFFF         0~255           UINT         16#0000~16#FFFF         0~255           UDINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~127           10HT         16#0000~16#FFFF         0~32767           10HT         16#0000~16#FFFF         0~32767           10HT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UINT         16#0000~16#FFFF         0~65535           UINT         16#0000~16#FFFF         0~65535           UINT         16#******00~16#******FF         0~65535           UINT         16#0000_0000~16#FFFF         0~255           UINT         16#****000~16#******FF         0~255           UINT         16#******00~16#******FF <td></td> <td>ULINT</td> <td>16#00~16#FF</td> <td>0~255</td>		ULINT	16#00~16#FF	0~255
Int         16#80~16#FF         -128~-1           INT         16#00~16#FF         0~255           DINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           USINT         16#00~16#FFF         0~255           UINT         16#000~16#FFF         0~255           UINT         16#000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~127           SINT         16#*00-16#**FF         -128~-1           INT         16#0000~16#FFFF         0~32767           INT         16#0000~16#FFFF         0~32767           INT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~255           UNT         16#****_**00~16#****_**FF         0~255           UNT         16#****_0000~16#FFFF         0~4294967295           UNT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF <td>SINT</td> <td rowspan="2">SINT</td> <td>16#00~16#7F</td> <td>0~127</td>	SINT	SINT	16#00~16#7F	0~127
DINT         16#00~16#FF         0~255           LINT         16#00~16#FF         0~255           USINT         16#**00~16#**FF         0~255           UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ILINT         16#0000~16#FFFF         0~2767           1NT         16#0000~16#FFFF         0~32767           INT         16#0000~16#FFFF         0~65535           INT         16#0000~16#FFFF         0~65535           DINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UINT         16#0000~16#FFFF         0~65535           UINT         16#***_**00~16#****_**FF         0~255           UINT         16#****_0000~16#FFFF         0~4294967295           UINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#0000_016#****_**7F         0~127           SI			16#80~16#FF	-128~-1
LINT         16#00~16#FF         0~255           USINT         16#**00~16#*FFF         0~255           UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~277           10000         16#**FF         -128~1           INT         16#0000~16#FFFF         0~32767           1NT         16#0000~16#FFFF         0~32767           10NT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#*****00~16#*****FF         0~255           UNT         16#***0000~16#FFFF         0~4294967295           UNT         16#****_0000_0000~16#FFFF_FFFF         0~4294967295           UDINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#****_**00~16#****_**7F         0~127 <t< td=""><td></td><td>INT</td><td>16#00~16#FF</td><td>0~255</td></t<>		INT	16#00~16#FF	0~255
INT         IG#**00~16#**FF         0~255           UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#*00~16#*7F         0~127           SINT         16#**00~16#*FFF         0~32767           1NT         16#0000~16#FFFF         0~32767           1NT         16#0000~16#FFFF         0~32767           1NT         16#0000~16#FFFF         0~65535           UINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           USINT         16#****_**00~16#****_**FF         0~255           UNT         16#****_0000~16#FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           ULINT         16#****_**00~16#****_**7F         0~127           SINT         16#****_**00~16#****_**7F         0~127           SINT         16#****_**00~16#****_**7F         0~127           16#****_**00~16#****_**7F         0~127         16#****_**80~16#****_**7F <td></td> <td>DINT</td> <td>16#00~16#FF</td> <td>0~255</td>		DINT	16#00~16#FF	0~255
UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~127           SINT         16#**00~16#**FF         -128~-1           INT         16#0000~16#FFFF         0~32767           INT         16#0000~16#FFFF         0~32768~-1           DINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~255           UNT         16#****_000~16#****_**FF         0~4294967295           UNT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FFF         -128~-1		LINT	16#00~16#FF	0~255
UINT         16#0000~16#FFFF         0~65535           UDINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           ULINT         16#0000~16#FFFF         0~65535           NT         16#**00~16#**7F         0~127           16#**80~16#**FF         -128~-1         16#8000~16#FFFF           INT         16#0000~16#FFFF         0~32767           10NT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~255           UNT         16#****_000~16#*****FF         0~255           UNT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           ULINT         16#****_**00~16#****_**7F         0~127           SINT         16#****_*80~16#****_**FFF         -128~-1		USINT	16#**00~16#**FF	0~255
$\begin{tabular}{ c c c c c c } \hline ULINT & 16\#000-16\#FFF & 0~65535 \\ \hline & & \\ \hline & & \\ \hline SINT & \frac{16\#^{**}00-16\#^{**}7F & 0~127}{16\#^{**}80-16\#^{**}FF & -1281} \\ \hline & & \\ \hline \\ \hline$		UINT	16#0000~16#FFFF	0~65535
INT SINT		UDINT	16#0000~16#FFFF	0~65535
INT         SINT         16#**80~16#**FF         -128~-1           INT         16#0000~16#7FFF         0~32767           INT         16#0000~16#FFFF         -32768~-1           DINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           UNT         16#0000~16#FFFF         0~255           USINT         16#****_*00~16#****_*FFF         0~255           UINT         16#****_0000~16#FFFFF         0~65535           UINT         16#0000_0000~16#FFFFF         0~255           UDINT         16#0000_0000~16#FFFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1		ULINT	16#0000~16#FFFF	0~65535
$\begin{array}{c c c c c c c c c c c c c c c c c c c $			16#**00~16#**7F	0~127
INI         16#8000~16#FFFF         -32768~-1           DINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           USINT         16#****_**00~16#****_**FF         0~255           UINT         16#****_0000~16#FFFF         0~65535           UINT         16#****_0000~16#****_FFF         0~65535           UINT         16#****_0000~16#****_FFF         0~65535           UDINT         16#0000_0000~16#FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1	INT	SINT	16#**80~16#**FF	-128~-1
16#8000~16#FFFF         -32768~-1           DINT         16#0000~16#FFFF         0~65535           LINT         16#0000~16#FFFF         0~65535           USINT         16#****_**00~16#****_**FF         0~255           UINT         16#****_0000~16#FFFF         0~65535           UINT         16#****_0000~16#****_FFF         0~255           UINT         16#0000_0000~16#FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1			16#0000~16#7FFF	0~32767
LINT         16#0000~16#FFFF         0~65535           USINT         16#****_**00~16#****_**FF         0~255           UINT         16#****_0000~16#****_FFFF         0~65535           UDINT         16#0000_0000~16#FFFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1			16#8000~16#FFFF	-32768~-1
USINT         16#****_**00~16#****_**FF         0~255           UINT         16#****_0000~16#****_FFF         0~65535           UDINT         16#0000_0000~16#FFFF_FFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1		DINT	16#0000~16#FFFF	0~65535
DINT         16#****_0000~16#****_FFFF         0~65535           UDINT         16#0000_0000~16#FFFF_FFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1		LINT	16#0000~16#FFFF	0~65535
DINT         16#****_0000~16#****_FFFF         0~65535           UDINT         16#0000_0000~16#FFFF_FFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1		USINT	16#****_**00~16#****_**FF	0~255
UDINT         16#0000_0000~16#FFF_FFF         0~4294967295           ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1		UINT		0~65535
ULINT         16#0000_0000~16#FFFF_FFF         0~4294967295           SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1	2	UDINT		
SINT         16#****_**00~16#****_**7F         0~127           16#****_**80~16#****_**FF         -128~-1				
SINT 16#****_**80~16#****_**FF -128~-1				
		SINT		
		INT	16#****_0000~16#****_7FFF	0~32767

Data type		The value of <i>In</i> correspo	nds to the value of Out
In	Out	In	Out
DINT		16#****_8000~16#****_FFFF	-32768~-1
	DINT	16#0000_0000~16#7FFF_FFF	0~2147483647
	DINT	16#8000_0000~16#FFFF_FFF	-2147483648~-1
	LINT	16#0000_0000~16#FFFF_FFF	0~4294967295
	USINT	16#****_****_***00~ 16#****_****_**FF	0~255
	UINT	16#****_****_****_0000~ 16#****_********_FFFF	0~65535
	UDINT	16#****_****_0000_0000~ 16#****_****_FFFF_FFF	0~4294967295
	ULINT	16#0000_0000_0000_0000~ 16# FFFF_FFFF_FFFF	0~18446744073709551645
	SINT	16#****_****_***00~ 16#****_****_***7F	0~127
LINT		16#****_****_****_**80~ 16#****_****_***FF	-128~-1
	INT	16#****_****_****_0000~ 16#****_****_****_7FFF	0~32767
		16#****_****_****_8000~ 16#****_****_****_FFFF	-32768~-1
	DINT	16#****_****_0000_0000~ 16#****_****_7FFF_FFF	0~2147483647
		16#****_****_8000_0000~ 16#****_****_FFFF_FFF	-2147483648~-1
		16#0000_0000_0000_0000~ 16#7FFF_FFF_FFF_FFF	0~9223372036854775807
	LINT	16#8000_0000_0000_0000~ 16#FFFF_FFF_FFFF_FFFF	-9223372036854775808~0

#### Integer to Real number

The Integer data can be converted to the Real-number data. And some instructions are shown below.

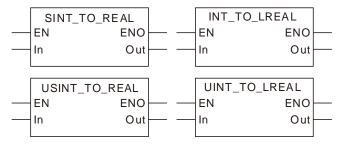


8

Data	type	The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out		
USINT	REAL	0~255	0~2.55e+2		
USINT	LREAL	0~255	0~2.55e+2		
	REAL	0~65535	0~6.5535e+4		
UINT	LREAL	0~65535	0~6.5535e+4		
	REAL	0~4294967295	0~4.294967e+9		
UDINT	LREAL	0~4294967295	0~4.294967295e+9		
	REAL	0~18446744073709551615	0~1.844674e+19		
ULINT	LREAL	0~18446744073709551615	0~1.84467440737095e+19		
CINIT	REAL	-128~127	-1.28e+2~1.27e+2		
SINT	LREAL	-128~127	-1.28e+2~1.27e+2		
	REAL	-32768~32767	-3.2768e+4~3.2767e+4		
INT	LREAL	-32768~32767	-3.2768e+4~3.2767e+4		
DINT	REAL	-2147483648~2147483647	-2.147483e+9~2.147483e+9		
DINT	LREAL	-2147483648~2147483647	-2.147483e+9~2.147483e+9		
	REAL	-9223372036854775808~ 9223372036854775807	-9.223372e+18~9.223372e+18		
LINT	LREAL	-9223372036854775808~ 9223372036854775807	-9.22337203685477e+18~ 9.22337203685477e+18		

> The Integer data are converted into the Real-number data as the following table shows.

#### Integer to Time or Date

The Integer data are converted into the Time or Date data and some instructions are shown as below.

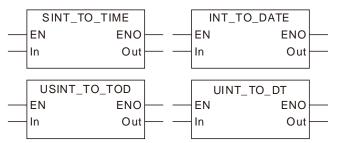

The rule for the conversion of the Integer data into the Time or Date data is the same as that for the conversion of the Integer data into the unsigned integer data.

> The Integer data are converted into the Time or Date data as the following table shows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>			
In	Out	In	Out		
	TIME	16#00~16#FF	T#0ns~T#255ns		
	DATE	16#00~16#FF	D#1970-1-1		
USINT	TOD	16#00~16#FF	TOD#0:0:0~ TOD#0:0:0.255		
	DT	16#00~16#FF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-0:4:15		
	TIME	16#0000~16#FFFF	T#0ns~T#65us535ns		
	DATE	16#0000~16#FFFF	D#1970-1-1		
UINT	TOD	16#0000~16#FFFF	TOD#0:0:0~ TOD#0:1:5.535		
	DT	16#0000~16#FFFF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-18:12:15		

Data type		The value of <i>In</i> corresp	onds to the value of Out
In Out		In	Out
	TIME	16#0000000~16#FFFFFFF	T#0ns~ T#4s294ms967us295ns
	DATE	16#00000000~16#FFFFFFF	D#1970-1-1~D#2016-2-7
		16#00000000~16#05265BFF	
UDINT	TOD	16#05265C00~16#0A4CB7FF	TOD#0:0:0~ TOD#23:59:59.999
	TOD	 16#FC579C00~16#FFFFFFF	TOD#0:0:0~ TOD#17:2:47.295
			DT#1970-1-1-0:0:0~ DT#2016-
	DT	16#00000000~16#FFFFFFF	2-7-6:28:15
	TIME	16#000000000000000000~ 16# FFFFFFFFFFFFFFFF	T#213503d23h34m33s709ms5 51us615ns
	DATE	16#*******00000000~ 16#*******FFFFFFF	D#1970-1-1~D#2016-2-7
		16#******0000000~	
		16#******0A4CB7FF	
ULINT		16#******05265C00~	TOD#0:0:0~ TOD#23:59:59.999
	TOD	16#******0A4CB7FF	
		16#*******0000000~	
		16#******FFFFFFFF	TOD#0:0:0~ TOD#17:2:47.295
	DT	16#******0000000~	DT#1970-1-1-0:0:0~ DT#2016-
		16#******FFFFFFFF	2-7-6:28:15
	TIME	16#00~16#FF	T#0ns~T#255ns
	DATE	16#00~16#FF	D#1970-1-1
SINT	TOD	16#00~16#FF	TOD#0:0:0~ TOD#0:0:0.255
	DT	16#00~16#FF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-0:4:15
	TIME	16#0000~16#FFFF	T#0ns~T#65us535ns
	DATE	16#0000~16#FFFF	D#1970-1-1
INT	TOD	16#0000~16#FFFF	TOD#0:0:0~ TOD#0:1:5.535
	DT	16#0000~16#FFFF	DT#1970-1-1-0:0:0~ DT#1970- 1-1-18:12:15
	TIME	16#0000000~16#FFFFFFF	T#0ns~ T#4s294ms967us295ns
	DATE	16#0000000~16#FFFFFFF	D#1970-1-1~D#2016-2-7
		16#0000000~16#05265BFF	TOD#0:0:0~ TOD#23:59:59.999
DINT	TOD	16#05265C00~16#0A4CB7FF	
		16#FC579C00~16#FFFFFFF	TOD#0:0:0~ TOD#17:2:47.295
	DT	16#0000000~16#FFFFFFF	DT#1970-1-1-0:0:0~ DT#2016- 2-7-6:28:15

Data	type	The value of <i>In</i> corresp	onds to the value of Out
In	Out	In	Out
	TIME	16#00000000000000000000~ 16# FFFFFFFFFFFFFFFFFF	T#213503d23h34m33s709ms5 51us615ns
	DATE	16#*******00000000~ 16#******FFFFFFF	D#1970-1-1~D#2016-2-7
		16#*******00000000~ 16#*******0A4CB7FF	TOD#0:0:0~ TOD#23:59:59.999
LINT	TOD	16#*******05265C00~ 16#*******0A4CB7FF	
		 16#******00000000~ 16#******FFFFFFF	TOD#0:0:0~ TOD#17:2:47.295
	DT	16#*******00000000~ 16#*******FFFFFFF	DT#1970-1-1-0:0:0~ DT#2016- 2-7-6:28:15

#### Integer to String

The Integer data can be converted to the String data and some instructions are shown as below.

 SINT_TO_STRING EN ENC In Ou		INT_TO_ EN In	STRING ENO Out	
 USINT_TO_STRING EN ENC In Ou		UINT_TO EN In	_STRING ENO Out	

> The Integer data are converted into the String data as the following table shows.

Data	type	The value of <i>In</i> corresponds to the value of <i>Out</i>				
In	Out	In	Out			
USINT	STRING	0~255	'0'~'255'			
UINT	STRING	0~65535	'0'~'65535'			
UDINT	STRING	0~4294967295	'0'~'4294967295'			
ULINT	STRING	0~18446744073709551615	'0'~'18446744073709551615'			
SINT	STRING	-128~127	'-128'~'127'			
INT	STRING	-32768~32767	'-32768'~'32767'			
DINT	STRING	-2147483648~2147483647	'-2147483648'~'2147483647'			
LINT	STRING	-9223372036854775808~ 9223372036854775807	'-9223372036854775808'~ '9223372036854775807'			


When the Bit-string data are converted to the String data, the length of the output String data must meet the length of the input parameter.

#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

## 8.13.4 Real numbers\_TO\_\*\*\*

FB/FC	Explanation	Applicable model
FC	Real numbers_TO_*** instructions convert real numbers into the data of basic data types. "***" can be any basic data type.	AS524C-B

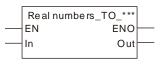

#### Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	e	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In														•	•					
Out	The data type of <i>Out</i> must be the same as "***" of the instruction name.																			


#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

### Real Number to BOOL

Relevant instructions:

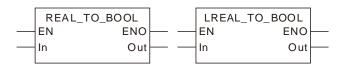


The real numbers are converted into the Boolean data as the following table shows. If the real number is 0, the conversion result is FALSE. If the real number is not 0, the conversion result is TRUE. For details on the rule, see the table as follows.

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>				
In	Out	In	Out			
		-3.402823E+38~-1.175495E-38	TRUE			
REAL	BOOL	0	FALSE			
		1.175495E-38~3.402823E+38	TRUE			

Data type		The value of <i>In</i> corresponds to the value of <i>Out</i>				
In	Out	In	Out			
		-1.79769313486231E+308~	TRUE			
		-2.22507385850721E-308	INUE			
LREAL	BOOL	0	FALSE			
		2.22507385850721E-308~	TRUE			
		1.79769313486231E+308	IRUE			

#### Real Number to Integer

Real numbers can be converted to integers. And some instructions are shown below.

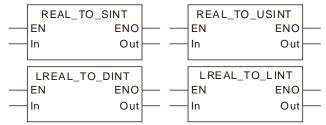

For the real number-to-integer conversion, there are two cases in which the fractional part is truncated and rounded up as follows.

*Case 1:* If the first digital number of the fractional part is less than 5, the fractional part will be truncated and the integer part will not change.

**Case 2:** If the first digital number of the fractional part is greater than or equal to 5, the fractional part will be truncated and the integer part will add by 1.

	anut valua	Output result				
	nput value	Data type	Output value			
	1.36	SINT	1			
Case 1	1.50	USINT	1			
Case I	-2.4	SINT	-2			
	-2.4	USINT	254			
	1.6	SINT	2			
Casa 2	1.6	USINT	2			
Case 2	26	SINT	-3			
	-2.6	USINT	253			


Note:

For the Real Number-to-Integer Conversion, there are two cases for the value of a real number.

- If the number of input digits of a real number exceeds what is allowed, the result will be an unsure value. Please set a limit in the user program in order to get a correct value. For example: Then the input value is 123456789 and the number of its digits exceeds the set limit 7. The digits which go beyond the limit are abnormal. Then the output value is 1234567<u>92</u>.
- 2. If the number of input digits does not exceed the set limit, the result is calculated based on the conversion rule.

#### Real Number to Bit string


> Real numbers can be converted to bit strings. And some instructions are shown below.

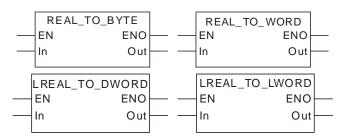

The rule for the conversion of real numbers into bit strings is the same as that for the conversion of real numbers into unsigned integers.


#### Real Number to Real Number

> Real numbers can be converted to real numbers. And some instructions are shown below.

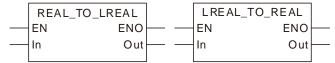

#### Real Number to Time or Date

> Real numbers can be converted to times or dates. And some instructions are shown below.

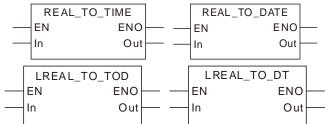

For the real number-to-time or date conversion, the real number is converted to the integer first and then the integer is converted to the time or date. For relevant contents, refer to the real number-to- integer conversion and integer-to-time or date conversion.

#### Real Number to String

> Real numbers can be converted to strings. And some instructions are shown below.

REAL_TO_STRI	NG	LREAL_TO	_STRING	
 EN E	NO -	 EN	ENO	
 In	Out –	 In	Out	


The rule for the real number-to-string conversion is the same as that for the integer-to-string conversion. Refer to section 8.13.3 for details.

#### Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

## 8.13.5 Times, dates\_TO\_\*\*\*

F	FB/FC	Explanation	Applicable model
	FC	Times, dates_TO_*** instructions convert Time or date data into the data of basic data types. "***" can be any basic data type.	AS524C-B

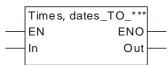

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bits	string					Inte	eger					eal nber		Time	, date	Э	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In																•	•	•	•	
Out				The	data	type	of Ou	<i>it</i> mu	st be	the sa	ame a	as "**	*" of t	he in	struc	tion r	ame	•		

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.


#### • Function Explanation

#### Time and Date to Bool, Bit String, Integer, Real Number and String

The rule for the conversion of the time and date into the bool, bit string, integer, real number and string is the same as that for the conversion of the unsigned integer into bool, bit string, integer, real number and string. Refer to section 8.13.5 for details.

#### Time and Date to Time and Date

The time and date data can be converted to each other. And some instructions are shown below.

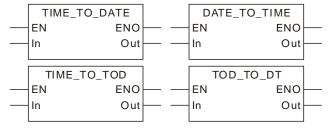


The rule for the conversion of the time and date data into the time and date data is the same as that for the conversion of unsigned integers into unsigned integers. The units must be uniform during the conversion. The unit of TIME is ns (nanosecond) and the unit of others is ms (millisecond).

#### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

## 8.13.6 Strings\_TO\_\*\*\*

FB/FC	Explanation	Applicable model
FC	Strings_TO_*** instructions convert String data into the data of basic data types. "***" can be any basic data type.	AS524C-B

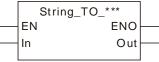

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Data to convert	Input	Data to convert	Depends on the data type of the variable that the input parameter is connected to.
Out	Conversion result	Output	Conversion result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	Э	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In																				
Out				The	data	type o	of Ou	t mus	st be t	the sa	ame a	as "**	*" of t	he in	struc	tion r	name			

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation


- String to Bool
  - Relevant instructions:

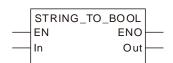

The rule for the String-to-Bool conversion is that the output Bool value is TRUE only when the string value is TRUE or true. Otherwise, the output is FALSE.

#### String to Integer

Strings can be converted to integers. And some instructions are shown below.

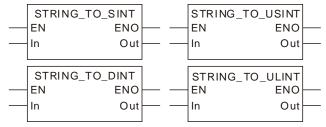


For the string-to-integer conversion, the string is required to be the integer value such as '123', '-123' and '+123'. The string like 'M123' is not allowed to convert to the integer. The conversion examples are shown in the following table.

	Output result					
Input value	Data type	Output value				
'123'	SINT	123				
'+123'	SINT	123				
·-123'	SINT	-123				
'M123'	SINT	The conversion is not allowed and the original value of the output variable is retained.				

#### String to Real Number

Strings can be converted to real numbers. And some instructions are shown below.

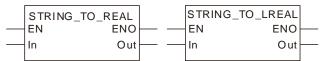

For the string-to-real number conversion, the string is required to be the real number value such as '123', '-123.123' and '1.23e+5'. The conversion examples are shown in the following table.

	Output result					
Input value	Data type	Output value				
'123'	REAL	123				
'-123.123'	REAL	-123.123				
'1.23e+5'	REAL	-1.23e+5				
'M123.123'	REAL	The conversion is not allowed and the original value of the output variable is retained.				

#### String to Time or Date

> Strings can be converted to times and dates. And some instructions are shown below.

STRING_TO_	ГІМЕ		STRING_TO_	DATE	
 EN	ENO	 	EN	ENO	
 In	Out	 	In	Out	
STRING_TO_	TOD		STRING_TC	DT_D	
 STRING_TO_ EN	TOD ENO		STRING_TC EN	D_DT ENO	
 			_	-	


For the string-to-time or date conversion, the string is required to represent the time or date value such as 'T#1ns', 'D#1970-1-1', 'TOD#0:0:0' and 'DT#1970-1-1-0:0:0'. The conversion examples are shown in the following table.

	Output result						
Input value	Data type	Output value					
'T#1ns'	TIME	T#1ns					
'D#1970-1-1'	DATE	D#1970-1-1					
'TOD#0:0:0'	TOD	TOD#0:0:0					
'DT#1970-1-1-0:0:0'	DT	DT#1970-1-1-0:0:0					

String to Bit String

8

Strings can be converted to bit strings. And some instructions are shown below.

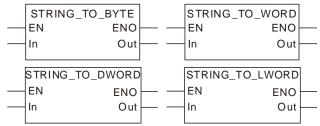

The rule for the string-to-bit string conversion is the same as that for the string-to integer conversion.

#### • Precautions for Correct Use

The input variable is not allowed to omit. An error will occur during the compiling of the software if the input variable is omitted. But the output variable is allowed to omit.

# 8.14 Communication Instructions

## 8.14.1 CANopen Communication Instructions

## 8.14.1.1 DMC\_ReadParameter\_CANopen

FB/FC	Explanation	Applicable model
FB	DMC_ReadParameter_CANopen is used to read a parameter value of a slave.	AS524C-B

#### DMC\_ReadParameter\_CANopen\_instance

DMC_ReadParameter_CANopen					
 Axis	Done				
 Execute	Busy				
 Index	Active				
 SubIndex	Error				
	ErrorlD				
	DataType				
	Data	<u> </u>			

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the slave which is to be controlled by the instruction	USINT	1~127 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Index	The index of a parameter to be read	UINT	0	When <i>Execute</i> changes from FALSE to TRUE
SubIndex	The subindex of a parameter to be read	USINT	0	When <i>Execute</i> changes from FALSE to TRUE

#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	
Data Type	The data type of the read parameter. 1: Byte, 2: Word, 4: Double Word	USINT	
Data	The value of the parameter which has been read	UDINT	

#### ■ The index and subindex of the slave parameter to be read:

1. The user-defined parameter is a servo drive parameter to be read. The data length is specified by users according to the data type of the read parameter. The data length of the byte parameter is 1, the data length of the word parameter is 2 and the data length of the double-word parameter is 4.


The method of calculating the index and subindex of a servo drive parameter: Index= a servo drive parameter value (Hex) + 2000 (Hex) Subindex= 0.

#### Example:

The index and subindex of the servo drive parameter P6-10 are [2000 + 060A (the hexdecimal value of P6-10)] 260A and 0 respectively.

Variable name	Data type	Initial value
ReadPm_C	DMC_ReadParameter_CANopen	
ReadPm_C_Ex	BOOL	FALSE
ReadPm_C_Done	BOOL	
ReadPm_C_Bsy	BOOL	
ReadPm_C_Act	BOOL	
ReadPm_C_Err	BOOL	
ReadPm_C_ErrID	WORD	
ReadPm_C_DaTy	USINT	
ReadPm_C_Dat	UDINT	

#### > The variable table and program

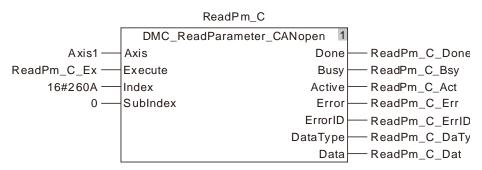


2. For the index and subindex of other slave parameters, refer to CANopen-related manual of the slave.

#### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the reading of the parameter content is completed.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	When Execute changes to TRUE	<ul> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>Done</i> changes from FALSE to TRUE</li> </ul>
Active	<ul> <li>When the slave starts being controlled by the instruction</li> </ul>	<ul> <li>When Error changes to TRUE</li> <li>When Done changes from FALSE to TRUE</li> </ul>

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

#### Output Timing Chart

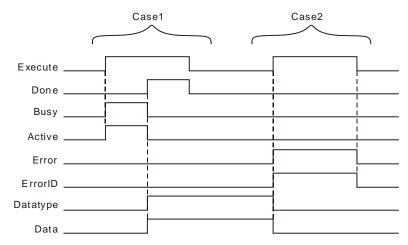

- **Case 1**: Busy and Active change to TRUE when Execute changes from FALSE to TRUE and one period later, Done changes to TRUE and Datatype and Data show corresponding data. When Done changes to TRUE, Busy and Active change to FALSE. When Execute changes from TRUE to FALSE, Done changes from TRUE to FALSE and Datatype and Data retain original values.
- **Case 2**: Before DMC\_ReadParameter\_CANopen is executed, the input parameter value such as axis No: 0 is illegal. When *Execute* changes from FALSE to TRUE, *Error* changes from FALSE to TRUE, the values of Datatype and Data are cleared to 0 and *ErrorID* shows corresponding error codes. As *Execute* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the content of *ErrorID* is cleared to 0.

#### • Functions

DMC\_ReadParameter\_CANopen is used to read the parameter value of a slave. Users can specify the index and subindex of the parameter to be read.

## 


### Programming Example

Below is an example of DMC\_ReadParameter\_CANopen instruction execution.

The variable table and program

Variable name	Data type	Current value
ReadPm_C1	DMC_ReadParameter_CANopen	
Axis1	USINT	1
ReadPm_C1_Ex	BOOL	TRUE
ReadPm_C1_Done	BOOL	TRUE
ReadPm_C1_Bsy	BOOL	FALSE
ReadPm_C1_Act	BOOL	FALSE
ReadPm_C1_Err	BOOL	FALSE
ReadPm_C1_ErrID	WORD	FALSE
ReadPm_C1_DaTy	USINT	2
ReadPm_C1_Dat	UDINT	5000
WritePm_C	DMC_WriteParameter_CANopen	
WritePm_C_Done	BOOL	TRUE
WritePm_C_Bsy	BOOL	FALSE

Variable name	Data type	Current value
WritePm_C_Act	BOOL	FALSE
WritePm_C_Err	BOOL	FALSE
WritePm_C_ErrID	WORD	FALSE
ReadPm_C2	DMC_ReadParameter_CANopen	
ReadPm_C2_Done	BOOL	TRUE
ReadPm_C2_Bsy	BOOL	FALSE
ReadPm_C2_Act	BOOL	FALSE
ReadPm_C2_Err	BOOL	FALSE
ReadPm_C2_ErrID	WORD	FALSE
ReadPm_C2_DaTy	USINT	2
ReadPm_C2_Dat	UDINT	1000

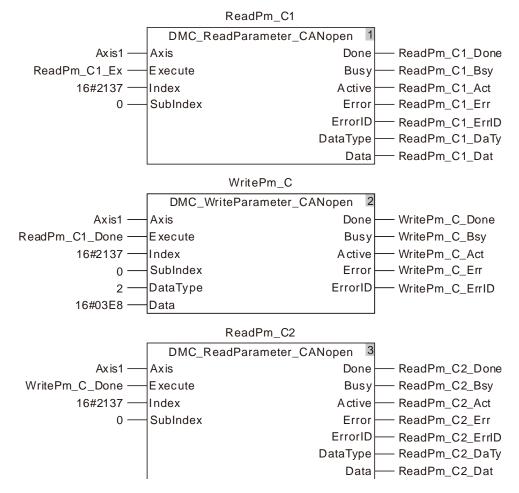

#### Timing Chart

ReadPm_C1		
ReadPm_C1_Ex		
ReadPm_C1_Done		
ReadPm_C1_Bsy		i 
ReadPm_C1_Act		 
ReadPm_C1_DaTy		<u> </u>
ReadPm_C1_Dat		<u> </u>
WritePm_C ReadPm_C1_Done		     
WritePm_C_Done	I	
WritePm_C_Bsy		I
WritePm_C_Act		
ReadPm_C2		] 
	i	, 
ReadPm_C2_Bsy		
ReadPm_C2_Act		
ReadPm_C2_DaTy		
ReadPm_C2_Dat		

The first DMC\_ReadParameter\_CANopen starts being executed as ReadPm\_C1\_Ex changes from FALSE to TRUE. When the execution of the first DMC\_ReadParameter\_CANopen is completed, ReadPm\_C1\_Done changes to TRUE, ReadPm\_C1\_DaTy = 2 and ReadPm\_C1\_Dat=5000.

That is, the content of the servo slave parameter P1-55 which is read is 5000. (The maximum speed of the servo is limited to 5000rpm.)

- As ReadPm\_C1\_Done changes from FALSE to TRUE, DMC\_WriteParameter\_CANopen starts being executed. When the DMC\_WriteParameter\_CANopen instruction execution is completed, WritePm\_C\_Done changes to TRUE. That is, 1000 is written as the content of the servo slave parameter P1-55. (The maximum speed of the servo is limited to 1000rpm.)
- The second DMC\_ReadParameter\_CANopen is executed as WritePm\_C\_Done changes from FALSE to TRUE. When the execution of the second DMC\_ReadParameter\_CANopen is completed, ReadPm\_C2\_Done changes to TRUE, ReadPm\_C2\_DaTy = 2 and ReadPm\_C2\_Dat=1000. That is, the read content of the servo slave parameter P1-55 is 1000. (The maximum speed of the servo is limited to 1000rpm.)

FB/FC	Explanation	Applicable model
FB	DMC_WriteParameter_CANopen is used to set a parameter value of a slave.	AS524C-B
DMC WriteParameter CANopon instance		

## 8.14.1.2 DMC\_WriteParameter\_CANopen

DMC_WriteParameter_CANopen_instance				
	DMC_WriteParame	eter_CANopen		
	Axis	Done		
	Execute	Busy		
	Index	Active		
	SubIndex	Error		
	DataType	ErrorlD		
	Data			

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the slave which is to be controlled by the instruction	USINT	1~127 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Index	The index of a parameter which is set	UINT		
SubIndex	The subindex of a parameter which is set	USINT		
	The data type of the parameter which is set			
DataType	1 : Byte,	USINT		
	2 : Word,			
	4 : Double Word.			
Data	The content value of the parameter which is set	UDINT		
lotos:	1.	I	1	

Notes:

- 1. The value of *DataType* must indicate the data type of the parameter which is set. If the filled value is incorrect, an error will occur in the instruction.
- 2. For the method of calculating the index and subindex of CANopen slave parameter, refer to Introduction of Axis Parameters in Chapter 9.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the writing of the parameter content is completed</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE	<ul> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>Done</i> changes from FALSE to TRUE</li> </ul>
Active	<ul> <li>When the slave starts being controlled by the instruction</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>Done</i> changes from FALSE to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

#### Timing Chart

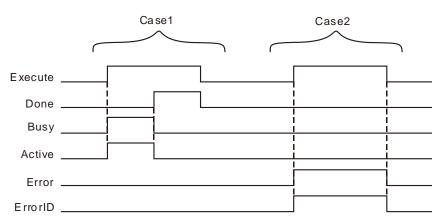

- **Case 1**: Busy and Active change to TRUE when Execute changes from FALSE to TRUE and one period later, Done changes to TRUE. When Done changes to TRUE, Busy and Active change to FALSE. When Execute changes from TRUE to FALSE, Done changes from TRUE to FALSE.
- **Case 2**: Before DMC\_WriteParameter\_CANopen is executed, the input parameter value such as axis No: 0 is illegal. After *Execute* changes from FALSE to TRUE, *Error* changes from FALSE to TRUE and *ErrorID* shows corresponding error codes. As *Execute* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the content of *ErrorID* is cleared to 0.

## • Function

DMC\_WriteParameter\_CANopen is used to set the parameter value of a slave. Users can specify the index and subindex of the parameter which is to be set.


## 📕 Programming Example

Below is an example of one DMC\_WriteParameter\_CANopen instruction execution.

#### The variable table and program

Variable name	Data type	Initial value
ReadPm_C1	DMC_ReadParameter_CANopen	
Axis1	USINT	1
ReadPm_C1_Ex	BOOL	TRUE
ReadPm_C1_Done	BOOL	TRUE
ReadPm_C1_Bsy	BOOL	FALSE

Variable name	Data type	Initial value
ReadPm_C1_Act	BOOL	FALSE
ReadPm_C1_Err	BOOL	FALSE
ReadPm_C1_ErrID	WORD	FALSE
ReadPm_C1_DaTy	USINT	2
ReadPm_C1_Dat	UDINT	5000
WritePm_C	DMC_WriteParameter_CANopen	
WritePm_C_Done	BOOL	TRUE
WritePm_C_Bsy	BOOL	FALSE
WritePm_C_Act	BOOL	FALSE
WritePm_C_Err	BOOL	FALSE
WritePm_C_ErrID	WORD	FALSE
ReadPm_C2	DMC_ReadParameter_CANopen	
ReadPm_C2_Done	BOOL	TRUE
ReadPm_C2_Bsy	BOOL	FALSE
ReadPm_C2_Act	BOOL	FALSE
ReadPm_C2_Err	BOOL	FALSE
ReadPm_C2_ErrID	WORD	FALSE
ReadPm_C2_DaTy	USINT	2
ReadPm_C2_Dat	UDINT	1000

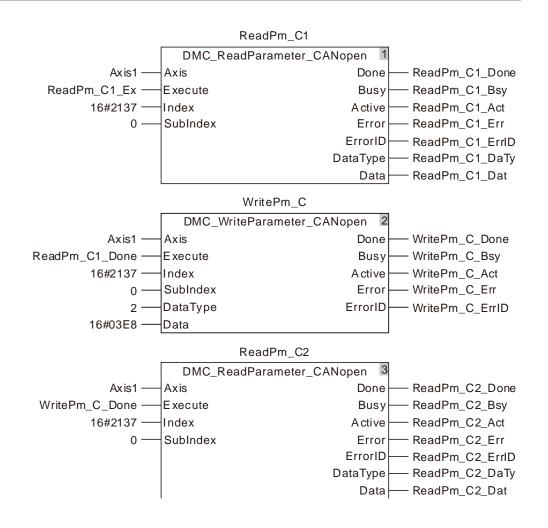

#### Timing chart

ReadPm_C1	
ReadPm_C1_Ex	 
ReadPm_C1_Done	
ReadPm_C1_Bsy	   
ReadPm_C1_Act	   
ReadPm_C1_DaTy	 
ReadPm_C1_Dat	    
WritePm_C ReadPm_C1_Done	
WritePm_C_Done	
WritePm_C_Bsy	
WritePm_C_Act	   
ReadPm_C2	
WritePm_C_Done	 
ReadPm_C2_Done	
ReadPm_C2_Bsy	 
ReadPm_C2_Act	 
ReadPm_C2_DaTy	 
ReadPm_C2_Dat	 

- When ReadPm\_C1\_Ex changes from FALSE to TRUE, the first DMC\_ReadParameter\_CANopen starts being executed. After the execution of the first DMC\_ReadParameter\_CANopen is completed, ReadPm\_C1\_Done changes to TRUE, ReadPm\_C1\_DaTy =2 and ReadPm\_C1\_Dat=5000. That is, the content of the servo slave parameter P1-55 which is read is 5000. (The maximum speed of the servo is limited to 5000rpm.)
- When ReadPm\_C1\_Done changes from FALSE to TRUE, the DMC\_ WriteParameter \_CANopen instruction starts being executed. After the execution of the DMC\_WriteParameter\_CANopen instruction is completed, WritePm\_C\_Done changes to TRUE. That is, the content of the servo slave parameter P1-55 which is written is 1000. (The maximum speed of the servo is limited to 1000rpm.)
- When WritePm\_C\_Done changes from FALSE to TRUE, the second DMC\_ ReadParameter \_CANopen instruction starts being executed. After the execution of the second DMC\_ ReadParameter \_CANopen instruction is completed, ReadPm\_C2\_Done changes to TRUE, ReadPm\_C2\_DaTy =2 and ReadPm\_C2\_Dat=1000. That is, the content of the servo slave parameter P1-55 which is read is 1000. (The maximum speed of the servo is limited to 1000rpm.)

## 8.14.2 Ethernet Instructions

## 8.14.2.1 ETH\_Link\_Config

FB/FC	Explanation	Applicable model
FB	ETH_Link_Config is used for configuring parameters for MODBUS TCP data exchange at Ethernet 2 port of the motion controller.	AS524C-B
	ETH_Link_Config_instance	
	ETH_Link_Config	
	Execute Done	
	LinkNum Error	
	EnableLink ErrorID	
	SlavelP_segment1	
	SlavelP_segment2	
	SlaveIP_segment3	
	SlavelP_segment4	
	SlaveNodeID	
	— ОbјТуре	
	En_FunCode17	
	Write_Buffer_Address	
	Write_Buffer_Address_Offset	
	Write_Destination_Address	
	Write_Length	
	Write_FunCode	
	Read_Buffer_Address	
	Read_Buffer_Address_Offset	
	Read_Destination_Address	
	Read_Length	
	Read_FunCode	
	TimeOut	

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	Set the number of MODBUS TCP data exchange	UINT	1~16 (0)	When <i>Execute</i> changes from FALSE to TRUE
EnableLink	Enable or disable the link	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
SlaveIP_segment1	Set the first segment of the target IP address	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
SlaveIP_segment2	Set the second segment of the target IP address	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
SlaveIP_segment3	Set the third segment of the target IP address	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
SlaveIP_segment4	Set the fourth segment of the target IP address	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
SlaveNodeID	Set the node ID of the MODBUS slave	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
ОbјТуре	Set the type of slave registers to be read and written. 0 : Word register 1 : Bit register	USINT	0~1 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
En_FunCode17	Set the function code 17 to be used or not.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Write_Buffer_Addre ss	Specify the starting register of the master where data to be sent are stored.	UINT	%MW0~%MW32 767 %QW0~%QW63	When <i>Execute</i> changes from FALSE to TRUE
Write_Buffer_Addre ss_Offset	Set the offset of the starting register of the master sending data. The setting value 1 means the offset is 1 word if data are written to the word registers of the slave. The setting value 1 means the offset is 1 bit if data are written to bit registers of the slave.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Write_Destination_ Address	Specify the starting address of the registers of the MODBUS slave receiving the data from the master	UINT	16#0~16#FFFF (0)	When <i>Execute</i> changes from FALSE to TRUE
Write_Length	The length of data to be written	UINT	Word register: 0~100 Bit register: 0~256 Word register or bit register can be set via the value of <i>ObjType</i> (0)	When <i>Execute</i> changes from FALSE to TRUE
Write_FunCode	Specify the function code for writing data in registers.	USINT	Bit register: 05, 16#0F Word register: 06,16#10	When <i>Execute</i> changes from FALSE to TRUE

#### AS500C Series Motion Controller Operation Manual

Parameter name	Function	Data type	Valid range (Default)	Validation timing
			(16#10)	
Read_Buffer_Addre ss	Specify the starting register of the master where data received are stored.	UINT	%MW0~%MW32 767 %QW0~%QW63	When <i>Execute</i> changes from FALSE to TRUE
Read_Buffer_Addre ss_Offset	Set the offset of the starting register of the master receiving data. The setting value 1 means the offset is 1 word if the word register of the slave is read. The setting value 1 means the offset is 1 bit if the bit register of the slave is read.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Read_Destination_ Address	Specify the starting address of the MODBUS slave that the master is to read	UINT	16#0~16#FFFF (0)	When <i>Execute</i> changes from FALSE to TRUE
Read_Length	The length of data to be read	UINT	0~100 for ObjType: 0; 0~256 for ObjType: 1; ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
Read_FunCode	Set the function code for reading registers of the salve.	USINT	Bit register: 01~02 Word register: 03~04 (03)	When <i>Execute</i> changes from FALSE to TRUE
Timeout	Set the time for the master to wait for the slave's response. The slave timeout occurs if the slave does not respond to the master request within the set time. Unit: ms	UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE

Note:

- The 1. parameters SlaveIP\_segment1, SlaveIP\_segment2, SlaveIP\_segment3 input and SlaveIP\_segment4 are respectively segment 1~ segment 4 of the IP address of the slave. E.g. the slave IP is 192.168.1.10. So the input value of SlaveIP\_segment1 is 192, SlaveIP\_segment2 is 168; SlaveIP\_segment3 is 1 and SlaveIP\_segment4 is 10.
- The input parameters Write\_Buffer\_Address and Read\_Buffer\_Address mean the starting registers of the 2. MODBUS TCP master where sent and received data are stored. The two input values must be entered. You can define variables and combine register addresses such as %MW0 for them.
- 3. The input parameter *ObjType* is the data type of the read/written parameter. If *ObjType* is 0, it means to read and write data in the word registers of the slave and the ranges of Write\_Length and Read\_Length are 0~100. Write Length and Read Length can not be 0 simultaneously. If ObjType is 1, it means to read and write data in the bit registers of the slave and the ranges of Write Length and Read Length are 0~256. Write Length and Read Length can not be 0 simultaneously.

- 4. When the instruction without the Write\_FunCode input reads and writes data in Word register according to the selection of *ObjType*, the default function code to write data is 16#10 and the default function code to read data is 03. When *ObjType* specifies Bit register, the default function code to write data is 16#0F and the function code to read data, 01 or 02 is selected based on the type of bit registers by referring to corresponding product manual.
- 5. The firmware later than V1.02 supports the Write\_FunCode input of the instruction.
- 6. For the instruction with the Write\_FunCode input, Bit register or Word register can be selected via *ObjType*, the function code to write data can be specified via the Write\_FunCode input and the function code to read data can be specified via the Read\_FunCode input.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE When the configuration of parameters is completed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the configuration of parameters is completed.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

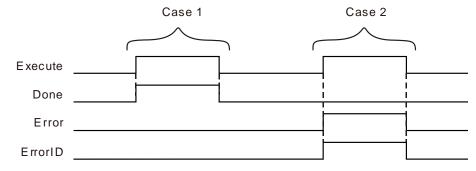

- Case 1: When *Execute* changes from FALSE to TRUE, *Done* becomes TRUE and the configuration of parameters is successful. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- Case 2: When *Execute* changes from FALSE to TRUE, *Error* becomes TRUE and *ErrorID* shows corresponding error code if some parameter is illegal. When *Execute* changes to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

#### • Function

ETH\_Link\_Config is used to configure MODBUS TCP parameters. The firmware of V1.01 and above supports

the function.

- 1. When the Modbus TCP master function of the motion controller is used, only Ethernet 2 port supports the function and the port does not support the function.
- 2. MODBUS TCP data must be sent by jointly using instruction ETH\_Link\_Config and ETH\_Link\_Manage
- 3. If you modify parameters during instruction execution, the parameters are not written. After the instruction parameters are modified, the parameter will not be written until Execute is triggered again.
- 4. If you modify parameters of ETH\_Link\_Config instruction, the new parameters will not take effect immediately until ETH\_Link\_Manage instruction is re-executed.
- 5. When word registers in the slave are read and written, the %MW registers of local device can be chosen as the registers for storing the read and written data. The storage registers range from %MW0~%MW32767. If registers exceed the range or other register is used, an error will occur in the instruction.

When bit registers in the slave are read and written, the %MW and %QW registers of local device can be chosen as the registers for storing the read and written data. The ranges of storage registers are %MW0~%MW32767 and %QW0~%QW63. If registers exceed the ranges or other register is used, an error will occur in the instruction.

- 6. When the bit registers of the slave are read and written and the offset value is 0, the PLC will begin to read or write Read\_Length and Write\_Length bits of data starting at bit0 of the starting register where the data are stored.
- 7. When the bit registers of the slave are read and written and the offset value is n which is not equal to 0, the PLC will begin to read or write Read\_Length and Write\_Length bits of data by offsetting n bits backward.

E.g. Write\_Buffer\_Address\_Offset is 0, ObjType is 1, the register combined with Write\_Buffer\_Address is %MW0 and Write\_Length is 5. Then the PLC will send the data in %MX0.0~%MX0.4 to the slave. E.g. Write\_Buffer\_Address\_Offset is 8, ObjType is 1, the register combined with Write\_Buffer\_Address is %MW0 and Write\_Length is 5. Then the PLC will send the data in %MX1.0~%MX1.4 to the slave.

- 8. The parameter values of this instruction are only valid during the operation of the PLC. When the motion controller is repowered after power off, the parameters configured before the power off are all invalidated. The ETH\_Link\_Config instruction must be performed again if the configuration before the power off is needed to use.
- 9. When the MODBUS TCP master function of the motion controller is used, the motion controller conducts the data exchange with other slaves via the Ethernet2 port of the motion controller.

## 8.14.2.2 ETH\_Link\_Manage

FB/FC	Explanation	Applicable model
FB	ETH_Link_Manage is used to enable and disable the MODBUS TCP data exchange.	AS524C-B
ETH_Link_Manage_instance		
	ETH_Link_Manage — Enable Valid	

LinkOpened PhysicalLinkError

Open

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Open	Enable or disable the MODBUS TCP data exchange.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes from FALSE to TRUE

#### Note:

ETH\_Link\_Manage is used to enable the MODBUS TCP data exchange after MODBUS TCP parameters are configured with ETH\_Link\_Config instruction.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
LinkOpened	TRUE when the MODBUS TCP data exchange is enabled.	BOOL	TRUE / FALSE
PhysicalLink Error	TRUE when the physical link to the Ethernet interface of the PLC is disconnected.	BOOL	TRUE / FALSE

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	♦ When <i>Enable</i> changes to TRUE	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
LinkOpened	<ul> <li>When the link to the MODBUS TCP is successful.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Open</i> changes from TRUE to FALSE</li> <li>When the physical link to the Ethernet interface of the CPU is disconnected.</li> </ul>
PhysicalLink Error	<ul> <li>When Open is TRUE and the physical link to the Ethernet interface of the PLC is disconnected.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>LinkOpened</i> changes from FALSE to TRUE</li> </ul>

8\_

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE	
		<ul> <li>When the physical link to the Ethernet interface of the PLC is reconnected.</li> </ul>	
	adata Timing Chart		

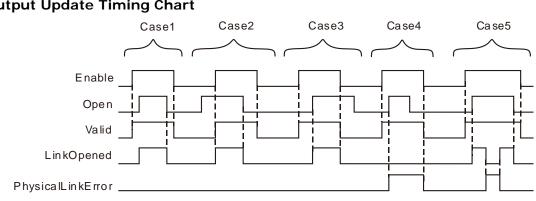

- Case 1 When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. When *Open* changes from FALSE to TRUE, *LinkOpened* changes to TRUE. When *Open* changes from TRUE to FALSE, *LinkOpened* changes FALSE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE.
- Case 2 When *Enable* changes to FALSE, *Open* changes to TRUE and at the moment, the outputs of the instruction do not change. When *Enable* changes from FALSE to TRUE, *Valid* and *LinkOpened* change to TRUE. When *Open* changes to FALSE, *LinkOpened* changes to FALSE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE.
- Case 3 When *Enable* changes to TRUE, *Valid* changes to TRUE. When *Open* changes from FALSE to TRUE, *LinkOpened* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* and *LinkOpened* change to FALSE. Afterwards, changing *Open* from TRUE to FALSE will not affect the output result.
- Case 4 When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. If there is a problem in the link to Ethernet 2 port of the motion controller at the moment, *PhysicalLinkError* changes to TRUE if *Open* changes to TRUE; *PhysicalLinkError* does not change to FALSE if *Open* changes to FALSE and *Valid* and *PhysicalLinkError* changes to FALSE simultaneously if *Enable* changes from TRUE to FALSE.
- Case 5 If the link to Ethernet 2 port of the motion controller is disconnected during the instruction execution, *PhysicalLinkError* changes to TRUE and meanwhile *LinkOpened* changes to FALSE. When the link to Ethernet 2 port of the motion controller is restored, *PhysicalLinkError* changes to FALSE and meanwhile *LinkOpended* changes to TRUE.


## Function

ETH\_Link\_Manage is used to start the MODBUS TCP communication. The firmware of V1.01 and above supports the function.

- 1. After the input *Enable* of ETH\_Link\_Manage changes to TRUE and *Open* is set to TRUE, the MODBUS TCP data start being sent if the physical Ethernet interface of the PLC is connected normally. As *Open* changes from TRUE to FALSE, the PLC stops sending the MODBUS TCP data.
- 2. If *Enable* is set to FALSE during the instruction execution, the outputs of ETH\_Link\_Manage all change to FALSE. But the PLC will not stop sending the MODBUS TCP data. The link will not be closed until *Open* is set to FALSE only as *Enable* is TRUE.
- 3. The error message from the slave or communication timeout has no impact on the instruction execution.

## 8.14.2.3 ETH\_Link\_Status

FB/FC	Explanation	Applicable model
FB	ETH_Link_Status is used to watch if an error occurs in the MODBUS TCP link which the number corresponds to or if the slave replies with error codes.	AS524C-B

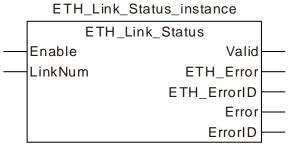

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is validated when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	The number of MODBUS TCP link to be monitored.	UINT	1~16 (0)	When <i>Enable</i> changes from FALSE to TRUE

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
ETH_Error	TRUE when an error occurs in the MODBUS TCP data exchange.	BOOL	TRUE / FALSE
ETH_ErrorID	MODBUS TCP data exchange error code. Refer to the table in the following <b>Function</b> section. If the <i>ETH_ErrorID</i> value is 1~10, refer to the relevant slave manual for corresponding error ID explanation.	WORD	
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	♦ When <i>Enable</i> changes to TRUE.	<ul> <li>When Enable changes from TRUE to FALSE.</li> </ul>

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
ETH_Error	<ul> <li>When an error occurs in MODBUS TCP data exchange.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When the MODBUS TCP data exchange is restored to normal.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When the correct parameter value is filled.</li> </ul>

#### • Output Update Timing Chart

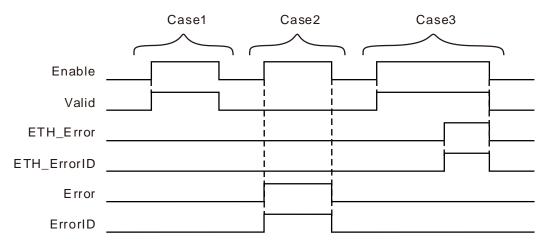

- Case 1 When *Enable* changes to TRUE, *Valid* changes to TRUE. When *Enable* changes to FALSE, *Valid* changes to FALSE.
- Case 2 When an error occurs while *Enable* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. *Error* changes to FALSE and the value in *ErrorID* changes to 0 when *Enable* changes to FALSE.
- Case 3 When *Enable* changes to TRUE, *Valid* changes to TRUE. *ETH\_Error* changes to TRUE and *ETH\_ErrorID* shows corresponding error code when the MODBUS TCP data sending fails or timeout occurs during the instruction execution. When *Enable* changes to FALSE, *ETH\_Error* changes to FALSE and *ETH\_ErrorID* shows corresponding error code.

#### Function

ETH\_Link\_Status is used for watching if an error occurs in the corresponding MODBUS TCP link or the slave replies with error codes. The firmware of V1.01 and above supports the function.

Error code	Description	How to deal with
101	The TCP link is disabled.	<ol> <li>Check if the Ethernet connection is normal.</li> <li>Re-execute ETH_Link_Manage instruction to enable the MODBUS TCP data exchange.</li> </ol>
102	TCP link timeout	<ol> <li>Check if the Ethernet connection is normal.</li> <li>Check if the settings for the parameters of ETH_Link_Config instruction are correct.</li> </ol>

8

Error code	Description	How to deal with	
		<ol> <li>Check if the Ethernet connection is normal.</li> </ol>	
103	MODBUS TCP message response timeout	<ol> <li>Increase the timeout period by modifying the value of <b>Timeout</b> parameter of ETH_Link_Config instruction.</li> </ol>	
104	Reserved	-	
105	Reserved	-	
106	Transaction identifier error (in the message header)	Make sure that the format of the response message from the slave is correct.	
107	Protocol identifier error (in the message header)	Make sure that the format of the response message from the slave is correct.	
108	Modbus TCP message length error (in the message header)	Make sure that the length of the response message from the slave is correct.	
109	Reserved	-	
110	The establishment of the link is performed when the TCP link is not disabled.	Disable the current link before re- establishing the link.	

## 8.14.2.4 MODBUS TCP Data Exchange Example

# Programming Example 1

#### Example of reading and writing word registers in the slave


#### > Example explanation

- 1. The motion controller is the MODBUS TCP master, DVP12SE is the MODBUS TCP slave and the IP address of DVP12SE is 192.168.1.10.
- The motion controller writes the values in %MW10~%MW19 to D0~D9 in DVP12SE, then reads the values in D100~D109 in DVP12SE and stores the read values in %MW110~%MW119.

#### > Variable table and program

Variable name	Address	Data type	Initial value
ETH_Link_Config0		ETH_Link_Config	
Config0_Ex		BOOL	
Config0_En		BOOL	TRUE
Config0_SIP1		USINT	192
Config0_SIP2		USINT	168
Config0_SIP3		USINT	1
Config0_SIP4		USINT	10
Config0_SNodeID		USINT	0
Config0_OT		USINT	0
Config0_En_FunCode17		BOOL	FALSE
Config0_WBf_Add	%MW0	UINT	
Config0_WBf_Off		USINT	10
Config0_WDes_Add		UINT	16#1000

Variable name	Address	Data type	Initial value
Config0_WLTH		UINT	10
Config0_W_Code		USINT	16#10
Config0_RBF_ADD	%MW100	UINT	
Config0_RBF_OFF		USINT	10
Config0_RDES_ADD		UINT	16#1064
Config0_RLTH		UINT	10
Config0_R_Code		USINT	16#03
Config0_T		UINT	1000
Config0_Done		BOOL	
Config0_Err		BOOL	
Config0_ErrID		WORD	
ETH_Link_Manage0		ETH_Link_Manage	
MA_En		BOOL	
MA_Open		BOOL	
MA_Valid		BOOL	
MA_LinkOpen		BOOL	
MA_PhyErr		BOOL	
ETH_Link_Status0		ETH_Link_Status	
STA_En		BOOL	
STA_Valid		BOOL	
STA_ETH_Err		BOOL	
STA_ETH_ErrID		WORD	
STA_Err		BOOL	
STA_ErrID		WORD	

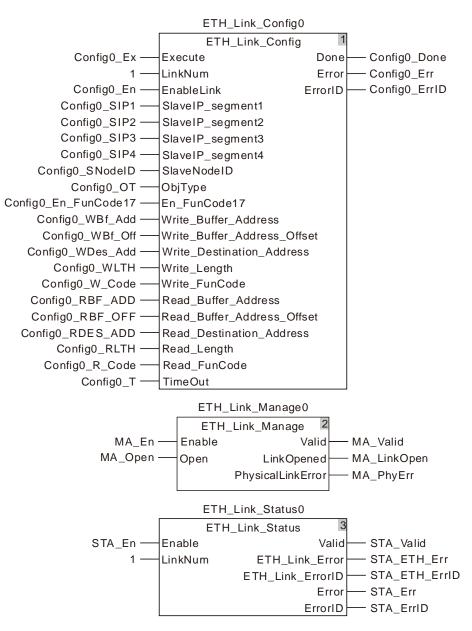

#### > Operation steps and data exchange explanation

- 1. Combine Config0\_WBf\_Add and Config0\_RBF\_ADD with %MW0 and %MW100 respectively. The initial values of Config0\_WBf\_Off and Config0\_RBf\_OFF are 10. Perform the online function after the program compiling and downloading is successful.
- Set Config\_Ex to TRUE. After ETH\_Link\_Config instruction execution is completed, set MA\_En to TRUE and then MA\_Open to TRUE. After the output MA\_LinkOpen of ETH\_Link\_Manage instruction changes to TRUE, the motion controller starts to exchange data with DVP12SE.

Via the ETH\_Link\_Status instruction, current communication status can be watched. The corresponding relationships between the motion controller and DVP12SE are shown in the following table.

%MW registers in the motion controller	D registers in DVP12SE
%MW10	D0
%MW11	D1
%MW12	D2

%MW18		D8
%MW19		D9
%MW110		D100
%MW111		D101
%MW112	-	D102
%MW118		D108
%MW119		D109
	1	<u> </u>

# Programming Example 2

### Example of reading and writing bit registers in the slave


### > Example explanation

- 1. The motion controller is the MODBUS TCP master, DVP12SE is the MODBUS TCP slave and the IP address of DVP12SE is 192.168.1.10.
- 2. The motion controller writes the values in %MX0.0~%MX0.7 to Y0~Y7 in DVP12SE, then reads the values in Y20~Y27 in DVP12SE and stores the read values in %MX2.0~%MX2.7.

#### > Variable table and program

Variable name	Address	Data type	Initial value
ETH_Link_Config1		ETH_Link_Config	
Config1_Ex		BOOL	
Config1_En		BOOL	TRUE
Config1_SIP1		USINT	192
Config1_SIP2		USINT	168
Config1_SIP3		USINT	1
Config1_SIP4		USINT	10
Config1_SNodeID		USINT	0
Config1_OT		USINT	1
Config1_En_FunCode17		BOOL	FALSE
Config1_WBf_Add	%MW0	UINT	
Config1_WBf_Off		USINT	0
Config1_WDes_Add		UINT	16#0500
Config1_WLTH		UINT	8
Config1_W_Code		USINT	16#0F
Config1_RBF_ADD	%MW1	UINT	
Config1_RBF_OFF		USINT	0
Config1_RDES_ADD		UINT	16#0510
Config1_RLTH		UINT	8
Config1_R_Code		USINT	1
Config1_T		UINT	1000

Variable name	Address	Data type	Initial value
Config1_Done		BOOL	
Config1_Err		BOOL	
Config1_ErrID		WORD	
ETH_Link_Manage1		ETH_Link_Manage	
MA1_En		BOOL	
MA1_Open		BOOL	
MA1_Valid		BOOL	
MA1_LinkOpen		BOOL	
MA1_PhyErr		BOOL	
ETH_Link_Status1		ETH_Link_Status	
STA1_En		BOOL	
STA1_ Valid		BOOL	
STA1_ETH_Err		BOOL	
STA1_ETH_ErrID		WORD	
STA1_Err		BOOL	
STA10_ErrID		WORD	

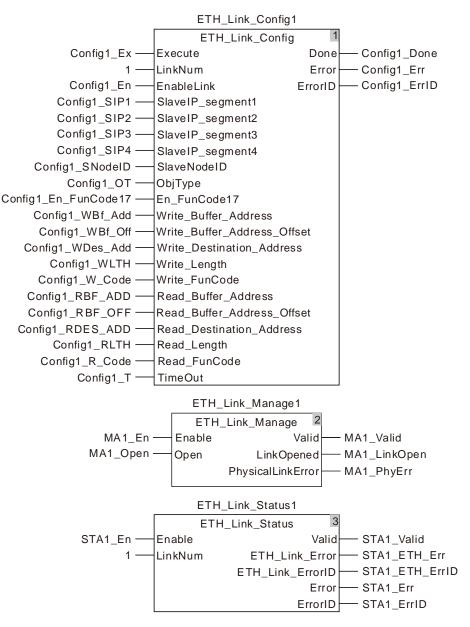

#### > Operation steps and data exchange explanation

- Combine Config1\_WBf\_Add and Config1\_RBF\_ADD with %MW0 and %MW1 respectively. Set the values of Config1\_WLTH and Config1\_RLTH to 8 and Config1\_OT to 1. Set the values of Config1\_WDes\_Add and Config1\_RDes\_Add to 16#0500 and 16#0510 respectively and Config1\_R\_Code to 1.
- 2. After the program compiling and downloading is successful, perform the online. Set Config1\_Ex to TRUE. After ETH\_Link\_Config instruction execution is completed, set MA1\_En to TRUE and then MA1\_Open to TRUE. After the output MA1\_LinkOpen of ETH\_Link\_Manage instruction changes to TRUE, the motion controller starts to exchange data with DVP12SE.

Devices in the motion controller		Bit devices Y in DVP12SE
%MX0.0		YO
%MX0.1		Y1
%MX0.2		Y2
%MX0.6		Y6
%MX0.7		Y7
%MX2.0		Y20
%MX2.1		Y21
%MX2.2		Y22
	Ĵ	
%MX2.6		Y26
%MX2.7		Y27

Via the ETH\_Link\_Status instruction, current communication status can be watched. The corresponding relationships between the motion controller and DVP12SE are shown in the following table.

### 8.14.2.5 ETH\_Link\_Config\_Ext

FB/FC	Explanation	Applicable model	
FB	ETH_Link_Config_Ext is used to configure the cycle time and link duration for MODBUS TCP data exchange.	AS524C-B	
ETH_Link_Config_Ext_instance			

ETH\_Link\_Config\_Ext Execute Done CycleTime LinkKeeptime

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
CycleTime	The cycle time the master sends MODBUS TCP data. (Unit: milliseconds)	ARRAY [116] OF UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.
LinkKeeptime	The link duration of the master (Unit: seconds)	ARRAY [116] OF UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### Note:

- 1. Every element of the values in *CycleTime* and *LinkKeeptime* corresponds to the number in a ETH\_Link\_Config instruction. For example, the first element of *CycleTime* value corresponds to the data-sending cycle time of the number 1.
- 2. The unit of CycleTime is milliseconds (ms) and LinkKeepTime is seconds (s).
- 3. *LinkKeeptime* is the link duration (unit:seconds). If there is no data exchange between the master and slave within the time specified by *LinkKeeptime*,, the controller will disconnect the link to the slave automatically.

#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE

Output Update Timing					
Parameter Name         Timing for changing to TRUE         Timing for changing to FALSE					
Done	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>			

### Function

When the MODBUS TCP master function of the controller is used, ETH\_Link\_Config\_Ext can be used to set the cycle time and link duration for MODBUS TCP data exchange. The firmware of V1.01 and above supports the function.

 The ETH\_Link\_Config\_Ext instruction can be used to set the cycle time and link duration for MODBUS TCP data exchange. The instructon can also be used in the configuration of MODBUS TCP parameters. And it can still be used in the MODBUS TCP master function of the controller. One piece of MODBUS TCP data sending is finished and then another piece will be sent out immediately. The link duration is 30s by default.

- 2. The parameter value which is modified during the instruction execution will not be written. The new parameter value of the instruction will be written only after *Execute* of the instruction is retriggered.
- 3. ETH\_Link\_Config\_Ex and ETH\_Link\_Config has no relation in the execution sequence. The parameters of ETH\_Link\_Config\_Ext will not take effect unless ETH\_Link\_Config\_Ext is executed prior to ETH\_Link\_Manage.

### 8.14.2.6 ETH\_SetServerlinkkeeptime

FB/FC	Explanation	Applicable model		
FB	ETH_SetServerlinkkeeptime is used to set the link duration as the controller serves as the MODBUS TCP slave.	AS524C-B		
ETH_SetServerlinkkeeptime_instance				

ETH\_SetServerlinkkeeptime Execute Done ServerLinkKeeptime

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
ServerLinkKeeptime	Link duration when the controller works as the MODBUS TCP slave (Unit: seconds)	UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### Note:

When the *ServerLinkKeeptime* parameter is set to 0 or blank, the default link duration of the MODBUS TCP slave which the controller serves as is 30s.

#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	◆ When <i>Execute</i> changes from FALSE to	◆ When Execute changes from TRUE to
Done	TRUE.	FALSE.

#### • Function

ETH\_SetServerlinkkeeptime is used to set the link duration as the controller serves as the MODBUS TCP slave.

- 1. The *ServerLinkKeeptime* value is valid only when the controller works as the MODBUS TCP slave. When the controller works as the MKODBUS TCP master, the execution of the ETH\_ SetServerlinkkeeptime instruction will have no impact on the MODBUS TCP master function.
- 2. If there is no data exchange between the controller slave and the master within the time specified by ServerLinkKeeptime, the controller slave will disconnect the link to the MODBUS TCP master automatically.
- 3. The instruction can only set the link duration of the MODBUS TCP slave which Ethernet 2 port of the motion controller works as.

FB/FC	Explanation	Applicable model
FB	ETH_Socket_Manage is used for managing Socket TCP/UDP.	AS524C-B
	ETH_Socket_Manage_instance	
	ETH_Socket_Manage	
	– Enable Valid –	
	EnableSocket SocketReady	
	PhysicalLinkError —	

### 8.14.2.7 ETH\_Socket\_Manage

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
EnableSocket	Enable the Socket.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes from FALSE to TRUE

### Note:

ETH\_Socket\_Manage is to enable the Socket function. Other Socket–related instructions can not be used until the instruction is executed.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the instruction output is valid.	BOOL	TRUE/FALSE
SokcetReady	TRUE when enabling the Socket is successful.	BOOL	TRUE/FALSE
PhysicalLinkError	TRUE when the physical connection to Ethernet port of the controller is disconnected.	BOOL	TRUE/FALSE

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	♦ When <i>Enable</i> changes to TRUE.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
SocketReady	<ul> <li>When enabling the Socket is successful.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>EnableSocket</i> changes from TRUE to FALSE.</li> </ul>
PhysicalLinkError	When Enable changes to TRUE and the physical connection to Ethernet 2 port of the controller is disconnected.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When the physical connection to Ethernet 2 port of the controller is returned to normal.</li> </ul>

### Output Update Timing Chart

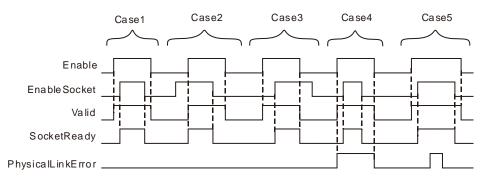

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. When *EnableSocket* changes from FALSE to TRUE, *SocketReady* changes to TRUE. When *EnableSocket* changes from TRUE to FALSE, *SocketReady* changes FALSE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE.
- **Case 2**: When *Enable* is FALSE and *EnableSocket* changes TRUE, the outputs of the instruction keep unchanged. When *Enable* changes from FALSE to TRUE, *Valid* and *SocketReady* both change to TRUE. When *EnableSocket* changes to FALSE, *SocketReady* changes to FALSE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE.
- Case 3 : When *Enable* changes to TRUE, *Valid* changes to TRUE. When *EnableSocket* changes from FALSE to TRUE, *SocketReady* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* and *SocketReady* both change to FALSE. After that, changing *EnableSocket* from TRUE to FALSE will not affect the output of the instruction.
- **Case 4**: When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. If there is a problem with AS524C-B's Ethernet 2 port connection at the moment, *PhysicalLinkError* will change to TRUE as *Enable* changes to TRUE. As *EnableSocket* changes to TRUE, *SocketReady* changes to TRUE and the state of *PhysicalLinkError* will keep unchanged. As *EnableSocket* changes from TRUE to FALSE, *SocketReady* changes to FALSE. As *Enable* changes from TRUE to FALSE, *Valid* and *PhysicalLinkError* both change to FALSE.
- **Case 5**: If the connection to Ethernet 2 port of the controller is disconnected during the instruction execution, *PhysicalLinkError* changes to TRUE and meanwhile the state of *SocketReady* keeps unchanged. When the connection to Ethernet 2 of the controller is returned to normal, *PhysicalLinkError* changes to FALSE.

### Function

ETH\_Socket\_Manage is used for enabling Socket. The firmware of V1.02 and above supports the function..

- 1. If *Enable* is set to FALSE during the instruction execution, all outputs of ETH\_Link\_Manage change to FALSE. But the controller will not disable the Socket. The Socket can be disabled by setting *EnableSocket* to FALSE only as *Enable* is TRUE.
- 2. The instruction execution will not be affected when there is an error message or communication timeout sent back from the target device.

FB/FC	Explanation	Applicable model
FB ET	TH_Socket_Config is used for configuring Socket parameters.	AS524C-B

# 8.14.2.8 ETH\_Socket\_Config

### ETH\_Socket\_Config\_instance

ETH_Socket_C	Config	
 Execute	Done	
 SocketNum	Busy	
 Protocol_Type	Error	
 RemotelP_segment1	ErrorID	
 RemoteIP_segment2		
 RemoteIP_segment3		
 RemoteIP_segment4		
 Remote_port		
 Local_port		
 LinkKeeptime		

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	Specify the number of the Socket.	USINT	1~8 (0)	When <i>Execute</i> changes from FALSE to TRUE.
Protocol_Type	Socket connection mode: 0: Socket UDP 1: Socket TCP	USINT	0: Socket UDP 1: Socket TCP (0)	When <i>Execute</i> changes from FALSE to TRUE.
RemotelP_segment	Set the first segment of the remote IP address.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE.
RemoteIP_segment 2	Set the second segment of the remote IP address.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE.
RemotelP_segment 3	Set the third segment of the remote IP address.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE.
RemotelP_segment 4	Set the fourth segment of the remote IP address.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE.
Remote_port	Set the number of the remote port.	UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Local_port	Set the number of the local port.	UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.
LinkKeeptime	Set the period of time for the connection (s).	UINT	65535 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### Note:

- 1. The input parameters RemotelP\_segment1, RemotelP\_segment2, RemotelP\_segment3 and RemotelP\_segment4 respectively represent the first segment to the fourth segment of the target IP address. For example, if the target IP is 192.168.1.10, the input value of SlavelP\_segment1 is 192, SlavelP\_segment2 is 168, SlavelP\_segment3 is 1 and SlavelP\_segment4 is 10.
- 2. The parameter *LinkKeeptime* means the duration time of connection with the unit of seconds. When there is no data transmission for the built link within the period of time, the controller will automatically abort the connection.


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the configuration of parameters is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Error	Error TRUE when an error occurs in the instruction execution.		TRUE/FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the configuration of parameters is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	<ul> <li>When input parameters of the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### Output Update Timing Chart

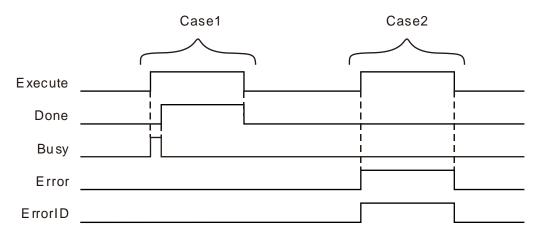

- Case 1 When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and the parameter writing succeeds. One cycle later, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- Case 2 When *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code if the parameter values writing is illegal. When *Execute* changes to FALSE, *Error* changes to FALSE and the vauel in *ErrorID* changes to 0.

### Function

ETH\_Socket\_Config is used for configuring Socket parameters. The firmware of V1.02 and above supports the function.

- 1. During the execution of ETH\_Socket\_Config, the modified parameter values will not be written unless you retrigger the input *Execute* after instruction parameter values are modified.
- 2. If you retrigger the instruction to execute when current link is not disconnected, the instruction will report an error.
- 3. The controller automatically allocates a local port to current link when the value of *Local\_port* is set to 0. When Socket TCP server mode is selected, the value of *Local\_port* can not be set to 0 and one local port which is a non 502 port must be set for the controller to monitor the port number.
- 4. When Socket TCP server mode is selected for the controller, the controller will select a remote host according to the values of the parameter RemoteIP\_segment1~4 or Remote\_port if the value of the parameter *RemoteIP\_segment1~4* or *Remote\_port* is not set to 0. If the IP address of the remote host or port number is inconsistent with that of RemoteIP\_segment1~4 or Remote\_port, the controller will disconnect the connection and stop monitoring local port set in current link.

### 8.14.2.9 ETH\_Socket\_Open

FB/FC		Applicable model		
FB	ETH_Socket_Open is used for enabling Socket TCP/UDP protocol.			AS524C-B
	ETH_Socket_Open			
		Execute	Done	
		SocketNum	Busy —	
		OpenMode	Error	
			ErrorID	

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	Set the number of the Socket	USINT	1~8 (The variable value must be set.)	When <i>Execute</i> changes from FALSE to TRUE
OpenMode	Mode to use the controller TRUE: Client mode FALSE: Server mode	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE

#### Note:

8

1. ETH\_Socket\_Open is used to enable Socket. After ETH\_Socket\_Open is executed, the controller will try to make connection with other node or wait for other node to send out the link request.

When OpenMode is TRUE, the controller is in Client mode. After ETH\_Socket\_Open instruction is executed, the controller sends out the link request to the target node.
 When OpenMode is FALSE, the controller is in Server mode. After ETH\_Socket\_Open instruction is executed, the controller waits for the link request from the target node.

3. If **Socket UDP** is selected as the Socket mode, selecting TRUE or FALSE for *OpenMode* will have no impact on the use of the instruction.


### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>TRUE when the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### Output Update Timing

### Output Update Timing Chart

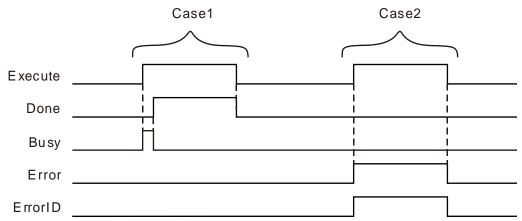

- **Case 1** When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and the writing of parameters is successful. One cycle later, *Done* changes to TRUE and meanwhile *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- **Case 2** When *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code if the parameter value is illegal. When *Execute* changes to FALSE, *Error* changes to FALSE and the value in *ErrorID* changes to 0.

### Function

ETH\_Socket\_Open instruction is used for building the TCP link or enabling UDP function. The firmware of V1.02 and above supports the function.

- 1. ETH\_Socket\_Send and ETH\_Socket\_Receive instructions can be executed only after ETH\_Socket\_Open instruction is executed normally.
- Current connection state can be checked via ETH\_Socket\_Status instruction after ETH\_Socket\_Open instruction is executed.

# 8.14.2.10 ETH\_Socket\_Send

FB/FC	Explanation	Applicable model
FB	ETH_Socket_Send is used for sending Socket data.	AS524C-B

#### ETH\_Socket\_Send\_instance

ETH_Socket_S	end	
 Execute	Done	
 Abort	Sent	
 SocketNum	Sending	
 CyclicRun	Busy	
 CycleTime	Active	
 Send_Buffer_Address	Aborted	
 Send_Length	Error	
	ErrorID	

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Abort	Abort the instruction execution.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	Specify the number of the Socket.	USINT	1~8 (0)	When <i>Execute</i> changes from FALSE to TRUE
CyclicRun	Set whether to cyclically send data or not. TRUE: Cyclic sending, FALSE: Only one-time data sending	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
CycleTime	Set the time of a cycle. Unit: ms	UINT	0~65535 (0)	When <i>Execute</i> changes from FALSE to TRUE
Send_Buffer_Addre ss	Specify the start register for storing the sent data.	USINT	%MB0~%MB65 535	When <i>Execute</i> changes from FALSE to TRUE
Send_Length	Set how many Bytes of data to be sent.	UINT	0~200 (0)	When <i>Execute</i> changes from FALSE to TRUE

#### Note:


The input parameter Send\_Buffer\_Address represents the first register address where the data the controller sends are stored, and the parameter Send\_Length is the length of the data sent by the controller. The two input values must be set.

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the one-time Socket data sending is completed in non-cyclic sending mode.	BOOL	TRUE/FALSE
Sent	TRUE when Socket data sending is completed.	BOOL	TRUE/FALSE
Sending	TRUE when Socket data are being sent.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the instruction is controlling the controller for sending data.	BOOL	TRUE/FALSE
Aborted	TRUE when the instruction execution is aborted.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

## Output Update Timing

Parameter name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is finished.</li> </ul>	When Execute changes from TRUE to FALSE.
Sent	<ul> <li>When sending one piece of Socket message is completed.</li> </ul>	<ul> <li>When the controller starts sending another piece of data.</li> </ul>
Sending	<ul> <li>When one piece of Socket message is being sent.</li> </ul>	When sending one piece of data is completed.
Busy	♦ When Execute changes to TRUE.	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> <li>When <i>Aborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Active	<ul> <li>When the instruction is controlling the controller for sending data.</li> </ul>	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> <li>When <i>Aborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Aborted	<ul> <li>When the instruction execution is aborted.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	When Execute changes from TRUE to FALSE.

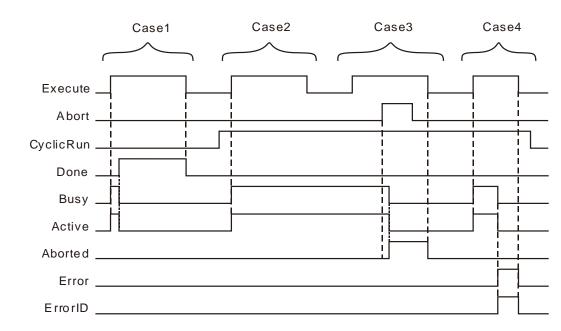

### Output Update Timing Chart

- Case 1 When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE if you choose the mode to send only one piece of data. When one piece of Socket data sending is completed, *Done* changes to TRUE and meanwhile *Busy* and *Active* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- Case 2 When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE and the instruction starts to control the controller for sending Socket data if you choose the mode to cyclically send data. When *Execute* changes from TRUE to FALSE, the TRUE state of *Busy* and *Active* keep unchanged.
- Case 3 The output state will keep unchanged by setting *Execute* from FALSE to TRUE again after case 2. By setting *Abort* from FALSE to TRUE, one cycle later, *Aborted* changes to TRUE and *Busy* and *Active* change to FALSE. When *Abort* changes from TRUE to FALSE, the output will keep unchanged. When *Execute* changes from TRUE to FALSE, *Aborted* changes to FALSE.
- Case 4 When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE. When an error occurs in the instruction execution, *Error* changes to TRUE and the value in *ErrorID* shows corresponding error code and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value in *ErrorID* changes to 0.

### • Function

ETH\_Socket\_Send is used for sending Socket data. The firmware of V1.02 and above supports the function.

- The input paramter *CyclicRun* sets whether to cyclically send data or not and *CycleTime* value is the time of a cycle. When *CyclicRun* is TRUE and ETH\_Socket\_Send instruction is executed, the controller sends a piece of data every a period of time which is the vaue of *CycleTime*. When *CyclicRun* is FALSE and ETH\_Socket\_Send instruction is executed, the controller only sends out one piece of data.
- 2. When the value of *CycleTime* is 0 and *CyclicRun* is TRUE, the controller still sends data cyclically without any limit in time interval.

- 3. If the input parameter value is changed and then the instruction is retriggered during the instruction execution, the new input parameter value will not be effective. You have to use the input parameter *Abort* to abort the instruction first, then re-execute the instruction and then the new input parameter value will take effect.
- 4. The value of *Send\_Length* can not be set to 0. Otherwise, an error will occur in the instruction execution.

FB/FC		Applicable model		
FB	ETH_Socket_Red	ceive is used for receiving Socl	ket data.	AS524C-B
	1	ETH_Socket_Rece	ive_instance	
		ETH_Socket_F	Receive	
		Execute	Done	
	Abort Received			
		SocketNum	Receiving	
		ReceiveMode	Received_Length	
		DataSaveMode	Busy	
		Receive_Buffer_Address	Active	
		Receive_Length	Aborted	
			Error	
			ErrorID	_

# 8.14.2.11 ETH\_Socket\_Receive

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Abort	Abort the instruction execution.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	Specify the number of the Socket.	USINT	1~8 (0)	When <i>Execute</i> changes from FALSE to TRUE
ReceiveMode	<ul><li>Set the mode to receive data.</li><li>0: Keep receiving data</li><li>1: Only receive one piece of data</li></ul>	USINT	0, 1 (0)	When <i>Execute</i> changes from FALSE to TRUE
DataSaveMode	Set the mode to save data. 0: Splicing 1: Covering	USINT	0, 1 (0)	When <i>Execute</i> changes from FALSE to TRUE
Receive_Buffer_Ad dress	Specify the start register for storing the received data.	USINT	%MB0~%MB65 535	When <i>Execute</i> changes from FALSE to TRUE
Receive_Length	Set how many Bytes of data to be received.	UINT	0~200 (200)	When <i>Execute</i> changes from FALSE to TRUE

### Note:

The input parameter **Receive\_Buffer\_Address** represents the first register address where the data the controller receives are stored, and the parameter **Receive\_Length** is the length of the data received by the controller. The two input values must be set.

### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the one-time socket data receiving is completed in the only-one-time data receiving mode.	BOOL	TRUE/FALSE
Received	TRUE when Socket data receiving is completed.	BOOL	TRUE/FALSE
Receiving	TRUE when Socket data are being received.	BOOL	TRUE/FALSE
Received_Length	The size of the data which are actually received.	UINT	
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the instruction is controlling the controller for receiving data.	BOOL	TRUE/FALSE
Aborted	TRUE when the instruction execution is aborted.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes from TRUE to FALSE.
Received	<ul> <li>When one piece of Socket data receiving is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li>When the instruction starts receiving the next piece of data.</li> </ul>
Receiving	<ul> <li>While one piece of Socket data is being received.</li> </ul>	<ul> <li>When one piece of Socket data receiving is completed.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes from FALSE to TRUE;</li> <li>When the instruction execution is aborted;</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Active	<ul> <li>When the instruction is controlling the controller for receiving data.</li> </ul>	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> <li>When the instruction execution is aborted.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Aborted	<ul> <li>When the instruction execution is aborted.</li> </ul>	♦ When <i>Execute</i> changes from TRUE to FALSE.

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### Output Update Timing Chart

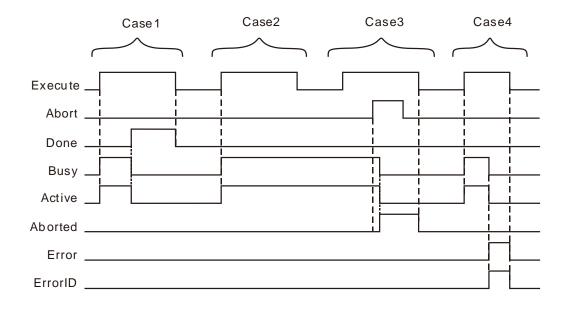

- **Case 1** If the instruction is used to receive one message or constantly receive multiple messages by setting the value of *DataSaveMode* to 0, *Busy* and *Active* both change to TRUE when *Execute* changes from FALSE to TRUE. *Done* changes to TRUE and both *Busy* and *Active* change to FALSE when a piece of data receiving is finished or the total length of spliced data reaches or exceeds the set length. *Done* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 2** If the value of *DataSaveMode* is set to 1, *Busy* and *Active* change to TRUE as *Execute* changes from FALSE to TRUE. And the state of *Busy* and *Active* both keep unchanged and the instruction keep receiving data as *Execute* changes from TRUE to FALSE.
- **Case 3** *Execute* is set from FALSE to TRUE again after case 2 and the output state of the instruction keeps unchanged. Set *Abort* from FALSE to TRUE. One cycle later, *Aborted* changes from FALSE to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Abort* changes from TRUE to FALSE, the output of the instruction keeps unchanged. When *Execute* changes from TRUE to FALSE, *Aborted* changes to FALSE.
- **Case 4** When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE. When an error occurs, *Error* changes to TRUE, *ErrorID* shows corresponding error code and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* changes to 0.


#### Function

ETH\_Socket\_Receive is used for receiving Socket data. The firmware of V1.02 and above supports the function.

- 1. When the value of *ReceiveMode* is set to 0, the controller can constantly receive Socket data. When the value of *DataSaveMode* is set to 0, the instruction has the received data stored in the registers starting from the start register specified by *Receive\_Buffer\_Address* in the mode of splicing. The controller stores new data in the registers following where the last data are stored. When the total length of received data is greater than the value of *Receive\_Length*, the output *Done* changes to TRUE and the instruction execution is finished.
- 2. When the value of input parameter *ReceiveMode* is 0 and *DataSaveMode* is 1, the instruction has the received data stored in the registers starting from the start register specified by *Receive\_Buffer\_Address* in the mode of covering. Every time the controller has the received data stored in the registers starting from the start register specified by *Receive\_Buffer\_Address*.
- 3. When the length of the first peiece of data received exceeds the length specified by *Receive\_Length*, the controller writes the data of the length specified by *Receive\_Length* to the specified device first, the data beyond the set length are discarded, and then the instruction reports an error.
- 4. In the process of instruction execution, modify the input parameter value of the instruction, then trigger the instruction execution, the new input parameter value will not take effect. The instruction must be interrupted by using the input parameter *Abort*, then the new input parameter value will take effect as the instruction is re-executed.

### 8.14.2.12 ETH\_Socket\_Close

FB/FC	Explanation	Applicable model
FB	ETH_Socket_Close is used for disabling Socket.	AS524C-B

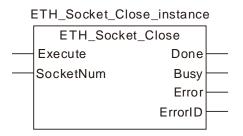

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed as <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	Specify the number of the Socket.	USINT	1~8 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE

Note: The TCP link and UDP function can be disabled through ETH\_Socket\_Close.


### • Output Update Timing

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is finished.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes from TRUE to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing

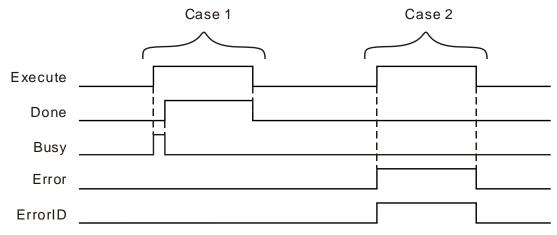

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and parameter values writing succeeds. One cycle later, *Done* changes to TRUE and meanwhile *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code if the written parameter value is illegal. When *Execute* changes to FALSE, *Error* changes to FALSE and the value in *ErrorID* changes to 0.


### • Function

ETH\_Socket\_Close is used for disconnecting the TCP link or disabling UDP function. The firmware of V1.02 and above supports the function.

FB/FC	Explanation	Applicable model
FB	ETH_Socket_Status is used for reading current state of the specified Socket.	AS524C-B

### 8.14.2.13 ETH\_Socket\_Status

### ETH\_Socket\_Status\_instance

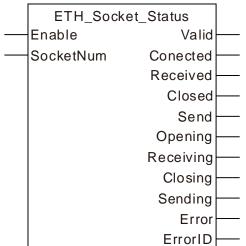

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed as <i>Enable</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	
SocketNum	The number of the Socket to be monitored.	UINT	1~8 (0)	When <i>Enable</i> changes to TRUE

Note: Current state of the Scocket of the specified number and the occurrence of any error can be monitored through ETH\_Socket\_Status instruction.

### • Output Update Timing


Parameter name	Function	Data type	Valid range
Valid	TRUE when Socket data sending and receiving are both completed.	BOOL	TRUE/FALSE
Connected	TRUE when the connection to the target device is successful.	BOOL	TRUE/FALSE
Received	TRUE when data receiving is successful.	BOOL	TRUE/FALSE
Closed	TRUE when the link has been closed.	BOOL	TRUE/FALSE
Send	TRUE when data have been sent.	BOOL	TRUE/FALSE
Opening	TRUE when the link to the target device is being conducted.	BOOL	TRUE/FALSE
Receiving	TRUE when data are being received.	BOOL	TRUE/FALSE
Closing	TRUE when current link is being closed.	BOOL	TRUE/FALSE
Sending	TRUE when a timeout occurs in data sending or receiving.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE

Parameter name	Function	Data type	Valid range
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When Enable changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
Connected	<ul> <li>When Socket link is finished.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Closing</i> changes from FALSE to TRUE.</li> </ul>
Received	<ul> <li>When a piece of message receiving is completed.</li> </ul>	<ul> <li>When <i>Receiving</i> changes from FALSE to TRUE.</li> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
Closed	When Socket link is closed.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Opening</i> changes from FALSE to TRUE.</li> </ul>
Send	When a piece of message sending is completed.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Sending</i> changes from TRUE to FALSE.</li> </ul>
Opening	When the controller starts to build the Socket link or is waiting to be linked to.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Connected</i> changes from FALSE to TRUE.</li> </ul>
Receiving	<ul> <li>When the controller is receiving a piece of message.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Received</i> changes from FALSE to TRUE.</li> </ul>
Closing	<ul> <li>When Socket is disabled</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Closed</i> changes from FALSE to TRUE.</li> </ul>
Sending	◆ When a piece of message is being sent.	<ul> <li>When Enable changes from TRUE to FALSE.</li> </ul>
Error	<ul> <li>When an instruction execution error or Socket error occurs.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing

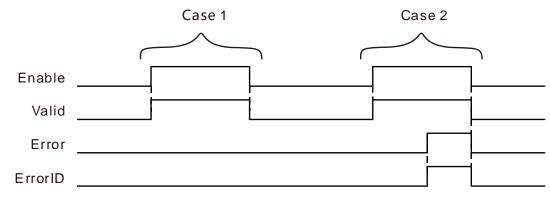

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* changes to FALSE.
- **Case 2**: When *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. When an error occurs in the instruction execution, *Error* changes to TRUE and *ErrorID* shows error codes and *Valid* keeps the state of TRUE. When *Enable* changes from TRUE to FALSE, *Valid* and *Error* both change to FALSE and the value in *ErrorID* changes to 0.

### Function

ETH\_Socket\_Status is used for monitoring current state of the Socket of the specified number. The firmware of V1.02 and above supports the function.

# 8.14.2.14 Ethernet Free Protocol Example

# Programming Example


### • Example of how to use ETH\_Socket\_Config instruction:


### > Variable table and the program

Variable name	Address	Data type	Initial value
TEST_BEGIN		BOOL	
ETH_Socket_Manage0		ETH_Socket_Manage	
M_En		BOOL	
M_SEN		BOOL	
M_Valid		BOOL	
M_SR		BOOL	
M_LErr		BOOL	
ETH_Socket_Config0		ETH_Socket_Config	
CON_Ex		BOOL	
CON_PType		USINT	1
CON_IP1		USINT	192
CON_IP2		USINT	168
CON_IP3		USINT	1
CON_IP4		USINT	10
CON_RP		UINT	502
CON_LP		UINT	502
CON_KT		UINT	30
CON_Done		BOOL	
CON_Bsy		BOOL	
CON_Err		BOOL	
CON_ErrID		WORD	
ETH_Socket_Open0		ETH_Socket_Open	
O_Ex		BOOL	
O_SMode		BOOL	TRUE
O_Done		BOOL	
O_Bsy		BOOL	
O_Err		BOOL	
O_ErrID		WORD	
ETH_Socket_Send0		ETH_Socket_Send	
S_Ex		BOOL	
S_Abort		BOOL	
S_CR		BOOL	TRUE
S_CT		UINT	100

Variable name	Address	Data type	Initial value
S_BFA	%MB200	USINT	
S_LTH		UINT	17
S_Done		BOOL	
S_Sent		BOOL	
S_Sending		BOOL	
S_Bsy		BOOL	
S_Act		BOOL	
S_Abt		BOOL	
S_Err		BOOL	
S_ErrID		WORD	
ETH_Socket_Receive0		ETH_Socket_Receive	
R_Ex		BOOL	
R_Abort		BOOL	
R_Mode		USINT	0
R_SMode		USINT	1
R_BFA	%MB600	USINT	
R_LTH		UINT 100	
R_Done		BOOL	
R_RECD		BOOL	
R_RING		BOOL	
R_RLTH		BOOL	
R_Bsy		BOOL	
R_Act		BOOL	
R_Abt		BOOL	
R_Err		BOOL	
R_ErrID		WORD	
ETH_Socket_Close0		ETH_Socket_Close	
C_Ex		BOOL	
C_Done		BOOL	
C_Bsy		BOOL	
C_Err		BOOL	
C_ErrID		WORD	
ETH_Socket_Status0		ETH_Socket_Status	
STA_En		BOOL TRUE	
STA_Valid		BOOL	
STA_CON		BOOL	
STA_REC		BOOL	
STA_CLO		BOOL	

Variable name	Address	Data type	Initial value
STA_Send		BOOL	
STA_OING		BOOL	
STA_RING		BOOL	
STA_CING		BOOL	
STA_SING		BOOL	
STA_Err		BOOL	
STA_ErrID		WORD	

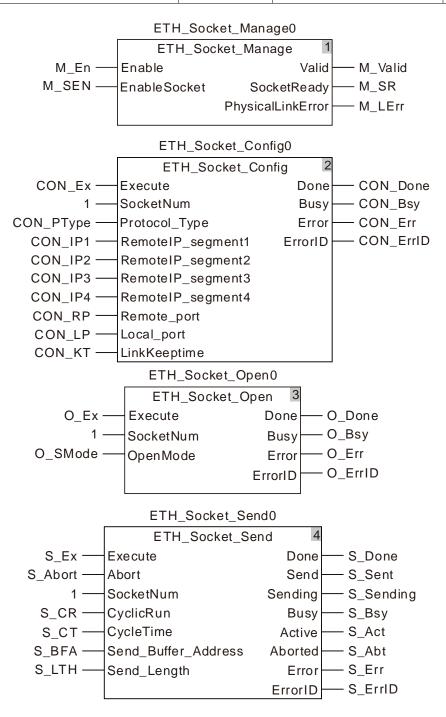

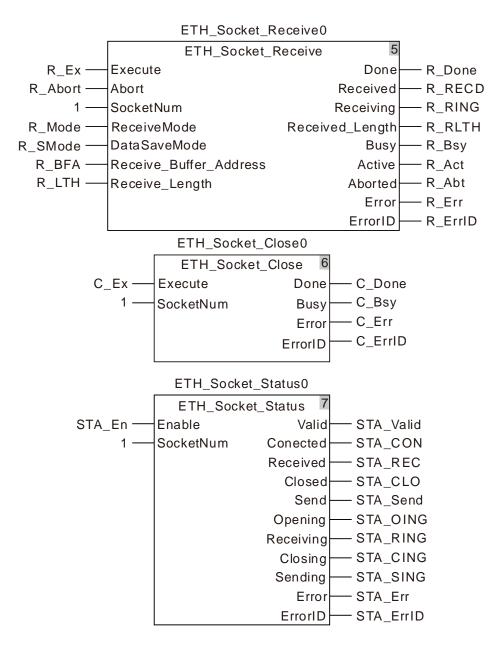

#### Operation steps and data exchange description

- The variables S\_BFA and R\_BFA are respectively bound to the addresses %MB200 and %MB600. After the program compiling is successful and download is completed, the online is performed. After the online is activated, the standard MODBUS TCP data "00 00 00 00 00 00 00 10 10 00 00 204 aa bb cc dd" are written to 17 consecutive %MB registers starting from %MB200.
- Execute ETH\_Socket\_Manage instruction first by setting *M\_En* to TRUE and then setting *M\_SEN* to TRUE. After *M\_SR* variable changes to TRUE, execute ETH\_Socket\_Config by setting *CON\_Ex* variable to TRUE.
- 3. After the execution of ETH\_Socket\_Config instruction is competed, execute ETH\_Socket\_Open instruction by setting *O\_Ex* to TRUE. The controller starts to build the link to the target host. Current connection state can be known by checking the output of ETH\_Socket\_Status instruction.

- After the controller builds the link to the target successfully, the output *Connected* of ETH\_Socket\_Status changes to TRUE. Then execute ETH\_Socket\_Send by setting S\_Ex to TRUE. The controller will cyclically send 17 bytes of data in the registers starting from %MB200 to the target host.
- 5. Execute ETH\_Socket\_Receive to receive the data that the target host returns or sends to the controller. The controller will receive and store the data constantly in the mode of covering in this example.
- 6. ETH\_Socket\_Close instruction is used to disable current link. After C\_Ex is set to TRUE, the controller will disconnect the link and stop sending and receiving data.

# 8.14.3 RS485 Communication Instructions

### 8.14.3.1 RS485\_Link\_Manage

FB/FC	Explanation	Applicable model
FB	RS485_Link_Manage is used for switching on or off RS485 communication.	AS524C-B

# RS485\_Link\_Manage\_instance RS485\_Link\_Manage Enable Valid Open LinkOpened

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Open	The 485 communication is switched on or off.	BOOL	TRUE or FALSE (FALSE)	When Enable changes from FALSE to TRUE


### Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
LinkOpened	TRUE when 485 communication is enabled.	BOOL	TRUE / FALSE

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	♦ When <i>Enable</i> changes to TRUE.	<ul> <li>When Enable changes from TRUE to FALSE.</li> </ul>
LinkOpened	<ul> <li>When <i>Enable</i> changes to TRUE, <i>Open</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Open</i> changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing Chart

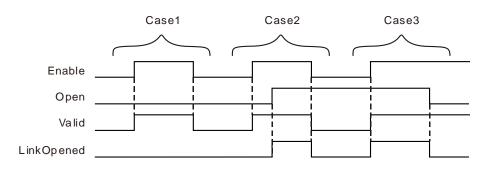

- **Case 1**: When *Enable* changes from FALSE to TRUE and Open is FALSE, Valid changes to TRUE and *LinkOpened* is FALSE.
- **Case 2** : As *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. In this case, LinkOpened changes to TRUE as Open changes from FALSE to TRUE. When Enable changes from TRUE to FALSE, Valid and LinkOpened change to FALSE.
- **Case 3** : As Open is TRUE and Enable changes from FALSE to TRUE, Valid and *LinkOpened* change to TRUE. As *Open* changes to FALSE, *LinkOpened* changes to FALSE.

#### • Function:

RS485\_Link\_Manage is used to enable or disable the RS485 communication. The firmware of V1.01 and above supports the function.

- 1. The input *Enable* is used to control the instruction to take effect or not. When *Enable* changes to FALSE, the operation of other parameters of the instruction will be invalid. When *Enable* changes to TRUE, the instruction will take effect and then the operation of other parameter of the instruction will be valid.
- 2. In the case that *Enable* is TRUE, the RS485 communication is switched on as *Open* changes to TRUE. The RS485 communication is switched off as *Open* is FALSE.
- Before the RS485 communication function is switched on, the parameters of the RS485\_Link\_Config instruction must have been configured.
   Otherwise, the configured parameters will be not effective if the RS485 function is switched on before the parameters of the RS485\_Link\_Config instruction are configured, unless the RS485 communication function is re-switched on.
- 4. After multiple LinkNum parameters are configured through RS485\_Link\_Config instructions, only one RS485\_Link\_Manage instruction is enough to switch on the RS485 communication function. And all configurations specified by RS485\_Link\_Config instructions are for the exchange data with the slave.

FB/FC	Explanation	Applicable model
FB	RS485_Link_Config is used for configuration of 485 communication parameters of AS524 controller.	AS524C-B
	RS485_Link_Config_instance	
	RS485_Link_Config	
	Execute Done	
	LinkNum Error	
	EnableLink ErrorID	
	Noncyclic	
	SlaveNodeID	
	— ОbjТуре	
	En_FunCode17	
	Write_Buffer_Address	
	Write_Buffer_Address_Offset	
	Write_Destination_Address	
	Write_Length	
	Write_FunCode	
	Read_Buffer_Address	
	Read_Buffer_Address_Offset	
	Read_Destination_Address	
	Read_Length	
	TimeOut	

# 8.14.3.2 RS485\_Link\_Config

# • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	Specify the number of the Link.	UINT	1~24 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
EnableLink	Enable or disable the Link.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Noncyclic	Set the Link communication mode FALSE: Cyclic, TRUE: Non-cyclic	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
SlaveNodeID	Specify the node ID of the 485 slave.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
ОbјТуре	Set the type of the slave register to be read and written 0: Word register 1: Bit register	USINT	0~1 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
En_FunCode17	Set the function code 17 to be used or not.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Write_Buffer_A	The starting register of the master	UINT	%MW0 ~	When Execute

8

Parameter name	Function	Data type	Valid range (Default)	Validation timing
ddress	where the sent data are stored		%MW32767 %QW0 ~ %QW63	changes from FALSE to TRUE
Write_Buffer_A ddress_Offset	Set the offset of the starting register of the master sending data. The setting value 1 means the offset is 1 word if data are written to the word address of the slave. The setting value 1 means the offset is 1 bit if data are written to the bit address of the slave.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Write_Destinati on_Address	The starting address of the MODBUS slave receiving the data from the master	UINT	Standard Modbus address	When <i>Execute</i> changes from FALSE to TRUE
Write_Length	The length of data to be written	UINIT	Word register: 0~100 Bit register: 0~256	When <i>Execute</i> changes from FALSE to TRUE
Write_FunCode	Specify the function code for writing data in registers.	USINT	Bit register: 05, 16#0F Word register: 06, 16#10 (16#10)	When <i>Execute</i> changes from FALSE to TRUE
Read_Buffer_A ddress	The starting register of the master where data received are stored.	UINT	%MW0~%MW327 67 %QW0~%QW63	When <i>Execute</i> changes from FALSE to TRUE
Read_Buffer_A ddress_Offset	Set the offset of the starting register of the master receiving data. The setting value 1 means the offset is 1 word if the word register of the slave is read. The setting value 1 means the offset is 1 bit if the bit register of the slave is read.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Read_Destinati on_Address	Set the starting address of the MODBUS slave to be read by the master.	UINT	Standard Modbus address	When <i>Execute</i> changes from FALSE to TRUE
Read_Length	The length of data to be read	UINT	Word register: 0~100 Bit register: 0~256	When <i>Execute</i> changes from FALSE to TRUE
Read_FunCode	Set the function code for reading data in registers.	USINT	Bit register: 01~02 Word register: 03~04 (03)	When <i>Execute</i> changes from FALSE to TRUE
Timeout	Set the time for the master to wait for the slave's response. The slave timeout occurs if the slave does not respond to the master request within the set time. Unit: ms	UINT	An integer greater than 0 ( 300 )	When <i>Execute</i> changes from FALSE to TRUE

Note:

- When the instruction without the Write\_FunCode input reads and writes data in Word register according to the selection of *ObjType*, the default function code to write data is 16#10 and the default function code to read data is 03. When *ObjType* specifies Bit register, the default function code to write data is 16#0F and the function code to read data, 01 or 02 is selected based on the type of bit registers by referring to corresponding product manual.
- 2. The firmware later than V1.02 supports the Write\_FunCode input of the instruction.
- 3. For the instruction with the Write\_FunCode input, Bit register or Word register can be selected via *ObjType*, the function code to write data can be specified via the Write\_FunCode input and the function code to read data can be specified via the Read\_FunCode input.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE When the configuration of Link parameters is successful.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
Error ID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the configuration of parameters is correct and <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALE.</li> </ul>
Error	<ul> <li>When the configuration of parameters is incorrect and <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALE.</li> <li>When <i>Execute</i> is re-triggered after the parameter configuration is modified correctly.</li> </ul>

#### • Output Update Timing Chart

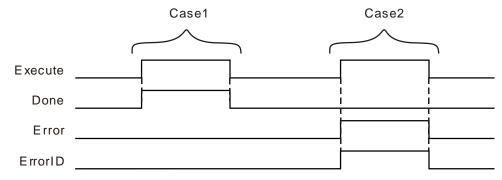

- **Case 1 :** If the configuration of parameters is correct, *Done* changes from FASLE to TRUE as *Execute* changes from FASLE to TRUE.
- **Case 2 :** If an error occurs in the configuration of parameters, *Done* is FASLE and *Error* changes from FALSE to TRUE as *Execute* changes from FASLE to TRUE.

# • Function

RS485\_Link\_Config is used to configure parameters for 485 communication Link. The firmware of V1.01 and above supports the function.

#### Precaution


- ObjType is the data type of the read and written parameter. When ObjType is 0, it means to read and write the word register of the slave. The range of Write\_Length and Read\_Length is 0~100 and the values of Write\_Length and Read\_Length can not be 0 at the same time.
   When ObjType is 1, it means to read and write the bit register of the slave. The range of Write\_Length and Read\_Length is 0~256 and the values of Write\_Length and Read\_Length can not be 0 at the same time. For local addresses, you can directly fill addresses, variables combined with addresses, arrays combined with the starting addresses.
- 2. For local address to fill the %MB address, you can only fill the low byte of the %MW address rather than the high byte.
- 3. For the register address of the slave, you can directly fill the MODBUS address and variable.
- 4. For the offset in the word operation, the actual address is calculated by word. For the offset in the bit operation, the actual address is calculated by bit. For example:
  - Actual address calculated via word offset : When the address is %MW0 and the offset is 15, the actual operation address is %MW15=%MW (0+15).
  - Actual address calculated via bit offset: When the address is %QW0 and the offset is 7, the actual operation address is %QX0.7.
- 5. If you choose to read and write the word register of the slave, the %MW register of the local device can be regarded as the storage register for reading and writing data. The range of the storage register is %MW0~%MW32767. If the range is exceeded or other register is used, an error will occur in the instruction.
- 6. If you choose to read and write the bit register of the slave, the %MW and %QW registers of the local device can be regarded as the storage registers for reading and writing data. The ranges of the storage register are %MW0~%MW32767 and %QW0~%QW63. If the ranges are exceeded or other register is used, an error will occur in the instruction.
- 7. The set parameter values of this instruction are only valid during the operation of the PLC. When the motion controller is repowered after power off, the parameters configured before the power off are all invalidated. The ETH\_Link\_Config instruction must be re-executed if the configuration before the power off is needed to use.
- 8. Set the communication mode via the input parameter *Noncyclic*. The communication mode is the cyclic communication mode if *Noncyclic* is set to FALSE. The communication mode is the non-cyclic communication mode if *Noncyclic* is set to TRUE.
  - a. Cyclic Communication Mode: When the current Link is set as cyclic communication mode. The configuration for the Link will be effective immediately and the data exchange between the master and slave will be conducted cyclically after RS485 communication function is enabled via RS485\_Link\_Manage instruction.
     The configuration for the link will not be executed and the data exchange with the slave will stop after RS485 communication function is disabled via RS485\_Link\_Manage instruction.
  - b. Non-Cyclic Communication Mode: When the current Link is set as non-cyclic communication mode. The configuration for the Link will be effective immediately and the data exchange between the master and slave will be conducted only once after RS485 communication function is enabled via RS485\_Link\_Manage instruction.
     If the data exchange between the master and the slave is to be made once again, re-enable

RS485 communication function after RS485 communication function is disabled via RS485\_Link\_Manage instruction.

# 8.14.3.3 RS485\_Link\_Status

FB/FC	Explanation	Applicable model
FB	RS485_Link_Status is used to watch if an error occurs in the 485 link which the number corresponds to or if the slave replies with error codes.	AS524C-B

# RS485\_Link\_Status\_instance

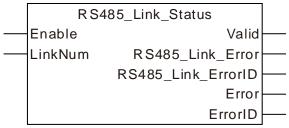

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is validated when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	The number of the link to be watched.	UINT	1~24 (The variable value must be set)	When <i>Enable</i> changes from FALSE to TRUE

# Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
RS485_Link_Error	TRUE when an error occurs in the corresponding link. It is valid when <i>Error</i> is FALSE.	BOOL	TRUE / FALSE
RS485_Link_ErrorID	<ul> <li>Outputs communication error code. See error codes and their meanings as below:</li> <li>1: Unidentified function code</li> <li>2: The address in the response message from the slave is different from the configured address.</li> <li>3: The length of received data in the response message from the slave is inconsistent with the configured length.</li> <li>4: Data-receiving timeout</li> <li>5: Checksum error</li> <li>6: The configured lengths of data to be read and written are both 0.</li> <li>7: The length of the data that is actually received exceeds the max. received data length.</li> <li>8: Data-sending timeout</li> <li>16#80+ exception code: the exception code from the slave</li> </ul>	WORD	
Error	TRUE when an error occurs in the instruction inputs.	BOOL	TRUE / FALSE

Parameter name	Function	Data type	Valid range
	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When <i>Enable</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
		<ul> <li>The communication is restored to normal. (<i>Error</i> is FALSE.)</li> </ul>
RS485_Link_Error	<ul> <li>When an error occurs in the communication as <i>Enable</i> is TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
		<ul> <li>When Open of RS485_Link_Manage changes from TRUE to FALSE. (Error is FALSE.)</li> </ul>
Error	<ul> <li>When an error occurs in the instruction inputs as <i>Enable</i> is TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When the correct parameter value is filled.</li> </ul>

## • Output Update Timing Chart

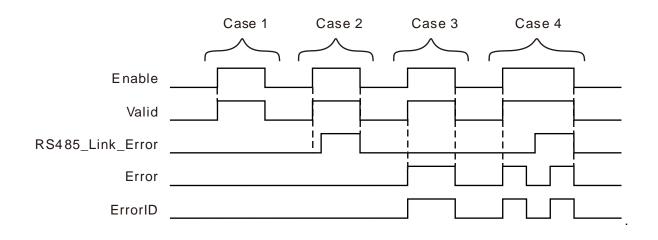

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE. (There is no error both in the communication and instruction inputs.)
- **Case 2**: If there is an error in the communication, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE and after a while, *RS485\_Link\_Error* changes to TRUE.
- **Case 3**: If there is an error in the instruction inputs, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE and *Error* changes to TRUE.
- Case 4 : If there is an error both in the communication and in the instruction inputs, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE, *Error* changes to TRUE and *RS485\_Link\_Error* is still FALSE. After the input parameter values are modified correctly, *Error* changes to FALSE and after a while, *RS485\_Link\_Error* changes to TRUE. When the input parameter error occurs again, *Error* changes to TRUE. At the moment, there will be no change in *RS485\_Link\_Error* no matter whether the communication works normally. When *Enable* is

TRUE and Error is TRUE, the state of RS485\_Link\_Error will not be refreshed and will be invalid.

#### • Function

RS485\_Link\_Status is used for watching the communication state of the corresponding link. The firmware of V1.01 and above supports the function.

## Precaution

- 1. The state of *RS485\_Link\_Error* will not be refreshed and will be invalid when *Enable* is TRUE and *Error* is TRUE.
- 2. The input value of *LinkNum* can be a number or variable.

8

# 8.14.3.4 RS485 Data Exchange Example

# Programming Example

- The node address of the slave DVP32ES2 is 1. The values in 10 word registers %MW100~%MW109 of the master are written to D0~D9 in the slave. Then the values in 20 word registers D100~D1190f the slave are read and stored in %MW0~%MW19 in the master as shown in the following variable table 1.
  - > Variable table 1

Variable name	Address	Data type	Initial value
Mng		RS485_Link_Manage	
Mng_En		BOOL	TRUE
Mng_Open		BOOL	FALSE
Mng_Valid		BOOL	
Mng_LOpen		BOOL	
Confg		RS485_Link_Config	
Confg _Ex		BOOL	FALSE
Confg _LN		UINT	1
Confg _EL		BOOL	TRUE
Confg _Ncyc		BOOL	FALSE
Confg_SNI		USINT	1
Confg_OT		USINT	0
Confg_EFC17		BOOL	FALSE
Confg_WBA	%MW100	UINT	
Confg_WBAO		USINT	0
Confg_WDA		UINT	16#1000
Confg_WL		UINT	10
Confg _WFC		USINT	16#10
Confg_RBA	%MW0	UINT	
Confg_RBAO		USINT	0
Confg_RDA		UINT	16#44C
Confg_RL		UINT	20
Confg_RFC		USINT	16#03
Confg _TOut		UINT	1000
Confg _Done		BOOL	
Confg _Err		BOOL	
Confg _ErrID		WORD	
LStatus		RS485_Link_Status	
LStatus_En		BOOL	TRUE
LStatus_LN		UINT	1
LStatus_Valid		BOOL	
LStatus_RLE		BOOL	

Variable name	Address	Data type	Initial value
LStatus_RLEID		BOOL	
LStatus_Err		BOOL	
LStatus_ErrID		WORD	

After these parameter settings are done, set Confg \_Ex to TRUE and then Mng\_Open to TRUE. If the configuration need be modified during the communication, the input Confg\_Ex should be triggered on the rising edge, Mng\_Open should be set to FALSE and then to TRUE after the new configuration data are set up.


■ The node address of the slave DVP32ES2 is 1. The values in 31 bit devices %MX0.0~%MX3.6 of the master are written to Y0~Y30 in the slave. Then the values in Y0~Y30 of the slave are read and stored in the 31 bit devices %QX0.1~%QX3.7 in the master as shown in the following variable table 2.

Name	Address	Data type	Initial value
Mng		RS485_Link_Manage	
Mng_En		BOOL	TRUE
Mng_Open		BOOL	FALSE
Mng_Valid			
Mng_LOpen			
Confg		RS485_Link_Config	
Confg _Ex		BOOL	FALSE
Confg _LN		UINT	1
Confg _EL		BOOL	TRUE
Confg _Ncyc		BOOL	FALSE
Confg _SNI		USINT	1
Confg _OT		USINT	1
Confg _EFC17		BOOL	FALSE
Confg _WBA	%MW0	UINT	
Confg _WBAO		USINT	0
Confg _WDA		UINT	16#0400
Confg _WL		UINT	31
Confg _WFC		USINT	16#0F
Confg _RBA	%QW0	UINT	
Confg_RBAO		USINT	1
Confg _RDA		UINT	16#0400
Confg _RL		UINT	31
Confg _RFC		USINT	
Confg _TOut		UINT	1000
Confg _Done			
Confg _Err			

> Variable table 2

Name	Address	Data type	Initial value
Confg _ErrID			
LStatus		RS485_Link_Status	
LStatus_En		BOOL	TRUE
LStatus_LN		UINT	1
LStatus_Valid			
LStatus_RLE			
LStatus_RLEID			
LStatus_Err			
LStatus_ErrID			

# Program

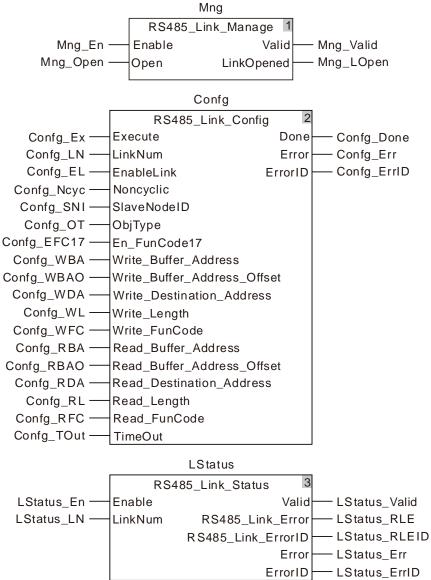

# 8.14.3.5 RS485\_RS

FB/FC	Explanation	Applicable model
FB	RS485_RS is used to configure RS485 free protocol communication parameters for the motion controller.	AS524C-B

#### RS485\_RS\_instance

RS	485_RS	
 Execute	Done	
 Abort	Busy	
 CyclicRun	Active	
 Send_Buffer_Addres	ss Aborted	
 Send_Length	NewCycle	
 Receive_Buffer_Add	dress Received	
 Receive_Length	Receive_TimeOut	
 Add_STX_ETX I	Receive_LengthOverMAX	
 STX	Receive_ActulLength	
 ETX1	Error	
 ETX2	ErrorID	
 Timeout		

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Abort	The free protocol communication is aborted when <i>Abort</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
CyclicRun	Communication mode setting for the instruction. FALSE: Non-cyclic; TRUE: Cyclic	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Send_Buffer_Address	Specify the starting register of the master where the sent data are stored.	USINT	%MB0-%MB32767	When <i>Execute</i> changes from FALSE to TRUE
Send_length	Set the length of sent data.	UINT	0-200(Byte) (0)	When <i>Execute</i> changes from FALSE to TRUE
Receive_Buffer_Address	Specify the starting register of the master where the received data are stored.	USINT	%MB0-%MB32767	When <i>Execute</i> changes from FALSE to TRUE
Receive_Length	Set the length of received data.	UINT	0-200(Byte) (0)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Add_STX_ETX	Set if the start and end codes are added or not in sent messages. FALSE: Not add the start and end codes. TRUE: Add the start and end codes.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
STX	Set the start of messages.	USINT	0-16#7F (16#3A)	When <i>Execute</i> changes from FALSE to TRUE
ETX1	Set the first end of messages.	USINT	0-16#7F (16#0D)	When <i>Execute</i> changes from FALSE to TRUE
ETX2	Set the second end of messages.	USINT	0-16#7F (16#0A)	When <i>Execute</i> changes from FALSE to TRUE
TimeOut	Set the timeout time when receiving data.	UINT	0-32767 (0)	When <i>Execute</i> changes from FALSE to TRUE

### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the communication proceeds.	BOOL	TRUE / FALSE
Aborted	TRUE when current execution of the instruction is aborted.	BOOL	TRUE / FALSE
Active	TRUE when the port is controlled by the instruction.	BOOL	TRUE / FALSE
NewCycle	TRUE when the instruction execution is completed once (in the multi-cycle state)	BOOL	TRUE / FALSE
Received	TRUE when receiving is successful.	BOOL	TRUE / FALSE
Receive_TimeOut	TRUE when timeout in message receiving occurs.	BOOL	TRUE / FALSE
Receive_LengthOverMAX	TRUE when the length of received data exceeds the max. length allowed.	BOOL	TRUE / FALSE
Receive_ActulLength	Actually received data length	UINT	0-200
Error	TRUE when an instruction configuration error occurs.	BOOL	TRUE / FALSE

8

Parameter name	Function	Data type	Valid range
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	


# Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>After Execute changes from FALSE to TRUE and Busy changes to TURE in the one single cycle work state</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE in the single cycle work state.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Abort</i> changes to TRUE in the multi-cycle state.</li> <li>When <i>Done</i> changes to TRUE in the one-single-cycle state.</li> </ul>
Aborted	<ul> <li>When <i>Abort</i> changes from FALSE to TRUE for the first time.</li> <li>When current instruction is aborted by another instruction in the multi-cycle state.</li> </ul>	FALSE.
Active	<ul> <li>When Execute changes from FALSE to TRUE.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> <li>When current instruction is aborted by another instruction in the multi-cycle state.</li> <li>When Done changes to TRUE in the one-single-cycle state.</li> </ul>
NewCycle	<ul> <li>When the PLC completes one cycle of work in the multi-cylce state.</li> </ul>	<ul> <li>When the instruction enters the next cycle for receiving and sending data.</li> </ul>
Received	<ul> <li>When the instruction receives the response message.</li> </ul>	<ul> <li>When the next cycle is entered after the instruction receives the response message.</li> </ul>
Receive_TimeOut	When the parameter configuration for receiving data has been done and the response message is not received within the set timeout time.	<ul> <li>When the response message is received.</li> </ul>
Receive_LengthOverMAX	<ul> <li>When the length of actually received data is greater than the max. length allowed.</li> </ul>	<ul> <li>When the length of received data is less than the max. length allowed.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction parameter configuration.</li> </ul>	<ul> <li>When the instruction configuration data are correct.</li> </ul>

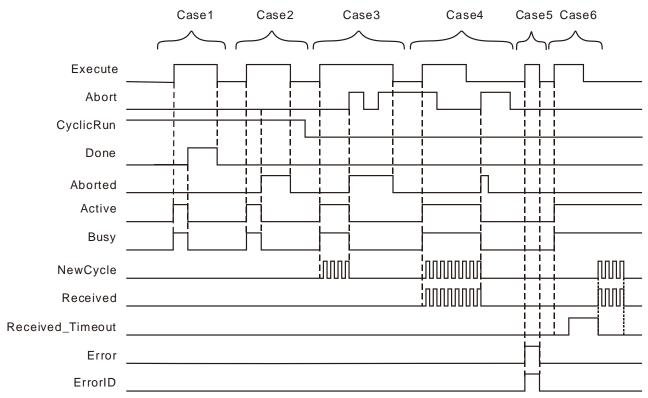

# • Output Update Timing Chart

- **Case 1**: In the one-single-cycle work state, *Busy* changes to TRUE when *Execute* changes from FALSE to TRUE. When the instruction execution is completed, *Busy* changes to FALSE and *Done* changes to TRUE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: In the one-single-cycle work state, *Busy* and *Active* change to FALSE and *Abort* changes to TRUE when the instruction is aborted by other instruction. Then *Aborted* changes to FALSE when *Execute* changes to FALSE. If *Execute* changes to FALSE before the instruction is aborted, *Aborted* changes to TRUE for one cycle.
- **Case 3**: In the multi-cycle state where only the data-sending parameters are configured, when *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. After a while, *Newcycle* changes between TRUE and FALSE alternately. When *Abort* changes to TRUE, *Busy* changes to FALSE and *Aborted* to TRUE. When *Abort* changes to FALSE, *Aborted* remains TRUE. *Aborted* remains TRUE when *Abort* changes to TRUE again. *Aborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the multi-cycle state where the parameters for receiving and sending data have been configured and *Abort* is TRUE, *Busy* changes to TRUE when *Execute* changes from FALSE to TRUE. After a while, both of *Newcycle* and *Received* begin *to* change between TRUE and FALSE alternately. When triggering *Abort* again after *Execute* changes from TRUE to FALSE, *Aborted* changes to TRUE, one cycle later, changes to FALSE and others change to FALSE.
- **Case 5** : If there is an error in the configured parameters of the instruction, *Error* changes to TRUE as *Execute* changes from FALSE to TRUE. *Error* changes to FALSE as *Execute* changes to FALSE.
- **Case 6**: In the event that the timeout of receiving data occurs, when *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and after a while, *Receive\_Timeout* changes to TRUE. When the communication is restored to normal, both of *NewCycle* and *Received* start to change between TRUE and FALSE alternately.

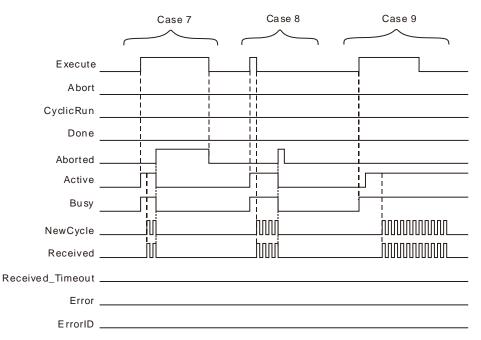

- **Case 7**: In the multi-cycle state where *Execute* is TRUE, when the instruction is aborted by other instruction, *Aborted* changes to TRUE, *Execute* changes to FALSE and *Aborted* changes to FALSE.
- **Case 8** : In the multi-cycle state where *Execute* is FALSE, when the instruction is aborted by other instruction, *Aborted* changes to TRUE and one cycle later, changes to FALSE.
- **Case 9**: When the instruction is aborted by other instruction, *Busy* changes to TRUE. After a while, *Active* changes to TRUE and other outputs give corresponding output according to the cases above.

## • Function

RS485\_RS is used to configure RS485 free protocol communication parameters and watch the communication status. The firmware of V1.01 and above supports the function.

## Precaution

- 1. RS485\_RS does not add the checksum automatically. In ASCII mode, the data sent out are required to be the ASCII message which has been converted into.
- 2. The total length of sent data is 200 Bytes. The length set in the instruction does not include that of the start and end of sent messages.
- 3. Add\_STX\_ET sets if the header and footer codes are added or not in the sent message. The function is only enabled when the header and footer codes of the sent message are identical to those of the received message. Otherwise, the function can not be enabled if the header and footer codes of the sent message differ from those of the received message and in this case, an error will occur if the function is enabled.
  - a. The header code and footer code set in the instruction are for the sent messages. If the sent message is correct but the header code and footer code in the received message are different from those of the sent message, the controller will fail to receive the message and the timeout will happen during receiving.
  - b. The header code and footer code set in the instruction are for the sent message. So the slave will not give a response if the sent message does not conform to the slave message requirement.
     Thus, the function could not be enabled when the header and footer codes of the sent message are not identical to those of the received message.
- 4. When RS485\_RS and RS\_485\_Link\_Config exist together,
  - a) When *Execute* of RS485\_RS instruction changes from FALSE to TRUE, the 485Link function of the PLC will take effect.

- b) When *Abort* of RS485\_RS instruction changes from FALSE to TRUE, the 485Link function which is being performed will take effect again.
- c) When *Execute* of RS485\_RS instruction changes from FALSE to TRUE, *Enable* of RS485\_Link\_Manage changes to TRUE, *Open* of the instruction can control the functions of 485 link and free protocol communication.
- d) If there are several RS485\_RS instructions in the program, only one of them, which is triggered the last time will take effect.
- e) For the message which is sent out via RS485\_RS instruction, the address where received data are stored must be set in the RS485\_RS instruction if the slave sends the response message.

8

# 8.14.3.6 RS485 Free Protocol Example

# Programming Example 1

#### • Enabling the function of the start and end of messages

The free protocol is applied to send a standard Modbus message in ASCII mode with the starting address %MB4000 where sent data are stored and %MB5000 where received data are stored and receive the response data from the slave.

Message content: 01 10 15 00 00 01 02 00 08.

The checksum CF is calculated first. Then the message is converted into ASCII code.

Message content after conversion: 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46.

If the parameters of RS485\_RS instruction are configured based on variable table 1, the data in %MB4000~%MB4019 are 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 30 38 43 46.

The message data on the bus: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46 0D 0A.

Variable name	Address	Data type	Initial value
RS		RS485_RS	
RS_Ex		BOOL	FALSE
RS_Abort		BOOL	FALSE
RS_CyRun		BOOL	TRUE
RS_SBA	%MB4000	USINT	16#30
RS_SL		UINT	20
RS_RBA	%MB5000	USINT	
RS_RL		UINT	23
RS_AddSE		BOOL	1
RS_Tout		UINT	500
RS_Done		BOOL	
RS_Bsy		BOOL	
RS_Abt		BOOL	
RS_Act		BOOL	
RS_NCyc		BOOL	
RS_Rec		BOOL	
RS_RTO		BOOL	
RS_RLOM		BOOL	
RS_RAL		UINT	
RS_Err		BOOL	
RS_ErrID		WORD	

#### Variable table 1

• Disabling the function of the start and end of messages

1. The free protocol is applied to send a standard Modbus message in ASCII mode with the starting address %MB4000 where sent data are stored and %MB5000 where received data are stored and receive the response data from the slave.

Message content: 01 10 15 00 00 01 02 00 08 ·

The checksum CF is calculated first. Then the message is converted into ASCII code.

Message content after conversion: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 30 38 43 46 0D 0A

 If the parameters of RS485\_RS instruction are configured based on variable table 2, the data in %MB4000~%MB4022 are 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46 0D 0A

The message data on the bus: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 30 38 43 46 0D 0A

### > Variable table 2

Variable name	Address	Data type	Initial value
RS		RS485_RS	
RS_Ex		BOOL	FALSE
RS_Abort		BOOL	FALSE
RS_CyRun		BOOL	TRUE
RS_SBA	%MB4000	USINT	16#3A
RS_SL		UINT	23
RS_RBA	%MB5000	USINT	
RS_RL		UINT	23
RS_AddSE		BOOL	0
RS_Tout		UINT	500
RS_Done		BOOL	
RS_Bsy		BOOL	
RS_Abt		BOOL	
RS_Act		BOOL	
RS_NCyc		BOOL	
RS_Rec		BOOL	
RS_RTO		BOOL	
RS_RLOM		BOOL	
RS_RAL		UINT	
RS_Err		BOOL	
RS_ErrID		WORD	

# > Program

		RS		_
	R	S485_RS	6 1	
RS_Ex —	Execute		Done	— RS_Done
RS_Abort	Abort		Busy	— RS_Bsy
RS_CyRun —	CyclicRun		Active	— RS_Act
RS_SBA —	Send_Buffer_Addre	ess	Aborted	— RS_Abt
RS_SL —	Send_Length		NewCycle	— RS_NCyc
RS_RBA —	Receive_Buffer_Ad	ldress	Received	— RS_Rec
RS_RL	Receive_Length		Receive_TimeOut	- RS_RTO
RS_AddSE —	Add_STX_ETX	Receive	_LengthOverMAX	- RS_RLOM
	STX	Red	eive_ActulLength	- RS_RAL
	ETX1		Error	— RS_Err
	ETX2		ErrorID	
RS_Tout	Timeout			

# 8.14.3.7 RS485\_SetDelayTime

FB/FC	Explanation	Applicable model				
FB	RS485_SetDelayTime sets the response-delay time at the RS485 communication port of the controller.	AS524C-B				
	RS485 SetDelayTime Instance					



### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
DelayTime	The response-delay time at the RS485 communication port of the controller. It is valid no matter whether the controller serves as a master or a slave. (Unit: ms)	UINT	0~65535 (0)	When <i>Execute</i> changes to TRUE


## Output Parameters

Parameter name Function		Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
Error ID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

# • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

# • Output Update Timing Chart

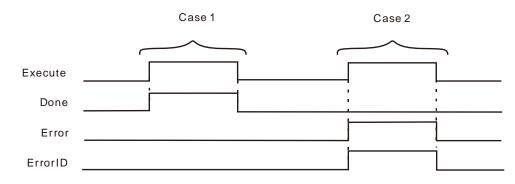

- Case 1 : When *Execute* changes from FALSE to TRUE, *DONE* changes from FALSE to TRUE.
- **Case 2** : When an error occurs as *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.

#### • Function

The RS485\_SetDelayTime instruction is used to set the response-delay time of the controller RS485 communication port. The setting time is valid when the RS485 communication port of the controller serves as a master or slave.

When RS485 communication port works as a master, it will not send a next message until the set delay time elapses after receiving the response data from the slave. When the RS485 communication port works as a slave, it will not reply to the master until the set delay time elapses after receiving the data from the master.

# 8.14.4 RS232 Communication Instructions

# 8.14.4.1 RS232\_Link\_Manage

FB/FC	Explanation	Applicable model
FB	RS232_Link_Manage is used for switching on or off RS232 communication.	AS524C-B
	RS232_Link_Manage_instance	

# RS232\_Link\_Manage Enable Valid Open LinkOpened

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Open	232 communication is switched on or off.	BOOL	TRUE or FALSE (FALSE)	When Enable changes from FALSE to TRUE


#### • Output Parameters

Parameter name Function		Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
LinkOpened	TRUE when 232 communication is enabled.	BOOL	TRUE / FALSE

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE	
Valid	♦ When <i>Enable</i> changes to TRUE	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>	
LinkOpened	<ul> <li>When <i>Enable</i> changes to TRUE and <i>Open</i> changes to TRUE</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Open</i> changes from TRUE to FALSE</li> </ul>	

# • Output Update Timing Chart

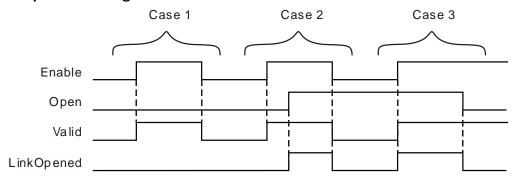

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Open* changes to FALSE, *Valid* changes to TRUE and *LinkOpened* changes to FALSE.
- **Case 2**: As *Enable* changes from FALSE to TRUE, *Valid* changes to TRUE. In this case, *LinkOpened* changes to TRUE as *Open* changes from FALSE to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* and *LinkOpened* change to FALSE.
- **Case 3**: As *Open* is TRUE and *Enable* changes from FALSE to TRUE, *Valid* and *LinkOpened* change to TRUE. As *Open* changes to FALSE, *LinkOpened* changes to FALSE.


#### • Function

RS232\_Link\_Manage is used to enable or disable the RS232 communication. The firmware of V1.01 and above supports the function.

- 0. The input *Enable* is used to control the instruction to take effect or not. When *Enable* changes to FALSE, the operation of other parameters of the instruction will be invalid. When *Enable* changes to TRUE, the instruction takes effect and then the operation of other parameter of the instruction will be valid.
- 1. In the case that *Enable* is TRUE, the RS232 communication is switched on as *Open* changes to TRUE. The RS232 communication is switched off as *Open* is FALSE.
- Before the RS232 communication function is switched on, the parameters of the RS232\_Link\_Config instruction must have been configured. Otherwise, the configured parameters will be not effective if the RS232 function is switched on before the parameters of the RS232\_Link\_Config instruction are configured, unless the RS232 communication function is re-switched on.
- After multiple LinkNum parameters are configured through RS232\_Link\_Config instructions, only one RS232\_Link\_Manage instruction is enough to switch on the RS232 communication function. And all configurations specified by RS232\_Link\_Config instructions are for the exchange data with the slave.

FB/FC	Explanation	Applicable model
FB	RS232_Link_Config is used for configuration of RS232 communication parameters of the motion controller.	AS524C-B

# 8.14.4.2 RS232\_Link\_Config

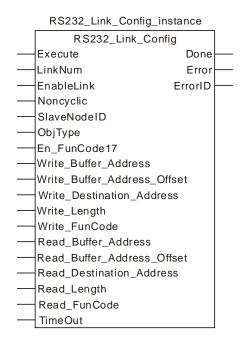

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	Specify the number of the Link.	UINT	1~24 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
EnableLink	Enable or disable the Link.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Noncyclic	Set the Link communication mode FALSE: Cyclic, TRUE: Non-cyclic	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
SlaveNodeID	Set the node ID of the 232 slave	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
ОbјТуре	Set the type of the slave register to be read and written. 0: Word register 1: Bit register	USINT	0~1 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
En_FunCode17	Set if the function code 17 is used or not.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from

Parameter name	Function	Data type	Valid range (Default)	Validation timing
				FALSE to TRUE
Write_Buffer_Ad dress	The starting register of the master where the data sent are stored	UINT	%MW0 ~ %MW32767 %QW0 ~ %QW63	When <i>Execute</i> changes from FALSE to TRUE
Write_Buffer_Ad dress_Offset	Set the offset of the starting register of the master sending data. The setting value 1 means the offset is 1 word if the word address of the slave is written. The setting value 1 means the offset is 1 bit if the bit address of the slave is written.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Write_Destinatio n_Address	Set the starting address of the MODBUS slave receiving the data from the master	UINT	Standard Modbus address	When <i>Execute</i> changes from FALSE to TRUE
Write_Length	The length of data to be written	UINIT	Word register: 0~100 Bit device: 0~256	When <i>Execute</i> changes from FALSE to TRUE
Write_FunCode	Specify the function code for writing data in registers.	USINT	Bit register: 05, 16#0F Word register: 06, 16#10 (16#10)	When <i>Execute</i> changes from FALSE to TRUE
Read_Buffer_Ad dress	The starting register of the master where data received are stored.	UINT	%MW0~%MW32767 %QW0~%QW63	When <i>Execute</i> changes from FALSE to TRUE
Read_Buffer_Ad dress_Offset	Set the offset of the starting register of the master receiving data. The setting value 1 means the offset is 1 word if the word register of the slave is read. The setting value 1 means the offset is 1 bit if the bit register of the slave is read.	USINT	0~255 (0)	When <i>Execute</i> changes from FALSE to TRUE
Read_Destinatio n_Address	Set the starting address of the MODBUS slave to be read by the master	UINT	Standard Modbus address	When <i>Execute</i> changes from FALSE to TRUE
Read_Length	The length of data to be read	UINT	Word register: 0~100 Bit register: 0~256	When <i>Execute</i> changes from FALSE to TRUE
Read_FunCode	Set the function code for reading data in registers.	USINT	Bit register: 01~02 Word register: 03~04 (03)	When <i>Execute</i> changes from FALSE to TRUE
Timeout	Set the time for the master to wait for the slave's response. The slave timeout occurs if the slave does not respond to	UINT	An integer greater than 0 (300)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
	the master request within the set time. Unit: ms			

Note:


- When the instruction without the Write\_FunCode input reads and writes data in Word register according to the selection of *ObjType*, the default function code to write data is 16#10 and the default function code to read data is 03. When *ObjType* specifies Bit register, the default function code to write data is 16#0F and the function code to read data, 01 or 02 is selected based on the type of bit registers by referring to corresponding product manual.
- 2. The firmware later than V1.02 supports the Write\_FunCode input of the instruction.
- 3. For the instruction with the Write\_FunCode input, Bit register or Word register can be selected via *ObjType*, the function code to write data can be specified via the Write\_FunCode input and the function code to read data can be specified via the Read\_FunCode input.

Parameter name	Function	Data type	Valid range
Done	TRUE When the configuration of Link parameters is successful.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
Error ID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

#### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the configuration of parameters is correct and <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	◆ When <i>Execute</i> changes from TRUE to
Error	<ul> <li>When the configuration of parameters is incorrect and <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	► When Execute is the triggered after the

## • Output Update Timing Chart

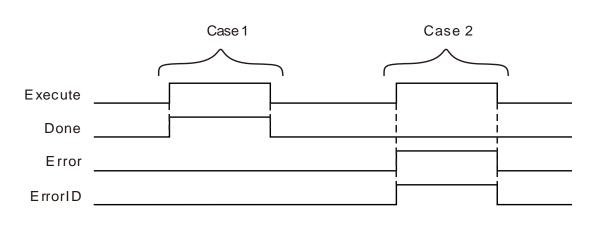

8\_

- **Case 1**: When the configuration of parameters is correct and *Execute* changes from FALSE to TRUE, *Done* changes from FALSE to TRUE.
- **Case 2**: When the configuration of parameters is incorrect and *Execute* changes from FALSE to TRUE, *Done* is FALSE and *Error* changes from FALSE to TRUE.

#### • Function

RS232\_Link\_Config is used to configure parameters for 232 communication Link. The firmware of V1.01 and above supports the function.

#### • Precaution

- ObjType is the data type of the read and written parameter. When ObjType is 0, it means to read and write the word register of the slave. The range of Write\_Length and Read\_Length is 0~100 and the values of Write\_Length and Read\_Length can not be 0 at the same time.
   When ObjType is 1, it means to read and write the bit register of the slave. The range of Write\_Length and Read\_Length is 0~256 and the values of Write\_Length and Read\_Length can not be 0 at the same time. For local addresses, you can directly fill addresses, variables combined with addresses, arrays combined with the starting addresses.
- 2. For local address to fill the %MB address, you can only fill the low byte of the %MW address rather than the high byte.
- 3. For the register address of the slave, you can directly fill the MODBUS address and variable.
- 4. For the offset in the word operation, the actual address is calculated by word. For the offset in the bit operation, the actual address is calculated by bit.

# For example:

- Actual address calculated via word offset : When the address is %MW0 and the offset is 15, the actual operation address is %MW15=%MW (0+15).
- Actual address calculated via bit offset: When the address is %QW0 and the offset is 7, the actual operation address is %QX0.7.
- 5. If you choose to read and write the word register of the slave, the %MW register of the local device can be regarded as the storage register for reading and writing data. The range of the storage register is %MW0~%MW32767. If the range is exceeded or other register is used, an error will occur in the instruction.
- 6. If you choose to read and write the bit register of the slave, the %MW and %QW registers of the local device can be regarded as the storage registers for reading and writing data. The ranges of the storage register are %MW0~%MW32767 and %QW0~%QW63. If the ranges are exceeded or other register is used, an error will occur in the instruction.
- 7. The set parameter values of this instruction are only valid during the operation of the PLC. When the motion controller is repowered after the power off, the parameters configured before the power off are all invalidated. The ETH\_Link\_Config instruction must be re-executed if the configuration before the power off is needed to use.
- 8. Set the communication mode via the input parameter *Noncyclic*. The communication mode is the cyclic communication mode if *Noncyclic* is set to FALSE. The communication mode is the non-cyclic communication mode if *Noncyclic* is set to TRUE.
  - a. Cyclic Communication Mode: When the current Link is set as cyclic communication mode. The configuration for the Link will be effective immediately and the data exchange between the master and slave will be conducted cyclically after RS232 communication function is enabled via RS232\_Link\_Manage instruction.
    The configuration for the link will not be executed and the data exchange with the eleve will store.

The configuration for the link will not be executed and the data exchange with the slave will stop after RS232 communication function is disabled via RS232\_Link\_Manage instruction.

b. Non-Cyclic Communication Mode: When the current Link is set as non-cyclic communication mode. The configuration for the Link will be effective immediately and the data exchange between the master and slave will be conducted only once after RS232 communication function

is enabled via RS232\_Link\_Manage instruction.


If the data exchange between the master and the slave is to be made once again, re-enable RS232 communication function after RS232 communication function is disabled via RS232\_Link\_Manage instruction.

8

# 8.14.4.3 RS232\_Link\_Status

FB/FC	Explanation	Applicable model
FB	RS232_Link_Status is used to watch if an error occurs in the 232 link which the number corresponds to or the slave replies with error codes.	AS524C-B

# RS232\_Link\_Status\_instance

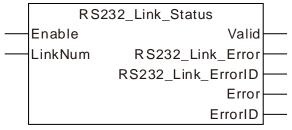

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is validated when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
LinkNum	The number of the link to be watched.	UINT	1~24 (The variable value must be set)	When <i>Enable</i> changes from FALSE to TRUE

# • Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the outputs of the instruction are valid.	BOOL	TRUE / FALSE
RS232_Link_Error	TRUE when an error occurs in the corresponding link. It is valid when <i>Error</i> is FALSE.	BOOL	TRUE / FALSE
RS232_Link_ErrorID	<ul> <li>Outputs communication error code. See error codes and their meanings as below:</li> <li>1: Unidentified function code</li> <li>2: The address in the response message from the slave is different from the configured address.</li> <li>3: The length of received data in the response message from the slave is inconsistent with the configured length.</li> <li>4: Data-receiving timeout</li> <li>5: Checksum error</li> <li>6: The configured lengths of data to be read and written are both 0.</li> <li>7: The length of the data that is actually received exceeds the max. received data length.</li> <li>8: Data-sending timeout</li> <li>16#80+ exception code: the exception code from the slave</li> </ul>	WORD	
Error	TRUE when an error occurs in the instruction inputs.	BOOL	TRUE / FALSE

Parameter name	Function	Data type	Valid range
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE	
Valid	<ul> <li>When <i>Enable</i> changes from FALSE to TRUE</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>	
RS232_Link_Error	<ul> <li>When an error occurs in the communication as <i>Enable</i> is TRUE.</li> </ul>	<ul> <li>The communication is restored to normal. (<i>Error</i> is FALSE.)</li> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When <i>Open</i> of RS232_Link_Manage changes from TRUE to FALSE. (<i>Error</i> is FALSE.)</li> </ul>	
Error	<ul> <li>When an error occurs in the instruction inputs as <i>Enable</i> is TRUE.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> <li>When the correct parameter value is filled.</li> </ul>	

# Output Update Timing Chart

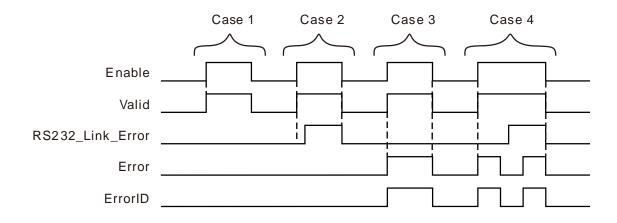

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE. (There is no error both in the communication and instruction inputs.)
- **Case 2**: If there is an error in the communication, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE and after a while, *RS232\_Link\_Error* changes to TRUE.
- **Case 3**: If there is an error in the instruction inputs, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE and *Error* changes to TRUE.
- **Case 4**: If there is an error both in the communication and in the instruction inputs, as *Enable* changes from FALSE to TRUE, *Valid* changes from FALSE to TRUE, *Error* changes to TRUE and *RS232\_Link\_Error* is still FALSE. After the input parameter values are modified correctly, *Error* changes to FALSE and after a while, *RS232\_Link\_Error* changes to TRUE. When the input parameter error occurs again, *Error* changes to TRUE. At the moment, there will be no change in *RS232\_Link\_Error* no matter whether the communication works normally. When *Enable* is TRUE and *Error* is TRUE, the state of *RS232\_Link\_Error* will not be refreshed and will be invalid.

#### • Function

RS232\_Link\_Status is used for watching the communication state of the corresponding link. The firmware of V1.01 and above supports the function.

#### Precaution

- 1. The state of *RS232\_Link\_Error* will not be refreshed and will be invalid when *Enable* is TRUE and *Error* is TRUE.
- 2. The input value of *LinkNum* can be a number or variable.

# 8.14.4.4 RS232 Data Exchange Example

# Programming Example

- The node address of the slave DVP32ES2 is 1. The values in 10 word registers %MW100~%MW109 of the master are written to D0~D9 in the slave. Then the values in 20 word registers D100~D119 of the slave are read and stored in %MW0~%MW19 in the master as shown in the following variable table 1.
  - > Variable table 1

Name	Address	Data type	Initial value
Mng		RS232_Link_Manage	
Mng_En		BOOL	TRUE
Mng_Open		BOOL	FALSE
Mng_Valid		BOOL	
Mng_LOpen		BOOL	
Confg		RS232_Link_Config	
Confg _Ex		BOOL	FALSE
Confg _LN		UINT	1
Confg _EL		BOOL	TRUE
Confg _Ncyc		BOOL	FALSE
Confg _SNI		USINT	1
Confg_OT		USINT	0
Confg _EFC17		BOOL	FALSE
Confg _WBA	%MW100	UINT	
Confg_WBAO		USINT	0
Confg_WDA		UINT	16#1000
Confg _WL		UINT	10
Confg _WFC		USINT	16#10
Confg_RBA	%MW0	UINT	
Confg_RBAO		USINT	0
Confg_RDA		UINT	16#44C
Confg _RL		UINT	20
Confg_RFC		USINT	16#03
Confg_TOut		UINT	1000
Confg _Done		BOOL	
Confg _Err		BOOL	
Confg _ErrID		WORD	
LStatus		RS232_Link_Status	
LStatus_En		BOOL	TRUE
LStatus_LN		UINT	1
LStatus_Valid		BOOL	

Name	Address	Data type	Initial value
LStatus_RLE		BOOL	
LStatus_RLEID		BOOL	
LStatus_Err		BOOL	
LStatus_ErrID		WORD	


After these parameter settings are done, set Confg \_Ex to TRUE and then Mng\_Open to TRUE. If the configuration need be modified during the communication, the input Confg\_Ex should be triggered on the rising edge, Mng\_Open should be set to FALSE and then to TRUE after the new configuration data are set up.

- The node address of the slave DVP32ES2 is 1. The values in 31 bit devices %MX0.0~%MX3.6 of the master are written to Y0~Y30 in the slave. Then the values in Y0~Y30 of the slave are read and stored in the 31 bit devices %QX0.1~%QX3.7 in the master as shown in the following variable table 2.
  - > Variable table 2

Name	Address	Data type	Initial value
Mng		RS232_Link_Manage	
Mng_En		BOOL	TRUE
Mng_Open		BOOL	FALSE
Mng_Valid			
Mng_LOpen			
Confg		RS232_Link_Config	
Confg _Ex		BOOL	FALSE
Confg _LN		UINT	1
Confg_EL		BOOL	TRUE
Confg_Ncyc		BOOL	FALSE
Confg_SNI		USINT	1
Confg_OT		USINT	1
Confg_EFC17		BOOL	FALSE
Confg_WBA	%MW0	UINT	
Confg_WBAO		USINT	0
Confg_WDA		UINT	16#0400
Confg_WL		UINT	31
Confg_WFC		USINT	16#0F
Confg_RBA	%QW0	UINT	
Confg_RBAO		USINT	1
Confg _RDA		UINT	16#0400
Confg _RL		UINT	31
Confg_RFC		USINT	1
Confg_TOut		UINT	1000
Confg _Done			

Name	Address	Data type	Initial value
Confg _Err			
Confg _ErrID			
LStatus		RS232_Link_Status	
LStatus_En		BOOL	TRUE
LStatus_LN		UINT	1
LStatus_Valid			
LStatus_RLE			
LStatus_RLEID			
LStatus_Err			
LStatus_ErrID			

#### Program

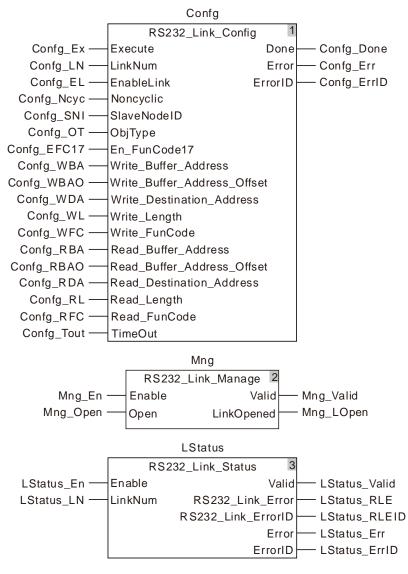

# 8.14.4.5 RS232\_RS

FB/FC	Explanation	Applicable model
FB	RS232_RS is used to configure RS232 free protocol communication parameters for the motion controller.	AS524C-B
	RS232_RS_instance	

NO202_NO_IIIStallice					
	RS	S232_RS			
	Execute		Done		
	Abort		Busy		
	CyclicRun		Active		
	Send_Buffer_Addre	SS	Aborted		
	Send_Length		NewCycle		
	Receive_Buffer_Ad	dress	Received		
	Receive_Length	Receiv	/e_TimeOut		
	Add_STX_ETX	Receive_Leng	thOverMAX		
	STX	Receive_	ActulLength		
	ETX1		Error		
	ETX2		ErrorID		
	Timeout				

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Abort	The free protocol communication is aborted when <i>Abort</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
CyclicRun	Communication mode setting for the instruction. FALSE: Non-cyclic; TRUE: Cyclic	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
Send_Buffer_Address	Specify the starting register of the master where the sent data are stored.	USINT	%MB0- %MB32767	When <i>Execute</i> changes from FALSE to TRUE
Send_length	Set the length of sent data.	UINT	0-200(Byte) (0)	When <i>Execute</i> changes from FALSE to TRUE
Receive_Buffer_Address	Specify the starting register of the master where the received data are stored.	USINT	%MB0- %MB32767	When <i>Execute</i> changes from FALSE to TRUE
Receive_Length	Set the length of received data.	UINT	0-200(Byte) (0)	When <i>Execute</i> changes from FALSE to TRUE
Add_STX_ETX	Set if the start and end codes are added or not in sent messages. FALSE: Not add the start and end codes. TRUE: Add the start and end codes.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE


Parameter name	Function	Data type	Valid range (Default)	Validation timing
STX	Set the start of messages.	USINT	0-16#7F (16#3A)	When <i>Execute</i> changes from FALSE to TRUE
ETX1	Set the first end of messages.	USINT	0-16#7F (16#0D)	When <i>Execute</i> changes from FALSE to TRUE
ETX2	Set the second end of messages.	USINT	0-16#7F (16#0A)	When <i>Execute</i> changes from FALSE to TRUE
Timeout	Set the timeout time when receiving data.	UINT	0-32767 (0)	When <i>Execute</i> changes from FALSE to TRUE

#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the communication proceeds.	BOOL	TRUE / FALSE
Aborted	TRUE when current execution of the instruction is aborted.	BOOL	TRUE / FALSE
Active	TRUE when the port is controlled by the instruction.	BOOL	TRUE / FALSE
NewCycle	TRUE when the instruction execution is completed once (in the multi-cycle state)	BOOL	TRUE / FALSE
Received	TRUE when receiving is successful.	BOOL	TRUE / FALSE
Receive_TimeOut	TRUE when timeout in message receiving occurs.	BOOL	TRUE / FALSE
Receive_LengthOverMAX	TRUE when the length of received data exceeds the max. length allowed.	BOOL	TRUE / FALSE
Receive_ActulLength	Actually received data length	UINT	0-200
Error	TRUE when an instruction configuration error occurs.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs in the instruction execution. Please refer to section 12.2 for the corresponding error code.	WORD	


### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>After Execute changes from FALSE to TRUE and Busy changes to TURE in the one single cycle work state</li> </ul>	
Busy	<ul> <li>When <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Abort</i> changes to TRUE in the multi-cycle state.</li> <li>When <i>Done</i> changes to TRUE in the one-single-cycle state.</li> </ul>
Aborted	<ul> <li>When <i>Abort</i> changes from FALSE to TRUE for the first time.</li> </ul>	
Active	<ul> <li>When <i>Execute</i> changes from FALSE to TRUE.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li>When current instruction is aborted by another instruction in the multi-cycle state.</li> <li>When <i>Done</i> changes to TRUE in the one-single-cycle state.</li> </ul>
NewCycle	<ul> <li>When the PLC completes one cycle of work in the multi-cycle state.</li> </ul>	
Received	• When the instruction receives the response message.	<ul> <li>When the next cycle is entered after the instruction receives the response message.</li> </ul>
Receive_TimeOut	When the parameter configuration for receiving data has been done and the response message is not received within the set timeout time.	♦ When the response message is
Receive_LengthOverMAX	<ul> <li>When the length of actually received data is greater than the max. length allowed.</li> </ul>	<ul> <li>When the length of received data is less than the max. length allowed.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction parameter configuration.</li> </ul>	<ul> <li>When the instruction configuration data are correct.</li> </ul>

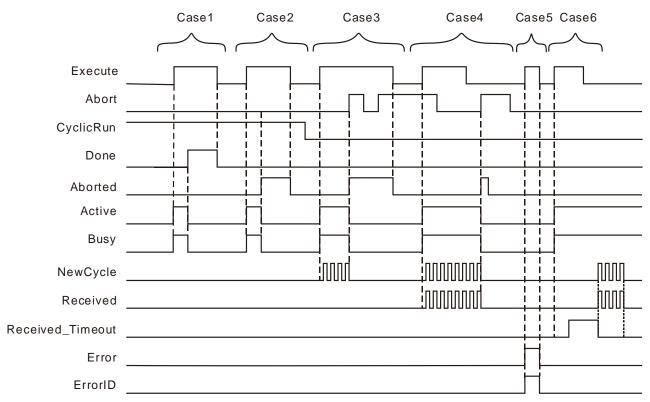

#### • Output Update Timing Chart

- **Case 1**: In the one-single-cycle work state, *Busy* changes to TRUE when *Execute* changes from FALSE to TRUE. When the instruction execution is completed, *Busy* changes to FALSE and *Done* changes to TRUE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: In the one-single-cycle work state, *Busy* and *Active* change to FALSE and *Abort* changes to TRUE when the instruction is aborted by other instruction. Then *Aborted* changes to FALSE when *Execute* changes to FALSE. If *Execute* changes to FALSE before the instruction is aborted, *Aborted* changes to TRUE for one cycle.
- **Case 3**: In the multi-cycle state where only the data-sending parameters are configured, when *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. After a while, *Newcycle* changes between TRUE and FALSE alternately. When *Abort* changes to TRUE, *Busy* changes to FALSE and *Aborted* to TRUE. When *Abort* changes to FALSE, *Aborted* remains TRUE. *Aborted* remains TRUE when *Abort* changes to TRUE again. *Aborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the multi-cycle state where the parameters for receiving and sending data have been configured and *Abort* is TRUE, *Busy* changes to TRUE when *Execute* changes from FALSE to TRUE. After a while, both of *Newcycle* and *Received* begin to change between TRUE and FALSE alternately. When triggering *Abort* again after *Execute* changes from TRUE to FALSE, *Aborted* changes to TRUE, one cycle later, changes to FALSE and others change to FALSE.
- **Case 5**: If there is an error in the configured parameters of the instruction, *Error* changes to TRUE as *Execute* changes from FALSE to TRUE. *Error* changes to FALSE as *Execute* changes to FALSE.
- **Case 6** : In the event that the timeout of receiving data occurs, when *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and after a while, *Receive\_Timeout* changes to TRUE. When the communication is restored to normal, both of *NewCycle* and *Received* start to change between TRUE and FALSE alternately.

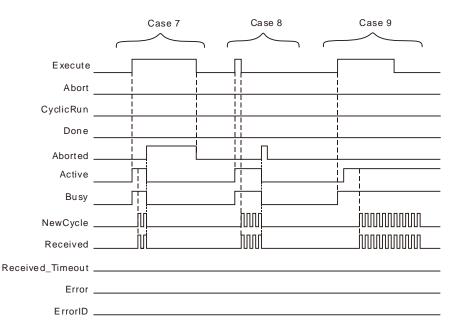

- **Case 1**: In the multi-cycle state where *Execute* is TRUE, when the instruction is aborted by other instruction, *Aborted* changes to TRUE, *Execute* changes to FALSE and *Aborted* changes to FALSE.
- **Case 2**: In the multi-cycle state where *Execute* is FALSE, when the instruction is aborted by other instruction, *Aborted* changes to TRUE and one cycle later, changes to FALSE.
- **Case 3**: When the instruction is aborted by other instruction, *Busy* changes to TRUE. After a while, *Active* changes to TRUE and other outputs give corresponding output according to the cases above.

#### • Function

RS232\_RS is used to configure RS232 free protocol communication parameters and watch the communication status. The firmware of V1.01 and above supports the function.

#### Precaution

- 1. RS232\_RS does not add the checksum automatically. In ASCII mode, the data sent out are required to be the ASCII message which has been converted into.
- 2. The total length of sent data is 200 Bytes. The length set in the instruction does not include that of the start of end of sent messages.
- 3. Add\_STX\_ET sets if the header and footer codes are added or not in the sent message. The function is only enabled when the header and footer codes of the sent message are identical to those of the received message. Otherwise, the function can not be enabled if the header and footer codes of the sent message differ from those of the received message and in this case, an error will occur if the function is enabled.
  - a. The header code and footer code set in the instruction are for the sent messages. If the sent message is correct but the header code and footer code in the received message are different from those of the sent message, the controller will fail to receive the message and the timeout will happen during receiving.
  - b. The header code and footer code set in the instruction are for the sent message. So the slave will not give a response if the sent message does not conform to the slave message requirement.
     Thus, the function could not be enabled when the header and footer codes of the sent message are not identical to those of the received message.
- 4. When RS232\_RS and RS\_232\_Link\_Config exist together,
  - a. When *Execute* of RS232\_RS instruction changes from FALSE to TRUE, the 232Link function of the PLC will take effect.
  - b. When *Abort* of RS232\_RS instruction changes from FALSE to TRUE, the 232Link function which is being performed will take effect again.

- c. When *Execute* of RS232\_RS instruction changes from FALSE to TRUE, *Enable* of RS232\_Link\_Manage changes to TRUE, *Open* of the instruction can control the functions of 232 link and free protocol communication.
- d. If there are several RS232\_RS instructions in the program, only one of them, which is triggered the last time will take effect.
- e. For the message which is sent out via RS232\_RS instruction, the address where received data are stored must be set in the RS232\_RS instruction if the slave sends the response message.

8

### 8.14.4.6 RS232 Free Protocol Example

## Programming Example 1

#### • Enabling the function of the start and end of messages

 The free protocol is applied to send a standard Modbus message in ASCII mode with the starting address %MB4000 where sent data are stored and %MB5000 where received data are stored and receive the response data from the slave.
 Message content: 01 10 15 00 00 01 02 00 08.
 The checksum CF is calculated first. Then the message is converted into ASCII code.

Message content after conversion: 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46.

2. If the parameters of RS232\_RS instruction are configured based on variable table 1, the data in %MB4000~%MB4019 are 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 30 38 43 46.

The message data on the bus: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46 0D 0A.

Variable name	Address	Data type	Initial value
RS		RS232_RS	
RS_Ex		BOOL	FALSE
RS_Abort		BOOL	FALSE
RS_CyRun		BOOL	TRUE
RS_SBA	%MB4000	USINT	16#30
RS_SL		UINT	20
RS_RBA	%MB5000	USINT	
RS_RL		UINT	23
RS_AddSE		BOOL	1
RS_Tout		UINT	500
RS_Done		BOOL	
RS_Bsy		BOOL	
RS_Abt		BOOL	
RS_Act		BOOL	
RS_NCyc		BOOL	
RS_Rec		BOOL	
RS_RTO		BOOL	
RS_RLOM		BOOL	
RS_RAL		UINT	
RS_Err		BOOL	
RS_ErrID		WORD	

#### Variable table 1

#### • Disabling the function of the start and end of messages

a. The free protocol is applied to send a standard Modbus message in ASCII mode with the starting address %MB4000 where sent data are stored and %MB5000 where received data are stored and receive the response data from the slave.

Message content: 01 10 15 00 00 01 02 00 08.

The checksum CF is calculated first. Then the message is converted into ASCII code.

Message content after conversion: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46 0D 0A

b. If the parameters of RS232\_RS instruction are configured based on variable table 2, the data in %MB4000~%MB4022 are 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 38 43 46 0D 0A

The message data on the bus: 3A 30 31 31 30 31 35 30 30 30 30 30 31 30 32 30 30 30 38 43 46 0D 0A.

#### > Variable table 2

Variable name	Address	Data type	Initial value
RS		RS232_RS	
RS_Ex		BOOL	FALSE
RS_Abort		BOOL	FALSE
RS_CyRun		BOOL	TRUE
RS_SBA	%MB4000	USINT	16#3A
RS_SL		UINT	23
RS_RBA	%MB5000	USINT	
RS_RL		UINT	23
RS_AddSE		BOOL	0
RS_Tout		UINT	500
RS_Done		BOOL	
RS_Bsy		BOOL	
RS_Abt		BOOL	
RS_Act		BOOL	
RS_NCyc		BOOL	
RS_Rec		BOOL	
RS_RTO		BOOL	
RS_RLOM		BOOL	
RS_RAL		UINT	
RS_Err		BOOL	
RS_ErrID		WORD	

### > Program

		RS			
	RS	232_RS	1		
RS_Ex —	Execute		Done	— R S_	Done
RS_Abort —	Abort		Busy	— R S_	Bsy
RS_CyRun —	CyclicRun		Active	— R S_	Act
RS_SBA —	Send_Buffer_Addres	SS	Aborted	— R S_	Abt
RS_SL —	Send_Length		NewCycle	— R S_	NCyc
RS_RBA —	Receive_Buffer_Add	ress	Received	— R S_	Rec
RS_RL —	Receive_Length	Receive	e_TimeOut	— R S_	RTO
RS_AddSE —	Add_STX_ETX F	Receive_Length	nOverMAX	— R S_	RLOM
	STX	Receive_A	ctulLength	— R S_	RAL
	ETX1		Error	— R S_	Err
	ETX2		ErrorID	— R S_	ErrID
RS_Tout —	Timeout				

## 8.14.4.7 RS232\_SetDelayTime

FB/FC	Explanation	Applicable model					
FB	RS232_SetDelayTime sets the response-delay time at the RS485 communication port of the controller.	AS524C-B					
	RS232 SetDelavTime Instance						



#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
DelayTime	The response-delay time at the RS232 communication port of the controller. It is valid no matter whether the controller serves as a master or a slave. (Unit: ms)	UINT	0~65535 (0)	When <i>Execute</i> changes to TRUE


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
Error ID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE				
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>				
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>				

#### • Output Update Timing Chart

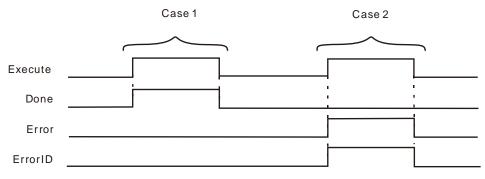

- **Case 1**: When *Execute* changes from FALSE to TRUE, *DONE* changes from FALSE to TRUE.
- **Case 2** : When an error occurs as *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.

#### • Function


The RS232\_SetDelayTime instruction is used to set the response-delay time of the controller RS232 communication port. The setting time is valid when the RS232 communication port of the controller serves as a master or slave.

When RS232 communication port works as a master, it will not send a next message until the set delay time elapses after receiving the response data from the slave. When the RS232 communication port works as a slave, it will not reply to the master until the set delay time elapses after receiving the data from the master.

## 8.15 String Processing Instructions

## 8.15.1 CONCAT

FB/FC	Explanation	Applicable model
FC	CONCAT joins two or more string variables or constants together to form a new string.	AS524C-B

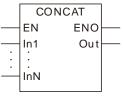

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1 to InN	Strings to join	Input	The joined parameter can be added or removed while the program is being written. The maximum number of joined parameters is 8 and the minimum number is 2. N=2~8.	Depends on the data type of the variable that the input parameter is connected to.
Out	Result of joining	Output	String resulted from joining	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit string				Integer					eal nber		Time	, date	9	String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1 to InN																				•
Out																				•

Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The CONCAT instruction joins two or more strings to form a new string and the new string is output to *Out*. The parameters from In1 to InN are joined in order as shown in the following figure.

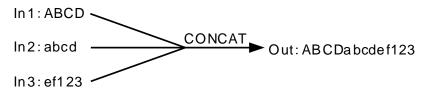

#### Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

#### Programming Example

The data types of CONCAT\_In1, CONCAT\_In2 and Out1 are strings and the values of CONCAT\_In1 and CONCAT\_In2 are 'Asasz' and 'B1255' respectively. When CONCAT\_EN is TRUE, the value of Out1 is 'AsaszB1255'.


#### > The variable table and program

Variable name	Data type	Current value
CONCAT_EN	BOOL	TRUE
CONCAT_In1	STRING	'Asasz'
CONCAT_In2	STRING	'B1255'
Out1	STRING	'AsaszB1255'

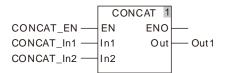

## 8.15.2 DELETE

FB/FC	Explanation	Applicable model
FC	DELETE deletes the specified-length string from the specified position from the string variable or constant.	AS524C-B
	DELETE	

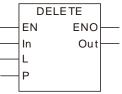

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	String for deletion	Input	String for deletion	Depends on the data type of the variable that the input parameter is connected to.
L	Number of characters to delete	Input	Number of characters to delete	0~ maximum length of the string
Р	Deletion start position	Input	Deletion start position	1~ maximum length of the string
Out	Deletion result	Output	String after deletion	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bits	string					Inte	eger					eal nber		Time	, date	e	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In																				
L																				
Р							•													
Out																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The DELETE instruction deletes L characters starting from the position specified by P of the In string and the characters after deletion will be output to Out. The deletion way is illustrated as below.

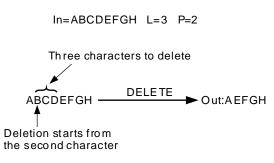

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.




## Programming Example

DELETE\_In is 'AaBbCcDd', DELETE\_L= 2 and DELETE\_P = 3. When DELETE\_EN is TRUE, Out1 is'AaCcDd'.


#### The variable table and program

Variable name	Data type	Current value
DELETE_EN	BOOL	TRUE
DELETE_In	STRING	'AaBbCcDd'
DELETE_L	UINT	2
DELETE_P	UINT	3
Out1	STRING	'AaCcDd'

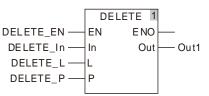

## 8.15.3 INSERT

FB/FC	Explanation	Applicable model
FC	INSERT inserts a string to the specified position in the string variable or constant.	AS524C-B
	Insert	

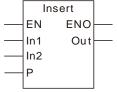

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Original string	Input	Original string	Depends on the data type of the variable that the input parameter is connected to.
In2	String to insert	Input	String to insert	Depends on the data type of the variable that the input parameter is connected to.
Р	Insertion start position	Input	Insertion start position	0~ maximum length of the string
Out	Insertion result	Output	Staring after insertion	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	Ð	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In1																				•
In2																				
Р																				
Out																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The INSERT instruction inserts the *In2* string into the *In1* string and the new string is output to *Out*. The insertion position is between the position specified by *P* and the position specified by *P+1* of the characters in *In1*. If P =0, the *In2* string is inserted at the start of the *In1* string. The insertion way is illustrated as below.

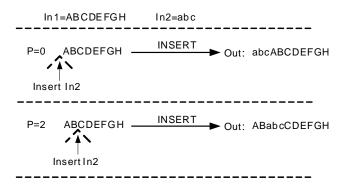

#### Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

#### Programming Example

Insert\_In1 is 'AaBbCcDd', Insert\_In2 is 'Ee' and Insert\_P=2. When Insert\_EN is TRUE, Out1 is 'AaEeBbCcDd'.

#### > The variable table and program

Variable name	Data type	Current value
Insert_EN	BOOL	FALSE
Insert_In1	STRING	'AaBbCcDd'
Insert_In2	STRING	'Ee'
Insert_P	UINT	2
Out1	STRING	'AaEeBbCcDd'

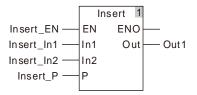

## 8.15.4 LEFT / RIGHT

FB/FC	Explanation	Applicable model
FC	LEFT/RIGHT extracts a specified-length string from the string variable or constant.	AS524C-B
	LEFT RIGHT	



#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Original string	Input	Original string	Depends on the data type of the variable that the input parameter is connected to.
L	Number of characters to get	Input	Number of characters to get	0~maximum number of characters
Out	Extraction result	Output	Extraction result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string					Inte	eger					eal nber		Time	, date	e	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
In																				•
L							•													
Out																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The LEFT/RIGHT instruction extracts a specified-length string from the string *In* and the extracted string is output to *Out*. The LEFT instruction extracts characters from the left of the string *In* and the RIGHT instruction extracts characters from the right of the string. The way of extracting characters is illustrated as below.

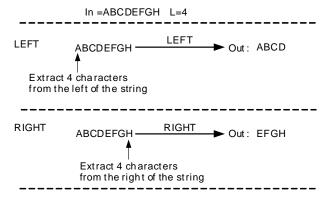


#### • Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

#### Programming Example


- When the LEFT\_In string is 'AaBbCcDd', LEFT\_L=2 and LEFT\_EN is TRUE, Out1 is 'Aa' as shown in the following table 1. When the RIGHT\_In string is 'AaBbCcDd', RIGHT\_L=2 and RIGHT\_EN is TRUE, Out1 is 'Dd' as shown in the following table 2.
  - > The variable table and program 1

Variable name	Data type	Current value
LEFT_EN	BOOL	TRUE
LEFT_In	STRING	'AaBbCcDd'
LEFT_L	UINT	2
Out1	STRING	'Aa'

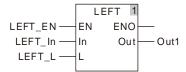


#### > The variable table and program 2

Variable name	Data type	Current value
RIGHT_EN	BOOL	TRUE
RIGHT_In	STRING	'AaBbCcDd'
RIGHT_L	UINT	2
Out1	STRING	'Dd'

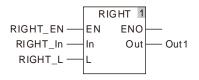

## 8.15.5 MID

FB/FC	Explanation	Applicable model
FC	MID extracts a specified-length string from the specified character position of a string variable or constant.	AS524C-B

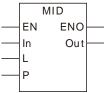

#### • Parameters

Parameter	Meaning	Input/	Description	Valid range
name In	Original string	Output Input	Original string	Depends on the data type of the variable that the input parameter is
L	Length of characters to extract	Input	Number of characters to extract	connected to. 0~ maximum number of characters
Р	Extraction start position	Input	Extraction start position	1~ maximum number of characters
Out	Extraction result	Output	Extraction result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bits	string			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	DT TOD DATE LINT LINT LINT SINT ULINT ULINT									DT	STRING			
In																				
L							•													
Р							•													
Out																				•

### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The MID instruction extracts L characters starting from the number-P character of the In string. The extracted string is output to Out. The extraction way is illustrated as below.

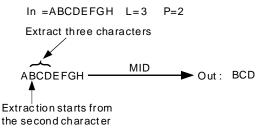

#### • Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

#### Programming Example

■ The MID\_In string is 'AaBbCcDd', MID\_L=2 and MID\_LP=3. When MID\_EN is TRUE, Out1 is 'Bb'.


#### > The variable table and program

Variable name	Data type	Current value
MID_EN	BOOL	TRUE
MID_In	STRING	'AaBbCcDd'
MID_L	UINT	2
MID_P	UINT	3
Out1	STRING	'Bb'

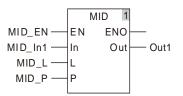

## 8.15.6 REPLACE

FB/FC	Explanation	Applicable model
FC	The REPLACE instruction replaces the specified-length string starting from the specified position with another string.	AS524C-B

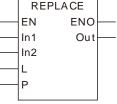

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	Original string	Input	Depends on the data type of the variable that the input parameter is connected to.	
In2	Insert string	Input	String to insert	Depends on the data type of the variable that the input parameter is connected to.
L	Number of characters	Input	Number of characters to delete	0~ maximum number of characters
Р	Replacement start position	Input	Replacement start position	1~ maximum number of characters
Out	Replacement result	Output	Replacement result	Depends on the data type of the variable that the output parameter is connected to.


	Boolean		Bit s	string			Integer								eal nber	Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	TOD DATE TIME LREAL DINT DINT NINT ULINT ULINT									DT	STRING			
ln1																				
ln2																				
L																				
Р							•													
Out																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The REPLACE instruction replaces L characters starting from the number-P character of the *In1* string by inserting another string *In2*. And the replacement result is output to *Out*. The replacement process is illustrated as below.

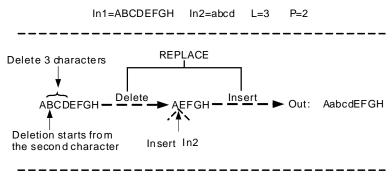

#### Precautions for Correct Use

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.




#### Programming Example

■ The REPLACE\_In1 string is 'AaBbCcDd', the REPLACE\_In2 string is 'DELTA', REPLACE\_L=2 and REPLACE\_LP=3. When REPLACE\_EN is TRUE, Out1 is 'AaDELTACcDd'.


#### The variable table and program

Variable name	Data type	Current value
REPLACE_EN	BOOL	TRUE
REPLACE_In1	STRING	'AaBbCcDd'
REPLACE_In2	STRING	'DELTA'
REPLACE_L	UINT	2
REPLACE_P	UINT	3
Out1	STRING	'AaDELTACcDd'

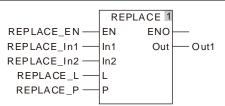

## 8.15.7 LEN

FB/FC	Explanation	Applicable model
FC	LEN calculates the number of characters in a string.	AS524C-B

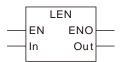

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	String	Input	String	Depends on the data type of the variable that the input parameter is connected to.
Out	Number of characters	Output	Number of characters	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string			Integer r									Time, date				String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UUINT ULINT UUNT								LREAL	TIME	DATE	TOD	DT	STRING
In																				
Out																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

The LEN instruction finds the number of characters in a string and the result is output to *Out*. For example, when the string is ABCDEFGH, the value of *Out* is 8.

#### • Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.

## Programming Example

The LEN\_In string is 'AaBbCcDd'. As LEN\_EN is TRUE, the value of Out1 is 8.


#### > The variable table and program

Variable name	Data type	Current value
LEN_EN	BOOL	TRUE
LEN_In	STRING	AaBbCcDd
Out1	UINT	8

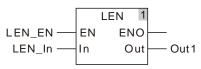

## 8.15.8 FIND

FB/FC	Explanation	Applicable model
FC	FIND searches for the position of a specified string in another string.	AS524C-B
	FIND	

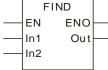

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In1	String	Input	String	Depends on the data type of the variable that the input parameter is connected to.
In2	Key characters to search for	Input	Key characters to search for	Depends on the data type of the variable that the input parameter is connected to.
Out	Number of characters	Output	Number of characters	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	eger					eal nber	-	Time,	date	)	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	IN	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
ln1																				
ln2																				
Out							•													

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- The Find instruction takes the characters in *In2* as key characters and searches for the position of key characters in the string *In1*. For example, as *In1* is ABCDEFGH and *In2* is DE, the value of *Out* is 4.
- The search starts from the first character in the string *In1*.
- If multiple *In2* strings exist in *In1*, the value of *Out* is the position of the first *In2* from the beginning of *In1*.

8

#### **Precautions for Correct Use**

The input variables are not allowed to omit. An error will occur during the compiling of the software if the input variables are omitted. But the output variable is allowed to omit.




## Programming Example

The FIND\_In1 string is 'AaBbCcDd' and the FIND\_In2 string is 'Cc'. As FIND\_EN is TRUE, the value of Out1 is 5.

#### $\triangleright$ The variable table and program

Variable name	Data type	Current value
FIND_EN	BOOL	TRUE
FIND_In1	STRING	'AaBbCcDd'
FIND_In2	STRING	'Cc'
Out1	UINT	5

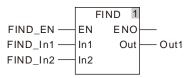


8

## 8.16 Immediate Refresh Instructions

## 8.16.1 FROM

FB/FC	Explanation	Applicable model		
FB	The FROM instruction reads the values in CR registers of the right-side extension modules.	AS524C-B		

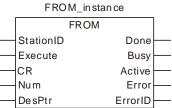

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
			Position range of right-side extension module: 1~32	
StationID	The position of the extension module connected to the right side of the motion controller	USINT	The position No. of the first module at the right side of the motion controller is 1. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (The variable value must be set)	-
CR	The number of the first CR (Controlled Register) to be read	UINT	0~max. CR number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Num	Number of CR registers which are to be read	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
DesPtr	The CR values read by the instruction	INT or DINT	The range of the data type of the read CR value (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	-

#### Output Parameters

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the reading of the parameter values is finished.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE	<ul> <li>When <i>Done</i> changes from FALSE to TRUE</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Active	When the instruction execution begins	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	

#### • Output Update Timing Chart

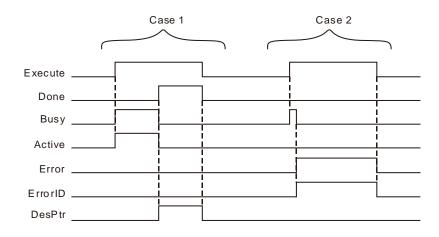

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE and one period later, *Done* changes to TRUE. Meanwhile *Busy* and *Active* change to FALSE and *DesPtr* shows the corrsponding data in CR registers of the extension module. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE and the value of *DesPtr* is cleared to *0*.
- **Case 2**: When an error occurs as *Execute* is TRUE, *Error* changes from FALSE to TRUE and *ErrorID* shows corresponding error codes. *Error* changes from TRUE to FALSE and the value in ErrorID is cleared to 0 after *Execute* changes from TRUE to FALSE.

#### • Function Explanation

The FROM instruction can be applied to read the values in the registers of the righ-side extension modules.

The position of the right-side module is specified by *StationID*. The Station ID range of right-side extension module is 1~32. 1 represents the first extension analog module at the right side and 32 means the thirty-second extension module at the right side. If the Standard ID range exceeds the specified range of the right side module, an error will occur in the instruction execution.

If more than one CR register need be read by the instruction, the parameter *DesPtr* need be defined as the N<sup>th</sup> element of an array. The data in the first CR register will be read to the N<sup>th</sup> element of the array, the data in the second CR register will be read to the N+1<sup>th</sup> element and so on. By doing so, the data in mutiple CR registers will be all read to the array. Refer to Programming Example 2 for details.


## A Precaution

Maximum 32 extension modules are connectable to the right side of the motion controller. For example, if AS04AD-A, AS16AP11T and AS04DA-A are connected to the right side of the motion controller one after another, the *StationID* value of AS04AD-A is 1, AS16AP11T is 2 and AS04DA-A is 3.

## Programming Example 1

#### The variable table and program

Variable name	Data type	Current value
FRM	FROM	
FRM_ID	USINT	1
FRM_Ex	BOOL	FALSE
FRM_CR	UINT	0
FRM_Num	USINT	1
FRM_DP	INT	
FRM _Done	BOOL	
FRM _Bsy	BOOL	
FRM _Act	BOOL	
FRM_Err	BOOL	
FRM_ErrID	WORD	

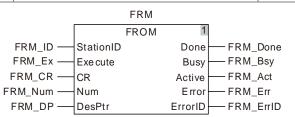

AS04AD-A is connected to the right side of the motion controller. When FRM \_Ex changes from FALSE to TRUE and FRM \_Bsy and FRM \_Act change to TRUE simultaneously, FROM instruction starts to execute. When FRM \_Done changes to TRUE, the instruction execution is finished. FRM \_DP displays that the value in CR0 read by the instruction is 136 and thus the version of AS-04AD is 1.36.

#### Programming Example 2

#### ■ The variable table and program

Variable name	Data type	Current value
FRM1	FROM	
FRM1_ID	USINT	1
FRM1_Ex1	BOOL	FALSE
FRM1_CR1	UINT	2
FRM1_Num1	USINT	4

Variable name	Data type	Current value
FRM1_DP	Array[14] of INT	
FRM1_Done	BOOL	
FRM1_Bsy	BOOL	
FRM1_Act	BOOL	
FRM1_Err	BOOL	
FRM1_ErrID	WORD	


		FRM1		
		FROM	1	
FRM1_ID	StationID		Done	
FRM1_Ex —	Execute		Busy	— FRM1_Bsy
FRM1_CR —			Active	— FRM1_Act
FRM1_Num —	Num		Error	— FRM1_Err
FRM1_DP[1]	DesPtr		ErrorID	

AS04AD-A is connected to the right side of the motion controller. When FRM1\_Ex changes from FALSE to TRUE and FRM1\_Bsy and FRM1\_Act change to TRUE simultaneously, FROM instruction starts to execute. When FRM1\_Done changes to TRUE, the instruction execution is finished. The values read from CR2, CR3, CR4 and CR5 are stored in the four elements FRM1\_DP[1], FRM1\_DP[2], FRM1\_DP[3] and FRM1\_DP[4] of the FRM1\_DP array.

8

## 8.16.2 TO

FB/FC	Explanation	Applicable model
FB	The TO instruction writes data to the specified CR registers of the right-side module.	AS524C-B
	TO_instance	

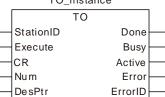

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
StationID	The position of the extension module connected to the right side of the motion controller	USINT	Position range of right- side extension module: 1~32 The position No. of the first module at the right side of the motion controller is 1. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
CR	The number of the first CR register which data is to be written into	UINT	0~ max. CR number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Num	Number of CR registers which are to be read	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
DesPtr	The CR value written by the instruction	INT or DINT	The range of the data type of the written CR value (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE


Parameter name	Function	Data type	Valid range
Done	TRUE when the parameter value writing is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	-

#### • Output Parameters

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the writing of the parameter values is finished.	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed</li> </ul>
Busy	When Execute changes to TRUE	<ul> <li>When <i>Done</i> changes from FALSE to TRUE</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Active	When the instruction execution begins	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	$\blacksquare$ When Everyte changes from LRUE to

#### Output Update Timing Chart

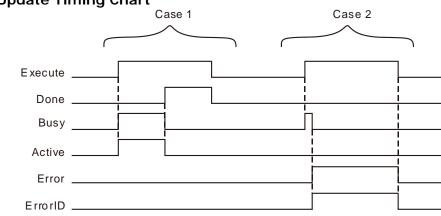

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE. One period later, *Done* changes to TRUE. Meanwhile *Busy* and *Active* changes from TRUE to FALSE. After *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- **Case 2**: When an error occurs as *Execute* changes from FALSE to TRUE, *Error* changes from FALSE to TRUE and *ErrorID* shows corresponding error codes. *Error* changes from TRUE to FALSE and the value in ErrorID is cleared to 0 after *Execute* changes from TRUE to FALSE.

#### • Function Explanation

The TO instruction is used to write data to the specified CR registers of the right-side module.

The positions of right-side extension modules are specified by *StationID*. The *StationID* range of right-side module is 1~32. 1 represents the first extension module at the right side. 32 is the thirty-second extension module at the right side. If *StationID* value exceeds the specified range for right-side modules, an error will occur in execution of the instruction.

If the instruction is used to write values to multiple CR registers, *DesPtr* need be defined as the N<sup>th</sup> element of the array. Then multiple values will be written to multiple CR registers by writing the N<sup>th</sup> element value to the first CR, the N+1<sup>th</sup> element value to the second CR and so on after execution of the instruction.

Refer to the following program examples for more details on the usage.


#### A Precaution

Maximum 32 extension modules are connectable to the right side of the motion controller. For example, if AS04AD-A, AS16AP11T and AS04DA-A are connected to the right side of the motion controller one after another, the *StationID* value of AS04AD-A is 1, AS16AP11T is 2 and AS04DA-A is 3.

## Rogramming Example 1

#### ■ The variable table and program

Variable name	Data type	Current value
TO1	ТО	
TO1_ID	USINT	1
TO1_Ex	BOOL	FALSE
TO1_CR	UINT	2
TO1_Num	USINT	1
TO1_DP	INT	10
TO1_Done	BOOL	
TO1_Bsy	BOOL	
TO1_Act	BOOL	
TO1_Err	BOOL	
TO1_ErrID	WORD	

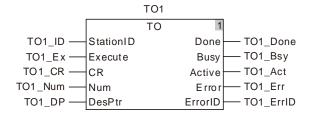


AS04AD-A is connected to the right side of the motion controller. When TO1\_Ex changes from FALSE to TRUE, TO1\_Bsy and TO1\_Act change to TRUE simultaneously and the TO instruction execution starts. When TO1\_Done changes to TRUE, the instruction execution is finished and the value which is written to CR2 in AS04AD-A is 10.

## Programming Example 2

#### The variable table and program

Variable name	Data type	Current value
TO2	ТО	
TO2_ID	USINT	1
TO2_Ex	BOOL	FALSE
TO2_CR	UINT	2
TO2_Num	USINT	4
TO2_DP	Array[14] of INT	
TO2_Done	BOOL	
TO2_Bsy	BOOL	
TO2_Act	BOOL	
TO2_Err	BOOL	
TO2_ErrID	WORD	


8

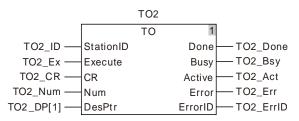

AS04AD-A is connected to the right side of the motion controller. When TO2\_Ex changes from FALSE to TRUE, TO2\_Bsy and TO2\_Act change to TRUE simultaneously and the TO instruction execution starts. As TO2\_Done changes to TRUE, the instruction execution is completed and the values written in CR2, CR3, CR4 and CR5 in AS04AD-A are the values written in the four elements TO2\_DP[1], TO2\_DP[2], TO2\_DP[3] and TO2\_DP[4] of the TO2\_DP array respectively.

## 8.16.3 ImmediateInput

FB/FC	Explanation	Applicable model
FC	ImmediateInput is used for the immediate refresh of input points.	AS524C-B

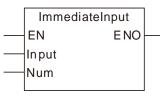

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
Input	Start input point	Input	Start input point	0~15
Num	Number	Input	Number of input points for immediate refresh	1~16

	Boolean		Bit s	tring					Inte	ger				Re num	eal iber	-	Time	, date	)	String
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
Input											•									
Num																				

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### • Function Explanation

- The ImmediateInput instruction is used for refreshing external input point status to %IX0.0~%IX0.7 and %IX1.0~%IX1.7. If the ImmediateInput instruction does not exist, the controller refreshes external input point status to %IX0.0~%IX0.7 and %IX1.0~%IX1.7 once only every time the program scan starts.
- The Input parameter value 0~7 and 8~15 corresponds to %IX0.0~%IX0.7 and %IX1.0~%IX1.7. Num represents the quantity of consecutive devices starting from the one specified by Input. E.g. when Input value is 0 and Num is 2, it indicates that the external input point status is refreshed to %IX0.0 and %IX0.1.


#### • Precautions for Correct Use

The instruction is only used for the immediate refresh of local input points instead of extension input points.

## Programming Example

#### The variable table and program

Variable name	Data type	Current value
ImdInput_EN	BOOL	FALSE
ImdInput_Input	INT	2
ImdInput_NM	USINT	2
ImdInput_ENO	BOOL	

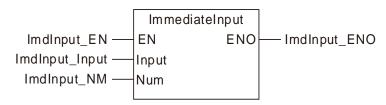


#### Program explanation

When the input variable ImdInput\_EN is TRUE, the external hardware input points status will be refreshed to %IX0.2 and %IX0.3.

8

## 8.16.4 ImmediateOutput

FB/FC	Explanation	Applicable model
FC	ImmediateOutput is used for the immediate refresh of output points.	AS524C-B

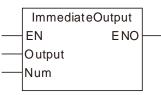

#### • Parameters

Parameter name	Meaning	Input/ Description		Valid range	
Output	utput Start output point		Start output point	0~7	
Num Number		Input	Number of output points for immediate refresh	1~8	

	Boolean		Bit s	tring			Integer						Real number		Time, date			String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INI	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
Outp ut											•									
Num						•														

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data

type. °

#### Function Explanation

- The ImmediateOutput instruction is used for refreshing current status of internal output point %QX0.0~%QX0.7 to external hardware output point. If the ImmediateOutput instruction does not exist, the controller refreshes internal output point status to external hardware output point. The status of %QX0.0~%QX0.7 is decided by other instructions. The ImmediateOutput instruction is only used for refreshing the status of %QX0.0~%QX0.7 to external hardware output points. The ImmediateOutput instruction does not control the TRUE or FALSE of %QX0.0~%QX0.7.
- The Output parameter value 0~7 of the ImmediateOutput instruction corresponds to %QX0.0~%QX0.7. Num represents the quantity of consecutive devices starting from the one specified by Output. E.g. when Output value is 0 and Num is 2, it indicates that the status of %QX0.0 and %QX0.1 is refreshed to the external hardware output point.


#### Precautions for Correct Use

The instruction is only used for the immediate refresh of local output points instead of extension output points.

# Programming Example

## The variable table and program

Variable name	Data type	Current value
ImdOput_EN	BOOL	FALSE
ImdOput_Oput	INT	2
ImdOput_NM	USINT	2
ImdOput_ENO	BOOL	
	ImmediateOutput	

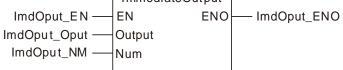

#### Program Explanation

When the input variable ImdOput\_EN is TRUE, the status of %QX0.2 and %QX0.3 will be refreshed to the external hardware output point.

# 8.17 PID-related Instructions

# 8.17.1 PID

FB/FC	Ex	Explanation								
FB	The PID instruction is applicable	AS524C-B								
		PID_instance								
		PID_RUN N	v							
		SV								
		PV								
		PID_MODE								
		PID_MAN								
		MOUT_AUTO								
		CYCLE								
		Кс_Кр								
		Ti_Ki								
		Td_Kd								
		Tf								
		PID_EQ								
		PID_DE								
		PID_DIR								
		ERR_DBW								
		MV_MAX								
		MV_MIN								
		MOUT								
		BIAS								
		I_MV								

## • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range			
PID_RUN	Enable PID operation	Input	Enable PID operation	TRUE or FALSE			
SV	Target value	Input	Target value	-3.402823e+38 ~			
PV	Current value	Input	Current value	-1.175495e-38 · 0 · +1.175495e-38 ~ +3.402823e+38			
PID_MODE	PID control mode	Input	<ul> <li>0: Auto control, the output value (MV) is involved in the automatic operation.</li> <li>1: Auto parameter-tuning function; when the tuning of the parameters is completed, the auto control mode is entered automatically (PID_MODE is set to 0) and appropriate parameters Kc_Kp, Ti_Ki, Td_Kd and Tf are filled.</li> </ul>	0 ~ 1			
PID_MAN	D_MAN PID A/M mode Input TRUE: Manual mode FALSE: Auto mode			TRUE or FALSE			
MOUT_AUTO	Reserved	Input	-	-			
CYCLE Sampling time (T <sub>S</sub> ) Input Sampling time (T <sub>S</sub> )				1~40,000 (Unit: ms)			

Parameter name	Meaning	Input/ Output	Description	Valid range		
Кс_Кр	Proportional Coefficient	Input	Calculated proportional coefficient. If the P coefficient is less than 0, the Kc_Kp will be 0.	0 · +1.175495e-38 ~ +3.402823e+38		
Ti_Ki	Integral coefficient	gral coefficient Input If the calculated coefficient I is less than 0, Ti_Ki will be 0.				
Td_Kd	Derivative Coefficient	Input	If the calculated coefficient D is less than 0, Td_Kd will be 0.	0 ·		
Tf	Derivative-action time constant	If the derivative-action time constant is less than 0, Tf will be 0	+1.175495e-38 ~ +3.402823e+38 (Unit: sec)			
PID_EQ	Reserved	Input	-	-		
PID_DE	Reserved	Input	-	-		
PID_DIR	ID_DIR PID forward/reverse direction		TRUE: Positive direction (E=SV-PV) FALSE: Negaitve direction (E=PV-SV)	TRUE or FALSE		
ERR_DBW	Range within which the error value is counted as 0	Input	Range within which the error value is counted as 0			
MV_MAX	The upper limt of MV output vlaue	Input	The upper limt of MV output vlaue	-3.402823e+38 ~ -1.175495e-38 <sup>,</sup>		
MV_MIN	The lower limt of MV output vlaue	Input	The lower limt of MV output vlaue	0,		
MOUT	Manual output value	Input	Manual output value	+1.175495e-38 ~ +3.402823e+38		
BIAS	IAS Feedforward output value		Feedforward output value			
I_MV	Reserved	Input	System parameter; DO not use it.			
MV	Output value	Output	MV value is between MV_MAX and MV_MIN.	-3.402823e+38 ~ -1.175495e-38 · 0 · +1.175495e-38 ~ +3.402823e+38		

	Boolean		Bit s	tring			Integer					eal nber	Time, date				String			
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
PID_RUN	•																			
SV														•						
PV														•						
PID_MO DE												•								
PID_MAN	•																			
MOUT_A UTO	•																			
CYCLE												•								
Кс_Кр														•						
Ti_Ki														•						
Td_Kd														•						
Tf														•						
PID_EQ	ullet																			
PID_DE	ullet																			
PID_DIR	ullet																			
ERR_DB W														•						
MV_MAX														•						
MV_MIN														•						
MOUT														•						
BIAS														•						
I_MV														•						
M∨																				

## Note:


The instruction is used to implement the PID operation. The PID operation is conducted only when PID instruction is performed by PLC. PID stands for Proportion, Integral and Derivative. The PID control is widely applied to mechanical equipment, pneumatic equipment and electronic equipment.

#### • Function Explanation

- There is no limit to how many times the instruction can be used. However, the variable specified by I\_MV can not be used by other program repeatedly.
- PID instruction can only be used in the cyclic task.

- As long as PID is scanned, according to the sampling time specified by CYCLE, the PID operation is implemented and the MV value is output directly. The PLC will not calculate automatically whether the scan time reaches the sampling time specified by CYCLE so as to output.
- The present value (PV) of PID must be a steady value before PID operation is performed. If the input values of special modules are to be captured for PID operation, users should notice the A/D conversion time of modules.
- When the PV value is in the range of ERR\_DBW, at the beginning, the present error will be brought into the PID operation according to the normal processing and then the PLC module will check whether the present error meets the cross status condition: PV (process value) passes by the SV (target value). Once the condition is met, the present error will be counted as 0 for the PID operation. And after the PV value is out of the ERR\_DBW range, the present error will be brought into the PID operation again.

If PID\_DE is TRUE, that means using the the PV value to calculate the control value of the derivative and after the cross status condition is met, the PLC will treat  $\Delta PV$  as 0 to implement the PID operation. ( $\Delta PV$ = current PV – previous PV). As the example shown below, the present error will be brought into the PID operation according to the normal processing in the section A and the present error or  $\Delta PV$  will be counted as 0 to implement the PID operation in the section B.

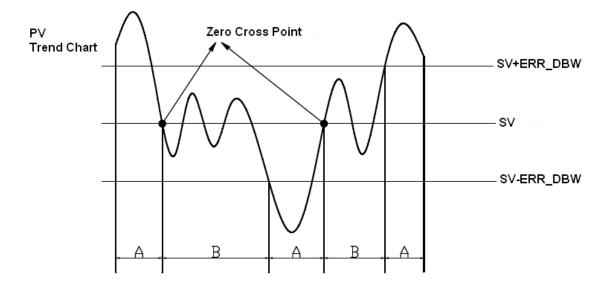

#### > PID Algorithm:


When **PID\_MODE** is set to 0, the PID control mode is the automatic control mode


Independent Formula & Derivative of E ( PID\_EQ=False & PID\_DE=False )

$$MV = K_{P}E + Ki \int_{0}^{t} Edt + K_{d} * \frac{dE}{dt} + BIAS \quad E = SV - PV \text{ or } E = PV - SV$$

When **PID\_MODE** is set to 1, the PID control mode is the automatic tuning mode. After the tuning of the parameter is completed, **PID\_MODE** becomes 0 automatically and the PID control mode becomes the automatic control mode

## > PID Block Diagram:

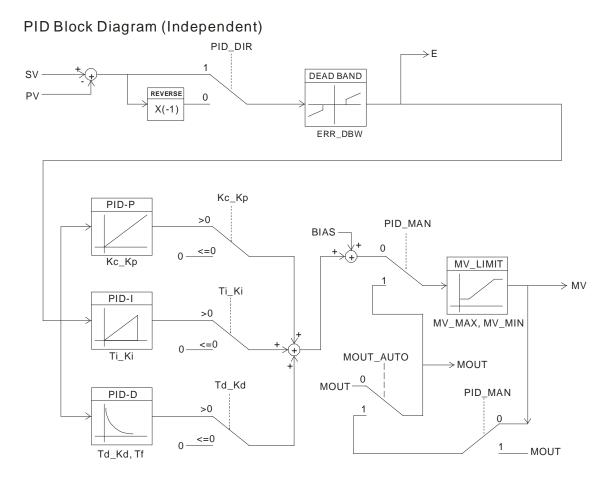

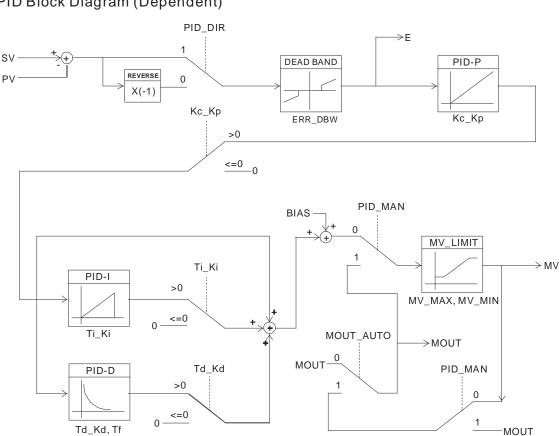

## PID Block Diagram (Dependent)

### > Precaution and Suggestion:

Owing to the fact that the instruction PID can be used in a lot of controlled environments, users have to choose the control function appropriately. For example, to prevent the improper control from occurring, **PID\_MODE** can not be used in the motor controlled environment because it is set to 1 and MV value is switched between MAX and MIN.

When users tune the parameters **Kc\_Kp**, **Ti\_Ki**, and **Td\_Kd** (PID\_MODE is set to 0), they have to tune **Kc\_Kp** first (according to the experience), and then set the **Ti\_Ki** and the **Td\_Kd** to 0. When users can handle the control, they can increase **Ti\_Ki** and the **Td\_Kd**. When the **Kc\_Kp** is 1, it means that the proportional gain is 100%. That is, the error value is increased by a factor of one. When the proportional gain is less than 100%, the error value is decreased. When the proportional gain is larger than 100%, the error value is increased.

To prevent the parameters which have been tuned automatically from disappearing after a power cut, we suggest users should store the parameters in the latched variables when **PID\_MODE** =1 is selected. The parameters which have been tuned automatically are not necessarily suitable for every controlled environment. Therefore, users can modify the parameters which have been tuned automatically. However, it is suggested that users only modify the **Ti\_Ki** and the **Td\_Kd**.


The instruction should be used with many parameters. To prevent the improper control from occurring, please do not set the parameters randomly.

## > The steps of tuning the parameters used with the instruction PID


Suppose that the transfer function of G (s) the plant is the first-order function  $G(s) = \frac{D}{s+a}$ , the SV is

1, the sampling time CYCLE is 10 milliseconds. It is suggested that the steps of tuning the parameters are as follows.

**Step 1:** First, set the *K<sub>i</sub>* and the *K<sub>d</sub>* to 0. Next, set the *K<sub>P</sub>* to 5, 10, 20 and 40 successively, and record the target values and the process values. The results are shown in the diagram below.

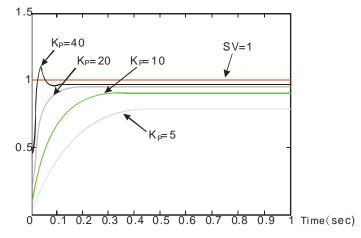

- Step 2: When the *K<sub>P</sub>* is 40, there is overreaction. Thus, the *K<sub>P</sub>* is not chosen. When the *K<sub>P</sub>* is 20, the reaction curve of the *PV* is close to the *SV*, and there is no overreaction. However, due to the fast start-up, the transient output value (MV) is very big. The *K<sub>P</sub>* is not chosen, either. When the *K<sub>P</sub>* is 10, the reaction curve of the *PV* approaches the *SV* smoothly. Therefore, the *K<sub>P</sub>* is chosen. When the *K<sub>P</sub>* is 5, the reaction is too slow. Thus, the *K<sub>P</sub>* is not chosen.
- Step 3: After the *K<sub>P</sub>* is set to 10, increase the *K<sub>L</sub>*. For example, the *K<sub>I</sub>* is set to 1, 2, 4, and 8 successively. The *K<sub>I</sub>* should not be larger than the *K<sub>P</sub>*. Then, increase the *K<sub>D</sub>*. For example, the *K<sub>D</sub>* is set to 0.01, 0.05, 0.1, and 0.2 successively. The *K<sub>D</sub>* should not be larger than ten percent of the *K<sub>P</sub>*. Finally, the relation between the *PV* and the *SV* is presented in the following diagram.

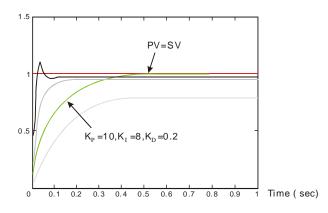

#### Note:

The example is only for reference. Users have to tune the parameters properly according to the practical condition of the control system

#### Programming Example

- Using the automatic tuning function to control the temperature
- Purpose: Using the automatic tuning function to calcaulte the most appropriate parameters for the PID temperature control

#### Explanation:

Due to the fact that users may not be familiar with the characteristics of the temperature environment which is controlled for the first time, they can use the automatic tuning function to make an initial adjustment (**PID\_MODE** is set to 1). After the tuning of the parameter is complete, **PID\_MODE** is set to 0. The controlled environment in this sample is an oven. The program example is as below

## > The variable table and program

## 1. Global variable table


Variable name	Data type	Current value
M1	BOOL	FALSE
D_RUN	BOOL	
G_In1	INT	

## 2. Local variable table

Variable name	Data type	Current value
PID0	PID	
D_SV	REAL	
D_PV	REAL	
D_MODE	DINT	
D_MAN	BOOL	
D_CYC	DINT	
D_Kc	REAL	
D_Ki	REAL	
D_Kd	REAL	
D_Tf	REAL	
D_DIR	BOOL	
D_DBW	REAL	
D_MAX	REAL	
D_MIN	REAL	
D_MOUT	REAL	
D_BIAS	REAL	
D_I_MV	REAL	
D_MV	REAL	


#### 3. The program

a. POU1 (Cyclic Task):

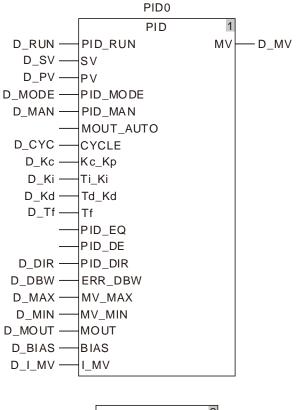




b. POU2 (Freewheeling Task):

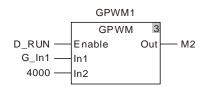


c. The experimental result of the automatic tuning function is shown below.

8

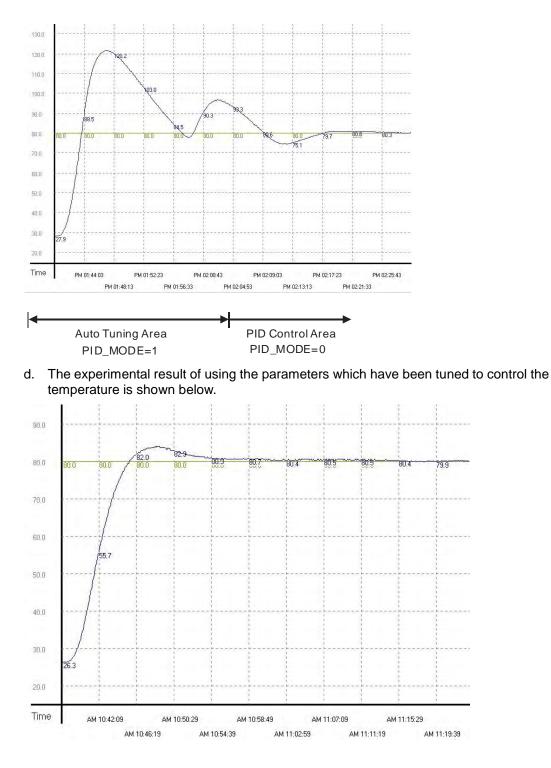

e. As the diagam above shows, after the parameters are tuned automatically, users can get a good temperature control result. It only takes about twenty minutes to control the temperature. When the target temperature changes from 80°C to100°C, the result is as below

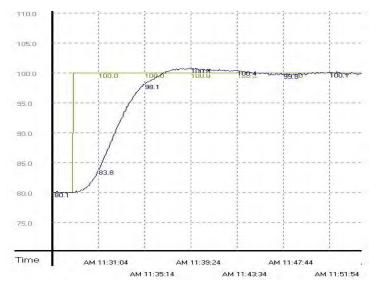

f. As the diagam above shows, when the target temperature changes from 80°C to 100°C, the parameters tuned previously still can be used to control the temperature. Besides, it does not take much time to control the temperature.

## 8.17.2 GPWM

FB/FC	Exp	Applicable model				
FB	The GPWM instruction is used in the	AS524C-B				
		GPWM_instar	nce			
		GPWM				
	—	Enable (	Out -	_		
	—	In1				
	—	In2				

#### • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range	
Enable	Enable	Input	The instruction execution starts when <i>Enable</i> changes from FALSE to TRUE.	TRUE or FALSE	
In1	The width of output pulse	Input	When the instruction is executed, set the width of output pulse (ms).	0~32767	
In2	Output cycle of pulse	Input	When the instruction execution starts, set the cycle of output pulse (ms).	1~32767	
Out Register for outputing pulse Outpu			The output is TRUE within the width of output pulse.	TRUE or FALSE	

	Boolean	Bit string				Integer						Re num		-	Fime,	, date	)	String		
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING
Enable	•																			
ln1											•									
In2											•									
Out																				

## Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.


## • Function Explanation

- The GPWM instruction is used in the pulse output.
- Please use GPWM instruction in the freewheeling task. Otherwise the output of GPWM instruction may be inaccurate.
- The values of In1 and In2 can be modified while GPWM instruction is being executed.
- When  $\ln 1 \le 0$ , the pulse output register has no output. When  $\ln 1 \ge \ln 2$ , the pulse output register is always ON.
- The output of GPWM instruction can use a variable or any bit register. For details, refer to "Section 3.1.2 Registers and Data Types".

# Programming Example

## The variable table and program

Variable name	Data type	Initial value			
GPWM0	GPWM				
GPWM0_En	BOOL	FALSE			
GPWM0_In1	INT	1000			
GPWM0_In2	INT	2000			

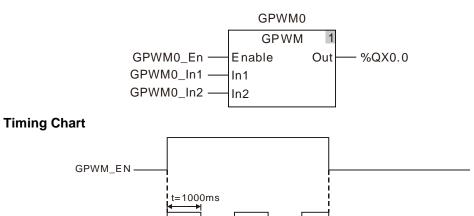

#### %QX0.0 \_

#### Additional Explanation:

When GPWM\_EN changes to TRUE, the instruction works nornally. When GPWM\_EN changes to FALSE, the output of the instruction changes to FALSE.

T=2000ms

# 8.18 Address Instruction

## 8.18.1 ADR

FB/FC	Explanation	Applicable model				
FC	ADR is used to get the address of a variable.	AS524C-B				



## • Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
In	Input vlaue	Input	The variable of which the address is to be ouput	Depends on the data type of the variable that the input parameter is connected to.
Out	Operation result	Output	Output variable address of IN	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit string		Integer			eal nber	-	Time	, date	9	String	Pointer							
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	STRING	Pointer To xx
In	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	
Out																					

#### Note:

- 1. The symbol indicates that the parameter is allowed to connect to the variable of the data type.
- 2. The data type xx of '**Pointer To** xx' must be the same as that of *IN*.


#### Function Explanation


The ADR instruction is used to get the address of a variable. Get the variable address and then find the value stored in the variable address by using the symbol ^.

# Programming Example

The ADR instruction is used to get the address of input variable ADR\_In and place it in the output variable ADR1. The address of ADR\_In is %MW0. After the ADR instruction is executed, ADR1 points to %MW0. After ADD is executed, ADR1 points to %MW1. ADR1^ means to get the value from the address of ADR1. (ADR1 value is %MW1 and ADR1^ means to get the value in %MW1.) The value in %MW1 is moved to the OUT1 variable through executing MOVE instruction.

Variable name	Address	Data type
ADR_EN		BOOL
ADR_In	%MW0	INT
ADR1		POINTER TO INT
OUT1		INT

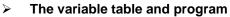

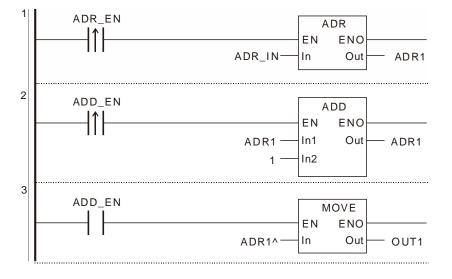

# 8.19 Network Diagnosis

## 8.19.1 Motion Diagnosis

## 8.19.1.1 CANmotion\_SysDiag (Motion System Diagnosis)

FB/FC	Explanation	Applicable model
FB	CANmotion_SysDiag is used for the diagnosis of states of all slaves connected to Motion port.	AS524C-B

CANmotion\_SysDiag\_instance

CANmotion_SysDiag			
 Enable	Done		
 DiagType	Error		
	ErrorID		
	Node		

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
DiagType	<ol> <li>Whether axes are configured in the software.</li> <li>Whether axes make connection with Motion port</li> <li>Whether axes have released Emergency message.</li> </ol>	USINT	1, 2, 3	When <i>Enable</i> changes to TRUE.

### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Node	Outputs corresponding states of all axes based on different values of <i>DiagType</i> .	Array[132]of BOOL	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Enable</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	

## • Functions

CANmotion\_SysDiag is used for the diagnosis of states of all slaves connected to Motion port. The instruction can only be applied to the Motion port built in the motion controller.

The output *Node* is an array of BOOL type for outputing the states of 1~32 axes. The value of *Node* has different meaning when the value of the input *DiagType* varies.

When the value of the input *DiagType* is 1, the value of *Node* means whether axes are configured in the software. TRUE means that axes are configured in the software. FALSE means axes are not configured in the software.

When the value of the input *DiagType* is 2, the value of *Node* means whether axes make the connection with Motion port. TRUE means the connetion is made. FALSE means the connetion is not made.

When the value of the input *DiagType* is 3, the value of *Node* means whether axes release Emergency message. TRUE means Emergency message has been sent. FALSE means Emergency message has not been sent.

E.g. if the value of *DiagType* is 2 and the variable of the output *Node* is a, the value of a[1] is TRUE when axis 1 and Motion port make the connection and the value of a[1] is FALSE when the CANmotion cable of axis 1 is removed.

## 📕 Programming Example

## 1. The variable table

Variable name	Data type	Initial value
CMSD	CANmotion_SysDiag	
CMSD_EN	BOOL	
CMSD_DT	USINT	2
CMSD_Node	ARRAY [132] OF BOOL	

### 2. The program

CMSD CANmotion\_SysDiag 1 CMSD\_En — Enable Done CMSD\_DT — DiagType Error ErrorID — Node — CMSD\_Node

From the values of members of the CMSD\_Node array, you can figure out if the corresponding axis is connected to Motion communication port of the controller or not.

If CMSD\_Node[1]=1, it indicates that axis 1 and Motion communication port have been connected, if the CMSD\_Node[1]=0, it indicates that axis 1 and Motion communication port have not been connected. The possible reason is that the communication cable between Motion communication port and axis 1 is not connected properly or the communication cable is unplugged after being plugged in.

For the connection of axis 2 to Motion communication port, you can use the value of CMSD\_Node[2] to judge whether the connection is successful or not.

For the connection of other axes to Motion communication port, use the same way to judge whether the connection is successful or not.

FB/FC	Explanation	Applicable model
FB	CANmotion_NodeDiag is used for the diagnosis of the state of the specified axis connected to Motion port.	AS524C-B
	CANmotion_NodeDiag_instance	
	CANmotion_NodeDiag	
	Enable Done	
	SlaveNode Error	
	Errorl D	
	InitDone —	
	ParaError —	
	PDO Mapping Failure	
	AutoSDOFailure	

NodeIDSame NodeOffline ServoAlarm

## 8.19.1.2 CANmotion\_NodeDiag (Motion Axis Diagnosis)

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
SlaveNode	Number of the axis which is diagnosed.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> changes to TRUE.

## Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
InitDone	TRUE when the slave axis initializing is finished.	BOOL	TRUE / FALSE
ParaError	TRUE when the key parameters of the slave axis are inconsistent.	BOOL	TRUE / FALSE
PDOMappingFailure	TRUE when the slave axis PDO mapping fails.	BOOL	TRUE / FALSE
AutoSDOFailure	TRUE when the setting for Auto SDO of the slave axis fails.	BOOL	TRUE / FALSE
NodeIDSame	TRUE when the station addresses of the master and slaves are duplicated.	BOOL	TRUE / FALSE
NodeOffLine	TRUE when the slave axis is offline.	BOOL	TRUE / FALSE
ServoAlarm	Recods servo's alarm code.	UINT	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done		<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Enable</i> changes to FALSE.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	♦ When the error is cleared

## Functions


CANmotion\_NodeDiag is used for the diagnosis of the state of the specified axis connected to Motion port. The instruction can only be applied to the Motion port built in the motion controller. If the axis configured in the software can not be used normally, the instruction can be used to diagnose the cause of an error for the axis.

8

## 8.19.2 CANopen Diagnosis

## 8.19.2.1 CANopen\_SysDiag

FB/FC	Explanation	Applicable model
FB	CANopen_SysDiag is used for the diagnosis of the states of all slaves connected to CANopen port.	AS524C-B

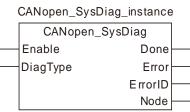

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
DiagType	<ol> <li>Whether slaves are configured in the software.</li> <li>Whether slaves and CANopen port are made connection.</li> <li>Whether slaves have released Emergency message.</li> </ol>	USINT	1,2,3 ( The variable value must be set )	When <i>Enable</i> changes to TRUE.

## Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Node	Outputs corresponding states of all slaves based on different values of <i>DiagType</i> .	Array[132]of BOOL	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE	
Done	◆ TRUE when the instruction	◆ When <i>Error</i> changes to TRUE.	
Done	execution succeeds.	◆ When <i>Enable</i> changes to FALSE.	
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	▲ When the error is cleared	

## • Functions

CANopen\_SysDiag is used for the diagnosis of the states of all slaves connected to CANopen port. (Only the CANopen port built in the motion controller can use the instruction.)

The output *Node* is an array of BOOL for outputing the states of 1~32 axes. The value of *Node* has different meaning when the value of the input *DiagType* varies.

When the value of the input *DiagType* is 1, the value of *Node* means whether slaves are configured in the software. TRUE means that slaves are configured in the software. FALSE means slaves are not configured in the software.

When the value of the input *DiagType* is 2, the value of *Node* means whether slaves make the connection with CANopen port. TRUE means the connection is made. FALSE means the connection is not made.

When the value of the input *DiagType* is 3, the value of *Node* means whether slaves release Emergency message. TRUE means Emergency message has been sent. FALSE means Emergency message has not been sent.


E.g. if the value of *DiagType* is 2 and the variable of the output *Node* is a, the value of a[1] is TRUE when slave 1 and CANopen port make the connection and the value of a[1] is FALSE when the CANopen cable of slave 1 is removed.

## 📕 Programming Example

#### 1. The variable table

Variable name	Data type	Initial value
CSD	CANOpen_SysDiag	
CSD_EN	BOOL	
CSD_DT	USINT	2
CSD_Node	ARRAY [132] OF BOOL	

#### 2. The program

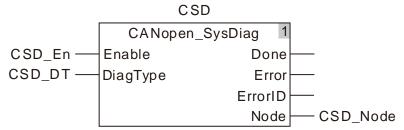

From the values of members of the CSD\_Node array, you can figure out if the corresponding slave is connected to CANopen communication port of the controller or not.

If CSD\_Node[1]=1, it indicates that axis 1 and CANopen communication port have been connceted, if the CSD\_Node[1]=0, it indicates that axis 1 and CANopen communication port have not been connected. The possible reason is that the communication cable between CANopen communication port and axis 1 is not connected properly or the communication cable is unplugged after being plugged in.

For the connection of axis 2 to CANopen communication port, you can use the value of CSD\_Node[2] to judge whether the connection is successful or not.

For the connection of other axes to CANopen communication port, use the same way to judge whether the connection is successful or not.

FB/FC	Explanation	Applicable model
FB	CANopen_NodeDiag is used for the diagnosis of the state of the specified slave connected to CANopen port.	AS524C-B
	CANopen_NodeDiag_instance CANopen_NodeDiag Enable Done SlaveNode Error ErrorID InitSuccess InitFailure DeviceNotRight AutoSDOFailure ReceiveEmcy HearbeatTimeout NodeNumSame EMCY_Num EMCY_Data	

## 8.19.2.2 CANopen\_NodeDiag

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
SlaveNode		USINT	1~32 ( The variable value must be set )	When <i>Enable</i> changes to TRUE.

## • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
InitSuccess	TRUE when the slave initializing succeeds.	BOOL	TRUE / FALSE
InitFailure	TRUE when the slave initializing fails.	BOOL	TRUE / FALSE
DeviceNotRight	TRUE when the slave register is incorrect.	BOOL	TRUE / FALSE
AutoSDOFailure	TRUE when the setting for Auto SDO of the slave fails.	BOOL	TRUE / FALSE
ReceiveEmcy	TRUE when the slave receives the Emergency message.	BOOL	TRUE / FALSE
HeartbeatTimeout	TRUE when the heartbeat message timeout occurs.	BOOL	TRUE / FALSE
NodeNumSame	TRUE when the station addresses of the master and slaves are duplicated.	BOOL	TRUE / FALSE
EMCY_Num	Recods the number of Emergency message the controller receives.	USINT	0~5

Parameter name	Function	Data type	Valid range
I EMILY Data	Recods the Emergency message that the controller receives from the slave.	ARRAY [15] OF CANopen_EMCY_Type	

## Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE	
Dana	◆ When the instruction execution	◆ When <i>Error</i> changes to TRUE.	
Done	succeeds.	♦ When <i>Enable</i> changes to FALSE.	
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	♦ When the error is cleared	

## • Functions

CANopen\_NodeDiag is used for the diagnosis of the state of the specified slave connected to CANopen port. (Only the CANopen port built in the motion controller can use the instruction.) If the slave configured in the software can not work normally, the instruction can be used to diagnose the cause of the error and record the number of times the slave sends Emergency message and the Emergency message data.

	• —		
FB/FC		Explanation	Applicable model
FB	CANopen_State is used for the	diagnosis of the state of CANopen port.	AS524C-B
		CANopen_State_instance CANopen_State Enable Done Error ErrorID Operational Operational PreOperational BusOff BusError SlaveOffline ParaErr TxBufferFull RxBufferFull	

## 8.19.2.3 CANopen\_State

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.

## • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Operational	TRUE when the master is in the operational state.	BOOL	TRUE / FALSE
Stopped	TRUE when the master is in Stop state.	BOOL	TRUE / FALSE
PreOperational	TRUE when the master is in the preoperational state.	BOOL	TRUE / FALSE
BusOff	TRUE when the bus interference is too strong or the products of different baud rates exist in the network.	BOOL	TRUE / FALSE
BusError	TRUE when the bus error occurs.	BOOL	TRUE / FALSE
SlaveOffline	TRUE when some slave is offline.	BOOL	TRUE / FALSE
ParaError	TRUE when the master and slave configuration parameter error occurs.	BOOL	TRUE / FALSE
TxBufferFull	TRUE when the buffer area for the master to send data is full.	BOOL	TRUE / FALSE
RxBufferFull	TRUE when the buffer area for the master to receive data is full.	BOOL	TRUE / FALSE

Name	Timing for changing to FALSE					
Done	◆ When the instruction execution	♦ When <i>Error</i> changes to TRUE.				
Done	succeeds.	♦ When <i>Enable</i> changes to FALSE.				
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>					

## Output Update Timing

## • Functions

CANopen\_State is used for the diagnosis of the state of CANopen port (Only the CANopen port built in the motion controller can use the instruction.) It can tell the state of CANopen port and if any slave is offline.

# 8.20 Read and Write Offset Bit Value

## 8.20.1 SetBitOffsetValue

FB/FC	Explanation	Applicable model
FC	SetBitOffsetValue is used to set the value of the specific bit of the specified address to TRUE or FALSE.	AS524C-B



## Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
StartRegister	Starting address	Input	Specify the starting address	
Offset	How many bits are offset	Input	Specify the offset value by regarding the bit0 of the variable that <i>StartRegister</i> points to as the reference.	0~1023
Value	Input value	Input	Input a specified bit value	TRUE / FALSE

	Boolean		Bits	string	I				Inte	eger					eal nber		Time	, dat	9	Pointer
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	Pointer To XX
StartR egister																				•
Offset			•																	
Value	•																			

Note:

1. The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

2. xx of the 'Pointer To xx' data type includes Bit string and Integer data types.

## • Function Explanation

The SetBitOffsetValue instruction is used to set the value of the specific bit of the specified address to TRUE or FALSE. The *StartRegister* parameter is a Pointer-type variable. The *Offset* parameter specifies the offset value which regards the bit0 of the variable the *StartRegister* parameter points to as the reference. The *Value* parameter shows the setting value of the specified bit, which is TRUE or FALSE. The bit which is specified by *StartRegister* and *Offset* together can be set to TRUE or FALSE through this instruction.

If the specified offset value exceeds the range of the starting address of *StartRegister*, the operation will be performed according to the corresponding offset address which regards the StartRegister as the starting address.

See more in the following example.


## • Precautions for Correct Use

The *StartRegister* parameter of the SetBitOffsetValue instruction is a **Pointer-type** variable and needs to use the ADR instruction to gain the address.

## Programming Example

#### The variable table and program

Variable name	Device address	Data type	Present value
SetBOV_EN		BOOL	TRUE
SetBOV _StartR	%MW0	UINT	
SetBOV _Offset		UINT	
SetBOV _Value		BOOL	

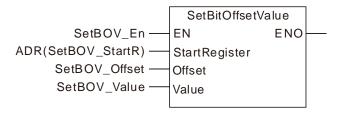

## Program Explanation

When the SetBOV\_EN variable is TRUE, set the value of the specified bit to the value of SetBOV\_Value by changing the values of SetBOV\_Offset and SetBOV\_Value variables. See the explanation below.

- 1. When SetBOV \_Value is set to FALSE and the value of SetBOV \_Offset is 2, the value of Bit2 of SetBOV \_StartR ( %MW0 ) is FALSE.
- 2. When SetBOV \_Value is set to TRUE and the value of SetBOV \_Offset is 2, the value of Bit2 of SetBOV \_StartR ( %MW0 ) is TRUE.
  - 3. When SetBOV \_Value is set to FALSE and the value of SetBOV \_Offset is 16 (which regards Bit0 of the variable that StartRegister points to as the reference bit ), the value of Bit1 of %MW1 is FALSE.
  - 4. When SetBOV \_Value is set to TRUE and the value of SetBOV \_Offset is 16 (which regards Bit0 of the variable that StartRegister points to as the reference bit ), the value of Bit1 of %MW1 is TRUE.

## 8.20.2 GetBitOffsetValue

FB/FC	Explanation	Applicable model
FC	GetBitOffsetValue is used to read the value of the specific bit of the specified address and display it in the output parameter.	AS524C-B
	CotPitOffcot\/oluo	

GetBitOffsetValue – EN ENO – StartRegister GetBitOffsetValue – Offset

## Parameters

	,	,		
Parameter name	Meaning	Input/ Output	Description	Valid range
StartRegister	Starting address	Input	Specify the starting address	
Offset	How many bits are offset	Input	Specify the offset value by regarding the bit0 of the variable that <i>StartRegister</i> points to as the reference	0~1023
GetBitOffsetValue	The read bit value	Output	The read bit value	TRUE / FALSE

	Boolean		Bit s	string	ļ				Inte	eger					eal nber		Time	, date	e	Pointer
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	Pointer To XX
StartR egister																				•
Offset																				
GetBit Offset Value	•																			

Note:

1. The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

2. xx of the 'Pointer To xx' data type includes Bit string and Integer data types.

## • Function Explanation

The GetBitOffsetValue instruction is used to read the value of the specified bit and the output *GetBitOffsetValue* shows the read state value. The *StartRegister* parameter is a Pointer-type variable. The *Offset* parameter specifies the offset value which regards the bit0 of the variable the *StartRegister* parameter points to as the reference. The *GetBitOffsetValue* parameter shows the state value of the specified bit, which is TRUE or FALSE.

If the specified offset value exceeds the range of the starting address of *StartRegister*, the operation will be performed according to the corresponding offset address which regards the StartRegister as the starting address.

See more in the following example.

#### • Precautions for Correct Use

The *StartRegister* parameter of the GetBitOffsetValue instruction is a Pointer-type variable and needs to use the ADR instruction to gain the address.

# Programming Example

#### The variable table and program

Variable name	Device address	Data type	Present value
SetBOV_EN		BOOL	
SetBOV _StartR	%MW5	UINT	
SetBOV _Offset		USINT	
GBOValue		BOOL	



#### Program Explanation


When the SetBOV\_EN variable is TRUE, read the state of the specified bit through changing the value of the *Offset* parameter. See the explanation below.

- 1. When the value of SetBOV \_StartR (%MW5) is 8 (2#0000,1000) and SetBOV \_Offset is 3, the value of GBOValue is TRUE, which is the value of Bit3 of %MW5.
- 2. When the value of SetBOV \_StartR is 0 and SetBOV \_Offset is 3, the value of GBOValue is FALSE, which is the value of Bit3 of %MW5.
- 3. When the value of %MW6 is 8 (2#0000,1000) and SetBOV \_Offset is 19 (which regards the Bit0 of the variable that *StartRegister* points to as the reference), the value of GBOValue is TRUE, which is the value of Bit3 of %MW6.
- 4. When the value of SetBOV \_StartR is 0 and SetBOV \_Offset is 19 (which regards the Bit0 of the variable that *StartRegister* points to as the reference), the value of GBOValue is FALSE, which is the value of Bit3 of %MW6.

# 8.21 FCS Instructions

# 8.21.1 CRC16

FB/F0	Explanation	Applicable model
FC	CRC16 instruction is used to calculate the CRC value of the specified data.	AS524C-B

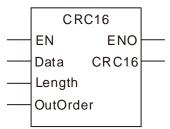

#### • Input Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
Data	The starting address of the data for CRC value calculation	Input	The starting address of the data for CRC value calculation. The starting address can be got by ADR instruction	
Length	The length of the data for CRC value calculation	Input	How many bytes of data are for the CRC value calculation by counting from the starting address of the data with the unit: byte.	1~255
OutOrder	Set the arrangement for the bytes of the output CRC value	Input	FALSE means that for the output CRC value, its low byte is on the left of its high byte. TRUE means that for the output CRC value its low byte is on the right of its high byte.	TRUE or FALSE
CRC16	The CRC value	Output	The CRC value got through calculation based on the parameter <i>Data</i>	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	string					Inte	ger				Re num			Time	, date		POINTER
	BOOL	ВҮТЕ	WORD	DWORD	LWORD	USINT	UINT	UDINT	ULINT	SINT	INT	DINT	LINT	REAL	LREAL	TIME	DATE	TOD	DT	POINTER TO BYTE
Data																				
Length																				
OutOrder	•																			
CRC16			•																	

#### Note:

The symbol ● indicates that the parameter is allowed to connect to the variable or constant of the data type.

#### Function Explanation

CRC16 instruction is used to calculate the CRC value of the specified data.

The instruction performs the calculation of the CRC value according to the starting address specified by *Data* and number of bytes specified by *Length*.

The calculation result is put in the output parameter *CRC16*. The arrangement for the bytes of the CRC value is specified by *OutOrder*.

### • Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted.

# Programming Example

#### The variable table and program


Variable name	Address	Data type	Current value
CRC_EN		BOOL	TRUE
IN_Data	%MB100	ARRAY[16] OF BYTE	[16#01,16#03,16#10,16#01,16#00,16#02]
IN_Length		UINT	6
IN_OutOrder		BOOL	FALSE
OUT_CRC		WORD	16#910B

When CRC\_EN changes from FALSE to TRUE, the CRC16 instruction checks the 6 bytes [16#01,16#03,16#10,16#01,16#00,16#02] in IN\_Data. The calculation result is 16#910B which is put in OUT\_CRC.

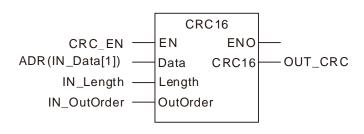

## 8.21.2 LRC

FB/FC	Explanation	Applicable model
FC	LRC instruction is used to find the LRC value of the specified data.	AS524C-B

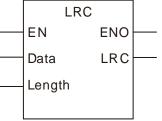

## Input Parameters

Parameter name	Meaning	Input/ Output	Description	Valid range
Data	The starting address of the data for LRC value calculation	Input	The starting address of the data for LRC value calculation. The starting address can be got by ADR instruction	
Length	Length of the data for LRC value calculation	Input	How many bytes of data are for the LRC value calculation by counting from the starting address of the data with the unit: byte.	1~255
LRC	The LRC value	Output	The LRC value of the specified data	Depends on the data type of the variable that the output parameter is connected to.

	Boolean		Bit s	tring		Integer				Re num	eal nber	Time, date			POINTER				
	BOOL	BYTE	WORD	DWORD	LWORD	USINT	LINT DINT INT SINT ULINT UDINT USINT			REAL	LREAL	TIME	DATE	TOD	DT	POINTER TO BYTE			
Data																			•
Length							•												
LRC																			

Note:

The symbol • indicates that the parameter is allowed to connect to the variable or constant of the data type.

## • Function Explanation

LRC instruction is used to find the LRC value of the specified data.

The instruction performs the calculation of the LRC value according to the starting address specified by *Data* and number of bytes specified by *Length*.

The calculation result is put in the output parameter LRC.

#### • Precautions for Correct Use


The input variables are not allowed to omit. An error will occur during the compiling of the software if any input variable is omitted.

# Programming Example

## ■ The variable table and program

Variable name	Address	Data type	Current value
LRC_EN		BOOL	TRUE
IN_Data	%MB100	ARRAY[16] OF BYTE	[16#01,16#03,16#10,16#01,16#00,16#02]
IN_Length		UINT	6
OUT_LRC		WORD	16#E9

When LRC\_EN changes from FALSE to TRUE, the LRC instruction checks the 6 bytes [16#01,16#03,16#10,16#01,16#00,16#02] in IN\_Data. The calculation result is 16#E9 which is put in OUT LRC.

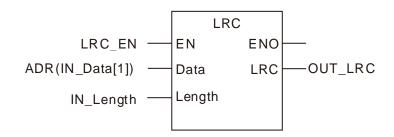

# 8.22 Right-Side Extension Module Instructions

## 8.22.1 AS02PU and AS04PU Related Instructions

## 8.22.1.1 Application Conditions of AS02PU and AS04PU Related Instructions


## • Notes:

- 1. The AS02PU and AS04PU related instructions are available to the PU module on the right side of AS500 series PLC only. But they are not applicable to the PU modules connected to the right side of the remote modules.
- 2. AS500 series controller with the firmware version 1.03 or later supports the AS02PU and AS04PU related instructions.
- 3. Only AS02PU with the firmware version 1.02.00 or later supports the PUCNT instruction.
- 4. For details on AS02PU and AS04PU modules, please refer to AS Series Module Manual.

## 8.22.1.2 AS02PU and AS04PU Related Instructions

## 8.22.1.2.1 PUCONF

FB/FC	Explanation	Applicable model
FB	PUCONF is used to modify the control parameters for the specified PU module.	AS524C-B
	PUCONF_instance	

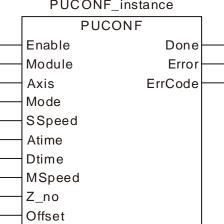

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error output</i> will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis	Specify the number of the axis for the specified PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4 (The variable value must be set)	When <i>Enable</i> is TRUE
Mode	Specify the output mode of the specified axis	USINT	0~255 (1)	When <i>Enable</i> is TRUE
SSpeed	The starting/ending speed Unit: Hz	UINT	0~10000 (100)	When <i>Enable</i> is TRUE
Atime	Specify acceleration time Unit: ms	UINT	0~10000 (100)	When <i>Enable</i> is TRUE
Dtime	Specify deceleration time Unit: ms	UINT	0~10000 (100)	When <i>Enable</i> is TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Mspeed	Specify maximum output speed Unit: Hz	UDINT	AS02PU: 100~200000 (20000) AS04PU: 100~100000 (100000)	When <i>Enable</i> is TRUE
Z_no	Specify the number of Z phase signals to seek after returning to the origin.	INT	-100~100 (0)	When <i>Enable</i> is TRUE
Offset	Specify the output offset position after the homing is finished and Z phase signals seeking is done.	INT	-10000~10000 (0)	When <i>Enable</i> is TRUE

#### Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUCONF instruction.
- 2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

Axis numbers and corresponding output points are shown in the following table.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0/ Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0/ Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

3. *Mode* sets the output mode of an output axis and the setting values are explained in the following table.

Output mode value	Description	Remark
0	Single-point pulse output (An even-number point for output only)	E.g. Y0.0 or Y0.2 for output
1	Pulse (An even-number point) + direction (An odd- number point)	E.g. Y0.0 is for the pulse and Y0.1 is for the direction. Y0.1: ON for negative direction; Y0.1: OFF for positive direction
2	CW (An even-number point) + CCW (An odd-number point)	E.g. Y0.0 is for CW (positive direction) and Y0.1 is for CCW (negative direction)
3	Phase A (An even-number point) + Phase B (An odd- number point)	E.g. Y0.0 is for phase A and Y0.1 is for phase B. When phase A is leading phase B: positive direction; when phase B is leading phase A: negative direction
Other value	Automatically switch to mode 1 (default value)	

### • Output Parameters

Parameter name	Function	Data type	Valid range
	TRUE when the parameter setting for the output axis of the PU module is done.	BOOL	TRUE / FALSE


# AS500C Series Motion Controller Operation Manual

Parameter name	Function	Data type	Valid range
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	• When the parameter setting for the specified axis is done	<ul> <li>When the axis is disabled</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal. When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	◆ When Enable changes from

# • Output Update Timing

# Output Update Timing Chart

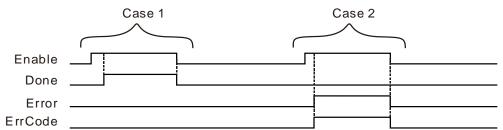

- **Case 1**: *Done* changes to TRUE when the axis parameters setting for the specified output axis is finished after *Enable* changes from FALSE to TRUE. *Done* changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.


#### • Function

PUCONF is used to set the control parameters for a PU module.

- 1. All the control parameters set in the instruction can be set from the software. It is suggested to execute the instruction in the case that the relevant parameter values need be modified several times during the program execution.
- 2. The PUCONF instruction is a pulse instruction. PU module parameters are set when the instruction is enabled. Therefore, if a parameter value is to be updated, re-trigger *Enable* of the instruction for resetting the parameter.
- 3. Since the set parameters are delivered through the module communication command, confirm the state of the output *Done* or *Error* before a parameter value is modified and then proceed with relevant operations.
- 4. It is valid to execute the PUCONF instruction when there is no impulse output from the output points of the PU module. However, the input parameters will not take effect by executing the PUCONF instruction while the output points of the PU module are outputting pulses.

# 8.22.1.2.2 PUSTAT

FB/FC	Explanation	Applicable model		
FB	PUSTAT reads the output state of the PU module.	AS524C-B		
	PUSTAT_instance			
	PUSTAT			

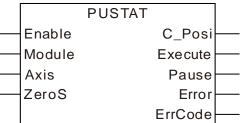

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis	Specify the axis number of the PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4 (The variable value must be set)	When <i>Enable</i> is TRUE
ZeroS	Clear present output position to 0	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE

#### Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUSTAT instruction.
- 2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7


# • Output Parameters

Parameter name	Function	Data type	Valid range
C_Posi	Outputs the present position of the output axis for the specified PU module.	DINT	-
Execute	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Pause	TRUE when the instruction execution is paused.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

# • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Execute	When the instruction is being executed.	<ul> <li>When the specified axis stops running</li> <li>When the specified axis pauses running</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Pause	When the instruction execution is paused.	<ul> <li>When the specified axis stops.</li> <li>While the specified axis is running</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

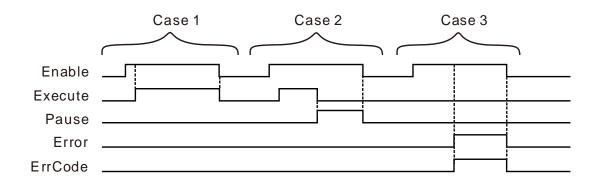

- **Case 1 :** When *Enable* changes from FALSE to TRUE and the output speed of pulses at the output points of the PU module is not 0, *Execute* changes from FALSE to TRUE. After *Enable* changes from TRUE to FALSE, *Execute* change from TRUE to FALSE.
- **Case 2**: When *Enable* changes from FALSE to TRUE and the output speed of pulses at the output points of the PU module is 0, *Pause* changes from FALSE to TRUE. After *Enable* changes from TRUE to FALSE, *Pause* change from TRUE to FALSE.
- **Case 3 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes and meanwhile *Done* change to FALSE. When *Enable* changes to TRUE and the error is cleared, *Error* changes to FALSE.

# Function


The PUSTAT instruction reads the state of a PU module in real time.

1. *C\_Posi* displays the present position of the output axis for the specified PU module. The parameter value is a latched value and stored in the PU module. If the value is to be cleared, set *ZeroS* to TRUE when the instruction is started.

- 2. *Execute* is an only-read output which displays whether the output axis of the specified PU module is outputting or not. When *Execute* is True, it means the output is being conducted. When *Execute* is FALSE, it means the output axis is unused and can accept the next output command.
- 3. *Pause* is an only-read ouput parameter to control the output axis of the specified PU module to pause its output. When *Pause* is True, it means the output is paused, the present velocity is 0 and the present output has not reached the specified target output position. If you restore the output, the output value will be cleared automatically. While *Pause* is TRUE, the next output command will not be accepted.

# 8.22.1.2.3 PUPLS

FB/FC	Explanation	Applicable model
FB	PUPLS controls the specified axis to output the set number of pulses at the target speed with the current position as the reference point via the PU module.	AS524C-B

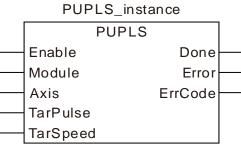

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis	Specify the axis number for the PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4 (The variable value must be set)	When <i>Enable</i> is TRUE
TarPulse	Specify the number of output pulses of the axis	DINT	0 or positive number (0)	When <i>Enable</i> is TRUE
TarSpeed	Specify the target output speed of the axis (Unit: Hz).	DINT	AS02PU: -200000~200000 (0) AS04PU: -100000~100000 (0)	When <i>Enable</i> is TRUE

#### Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUPLS instruction.
- Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

Axis numbers and corresponding output points are shown in the following table.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

- 3. *TarPulse* sets the number of output pulses. The pulse number is a 32-bit positive number. When the value is 0, it means the output is always being performed, the number of output pulses is not limited and the output is not stopped until the instruction is disabled. When the value is less than 0, the PLC automatically uses 2's complement to transform the value into a positive integer as the number of output pulses.
- 4. *TarSpeed* sets the target output speed (Unit: Hz). The target speed can be modified any time after the instruction is enabled and the PU module will automatically switch to the newly set target speed after outputting a full pulse.

Note: Before the target speed is changed, please take into consideration whether the modified speed and PLC scan time match or not.


# • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the target output pulse number specified by <i>TarPulse</i> is reached.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

#### • Output Update Timing

Parameter Timing for changing to TRUE		Timing for changing to FALSE
Done	When the target output pulse number specified by <i>TarPulse</i> is reached.	<ul> <li>When the specified axis is disabled.</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

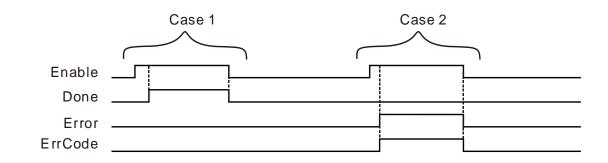

- **Case 1**: *Done* changes to TRUE when the target output pulse number specified by *TarPulse* is reached after *Enable* changes from FALSE to TRUE. *Done* changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.


# • Function

The PUPLS instruction controls a specified axis to output the set number of pulses at the target speed with the current position as a reference point via a PU module.

- 1. When *TarSpeed* is a positive number (>0), it means that the "positive direction" output point is ON. When TarSpeed is a negative number (<0), it means that the "negative direction" output point is ON. When TarSpeed is 0, it means that the output will be paused after the being executed pulse is output fully.
- 2. The PUPLS instruction does not support the function of acceleration and deceleration. Use the PUDRI instruction instead if you need the function of acceleration and deceleration.
- 3. The PUPLS instruction can be used for the speed change. While the instruction is being executed, you can change the value of *TarSpeed* so as to change the output speed.

# 8.22.1.2.4 PUDRI

FB/FC	Explanation	Applicable model	
FB	PUDRI controls the specified axis to output the set number of pulses at the target speed, acceleration rate and deceleration rate with the current position as the reference point via the PU module.	AS524C-B	
<b>DUDPL</b> instance			

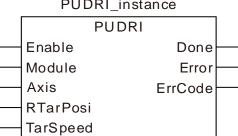

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis	Specify the axis number for the specified PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4 (The variable value must be set)	When <i>Enable</i> is TRUE
RTarPosi	Specify the number of output pulses for relative positioning.	DINT	0, positive number or negative number (0)	When <i>Enable</i> is TRUE
TarSpeed	Specify the target output speed of the axis. Unit: Hz	DINT	AS02PU: -200000~200000 (0) AS04PU: -100000~100000 (0)	When <i>Enable</i> is TRUE

Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUDRI instruction.
- 2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

Axis numbers and corresponding output points are shown in the following table.

- 3. *RTarPosi* sets the pulse number for relative positioning by regarding the current position as the start position. The value can be a 32-bit positive number, a 32-bit negative number or 0. When the value is greater than 0, the output will go in the positive direction (and the direction output point is off). When the value is less than 0, the output will go in the negative direction (and the direction output point is on). When the value is 0, the output *Done* changes to TRUE.
- 4. *TarSpeed* sets the target output speed (Unit: Hz). It can be a 32-bit positive number. When the value is less than 0, the instruction will automatically use 2's complement to transform the value into a positive integer. When the value is 0, the instruction will notify the module to enter the pause mode. The actual output will decelerate at the deceleration rate till the output speed is equal to 0 and then the output *Pause* will change to TRUE. Refer to PUSTAT instruction for more details.


# Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the pulse number for relative positioning specified by <i>RTarPosi</i> is reached.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

# • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE	
Done	<ul> <li>TRUE when the pulse number for relative positioning specified by <i>RTarPosi</i> is reached.</li> </ul>	<ul> <li>When the specified axis is disabled.</li> <li>When Error changes to TRUE</li> </ul>	
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>	

# • Output Update Timing Chart

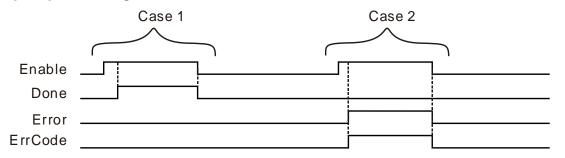


- **Case 1**: Done changes to TRUE when the position set by *RTarPosi* for relative positioning is reached after *Enable* changes from FALSE to TRUE. *Done* changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

#### Function

PUDRI controls the specified axis to output the set number of pulses at the target speed, acceleration rate and deceleration rate with the current position as the reference point via the PU module.

- After the output is started, the target speed is allowed to change any time. In the actual speed change, the PLC will automatically change the speed based on the set acceleration and deceleration rate in the PUCONF instruction.
- 2. See the illustration of the acceleration and deceleration curve of the DPUDRI instruction below.

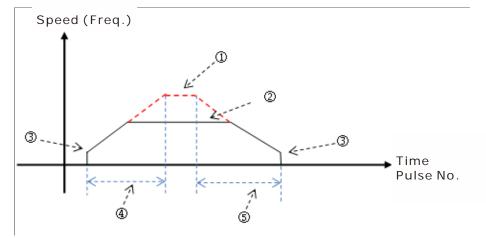

- ①: Maximum output speed value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.
- ②: The target speed specified by the PU module output instruction. The target speed output must not exceed the maximum output speed. If the maximum output speed is exceeded, the maximum output speed is regarded as the output speed.
- ③: Starting/ending output speed value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter values through the configuration area for PU module in Hardware Configuration.
- ④ : The acceleration time value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.
- ⑤ : The deceleration time value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.


The acceleration and deceleration that the PU module controls is performed according to the fixed slope. So the actual acceleration time and deceleration time change based on the output target speed. See the respective formulas for calculation of acceleration rate and deceleration rate as follows.

(Max. output speed - starting speed)/acceleration time,

(Max. output speed - ending speed)/deceleration time

# 8.22.1.2.5 PUDRA

FB/FC	Explanation	Applicable model	
FB	Via the PU module, PUDRA controls the specified axis to output the set number of pulses for absolute positioning at the target speed, acceleration rate and deceleration rate with the zero point as the reference point.	AS524C-B	
PUDPA instance			

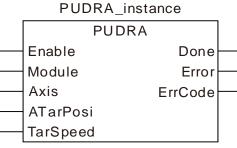

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis	Specify the axis number for the specified PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4 (The variable value must be set)	When <i>Enable</i> is TRUE
ATarPosi	Specify the number of output pulses for absolute positioning.	DINT	0, positive number or negative number (0)	When <i>Enable</i> is TRUE
TarSpeed	Specify the target output speed of the output axis. Unit: Hz	DINT	AS02PU: -200000~200000 (0) AS04PU: -100000~100000 (0)	When <i>Enable</i> is TRUE

Note:

1. AS500 series controller with the firmware V1.03 or later supports the PUDRA instruction.

2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

Axis numbers and corresponding output points are shown in the following table.

8\_

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

- 3. *ATarPosi* sets the output pulse number for absolute positioning by regarding the original point as the start position. The input value can be a 32-bit positive number, a 32-bit negative number or 0. The PU module will automatically compare it with the present position. If the comparison result is greater than 0, the output will be conducted in the positive direction (and the direction output point is off). If the comparison result is less than 0, the output will be conducted in the negative direction (and the negative direction (and the direction output point is on). When the value is 0, the output *Done* changes to TRUE.
- 4. *TarSpeed* sets the target output speed (Unit: Hz). It can be a 32-bit positive number. When the value is less than 0, the instruction will automatically use 2's complement to transform the value into a positive integer. When the value is 0, the instruction will notify the module to enter the pause mode. The actual output will decelerate at the deceleration rate till the output speed is equal to 0 and then the output *Pause* will change to TRUE. Refer to PUSTAT instruction for more details.


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the pulse number for absolute positioning specified by <i>ATarPosi</i> is reached.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the pulse number for absolute positioning specified by ATarPosi is reached.	<ul> <li>When the specified axis is disabled.</li> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

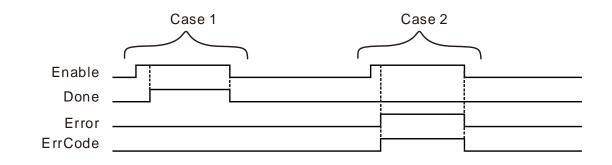


- **Case 1**: Done changes to TRUE when the target output pulse number specified by ATarPosi is reached after *Enable* changes from FALSE to TRUE. Done changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

#### • Function

The PUDRA instruction is used to control the specified axis to output the set number of pulses for absolute positioning at the target speed, acceleration rate and deceleration rate with the zero point as the reference point via the PU module.

- 1. After the output is started, the target speed is allowed to change any time. In the actual speed change, the PLC will automatically change the speed based on the set acceleration and deceleration rate in the PUCONF instruction.
- 2. See the illustration of the acceleration and deceleration curve of the PUDRA instruction below.

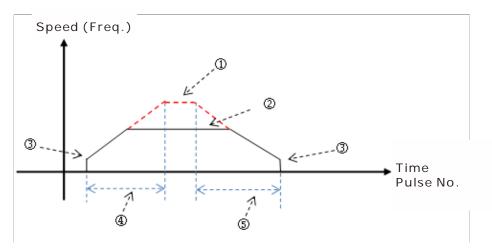

- ①: Maximum output speed value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.
- ②: The target speed specified by the PU module output instruction. The target speed output must not exceed the maximum output speed. If the maximum output speed is exceeded, the maximum output speed is regarded as the output speed.
- ③: Starting/ending output speed value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter values through the configuration area for PU module in Hardware Configuration.
- ④ : The acceleration time value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.
- ⑤ : The deceleration time value. Refer to the setting in the PUCONF instruction for the parameter setting. Alternatively, set the parameter value through the configuration area for PU module in Hardware Configuration.

The acceleration and deceleration that the PU module controls is performed according to the fixed slope. So the actual acceleration time and deceleration time change based on the output target speed. See the respective formulas for calculation of acceleration rate and deceleration rate as follows.


(Max. output speed - starting speed)/acceleration time,

(Max. output speed - ending speed)/deceleration time

# 8.22.1.2.6 PUZRN

FB/FC	Explanation	Applicable model
FB	PUZRN controls the specified axis to perform the homing action based on the set homing mode and speed via the PU module.	AS524C-B

# PUZRN\_instance

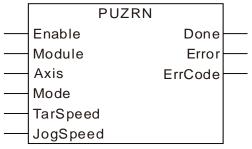

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE
	The axis number for the specified PU module.	USINT	AS02PU: 1~2 (The variable value must be set)	When <i>Enable</i> is TRUE
Axis			AS04PU: 1~4 (The variable value must be set)	
Mode	Specify the homing mode for the axis of the PU module	UINT	0~8 or 255 (0)	When <i>Enable</i> is TRUE
TarSpeed	Set the maximum output speed for the homing	DINT	For AS02PU, Mode 0~8: -100~-200000 and 100~200000 (The variable value must be set); Mode 255: 0, positive number or negative number (0)	When <i>Enable</i> is TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
			For AS04PU,	
			Mode 0~8:	
			-100 ~ -100000 and 100~100000	
			(The variable value must be set);	
			Mode 255:	
			0, positive number or negative number	
			(0)	
	Set the jog speed for the homing		1~10000	When <i>Enable</i> is
JogSpeed	Unit: Hz	INT	(The variable value must be set)	TRUE

#### Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUZRN instruction.
- 2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

Axis numbers and corresponding output points are shown in the following table.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

3. *Mode* sets a homing mode. The explanation of modes is shown in the following table.

Mode	Function description	Input point used with other setting together	Remark
0	Directly clear current position to 0.	None	
1	Specify the point where DOG point is touched as the original point; the axis starts to move in the negative direction and then stops after leaving the DOG point position.	DOG	Use the setting in Hardware Configuration
2	Specify the point where DOG point is touched as the original point; the axis starts to move in the positive direction and then stops after leaving the DOG point position.	DOG	Use the setting in Hardware Configuration
3	After the behavior of Mode=1 is finished, seek the set number of Z phases.	DOG and Z phase input	Used together with the setting in Hardware Configuration
4	After the behavior of Mode=2 is finished, seek the set number of Z phases.	DOG and Z phase input	Used together with the setting in Hardware Configuration

Mode	Function description	Input point used with other setting together	Remark
5	After the behavior of Mode=1 is finished, output the specified number of output pulses.	DOG	Used together with the setting in Hardware Configuration
6	After the behavior of Mode=2 is finished, output the specified number of output pulses.	DOG	Used together with the setting in Hardware Configuration
7	After the behavior of Mode=1 is finished, seek the number of Z phases and then output offset value.	DOG and Z phase input	Used together with the setting in Hardware Configuration
8	After the behavior of Mode=2 is finished, seek the number of Z phases and then output offset value.	DOG and Z phase input	Used together with the setting in Hardware Configuration
255	Modify the current output position for the axis.	None	Used together with the <i>TarSpeed</i> parameter
Other	Reserved		

Note: The specified homing behavior may not be realized if the input points for the selected mode are not used together with the setting in Hardware Configuration.

- 4. *TarSpeed* sets the maximum output speed for the homing when the mode value is between 0 to 8. The setting value can be a 32-bit positive number, a 32-bit negative number or 0. The plus (+) and minus (-) signs represent the direction in which the homing starts. E.g., the + sign means to start the homing in the positive direction. If the mode is 255, the value in *TarSpeed* is updated as the present output position of the PU module.
- 5. *JogSpeed* is the jog speed for reaching the home position. The setting value is a 16-bit positive number within the range of 1~10,000 (Hz).


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the output of the PU module reaches the home position.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

#### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the output of the PU module reaches the home position.	<ul> <li>When the specified axis is disabled.</li> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

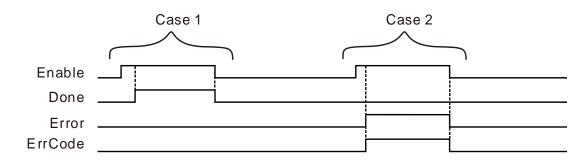


- **Case 1 :** *Done* changes to TRUE when the home position is reached after *Enable* changes from FALSE to TRUE. *Done* changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2 :** When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

#### Function

PUZRN controls the specified axis to perform the homing action based on the set homing mode and speed via a PU module.

# 8.22.1.2.7 PUJOG

FB/FC	Explanation	Applicable model		
FB	PUJOG controls the jog output of the specified axis via the PU module.	AS524C-B		
	PUJOG_instance			
	PUJOG			

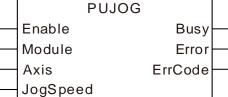

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE.
Axis	Specify the axis number for the specified PU module.	USINT	AS02PU: 1~2 (The variable value must be set) AS04PU: 1~4	When <i>Enable</i> is TRUE.
			(The variable value must be set)	
JogSpeed	Specify the output speed of jogging. Unit: Hz	DINT	AS02PU: -200000~200000 (0)	When <i>Enable</i> is
oogopeeu			AS04PU: -100000~100000 (0)	TRUE.

# 8

# Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUJOG instruction.
- 2. Axis sets the output axis number for the specified PU module. The setting values 1~4 represent the axis1~axis4 output of the specified PU module respectively. If the PU module has no corresponding axis number for output, *Error* will change from FALSE to TRUE.

Axis numbers and corresponding output points are shown in the following table.

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS02PU	Y0.0 / Y0.1	Y0.2 / Y0.3	NA	NA

PU module name	Axis 1	Axis 2	Axis 3	Axis 4
AS04PU	Y0.0 / Y0.1	Y0.2 / Y0.3	Y0.4 / Y0.5	Y0.6 / Y0.7

3. *TarSpeed* sets the jog output speed. The setting value can be a 32-bit positive number, a 32-bit negative number or 0. When *TarSpeed* value is a positive number (>0), it means the output in the positive direction (direction output point is OFF). When *TarSpeed* value is a negative number (<0), it means the output in the negative direction (direction output point is ON). When *TarSpeed* value is 0, it means that the output stops.


#### Output Parameters

Parameter name	Function	Data type	Valid range
Busy	TRUE while the instruction is being executed	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Busy	When Enable changes from FALSE to TRUE.	<ul> <li>When the specified axis is disabled.</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>

• Output Update Timing Chart

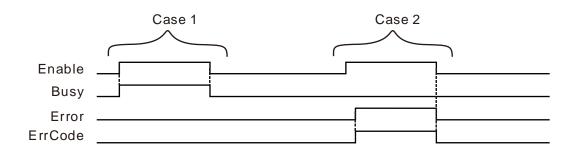


- **Case 1 :** Busy changes from FALSE to TRUE when *Enable* changes from FALSE to TRUE. *Done* changes from TRUE to FALSE when *Enable* changes from TRUE to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

#### Function


The PUJOG instruction controls the jog output of the specified axis via a PU module.

1. See the output timing diagram of the PUJOG instruction as below. (**Jog\_in** is the switch to start the instruction and the **Busyflag** for the *Busy* output.

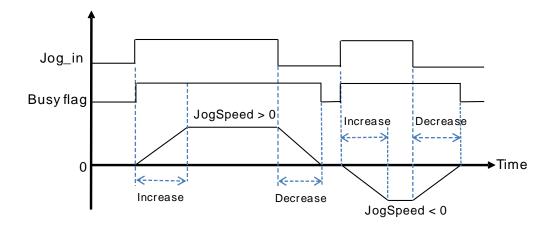

FB/FC	Explanation	Applicable model
FB P	PUCNT functions as the high-speed counter for the PU module.	AS524C-B

# 8.22.1.2.8 PUCNT

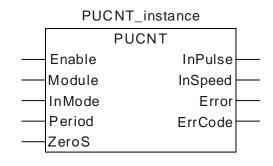

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.
Module	Specify the serial number of one of the modules at the right of the PLC. The first one is number 1, the second one is number 2 and so on. Whatever kind of module at the right of the PLC is numbered. The maximum number is 32. If the specified module is not a PU module, the <i>Error</i> output will change from FALSE to TRUE.	USINT	1~32 (The variable value must be set)	When <i>Enable</i> is TRUE.
InMode	Specify encoder input mode and frequency multiplication for counting.	USINT	0~7 (0)	When <i>Enable</i> is TRUE.
Period	Specify the period time for capturing the speed. Unit: ms	UINT	10~1000 (The minimum or maximum value is automatically set as the parameter value if the range is exceeded.)	When <i>Enable</i> is TRUE.
ZeroS	Clear the counter value to 0	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.

#### Note:

- 1. AS500 series controller with the firmware V1.03 or later supports the PUCNT instruction.
- 2. Only AS02PU-A with the firmware V1.02.00 or later support the PUCNT instruction.
- 3. *InMode* sets the input mode of the encoder source and the frequency multiplication for counting. See the detailed explanation of the setting values in the following table.

InMode

Setting	Input mode (PU module will run based on the setting value as below.)
	Fourfold frequency A/B phase input
16#00	Phase A leads phase B, indicating counting in the positive direction.
	Phase B leads phase A, indicating counting in the negative direction
	Onefold frequency A/B phase input
16#01	Phase A leads phase B, indicating counting in the positive direction.
	Phase B leads phase A, indicating counting in the negative direction
	Twofold frequency A/B phase input
16#02	Phase A leads phase B, indicating counting in the positive direction.
	Phase B leads phase A, indicating counting in the negative direction
	Pulse + directional input (A+/A-: pulse input; B+/B-: directional input)
16#05	Phase B OFF: counting in the positive direction;
10#00	Phase B ON: counting in the negative direction
	Phase A: Rising-edge triggered counting.
	Pulse + directional input (A+/A-: pulse input; B+/B-: directional input)
16#06	Phase B ON: counting in the positive direction
10#00	Phase B OFF: counting tin the negative direction
	Phase A: Rising-edge triggered counting.
16#07	Single phase pulse input (A+/A-: pulse input)
10#07	Phase A: Rising-edge triggered counting
others	Reserved


#### • Output Parameters

Parameter name	Function	Data type	Valid range
InPulse	The number of pulses which have been input.	DINT	-
InSpeed	The counted pulse number per period of time	DINT	-
ErrCode	Contains the error code when an error occurs. See more in section 12.2.	WORD	-

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE			
Busy	When Enable changes from FALSE to TRUE.	<ul> <li>When the specified axis is disabled.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>			
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When the error is fixed.			

# Output Update Timing Chart

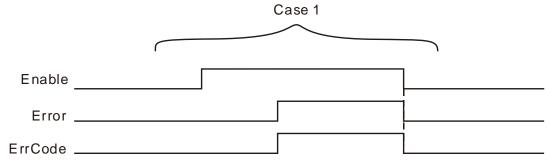

Case 1 : When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrCode* 

•

shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE.

# • Function

PUCNT functions as the high-speed counter for PU module.

- 1. *InPulse* is the number of pulses which have been input. It is a latched value. If it need be cleared to 0, just set *ZeroS* from FALSE to TRUE when PUCNT is executed.
- 2. *InSpeed* shows the pulse number counted per cycle time specified by *Period*. Users can use the formula **InSpeed/Period** for the conversion into the value with the unit of Hz. The values in the formula should be with international standard units.



# Chapter 9 Introductions of Axis Parameters

# Table of Contents

9.1	Description of Axis Parameters	9-2	2
/.		/-4	~

# 9.1 Description of Axis Parameters

	o Parameter Name	Function	Data Type	Defaul Value
1	Name	Axis name	STRING	-
Name" is	s a remark word only use	ed for naming the servo drive without actual m	neaning.	
2	Node ID	CANopen node ID of an axis; range:1-32	USINT	-
Node ID	" is the CANopen station	address of a servo drive.	I	1
		Axis type: linear axis/ rotary axis		
3	Axis type&unit	Unit: the unit of pitch ( <i>UnitsPerRotation</i> ).		Linea
3	Axis typeounit	E.g. Users can fill mm (millimeter) or °	-	axis
		(degree) as a unit.		
inear A			1	
	P2		P	1
	-30000	-10000 0 10000 3000	00	
		Linear Axis Model		
ote:				
P1	Positive Limit			
P2	Negative Limit			
▼	Servo Position	0°		
	Servo Position	270° Z 90° 180°	P1	
Rotary A	Servo Position	$270^{\circ} \underbrace{z}_{180^{\circ}} 90^{\circ}$ $360^{\circ} \underbrace{0^{\circ} \rightarrow 360^{\circ}}_{180^{\circ}} \underbrace{0^{\circ} \rightarrow 360^{\circ}}_{180^{\circ}} \underbrace{360^{\circ} \rightarrow 360^{\circ}}_{180^{\circ}} \underbrace{0^{\circ} \rightarrow 360^{\circ}}_{180^{\circ}} \underbrace$		
Cotary A	Servo Position <b>Axis :</b> $P_2^2 \qquad 0^{\circ} \rightarrow$	$360^{\circ} \qquad 0^{\circ} \rightarrow 360^{\circ} \rightarrow 0^{\circ} \rightarrow $		
♥ cotary A	Servo Position <b>Axis :</b> $P_{1}^{2} \qquad 0^{\circ} \rightarrow$ Positive Limit	$360^{\circ} \qquad 0^{\circ} \rightarrow 360^{\circ} \rightarrow 0^{\circ} \rightarrow $		
kotary A	Servo Position •xis : P2 0°→ Positive Limit Negative Limit	$360^{\circ} \qquad 0^{\circ} \rightarrow 360^{\circ} \rightarrow 0^{\circ} \rightarrow $		
♥ Rotary A	Servo Position <b>Axis :</b> $P_{1}^{2} \qquad 0^{\circ} \rightarrow$ Positive Limit	$360^{\circ} \qquad 0^{\circ} \rightarrow 360^{\circ} \rightarrow 0^{\circ} \rightarrow $		

The rotary axis regards modulo as its cycle, which is the difference between linear axis and rotary axis. The position of the terminal actuator of the linear axis is 500 and the corresponding position of the rotary axis is 140 which is the remainder of 500 divided by modulo (360).

Serial No	Parameter Name	Function	Data Type	Default Value
4	Modulo	The cycle used for equally dividing the actual position of the terminal actuator.	LREAL	360
5	5 Software Limitation If the item is not selected, the maximum/ minimum position of the axis which software limits is invalid. If the item is selected, the maximum/ minimum position of the axis limited by software is valid.		BOOL	0
6	Maximum Position	The maximum position of the axis limited by software	LREAL	-
7	Minimum Position	The minimum position of the axis limited by software	LREAL	-
8	Maximum Resolution	Maximum resolution for the number of servo pulses	UDINT	1280000
9	Unit Numerator	To set the number of pulses needed when the motor runs one rotation by adjusting the parameter and <i>Unit</i> <i>Denominator</i> .	UINT	128
10 Unit Depermineter when the motor runs		To set the number of pulses needed when the motor runs one rotation by adjusting <i>Unit Numerator</i> and the parameter.	UINT	1
11	Pulses/rotation	How many pulses are needed when the servo motor runs one rotation.	UINT	10000

*Unit Numerator* and *Unit Denominator* jointly set the electronic gear ratio of the servo drive. The electronic gear ratio is used to set how many pulses the servo drive receives for one rotation that the servo motor runs.


The resolution of the servo motor is 1,280,000 pulses/rotation. Suppose the value of parameter 11 (Pulses/rotation) is N. So N\*(Unit Numerator / Unit Denominator) = 1,280,000.

12	InputRotation	This parameter and <i>OutputRotation</i> decide the mechanical gear ratio.	UINT	1
13	OutputRotation	<i>InputRotation</i> and this parameter decide the mechanical gear ratio.	UINT	1
14	Pitch (UnitsPerRotation)	The number of units which the terminal actuator moves while output end of the gear rotates for one circle.	UINT	10000

As illustrated below, *InputRotation* =1, *OutputRotation* =2, it means the input mechanism of gear box rotates for one circle and the output mechanism of gear box rotates for 2 circles. *UnitsPerRotation* represents the corresponding position (units) that ball screw moves while the output mechanism of gear box rotates for one circle.

E.g. If output mechanism of gear rotates for one circle and ball screw moves 1mm and *UnitsPerRotation* is set to 1, through the relative position motion instruction the ball screw will move 1 unit, i.e. the ball screw will move 1mm;

If *UnitsPerRotation* is set to 1000, the ball screw will move 1 unit through the MC\_MoveRelative motion instruction, i.e. 1/1000mm actually. The unit of the position in the motion control instruction, G codes and electronic cam is Unit.

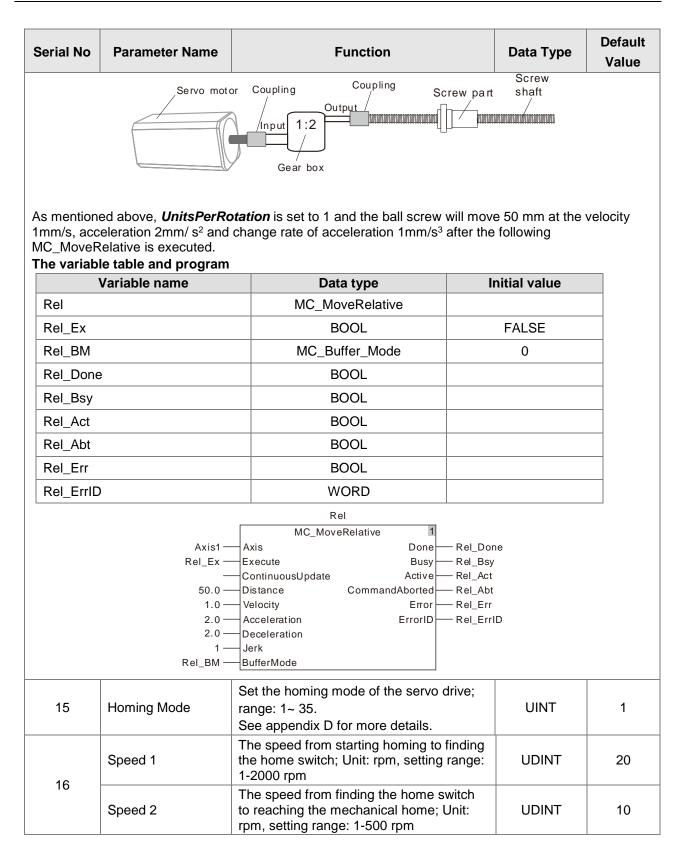



# **Chapter 10 Motion Control Function**

# **Table of Contents**

10.1	EN and ENO	10-2
10.2	Relation among Velocity, Acceleration and Jerk	10-3
10.3	Introduction of BufferMode	10-6
10.4	The State Machine 1	0-32

AS500C series motion controller is developed in compliance with CANopen DSP402 motion control protocol and the motion control instructions defined as function blocks are needed for it.

The motion control instructions for the MC module are based on the technical specifications of motion control function blocks in the PLCopen.

Below is the introduction of what need be known about while the motion instructions are used.

# 10.1 EN and ENO

When one instruction which is used has EN and ENO and EN is FALSE (0), the function defined by instruction will not be performed and the output values of the instruction will not be refreshed. On the contrary, the function defined by the instruction will be performed and the output values will be refreshed if EN is TRUE (1).

The output of ENO and the input of EN keep consistent with each other. ENO changes to TRUE while EN is TRUE. ENO changes to FALSE while EN is FALSE.

For the FB instruction, the instruction execution will continue as its EN changes from TRUE to FALSE after being executed. But the output values of the FB instruction will not be refreshed.

# 10.2 Relation among Velocity, Acceleration and Jerk


The motion controller adopts the method of the quadratic-curve acceleration and deceleration. By means of the method, the S-type velocity waveform which is generated can reduce the mechanical shock effectively. In addition, at least the velocity (v), acceleration (Acc) or deceleration (Dec) and change rate of the acceleration (Jerk) need be specified while the motion control instructions are used.

*Velocity:* Indicates the maximum velocity in the motion of an axis with the unit of unit/second. *Acceleration:* Indicates the maximum acceleration in the motion of an axis with the unit of unit/second<sup>2</sup>.

- *Jerk:* Indicates the maximum change rate of the acceleration or deceleration in the motion of an axis with the unit of unit/second<sup>3</sup>. The value of *Jerk* can be specified in the instruction and the value will be used for the axis in the acceleration and deceleration. The smoothness of the velocity can be improved by modifying the value of *Jerk*.
- The relation among the velocity, acceleration (deceleration) and jerk:

$$Acc(Dec) = \frac{dv}{dt}$$
$$Jerk = \frac{dAcc}{dt}$$

The acceleration (deceleration) is the variation of the velocity per unit time. The change rate of acceleration is the variation of the acceleration per unit time. For example, one MC\_MoveRelative instruction is be used to express the relation among the three elements. The distance is 1300000 units; the velocity is 100000units/second; the acceleration is 20000units/second<sup>2</sup> and the jerk is 10000units/second<sup>3</sup>. See the following chart for the relation among these elements.

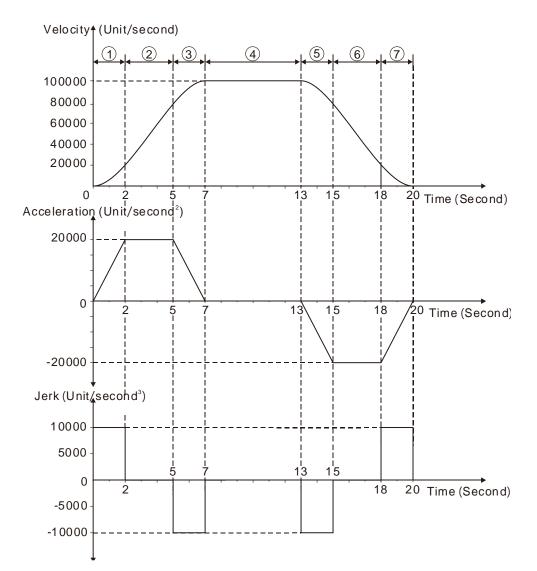

• The relations among Velocity, Acceleration and Jerk are explained in the following table.

Stage No.	Time (second)	Jerk (Unit/second <sup>3</sup> )	Acceleration/ Deceleration (Unit/second <sup>2</sup> )	Velocity (Unit/second)	Motion type
1	0~2	10000 units/second <sup>3</sup>	Acceleration is increased to 20000 units/second <sup>2</sup>	Increasing	The acceleration motion with an increasing acceleration
2	2~5	0	Acceleration stays at 20000 units/second <sup>2</sup>	Increasing	The acceleration motion with a constant acceleration
3	5~7	-10000 units/second <sup>3</sup>	Acceleration is decreased to 0.	Increases to 100000 unit/second	The acceleration motion with an decreasing acceleration
4	7~13	0	Acceleration has been decreased to Ounit/second <sup>2</sup> and it has been Ounit/second <sup>2</sup> during this stage.	100000 unit/second	The motion at a constant speed

Stage No.	Time (second)	Jerk (Unit/second³)	Acceleration/ Deceleration (Unit/second <sup>2</sup> )	Velocity (Unit/second)	Motion type
5	13~15	-10000 units/second <sup>3</sup>	Deceleration is increased to 20000unit/second <sup>2</sup> .	Decreasing	The deceleration motion with an increasing deceleration
6	15~18	0	Deceleration has been increased to 20000units/second <sup>2</sup> and it has been 20000units/second <sup>2</sup> during this stage.	Decreasing	The deceleration motion with a constant deceleration
7	18~20	10000 units/second <sup>3</sup>	Deceleration is decreased to 0.	Decreases to 0	The deceleration motion with a decreasing deceleration

# 10.3 Introduction of BufferMode

For the same axis, another motion instruction can be started while one motion instruction is controlling the axis motion. There are 6 buffer modes for selection to switch from one motion instruction being executed to another motion instruction. The buffer mode can be selected through the *BufferMode* parameter of the buffered motion instruction.

The terms about *BufferMode* are explained as below.

- 1. Current instruction: The motion instruction which is controlling the axis currently.
- 2. Buffered instruction: The instruction which is waiting to be executed.
- 3. Transit velocity: The speed at which the axis moves at the moment when the currently being executed instruction is switched to the buffered instruction.
- 4. Target velocity: The Velocity parameter of an instruction
- 5. Target position: The Position or Distance parameter of the position-related instructions

#### • Six Buffer Modes for Selection

Buffer Mode	Description		
0: mcAborting (Aborting)	The instruction being executed currently is aborted immediately.		
1: mcBuffered (Buffered)	The buffered instruction just starts to control the axis after the current instruction execution is completed.		
2: mcBlendingLow (Blend with low)	The buffered instruction just starts to control the axis after the target position of the current instruction is reached. The transit velocity is the lower of the target velocities of the current instruction and buffered instruction.		
3: mcBlendingPrevious (Blend with previous)	The buffered instruction just starts to control the axis after the target position of the current instruction is reached. The transit velocity is the target velocity of the current instruction.		
4: mcBlendingNext (Blend with next)	The buffered instruction just starts to control the axis after the target position of the current instruction is reached. The transit velocity is the target velocity of the buffered instruction.		
5: mcBlendingHigh (Blend with high)			

#### Notes:

1. The same axis only supports one buffer mode. An error will occur if multiple buffer modes are performed for the same axis.

For example, the *BufferMode* parameters of instruction 2 and instruction 3 are not mcAborting. Instruction 2 (the buffered instruction) will be switched to from instruction 1 (current instruction). Instruction 3 will report an error if instruction 3 is switched to from instruction 2 when the execution of instruction 1 is not completed. If the *BufferMode* parameter of Instruction 3 is mcAborting, instruction 1 and instruction 2 will be aborted immediately and instruction 3 will be executed right away.

 When the MC\_MoveSuperimposed instruction controls the axis alone, the buffered instruction excluding MC\_MoveAdditive is executed and the MC\_MoveSuperimposed instruction is aborted no matter what the value of the *BufferMode* parameter is.


While the current instruction and MC\_MoveSuperimposed or MC\_HaltSuperimposed jointly control the axis and then another motion instruction is executed, all the being executed previously instructions will be aborted if *BufferMode*=mcAborting; if *BufferMode*=mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext and mcBlendingHigh, the current instruction and buffered

instruction will be blended according to the setting value of *BufferMode* without any impact on the execution of MC\_MoveSuperimposed or MC\_HaltSuperimposed.

#### • Example: Using two MC\_MoveRelative instructions for explanation.


The maximum velocity of the first MC\_MoveRelative instruction is V<sub>1</sub> and distance is S<sub>1</sub>. The maximum velocity of the second MC\_MoveRelative instruction is V<sub>2</sub> and distance is S<sub>2</sub>. Modifying the value of *BufferMode* of the second MC\_MoveRelative instruction, you can get different blending processes of the two instructions. See details as below.

### ■ Aborting: Buffermode=mcAborting. See the examples of four cases as below.

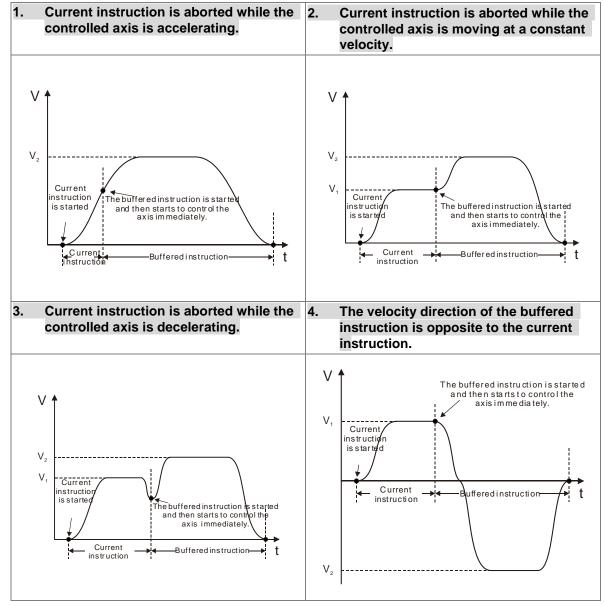


Buffered: Buffermode=mcBuffered. See two cases as below.


1.	When the direction of the buffered	2.	When the direction of the buffered
	instruction is the same as that of the		instruction is opposite to that of the
	current instruction		current instruction.

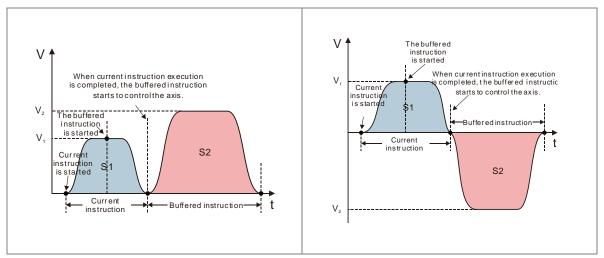

Blending with low velocity: Buffermode=mcBlendingLow. See three cases as below.

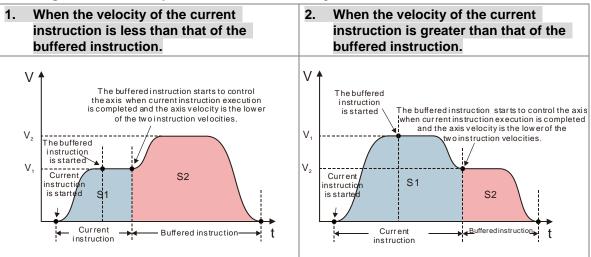



3. When the velocity direction of the current instruction is opposite to that of the buffered instruction.

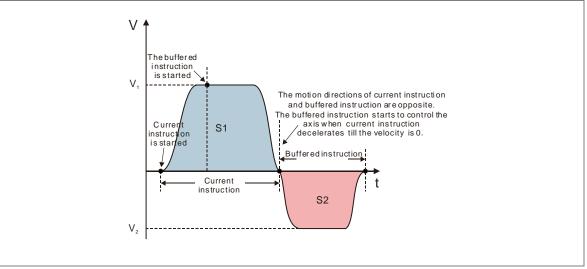


Blending with previous velocity: Buffermode=mcBlendingPrevious. See three cases as below.


1.	When the target velocity of the current	2.	When the target velocity of the current
	instruction is less than that of the buffered instruction.	1	instruction is greater than that of the buffered instruction.
		1	

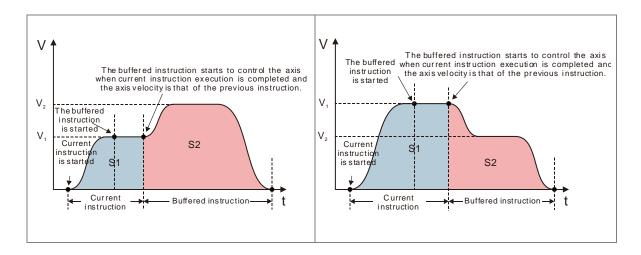

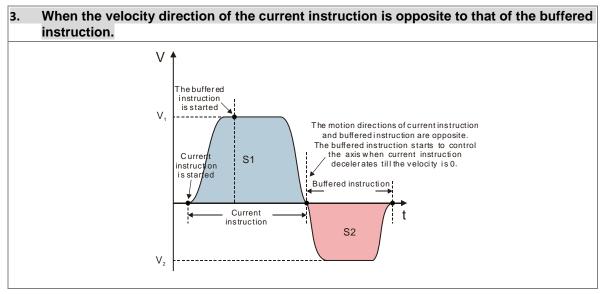

Blending with next velocity: Buffermode=mcBlendingNext. See three cases as below.

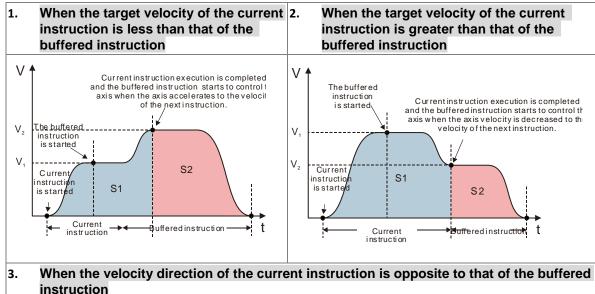

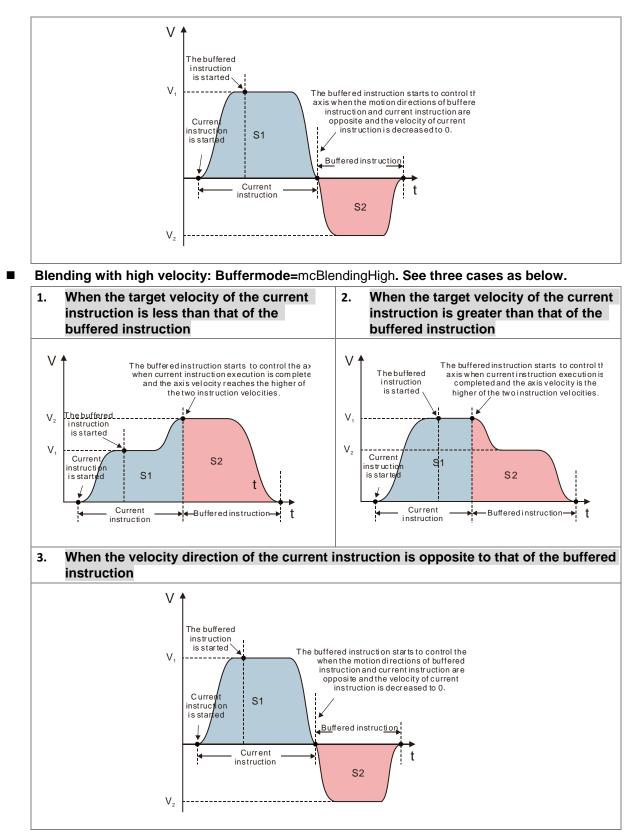

## Buffer Modes that various instructions support

The buffer mode of the current instruction and buffered instruction is set by modifying the value of the *BufferMode* parameter. The value of BufferMode of the buffered instruction is selected according to the buffer mode that current instruction supports and the *BufferMode* parameter of the current instruction is invalid.

## For example:

The *BufferMode* of MC\_MoveRelative supports mcAborting, mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext and mcBlendingHigh. The *BufferMode* of MC\_MoveVelocity supports mcAborting and mcBuffered.

- <u>Case 1</u>: If MC\_MoveRelative is the current instruction and MC\_MoveVelocity is the buffered instruction. The *BufferMode* parameter of MC\_MoveVelocity can select one of mcAborting, mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext and mcBlendingHigh.
- <u>Case 2</u>: If MC\_MoveVelocity is the current instruction and MC\_MoveRelative is the buffered instruction. The *BufferMode* parameter of MC\_MoveRelative can select one of mcAborting and mcBuffered.

The buffer mode of the buffered instruction can be selected according to the current instruction as listed below.

Current instruction	The selectable <i>BufferMode</i> value of the buffered instruction
MC_MoveAbsolute	【mcAborting, mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext, mcBlendingHigh】*1
MC_MoveRelative	【mcAborting, mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext, mcBlendingHigh】*1
MC_MoveAdditive	【mcAborting, mcBuffered, mcBlendingLow, mcBlendingPrevious, mcBlendingNext, mcBlendingHigh】*1
MC_MoveSuperimposed	mcAborting
MC_HaltSuperimposed	mcAborting
MC_MoveVelocity	mcAborting, mcBuffered
MC_Home	Only the MC_Stop instruction can abort the MC_Home instruction.
MC_Halt	mcAborting, mcBuffered
MC_ GearIn	mcAborting, mcBuffered
MC_ GearOut	mcAborting, mcBuffered
MC_CombineAxes	mcAborting, mcBuffered
MC_CamIn	mcAborting, mcBuffered
MC_ CamOut	mcAborting, mcBuffered

\*1: The *BufferMode* parameter of the buffered instructions MC\_GearIn, MC\_CamIn and MC\_CombineAxes can only choose mcAborting and mcBuffered.

Whether the current instruction execution has been completed or not depends on the completion output parameter of the instruction. As the completion output parameter is TRUE, it indicates that the instruction execution is completed and the buffered instruction execution starts.

See the completion output parameters of instructions in the following table so as to judge the instruction execution state in a buffer mode.

Instruction name	Is it a buffered instruction? (Yes or No)	Can it be followed by a buffered instruction? (Yes or No)	Completion output parameter of an instruction
MC_Home	No	No	Done
MC_Stop	No	No	Done
MC_Halt	Yes	Yes	Done
MC_MoveAbsolute	Yes	Yes	Done
MC_MoveRelative	Yes	Yes	Done
MC_MoveAdditive	Yes	Yes	Done
MC_MoveSuperimposed	No	No	
MC_HaltSuperimposed	No	No	
MC_MoveVelocity	Yes	Yes	InVelocity
MC_CamIn	Yes	Yes	EndOfProfile
MC_CamOut	No	Yes	Done
MC_GearIn	Yes	Yes	InGear
MC_GearOut	No	Yes	Done
MC_CombineAxes	Yes	Yes	InSync

## • Examples of Buffer Modes


## Example 1

The following example explains six buffer modes for the switch from the execution of one MC\_MoveRelative instruction to the other MC\_MoveRelative instruction.


## The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel1	MC_MoveRelative	
Rel1_Ex	BOOL	FALSE
Rel1_BM	MC_Buffer_Mode	0
Rel1_Done	BOOL	
Rel1_Bsy	BOOL	
Rel1_Act	BOOL	
Rel1_Abt	BOOL	
Rel1_Err	BOOL	
Rel1_ErrID	WORD	
Rel2	MC_MoveRelative	
Rel2_Ex	BOOL	FALSE
Rel2_BM	MC_Buffer_Mode	

Variable name	Data type	Initial value
Rel2_Done	BOOL	
Rel2_Bsy	BOOL	
Rel2_Act	BOOL	
Rel2_Abt	BOOL	
Rel2_Err	BOOL	
Rel2_ErrID	WORD	

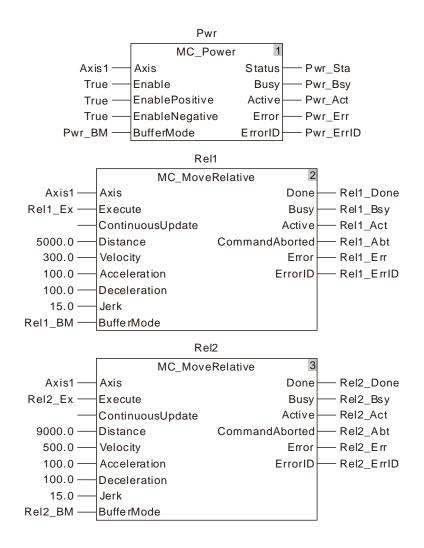


## Rel2\_BM=mcAborting

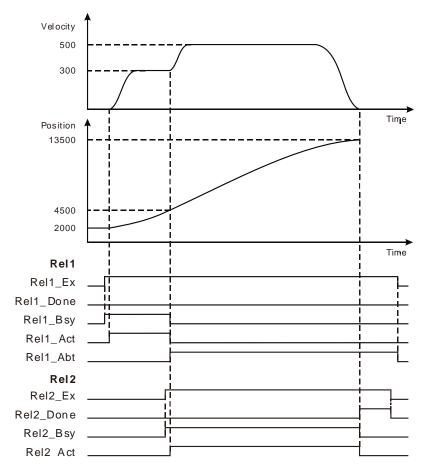

- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet, Rel2\_Ex changes from FALSE to TRUE and Rel2\_Bsy changes to TRUE. One period later, Rel1\_Abt and Rel2\_Act change to TRUE and Rel1\_Bsy and Rel1\_Act change to FALSE. Meanwhile the first MC\_MoveRelative instruction is aborted and the second MC\_MoveRelative instruction execution starts. As the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.


10-14

### Rel2\_BM =mcMcBuffered

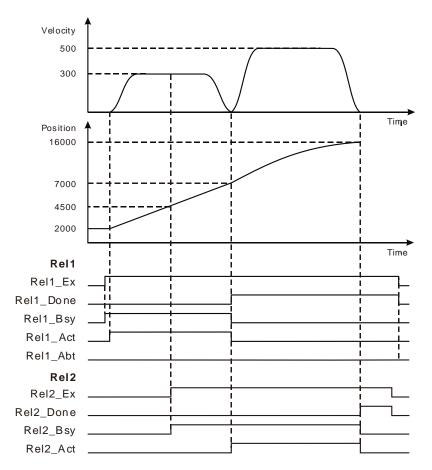

- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet and Rel2\_Ex changes from FALSE to TRUE, Rel2\_Bsy changes to TRUE, Rel1\_Bsy and Rel1\_Act remain TRUE and the first MC\_MoveRelative instruction execution continues. As the target position is reached, Rel1\_Done changes to TRUE, Rel1\_Bsy and Rel1\_Act change to FALSE. Rel2\_Act changes to TRUE and the second MC\_MoveRelative instruction execution starts immediately. When the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel1\_Ex changes from TRUE to FALSE, Rel1\_Done changes to FALSE. As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.


## Rel2\_BM =mcBlendingLow

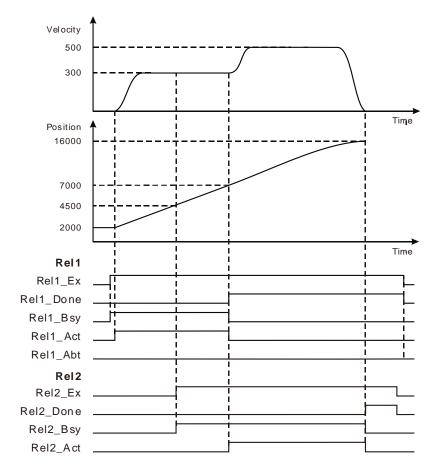

- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet and Rel2\_Ex changes from FALSE to TRUE, Rel2\_Bsy changes to TRUE, Rel1\_Bsy and Rel1\_Act remain TRUE and the first MC\_MoveRelative instruction execution continues. As the target position is reached, Rel1\_Done changes to TRUE. At the moment, the velocity is 300 units /second which is the lower one of the target velocities of the current instruction and buffered instruction, Rel1\_Bsy and Rel1\_Act change to FALSE, Rel2\_Act changes to TRUE and the second MC\_MoveRelative instruction execution starts immediately. As the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel1\_Ex changes from TRUE to FALSE, Rel1\_Done changes to FALSE. As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.


10-16

## Rel2\_BM =mcBlending \_Previous

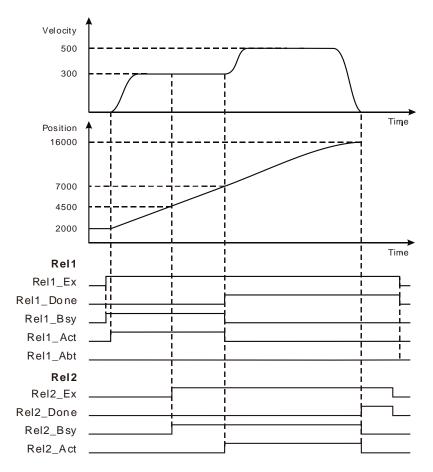

- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet and Rel2\_Ex changes from FALSE to TRUE, Rel2\_Bsy changes to TRUE, Rel1\_Bsy and Rel1\_Act remain TRUE and the first MC\_MoveRelative instruction execution continues. As the target position is reached, Rel1\_Done changes to TRUE. At the moment, the velocity is 300 units /second which is the target velocity of the current instruction, Rel1\_Bsy and Rel1\_Act change to FALSE, Rel2\_Act changes to TRUE and the second MC\_MoveRelative instruction execution starts immediately. As the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel1\_Ex changes from TRUE to FALSE, Rel1\_Done changes to FALSE. As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.


## Rel2\_BM =mcBlending \_Next

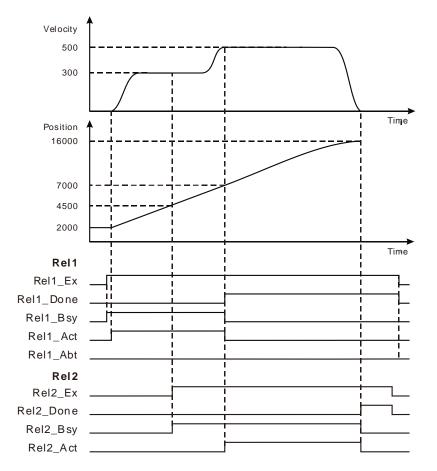

- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet and Rel2\_Ex changes from FALSE to TRUE, Rel2\_Bsy changes to TRUE, Rel1\_Bsy and Rel1\_Act remain TRUE and the first MC\_MoveRelative instruction execution continues. As the target position is reached, Rel1\_Done changes to TRUE. At the moment, the velocity is 500 units /second which is the target velocity of the buffered instruction; Rel1\_Bsy and Rel1\_Act change to FALSE; Rel2\_Act changes to TRUE and the second MC\_MoveRelative instruction execution starts. As the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel1\_Ex changes from TRUE to FALSE, Rel1\_Done changes to FALSE. As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.

10-18

## Rel2\_BM =mcBlending \_High

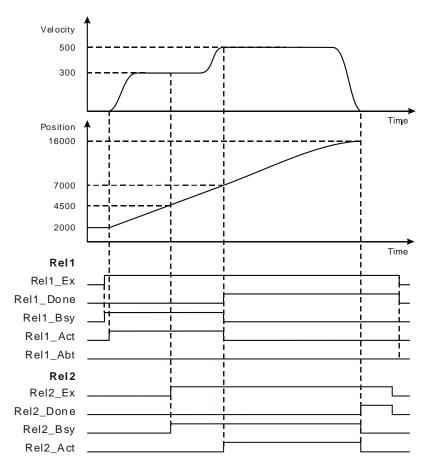


- As Rel1\_Ex changes from FALSE to TRUE, Rel1\_Bsy changes to TRUE. One period later, Rel1\_Act changes to TRUE and the first MC\_MoveRelative instruction execution starts. While the target position is not reached yet and Rel2\_Ex changes from FALSE to TRUE, Rel2\_Bsy changes to TRUE, Rel1\_Bsy and Rel1\_Act remain TRUE and the first MC\_MoveRelative instruction execution continues. As the target position is reached, Rel1\_Done changes to TRUE. At the moment, the velocity is 500 units /second which is the higher one of the target velocities of the current instruction and buffered instruction; Rel1\_Bsy and Rel1\_Act change to FALSE; Rel2\_Act changes to TRUE and the second MC\_MoveRelative instruction execution starts. As the target position is reached, Rel2\_Done changes to TRUE and meanwhile Rel2\_Bsy and Rel2\_Act change to FALSE.
- As Rel1\_Ex changes from TRUE to FALSE, Rel1\_Done changes to FALSE. As Rel2\_Ex changes from TRUE to FALSE, Rel2\_Done changes to FALSE.

## • Example 2


The following example explains the axis states for different *BufferMode* values with a MC\_MoveVelocity instruction and a MC\_MoveReltave instruction which is the buffered instruction.

## The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	FALSE
Vel_Vel	LREAL	10000.0
Vel_Acc	LREAL	10000.0
Vel _Dec	LREAL	10000.0
 Vel _Jerk	LREAL	10000.0
 Vel _Dir	MC_DIRECTION	1
 Vel _BM	 MC_Buffer_Mode	
 Vel _Invel	BOOL	
 Vel _Bsy	BOOL	
Vel_Act	BOOL	
 Vel _Abt	BOOL	
 Vel _Err	BOOL	
 Vel _ErrID	WORD	
Rel	MC_MoveRelative	
Rel_Ex	BOOL	FALSE
Rel_Dist	LREAL	100000.0
Rel_Vel	LREAL	20000.0
Rel_Acc	LREAL	10000.0
Rel_Dec	LREAL	10000.0
Rel_Jerk	LREAL	10000.0
 Rel_BM	MC_Buffer_Mode	0
 Rel_Done	BOOL	
 Rel_Bsy	BOOL	
Rel_Act	BOOL	
 Rel_Abt	BOOL	
 Rel_Err	BOOL	
 Rel_ErrID	WORD	

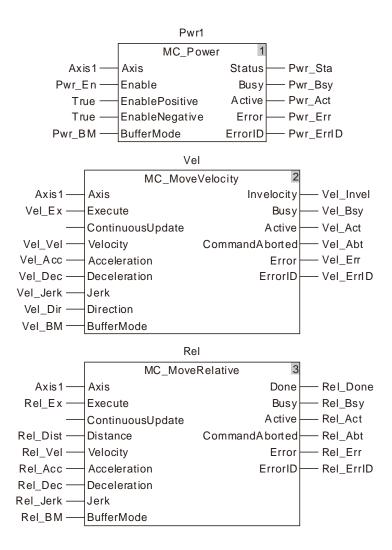


## Rel\_BM =mcAborting

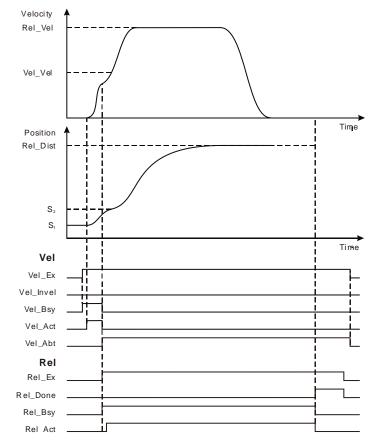

As Vel\_Ex changes from FALSE to TRUE, Vel\_Bsy changes to TRUE. One period later, Vel\_Act changes to TRUE. Before the target velocity is reached, the axis moves at the velocity and acceleration specified by the MC\_MoveRelative instruction as Rel\_Ex changes from FALSE to TRUE. As Vel\_Abt changes to TRUE, Vel\_Bsy and Vel\_Act change to FALSE, the velocity instruction is aborted, the MC\_MoveRelative instruction is executed and Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. As the positioning is completed, Rel\_Done changes to TRUE.

## Rel\_BM =mcBuffered

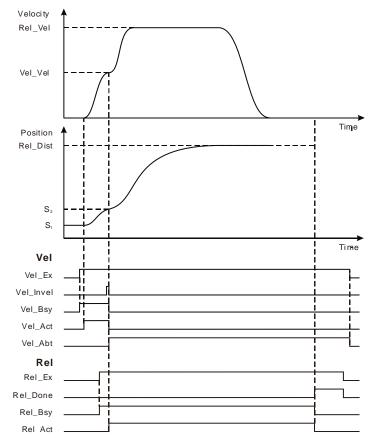

- As Vel\_Ex changes from FALSE to TRUE, Vel\_Bsy changes to TRUE. One period later, Vel\_Act changes to TRUE. Rel\_Ex changes from FASLE to TRUE when the target velocity is not reached. The axis will not execute the MC\_MoveRelatvie instruction till the velocity instruction execution is completed. At the moment, Rel\_Bsy changes to TRUE. When the velocity instruction execution is completed, Vel\_Invel changes to TRUE and one period later, the MC\_MoveRelatvie instruction starts to control the axis. Vel\_Abt changes to TRUE and the velocity instruction is aborted. Rel\_Act is TRUE, which means that the MC\_MoveRelative instruction starts to control the axis. Rel\_Done changes to TRUE as the positioning is completed.
- (The effect of Rel\_BM = mcBlendingLow, mcBlendingPrevious, mcBlendingNext or mcBlendingHigh is the same as that of Rel\_BM = mcBuffered.)


## • Example 3


The example explains the axis states for different *BufferMode* value with a MC\_MoveRelative instruction and a MC\_MoveVelocity instruction which is the buffered instruction.

Variable name	Data type	Initial value	
Pwr	MC_Power		
Axis1	USINT	1	
Pwr_En	BOOL	FALSE	
Pwr_BM	MC_Buffer_Mode	0	
Pwr_Sta	BOOL		
Pwr_Bsy	BOOL		
Pwr_Act	BOOL		

### The variable table and program

Variable name	Data type	Initial value
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel	MC_MoveRelative	
Rel_Ex	BOOL	FALSE
Rel_Dist	LREAL	100000.0
Rel_Vel	LREAL	10000.0
Rel_Acc	LREAL	10000.0
Rel_Dec	LREAL	10000.0
Rel_Jerk	LREAL	10000.0
Rel_BM	MC_Buffer_Mode	0
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel _Ex	BOOL	FALSE
Vel _Vel	LREAL	20000.0
Vel _Acc	LREAL	10000.0
Vel _Dec	LREAL	10000.0
Vel _Jerk	LREAL	10000.0
Vel _Dir	MC_DIRECTION	1
Vel _BM	MC_Buffer_Mode	
Vel _Invel	BOOL	
Vel _Bsy	BOOL	
Vel _Act	BOOL	
Vel _Abt	BOOL	
Vel _Err	BOOL	
Vel _ErrID	WORD	

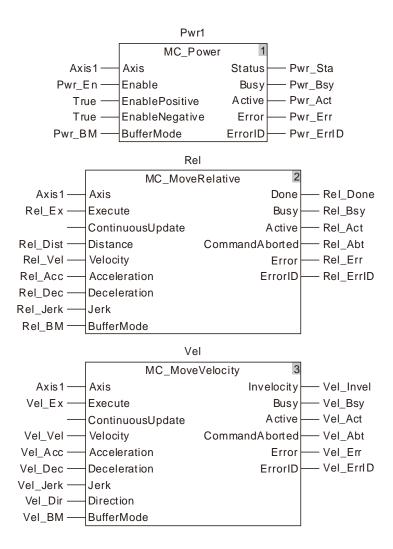


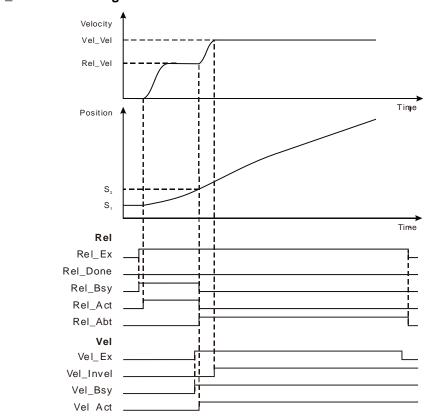

As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE, the axis moves at the velocity and acceleration specified by the velocity instruction. When Rel\_Abt changes to TRUE, Rel\_Bsy and Rel\_Act change to FALSE, the MC\_MoveRelative instruction is aborted and the velocity instruction is executed. Vel\_Bsy is TRUE and one period later, Vel\_Act changes to TRUE. As the velocity is reached, Vel\_Invel changes to TRUE.


## ■ Vel \_BM =mcAborting

## Vel \_BM =mcBuffered

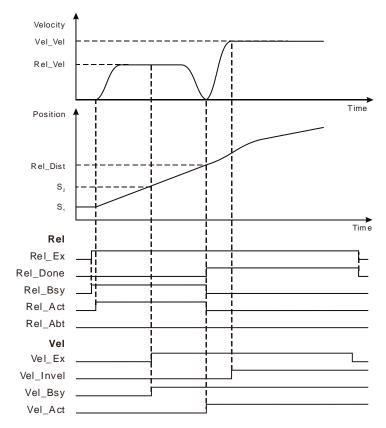


As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE. The axis decelerates to 0 when the execution of the MC\_MoveRelative instruction is completed. Then Rel\_Done changes to TRUE, Rel\_Bsy and Rel\_Act change to FALSE and the axis moves at the velocity and acceleration specified by the velocity instruction. Vel\_Bsy changes to TRUE and one period later, Vel\_Act changes to TRUE. Rel\_Invel changes to TRUE as the target velocity is reached.

## Vel \_BM =mcBlendingLow

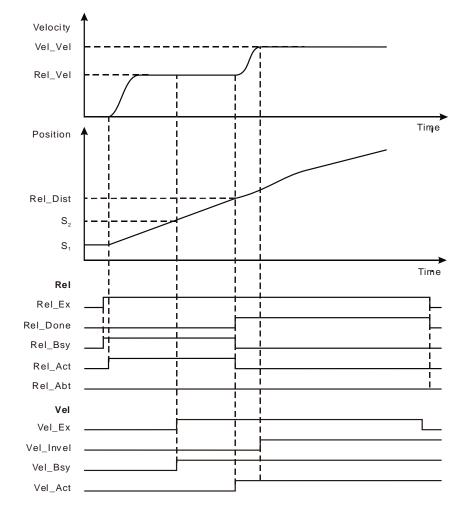


As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE and Vel\_Bsy changes to TRUE. The axis will wait for the completion of MC\_MoveRelative execution. After MC\_MoveRelative execution is completed, Rel\_Done changes to TRUE, Rel\_Bsy changes to FALSE and Rel\_Act changes to FALSE. Meanwhile Vel\_Act changes to TRUE. At the moment, the velocity is 10000units/second, which is the lower one of the target speeds of the current instruction and the buffered instruction. The velocity instruction execution starts after MC\_MoveRelative instruction execution is completed. Vel\_Invel changes to TRUE when the target velocity is reached.

## Vel \_BM =mcBlendingPrevious

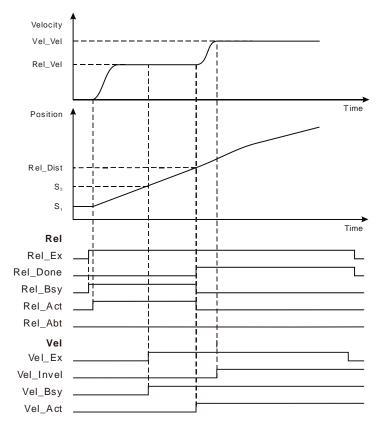


As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE and Vel\_Bsy changes to TRUE. The axis will wait for the completion of MC\_MoveRelative execution. After MC\_MoveRelative execution is completed, Rel\_Done changes to TRUE, Rel\_Bsy changes to FALSE, Rel\_Act changes to FALSE and meanwhile Vel\_Act changes to TRUE. At the moment, the velocity is 10000units/second (which is the target speed of the current instruction). Vel\_Invel changes to TRUE when the target velocity is reached.

## Vel \_BM =mcBlendingNext

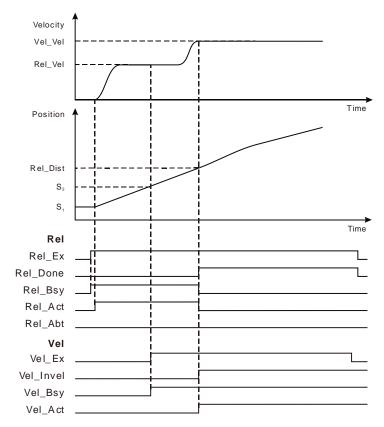

As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE and Vel\_Bsy changes to TRUE. The axis will wait for the completion of MC\_MoveRelative execution. After MC\_MoveRelative execution is completed, Rel\_Done changes to TRUE, Rel\_Bsy changes to FALSE, Rel\_Act changes to FALSE and meanwhile Vel\_Act changes to TRUE. At the moment, the velocity is 20000units/second (which is the target speed of the buffered instruction). Vel\_Invel changes to TRUE when the target velocity is reached.

## Vel \_BM =mcBlendingHigh

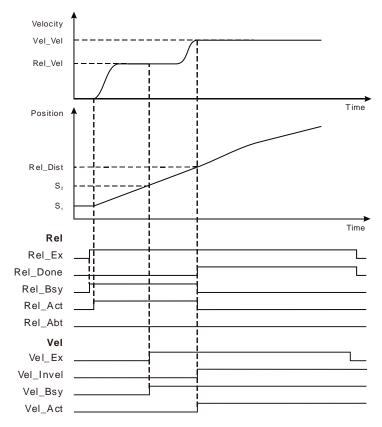


As Rel\_Ex changes from FALSE to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE. When the target position is not reached, Vel\_Ex changes from FALSE to TRUE and Vel\_Bsy changes to TRUE. The axis will wait for the completion of MC\_MoveRelative execution. After MC\_MoveRelative execution is completed, Rel\_Done changes to TRUE, Rel\_Bsy changes to FALSE and Rel\_Act changes to FALSE. At the moment, the velocity is 20000units/second (which is the higher one of the target speeds of the current instruction and the buffered instruction). And then the axis runs according to the velocity, acceleration and deceleration specified by the velocity instruction. Vel\_Invel changes to TRUE when the target velocity is reached.

# 10.4 The State Machine

When the motion controller utilizes the motion control instruction to control every axis, there is one internal-run state for every axis and axis states are switched by following the state machine instructions below. The state machine defines the motion instructions that can be executed in all states and the states after the motion instructions are executed. Using the motion instructions, users could judge if a certain instruction could be used in current state through the state machine.

The state machine of the motion controller is illustrated as below and the arrow points to the axis status.

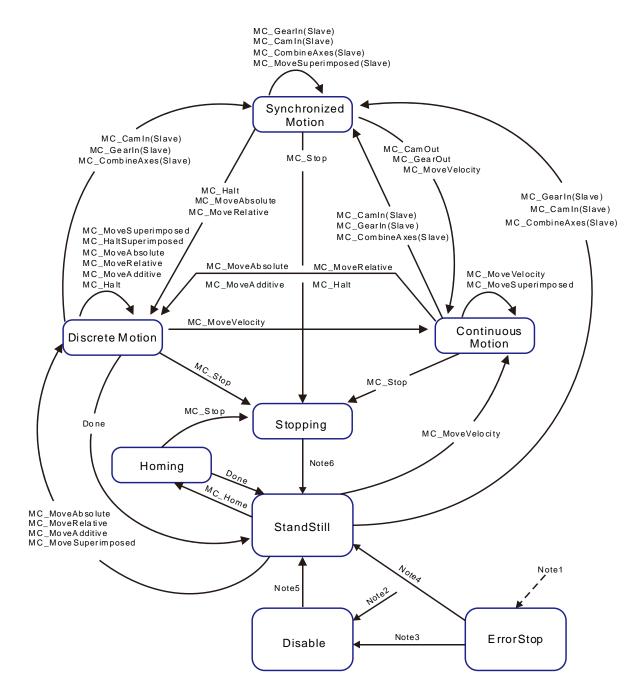

Note1 : The axis in any state will enter the ErrorStop state as long as an error occurs in the axis.

**Note2** : The axis enters the Disabled state when no axis error occurs in any state and *Enable* of MC\_Power is FALSE.

- **Note3**: When *Status* of MC\_Power is FALSE, the MC\_Reset instruction is used to reset the axis to the Disabled state.
- **Note4**: When *Enable* and *Status* of MC\_Power are TRUE, the MC\_Reset instruction is used to reset the axis to the Standstill state.
- **Note5** : The axis enters from Disabled to *Standstill* state when the MC\_Power instruction is used to enable the axis and *Status* of MC\_Power is TRUE.
- **Note6** : The axis enters from Stopping to *Standstill* state when *Done* of MC\_Stop is TRUE and *Execute* of MC\_Stop is FALSE.

No.	Axis state	Indication
1	StandStill	Pre-execution state
2	Disabled	No-execution state
3	ErrorStop	Error state
4	Stopping	Stop state
5	Homing	Homing state
6	Discrete Motion	Discrete motion state
7	Continuous Motion	Continuous motion state
8	Synchronized Motion	Synchronized motion state

**Note:** Axis state can be judged according to the output parameters of the MC\_ReadStatus instruction. Refer to section 11.3.17 for details on the MC\_ReadStatus instruction.

MEMO

# 11

# **Chapter 11 Motion Control Instructions**

# **Table of Contents**

11.1 Table of Motion Control Instructions	11-4
<b>11.2 About Motion Control Instructions</b>	11-6 oport 11-6
11.2.3 Configuration of Motion Control Instructions	
11.3 Single-axis Instructions	
11.3.1 MC_Power	
11.3.2 MC_Home	
11.3.3 MC_MoveVelocity	
11.3.4 MC_Halt	
11.3.5 MC_Stop	
11.3.6 MC_MoveRelative	
11.3.7 MC_MoveAdditive	
11.3.8 MC_MoveAbsolute	
11.3.9 MC_MoveSuperimposed	
11.3.10MC_HaltSuperimposed	
11.3.11MC_SetPosition	
11.3.12MC_SetOverride	
11.3.13MC_Reset	
11.3.14DMC_SetTorque	
11.3.15MC_ReadAxisError 11.3.16MC_ReadActualPosition	
11.3.17MC_ReadStatus	
11.3.18MC_ReadMotionState	
11.3.19DMC_ReadParameter_Motion	
11.3.20DMC_WriteParameter_Motion	
11.3.21 DMC_TouchProbe	
11.3.22 DMC_TouchProbeCyclically	
11.3.23 DMC_Jog	
11.3.24 DMC_MoveVelocityStopByPos	
11.3.25 DMC_MoveVelocityStopByLinePos	
11.3.26DMC_ReadPositionLagStatus	
11.3.27 DMC_WritePositionLagSetting	

11.3.28DMC_ChangeMechanismGearRatio	
11.3.29DMC_TorqueControl	
11.3.30DMC_MoveVelocity	
11.3.31DMC_SwitchSoftLimit	
11.4 Multi-axis Instructions	11-165
11.4.1 MC_GearIn	
11.4.2 MC_GearOut	
11.4.3 MC_CombineAxes	11-177
11.4.4 Introduction of Electronic Cam	11-185
11.4.5 MC_CamIn	
11.4.6 MC_CamOut	
11.4.7 DMC_CamReadPoint	
11.4.8 DMC_CamWritePoint	
11.4.9 DMC_CamSet	
11.4.10DMC_CamReadTappetStatus	
11.4.11DMC_CamReadTappetValue	
11.4.12DMC_CamWriteTappetValue	
11.4.13DMC_CamAddTappet	
11.4.14DMC_CamDeleteTappet	
11.5 Application Instructions	11-242
11.5.1 Rotary Cut Technology	
11.5.2 Rotary Cut Parameters	11 2/2
5	
11.5.3 Control Feature of Rotary Cut Function	11-244
11.5.3 Control Feature of Rotary Cut Function 11.5.4 Introduction to Cam Curve with Rotary Cut Function	11-244 11-245
11.5.3 Control Feature of Rotary Cut Function 11.5.4 Introduction to Cam Curve with Rotary Cut Function 11.5.5 Rotary-cut Instructions	
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> </ul>	
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> </ul>	11-244 11-245 11-249 11-249 11-252
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> </ul>	11-244 11-245 11-249 11-249 11-252 11-254
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> </ul>	11-244 11-245 11-249 11-249 11-252 11-254
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> </ul>	11-244 11-245 11-249 11-249 11-252 11-254 11-256
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	11-244 11-245 11-249 11-249 11-252 11-254 11-256 <b>11-260</b> 11-260 11-261
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> <li>11.5.6 Application Example of Rotary Cut Instructions</li> <li>11.6.1 CNC Introduction</li> <li>11.6.2 G Code Input Format</li> <li>11.6.3 Explanation of G Code Formats</li> <li>11.6.4 G Code Functions</li> </ul>	11-244 11-245 11-249 11-252 11-254 11-256 <b>11-260</b> 11-260 11-261 11-261 11-262
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	11-244 11-245 11-249 11-249 11-252 11-254 11-256 <b>11-260</b> 11-260 11-261 11-262 11-262
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	11-244 11-245 11-249 11-252 11-254 11-256 11-260 11-260 11-261 11-262 11-262 11-263
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> <li>11.5.6 Application Example of Rotary Cut Instructions</li> <li>11.6.1 CNC Introduction</li> <li>11.6.2 G Code Input Format</li> <li>11.6.3 Explanation of G Code Formats</li> <li>11.6.4 G Gode Functions</li> <li>11.6.4.1 G90 (Absolute Mode)</li> <li>11.6.4.3 G0 (Rapid Positioning)</li> </ul>	11-244 11-245 11-249 11-249 11-252 11-254 11-256 11-260 11-260 11-261 11-262 11-262 11-263 11-264
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	11-244 11-245 11-249 11-252 11-254 11-256 11-260 11-260 11-260 11-262 11-262 11-263 11-264 11-267
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> <li>11.5.6 Application Example of Rotary Cut Instructions</li> <li>11.6.1 CNC Introduction</li> <li>11.6.2 G Code Input Format</li> <li>11.6.3 Explanation of G Code Formats</li> <li>11.6.4.1 G90 (Absolute Mode)</li> <li>11.6.4.2 G91 (Relative Mode)</li> <li>11.6.4.3 G0 (Rapid Positioning)</li> <li>11.6.4.4 G1 (Linear Interpolation)</li> <li>11.6.4.5 G2 (Clockwise Circular/ Helical Interpolation)</li> </ul>	11-244 11-245 11-249 11-252 11-254 11-256 11-256 11-260 11-260 11-261 11-262 11-262 11-263 11-264 11-267 11-271
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li></ul>	11-244 $11-245$ $11-249$ $11-252$ $11-254$ $11-256$ $11-260$ $11-260$ $11-260$ $11-262$ $11-262$ $11-262$ $11-263$ $11-263$ $11-264$ $11-267$ $11-271$ $11-278$
<ul> <li>11.5.3 Control Feature of Rotary Cut Function</li> <li>11.5.4 Introduction to Cam Curve with Rotary Cut Function</li> <li>11.5.5 Rotary-cut Instructions</li> <li>11.5.5.1 APF_RotaryCut_Init</li> <li>11.5.5.2 APF_RotaryCut_In</li> <li>11.5.5.3 APF_RotaryCut_Out</li> <li>11.5.6 Application Example of Rotary Cut Instructions</li> <li>11.6.1 CNC Introduction</li> <li>11.6.2 G Code Input Format</li> <li>11.6.3 Explanation of G Code Formats</li> <li>11.6.4.1 G90 (Absolute Mode)</li> <li>11.6.4.2 G91 (Relative Mode)</li> <li>11.6.4.3 G0 (Rapid Positioning)</li> <li>11.6.4.4 G1 (Linear Interpolation)</li> <li>11.6.4.5 G2 (Clockwise Circular/ Helical Interpolation)</li> </ul>	11-244 11-245 11-249 11-252 11-254 11-254 11-256 11-260 11-260 11-260 11-261 11-262 11-262 11-263 11-264 11-271 11-278 e)11-284

11.6.4.9	G50 (Precise Stop)	. 11-285
11.6.4.10	G51 (Round path transition)	. 11-286
	G52 (Smooth path transition)	
	M Code	
11.6.5 G Co	ode Instructions	. 11-291
11.6.5.1	DMC_CartesianCoordinate	. 11-291
11.6.5.2	DMC_ReadMFunction	. 11-297
11.6.5.3	DMC_ResetMFunction	. 11-300
11.6.5.4	DMC_SetGOPara	. 11-303
11.6.5.5	DMC_SetG1Para	. 11-306
11.6.5.6	DMC_SetStartPosition	. 11-309
11.7 Axes Gr	oup Instructions	11-312
	AddAxisToGroup	
	 C_RemoveAxisFromGroup	
	 UngroupAllAxes	
	GroupEnable	
	C_GroupStop	
11.7.7 DMC	GroupContinue	. 11-332
11.7.8 DMC		. 11-334
11.7.9 DMC	_MoveDirectRelative	. 11-339
11.7.10DMC	_MoveLinearAbsolute	. 11-344
11.7.11DMC	_MoveLinearRelative	. 11-358
	_MoveCircularAbsolute	
11.7.13DMC	_MoveCircularRelative	. 11-382
11.7.14DMC	C_GroupSetOverride	. 11-393
11.7.15DMC	GroupReadActualPosition	. 11-398
11.8 Coordin	nation Instructions	11-400
11.8.1 DMC	ControlAxisByPos	. 11-400
11.8.2 DMC	C_NC	. 11-405

# **11.1 Table of Motion Control Instructions**


Instruction set	Instruction code	Function	
	MC_Power	Power Servo	
	MC_Home	Homing	
	MC MoveVelocity	Velocity	
	MC_Halt	Temporary Stop	
	MC_Stop	Stop	
	MC MoveRelative	Relative Positioning	
	MC MoveAdditive	Additive Positioning	
	MC_MoveAbsolute	Absolute Positioning	
	MC_MoveSuperimposed	Superimposed Positioning	
	MC_HaltSuperimposed	Halt Superimposing	
	MC_SetPosition	Set Position	
	MC_SetOverride	Set Override Factors	
	MC Reset	Reset	
	DMC_SetTorque	Set Torque	
Single-axis instructions	MC_ReadAxisError	Read Axis Error	
	MC_ReadActualPosition	Read Actual Position	
	MC_ReadStatus	Read Axis Status	
	MC_ReadMotionState	Read Motion State	
	DMC_ReadParameter_Motion	Read a Parameter	
	DMC_WriteParameter_Motion	Write a Parameter Value	
	DMC_TouchProbe	Capture Axis Position	
	DMC TouchProbeCyclically	Capture axis position cyclically	
	DMC_Jog	Jog	
	DMC_MoveVelocityStopByPos	Stop at a specified phase	
	DMC_MoveVelocityStopByLine Pos	Stop at a specified position	
	DMC_ReadPositionLagStatus	Detect position lag	
	DMC_WritePositionLagSetting	Set position lag	
	DMC_ChangeMechanismGearR atio	Modify axis parameter value	
	DMC TorqueControl	Torque control	
	DMC_MoveVelocity	Change velocity and make it valid immediately	
	DMC_SwitchSoftLimit	Software limit switch	
	MC_GearIn	Start E-Gear Operation	
	MC_GearOut	End E-Gear Operation	
	MC_CombineAxes	Combine Axes	
	MC_CamIn	Start E-Cam Operation	
Multi-axis instructions	MC CamOut	End E-Cam Operation	
	DMC_CamReadPoint	Read cam point information	
	DMC_CamWritePoint	Set cam point parameters	
	DMC_CamSet	Make the modified cam point info	

Instruction set	Instruction code	Function
		effective
	DMC_CamReadTappetStatus	Read tappet status
	DMC_CamReadTappetValue	Read tappet parameters
	DMC_CamWriteTappetValue	Set tappet parameters
	DMC CamAddTappet	Add a tappet point
	DMC_CamDeleteTappet	Delete a tappet point
	APF_RotaryCut_Init	Initialize Rotary Cut
Application instructions	APF_RotaryCut_In	Rotary Cut In
	APF_RotaryCut_Out	Rotary Cut Out
	DMC_CartesianCoordinate	Cartesian-coordinate robot
	DMC_ReadMFunction	Read M code status
	DMC_ResetMFunction	Reset M code
G Code Instructions	DMC_SetG0Para	Set G0 parameter
	DMC SetG1Para	Set G1 parameter
	DMC SetStartPosition	Set start position
	DMC_AddAxisToGroup	Add an axis to an axes group
	DMC_RemoveAxisFromGroup	Remove an axis from an axes group
	DMC_UngroupAllAxes	Remove all axes in an axes group
	DMC_ GroupEnable	Enable an axes group
	DMC_GroupStop	Stop the current axes group motion
	DMC_GroupInterrupt	Pause the current axes group motion temporarily
Axes Group Instructions	DMC GroupContinue	Make the paused axes group continue to run
	DMC_MoveDirectAbsolute	Direct absolute positioning
	DMC MoveDirectRelative	Direct relative positioning
	DMC_MoveLinearAbsolute	Linear absolute interpolation
	DMC_MoveLinearRelative	Linear relative interpolation
	DMC_MoveCircularAbsolute	Circular absolute interpolation
	DMC_MoveCircularRelative	Circular relative interpolation
	DMC_GroupSetOverride	Set override
	DMC_GroupReadActualPosition	Read actual position of axes in an group
Coordination Instructions	DMC ControlAxisByPos	Incremental position control
Coordination Instructions	DMC_NC	CNC File Parsing

# **11.2 About Motion Control Instructions**

# 11.2.1 Composition of A Motion Control Instruction

The instructions starting with "MC\_" or "DMC" belong to motion instructions.

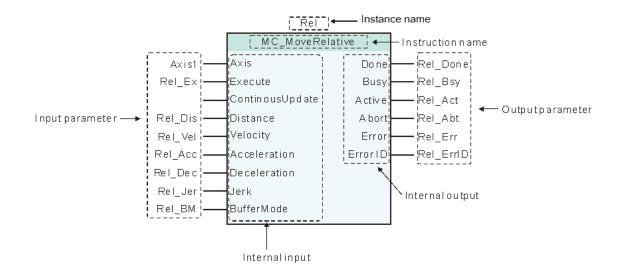

# 11.2.2 Program Languages that Motion Control Instructions Support

The motion instructions support the following two types of program languages.

For details, refer to the software help file.

- Ladder diagram (LD)
- Structured text (ST)

# 11.2.3 Configuration of Motion Control Instructions

Motion instructions can only be added to the motion event task. Otherwise, they can not be executed if they are added to other types of tasks.

The following table shows task types and whether motion instruction can be added to these tasks.

Task type		Whether motion intructions can be added or not	
Cyclic		No	
Freewheeling		No	
Triggered by	Motion event	Yes	
event	Non-motion event	No	

11

# **11.3 Single-axis Instructions**

# 11.3.1 MC\_Power

FB/FC	Explanation	Applicable model
FB	MC_Power is used to enable or disable the corresponding servo axis.	AS524C-B
	MC_Power_instance	

MC_Power_instance				
	MC_Powe	r		
	Axis	Status		
	Enable	Busy		
	EnablePositive	Active		
	EnableNegative	Error		
	BufferMode	ErrorID		

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE
EnablePositive	The specified axis is allowed to move forward only under the condition that <i>Enable</i> is TRUE and <i>EnablePositive</i> is also TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE
EnableNegative	The specified axis is allowed to move reversely only under the condition that <i>Enable</i> is TRUE and <i>EnableNegative</i> is also TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE
Buffermode	Specify the behavior of MC_Power when <i>Enable</i> changes to FALSE	MC_Buffer Mode	0: mcAborting 1: mcBuffered (0)	When <i>Enable</i> changes to TRUE

## Note:

Motion control instructions can control servo axes for corresponding motions only after Power ON. When Power OFF, no motion control instructions can be executed.

Parameter name	Function	Data type	Valid range
Status	TRUE when the axis is enabled.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE


## • Output Parameters

Parameter name	Function	Data type	Valid range
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

## • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Status	When the axis is enabled.	<ul> <li>When <i>Enable</i> changes to FALSE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Busy	<ul> <li>When the instruction is being executed.</li> </ul>	◆ When <i>Error</i> changes to TRUE.
Active	<ul> <li>The instruction starts controlling the axis.</li> </ul>	◆ When <i>Error</i> changes to TRUE.
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	<ul> <li>When an abnormal situation is cleared.</li> </ul>

## • Output Update Timing Chart

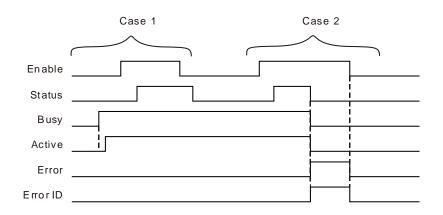

- **Case 1**: When MC\_Power instruction is executed for the first time, *Busy* changes to TRUE and one cycle later, *Active* changes to TRUE. After *Enable* changes from FALSE to TRUE and the axis is enabled, *Status* changes to TRUE. After *Enable* changes from TRUE to FALSE and the axis is disabled, *Status* changes from TRUE to FALSE.
- **Case 2**: When an error occurs in the execution of the instruction, *Error* changes to TRUE, the corresponding error code is contained in *ErrorID* and meanwhile *Status*, *Busy* and *Active* all change to FALSE. *Error* changes to FALSE when the error is cleared.

## Function

This instruction is used to enable or disable the corresponding servo axis.

- 1. *Status* will not change to TRUE if the axis is not enabled yet after *Enable* is set to TRUE. Please make sure that *Status* has already changed to TRUE before the axis is started to move.
- 2. When *Enable* and *EnablePositive* are both TRUE, the axis specified by a motion instruction is allowed to move in the positive direction.
- 3. When *Enable* is TRUE and *EnablePositive* is FALSE, the axis specified by a motion instruction is prohibited to move in the positive direction. In this case, there will be an error in existence if some motion instruction is used to move the axis forward. If the axis moves from backward to forward, the

instruction which is controlling the motion of the axis will be aborted and the axis will stop moving and enter the state of Standstill.

- 4. When *Enable* and *EnableNegative* are both TRUE, the axis specified by a motion instruction can move in the negative direction.
- 5. When *Enable* is TRUE and *EnableNegative* is FALSE, the axis specified by a motion instruction is prohibited to move in the negative direction. In this case, there will be an error in existence if some motion instruction is used to move the axis backward. If the axis moves from forward to backward, the instruction which is controlling the motion of the axis will be aborted and the axis will stop moving and enter the state of Standstill.
- 6. When the axis moves in the positive direction and *EnablePositive* changes from TRUE to FALSE, the axis will decelerate its speed at the deceleration rate specified by the current motion instruction controlling the axis and finally stop at the velocity of 0. When the axis moves in the negative direction and *EnableNegative* changes from TRUE to FALSE, the axis will decelerate its speed at the deceleration rate specified by the current motion instruction controlling the axis and finally stop at the velocity of 0. When the axis moves in the negative direction and *EnableNegative* changes from TRUE to FALSE, the axis will decelerate its speed at the deceleration rate specified by the current motion instruction controlling the axis and finally stop at the velocity of 0.
- 7. In principle, only one MC\_Power can be used for one axis. If there are two MC\_Power instructions in the program where the same axis is controlled, please refer to the execution result of the MC\_Power which is executed late.
- 8. While a motion instruction is controlling the axis, *Enable* of MC\_Power changes from TRUE to FALSE and whether the axis enters the Disable state depends on the value of Buffermode.

## 9. Buffermode

BufferMode specifies the behavior of MC\_Power when Enable changes from TRUE to FALSE.

Input	BufferMode selection	Function
Enable	0: mcAborting (Interrupt)	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE, the axis will stop moving immediately and become disabled (The state machine enters the state of Disabled).</li> <li>Precaution: Be cautious during operation in case of any danger to personnel or devices!</li> </ul>
	1: mcBuffered (Waiting)	When <i>Enable</i> changes from TRUE to FALSE, the axis will not enter the Disabled state immediately. Only when the axis stops moving, the state machine goes to the Standstill state first and one cycle later, it enters the Disabled state.

## Programming Example 1


## The example of MC\_Power instruction execution

When Pwr\_En is TRUE and Pwr\_EnPs is FALSE, the axis specified by the motion instruction is forbidden to move in the positive direction. While the axis is moving in the positive direction and Pwr\_EnPs changes from TRUE to FALSE, the axis will decelerate its speed at the deceleration rate specified by the current motion instruction controlling the axis till the velocity of the axis reaches 0.


#### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_EnPs	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	

Variable name	Data type	Initial value
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel _Ex	BOOL	FALSE
Vel _Dir	MC_DIRECTION	1
Vel _BM	MC_Buffer_Mode	0
Vel _Invel	BOOL	
Vel _Bsy	BOOL	
Vel _Act	BOOL	
Vel _Abt	BOOL	
Vel _Err	BOOL	
Vel _ErrID	WORD	

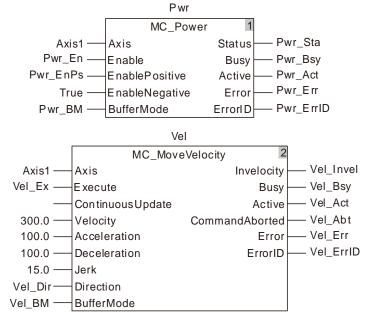

2. Motion Curve and Timing Chart

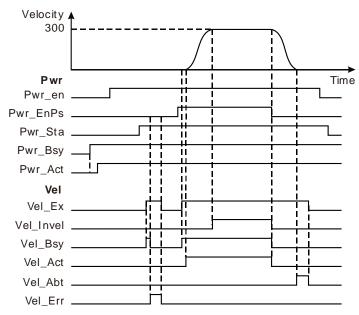

- When Vel \_Ex changes to TRUE for the first time, Vel \_Bsy changes to TRUE and one cycle later, Vel \_Err changes to TRUE. At this moment, the servo motor could not move because Pwr\_EnPs is FALSE.
- When Pwr\_EnPs is TRUE and Vel \_Ex changes to TRUE for the second time, Vel \_Bsy changes to TRUE; one cycle later, Vel \_Act changes to TRUE and the servo motor starts moving in the positive direction. When the servo motor reaches the target velocity, Vel \_Invel changes to TRUE.
- When Pwr\_EnPs changes to FALSE, MC\_Velocity instruction is aborted and the servo motor begins to decelerate its speed at the deceleration rate specified by MC\_Velocity instruction. When the velocity is decreased to 0, CommandAborted changes to TRUE.
- When Vel \_Ex changes to FALSE, Vel \_Abt changes to FALSE.
- When Pwr\_En changes to FALSE, Pwr\_Sta change to FALSE after the axis is disabled.

### Programming Example 2


#### The example of Vel \_BM =0


When the value of Vel \_BM is set to 0 and Pwr\_En changes from TRUE to FALSE, the axis will enter the Disabled state and the velocity will be decreased to 0 immediately.

#### 1. The variables and program


Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_EnPs	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	1
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel _Ex	BOOL	FALSE

Variable name	Data type	Initial value
Vel _Dir	MC_DIRECTION	1
Vel _BM	MC_Buffer_Mode	0
Vel _Invel	BOOL	
Vel _Bsy	BOOL	
Vel _Act	BOOL	
Vel _Abt	BOOL	
Vel _Err	BOOL	
Vel _ErrID	WORD	
Stp	MC_Stop	
Stp _Ex	BOOL	FALSE
Stp _Done	BOOL	
Stp _Bsy	BOOL	
Stp_Act	BOOL	
Stp _Abt	BOOL	
Stp _Err	BOOL	
Stp _ErrID	WORD	

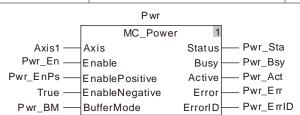

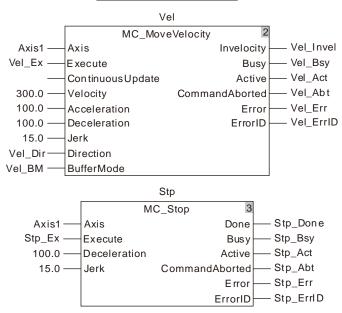

2. Motion Curve and Timing Chart

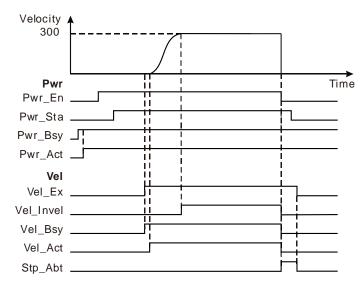

- When Vel \_Ex changes to TRUE, the servo motor starts moving in the positive direction. When the speed of the servo motor reaches target velocity, Vel \_Invel changes to TRUE.
- When Pwr\_En changes to FALSE, the speed of the servo motor is decreased to 0 and the axis enters the Standstill state right away. At the same time, Vel \_Abt changes to TRUE and Vel \_Bsy and Vel \_Act change to FALSE. Pwr\_Sta changes to FALSE after the axis is disabled.
- When Vel \_Ex changes to FALSE, Vel \_Abt changes to FALSE.


# Programming Example 3

### The example of Vel\_BM =1


When the value of *Buffermode* is set to 1 and *Enable* changes from TRUE to FALSE, there will be no change in *Status* of MC\_Power unless the axis stops moving. When the axis stops moving, the axis will enter the Standstill state first and one cycle later, it will go to the Disabled state.

### 1. The variables and program

Variable name	Data type	Initial value	
Pwr	MC_Power		
Axis1	USINT	1	
Pwr_En	BOOL	FALSE	
Pwr_EnPs	BOOL	FALSE	
Pwr_BM	MC_Buffer_Mode	0	
Pwr_Sta	BOOL		
Pwr_Bsy	BOOL		
Pwr_Act	BOOL		
Pwr_Err	BOOL		
Pwr_ErrID	WORD		
Vel	MC_MoveVelocity		
Vel _Ex	BOOL	FALSE	
Vel _Dir	MC_DIRECTION	1	
Vel _BM	MC_Buffer_Mode	0	
Vel _Invel	BOOL		
Vel _Bsy	BOOL		
Vel _Act	BOOL		
Vel _Abt	BOOL		
Vel _Err	BOOL		
Vel _ErrID	WORD		
Stp	MC_Stop		
Stp _Ex	BOOL	FALSE	
Stp _Done	BOOL		
Stp _Bsy	BOOL		
Stp _Act	BOOL		
Stp _Abt	BOOL		
Stp _Err	BOOL		
Stp _ErrID	WORD		

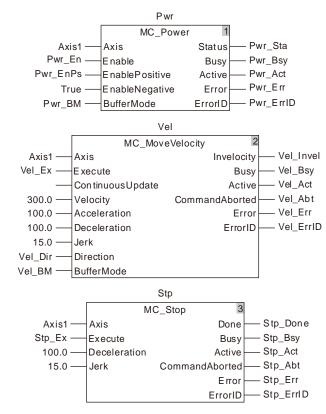

2. Motion Curve and Timing Chart

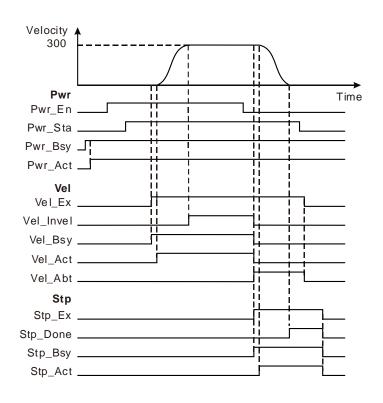


When Vel \_Ex changes to TRUE, Vel \_Bsy changes to TRUE; one cycle later, Vel \_Act changes to TRUE and the servo motor starts moving in the positive direction. When the speed of the servo motor reaches the target velocity, Vel \_Invel changes to TRUE.

- When Pwr\_En changes to FALSE, the axis will not enter the Standstill state immediately. When Stp \_Ex changes to TRUE, Stp \_Bsy changes to TRUE; one cycle later, Stp \_Act changes to TRUE and the servo motor begins to decelerate. When the speed of the servo motor drops to 0, Stp \_Done changes to TRUE. Meanwhile, the axis enters the Standstill state and Pwr\_Sta changes to FALSE. One cycle later, the axis goes to the Disabled state.
- When Vel \_Ex changes to FALSE, Vel \_Abt changes to FALSE.
- When Stp \_Ex changes to FALSE, Stp \_Done, Stp \_Bsy and Stp \_Act change to FALSE.

### 11.3.2 MC\_Home

FB/FC	Explanation	Applicable model	
FB	<b>FB</b> MC_Home controls the servo motor to perform the homing action according to the set mode and velocity.		
MC_Home_instance			

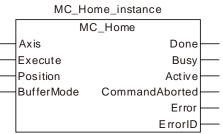

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Position	The servo home point offset, Unit: unit.	LREAL	Negative number, positive number and 0 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
BufferMode	Reserved	-	-	-


### • Output Parameters

Parameter name	Parameter name Function		Valid range
Done	Done TRUE when the homing is completed.		TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When homing is completed.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### Output Update Timing

### • Output Update Timing Chart

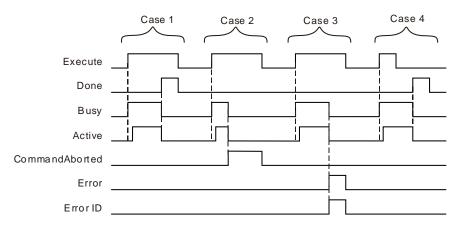

**Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Active* changes to TRUE. When the positioning is completed, *Done* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE.

- **Case 2**: When the instruction is aborted by other instruction after *Execute* changes from FALSE to TRUE, *CommandAborted* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs such as axis alarms or Offline after *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4** : *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE in the course of execution of the instruction. Meanwhile, *Busy* and *Active* change to FALSE and one cycle later, *Done* changes to FALSE.

### Function

- 1. According to the set homing mode, the MC\_Hme instruction is used for connecting the home switch and positive limit switch or negative limit switch to the external input points of the servo drive so as to achieve the homing function.
- 2. For real axes, the homing mode and phase-1 speed and phase-2 speed of the homing are set in the software axis parameter setting. See Appendix D for details on homing modes. For virtual axes, the homing mode can only be set to mode 35.
- 3. The instruction can be executed only while the axis is in Stanstill state. Otherwise, an error will occur.
- 4. Position parameter defines the offset between the mechanical zero point and servo reference zero point as the figure below:

A	Mechanical zero point, where the photoelectric sensor is.	For different <i>Position</i> value, the servo will eventually stop at the mechanical point A under the control of this instruction. But the reference zero point of the servo position will change as shown below.
•	The position is where the servo is after execution of the instruction is finished.	As Position=10000, the reference zero point of the servo position is point D and point A position is 10000;
		As Position=-15000, the reference zero point of the servo position is point C and point A position is -15000;

As Position=-10000, the reference zero point of the servo position is point B and point A position is -10000.

# 📕 Programming Example

Select an appropriate homing mode via the positions of the mechanism and photoelectric switch. When Hom \_Ex changes from FALSE to TRUE, the motion controller controls the servo motor to rotate and drive the mechanism to return to the mechanical zero point position A.

Hardware wiring Motion Controller ASD-CNSCD050 Motion Motion Motion COM+ COM-Home switch

Home position A

### Note:

- During wiring, COM+ and VDD must be shorted.
- Of the photoelectric switch, the brown terminal (24V+) is connected to COM+, the blue terminal (0V) is connected to COM- and the black terminal (Signal cable) is connected to DI7.
- The DI7 function is set to the home switch, i.e. P2-16 is set to 124.

### • Homing mode selection

It can be seen from the hardware wiring figure that the mechanism regards the home switch position as the mechanical zero point position A. The home switch is OFF before searching for the home. While the mechanism is searching for the home point, the servo rotates reversely at beginning and homing mode 21 can be selected to achieve the homing.


The settings for homing in the corresponding axis parameters are as follows.

Homing mode	21
The first-phase speed (the speed for finding the home switch, Unit: r/m)	100
The second-phase speed (The speed from finding the home switch	10
to reaching the mechanical zero point, Unit: r/m)	

Note: The set axis parameters are valid after being downloaded.

Variable name	Data type	Initial value	
Hom	MC_Home		
Axis1	USINT	1	
Hom_Ex	BOOL	FALSE	
Hom_Done	BOOL		
Hom_Bsy	BOOL		
Hom_Act	BOOL		
Hom_Abt	BOOL		
Hom_Err	BOOL		
Hom_ErrID	WORD		

#### • The variable table and program

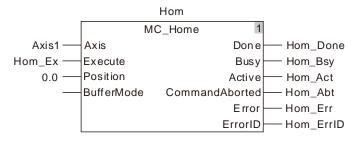

- When Hom\_Ex changes from FALSE to TRUE, the motion controller controls the motion of the servo motor. The mechanism starts to run reversely, rotates forward after reaching the home switch and then stops at the mechanical zero point. And the mechanism is driven to return to the mechanical zero point A by doing so.
- When the home switch is met, the homing is completed and Hom\_Done is set to ON.

# 11.3.3 MC\_MoveVelocity

FB/FC	Explanation			Applicable model		
FB		controls the axis motion based on the set acceleration I the set target velocity is reached and then the axis beed.			AS524C-B	
	MC_MoveVelocity_instance					
		MC_Mov	eVelocity			
		Axis	Invelocity			
		Execute	Busy			
		ContinuousUpdate	Active			
		Velocity	CommandAborted			
		Acceleration	Error			
		Deceleration	ErrorID			
		Jerk				
		Direction				

BufferMode

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpdate	Reserved	-	-	-
Velocity	Specify the target speed (Unit: unit/second)	LREAL	Positive number, Negative number and 0 ( The variable value must be set )	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the target acceleration (Unit: unit/second <sup>2</sup> )	LREAL	Positive number ( The variable value must be set )	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the target deceleration (Unit: unit/second <sup>2</sup> )	LREAL	Positive number ( The variable value must be set )	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number ( The variable value must be set )	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Direction	Specify the rotation direction 1: Positive direction 3: Negative direction 4: Current direction (When the motor is in stop state, the current direction is the positive direction.)	MC_Direc tion	1: mcPositiveDirection, 3: mcNegativeDirection 4: mcCurrentDirection, (1)	When <i>Execute</i> changes from FALSE to TRUE
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered 2: BlendingLow 3: BlendingPrevious 4: BlendingNext 5: BlendingHigh	MC_Buffe r_Mode	0: mcAborting 1: mcBuffered 2: mcBlendingLow 3: mcBlendingPrevious 4: mcBlendingNext 5: mcBlendingHigh ( 0 )	When <i>Execute</i> changes from FALSE to TRUE

#### Notes:

- 1. MC\_MoveVelocity instruction is executed when *Execute* changes from FALSE to TRUE. The instruction can be re-executed when *Execute* of the instruction changes from FALSE to TRUE again no matter whether the instruction execution is completed. At the moment, the parameters including *Velocity*, *Acceleration*, *Deceleration*, *Jerk* and *Direction* are effective again and other parameters are ineffective. When the velocity instruction has the BufferMode relationship with other motion instruction, the parameters will be valid after the instruction parameters are changed and the instruction is re-triggered. The previous buffermode relation remains and the transition speed will be re-calculated.
- Invelocity remains TRUE even if the target speed is changed through MC\_SetOverride after the velocity instruction execution is completed (that is, *Invelocity* changes from FALSE to TRUE.) Invelocity will change from FALSE to TRUE when the new target speed is reached after the target speed is changed through MC\_SetOverride before the execution of MC\_MoveVelocity is completed (when *Invelocity* is FALSE.)
- 3. Refer to section 10.2 for the relation among *Position, Velocity, Acceleration and Jerk*.
- 4. Refer to section 10.3 for details on *BufferMode*.

Parameter name	Function	Data type	Valid range
Invelocity	TRUE when the target velocity is reached.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	


### • Output Parameters

11-23

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Invelocity	<ul> <li>When the target velocity is reached.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> <li>Invelocity changes to FALSE immediately when Execute changes from FALSE to TRUE again if the input parameter values are revised after the target velocity is reached. If the input parameter values are not changed after the instruction execution is completed and Execute changes from FALSE to TRUE again, Invelocity changes to FALSE immediately and Invelocity changes to TRUE in the next cycle.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### • Output Update Timing Chart

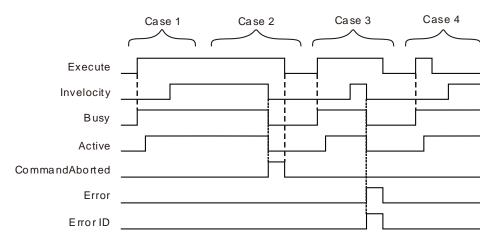

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Active* changes to TRUE. When the target velocity is reached, *Invelocity* changes to TRUE and meanwhile, *Busy* and *Active* remain TRUE.
- **Case 2**: When *Execute* is TRUE, the instruction is aborted by other instruction and *CommandAborted* changes to TRUE. Meanwhile, *Invelocity*, *Busy and Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.

- **Case 3**: When an error occurs such as parameter error while *Execute* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Invelocity, Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Invelocity* changes to TRUE when the target velocity is reached after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* remain TRUE.

### • Function


MC\_MoveVelocity controls the axis to speed up or down according to the set acceleration, deceleration and jerk till the set target velocity is reached and after that the axis moves at the target speed. The direction of the uniform motion is determined by the input parameter *Direction*. The *Direction* value 1 indicates the positive direction, 3 is the negative direction and 4 is the current direction. If *Direction* value is set to 4 and the axis is in STOP state before the MC\_MoveVelocity instruction is executed, the axis will move in the positive direction.

### Programming Example 1


The programming example is as follows when one MC\_ MoveVelocity instruction is used.

### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_BM	MC_Buffer_Mode	1
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1
Vel_BM	MC_Buffer_Mode	0
Vel_Invel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	

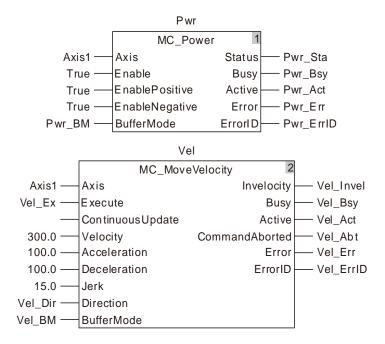

### 2. Motion Curve and Timing Chart

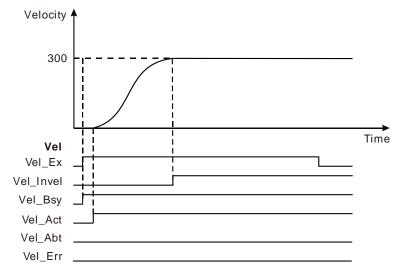

- When Vel\_Ex changes from FALSE to TRUE, Vel\_Bsy changes to TRUE. One cycle later, Vel\_Act changes to TRUE and the execution of the velocity instruction starts. When the target velocity is reached, Vel\_Invel changes to TRUE and Vel\_Bsy and Vel\_Act remain TRUE.
- When Vel\_Ex changes from TRUE to FALSE, Vel\_Inve, Vel\_Bsy and Vel\_Act remain TRUE.


# Programming Example 2

Below is the example that one MC\_MoveVelocity instruction aborts another MC\_MoveVelocity instruction.


Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_BM	MC_Buffer_Mode	1
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel1	MC_MoveVelocity	
Vel1_Ex	BOOL	FALSE
Vel1_Dir	MC_DIRECTION	1
Vel1_BM	MC_Buffer_Mode	0
Vel1_Invel	BOOL	
Vel1_Bsy	BOOL	
Vel1_Act	BOOL	
Vel1_Abt	BOOL	
Vel1_Err	BOOL	
Vel1_ErrID	WORD	
Vel2	MC_MoveVelocity	
Vel2_Ex	BOOL	FALSE
Vel2_Dir	MC_DIRECTION	1
Vel2_BM	MC_Buffer_Mode	0

#### 1. The variable table and program

Variable name	Data type	Initial value
Vel2_Invel	BOOL	
Vel2_Bsy	BOOL	
Vel2_Act	BOOL	
Vel2_Abt	BOOL	
Vel2_Err	BOOL	
Vel2_ErrID	WORD	

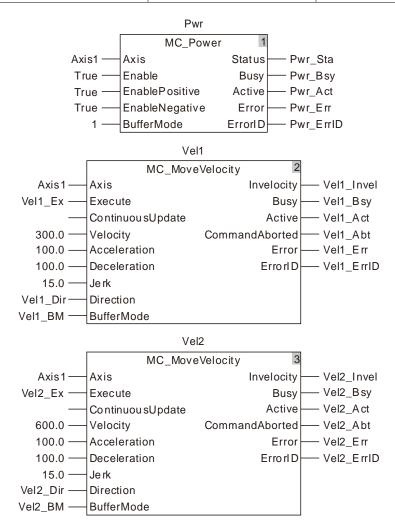


#### 2. Motion Curve and Timing Chart

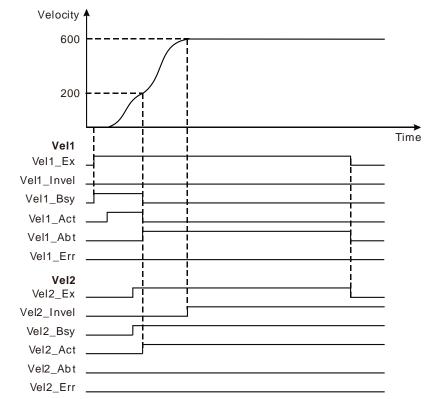

- When Vel1\_Ex changes from FALSE to TRUE, Vel1\_Bsy changes to TRUE. One cycle later, Vel1\_Act changes to TRUE and the first MC\_MoveVelocity instruction starts being executed. When the target velocity is not reached, Vel2\_Ex changes from FALSE to TRUE and Vel2\_Bsy changes to TRUE. One cycle later, Vel2\_Act changes to TRUE, the first MC\_MoveVelocity instruction is aborted, Vel1\_Abt changes to TRUE and the axis starts to perform the second MC\_MoveVelocity instruction. When the target velocity is reached, Vel2\_Invel changes to TRUE and meanwhile, Vel2\_Bsy and Vel2\_Act remain TRUE.
- When Vel1\_Ex changes from TRUE to FALSE, Vel1\_Abt changes to FALSE. When Vel2\_Ex changes from TRUE to FALSE, Vel2\_Invel, Vel2\_Bsy and Vel2\_Act remain TRUE.

### 11.3.4 MC\_Halt

FB/FC	Explanation	Applicable model		
FB	MC_Halt is used to make the axis decelerate at a given deceleration rate till it stops.	AS524C-B		
MC Link instance				

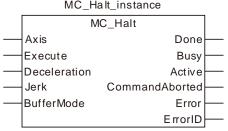

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered	MC_Buffer_ Mode	0: mcAborting 1: mcBuffered (0)	When <i>Execute</i> changes from FALSE to TRUE

Note:

- 1. MC\_Halt instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction changes from TRUE to FALSE in the course of the instruction execution.
- 2. While *Execute* changes from FALSE to TRUE once more in the course of execution of MC\_Halt, there is no impact on the instruction execution and the instruction will continue being executed in the previous way. When *Execute* changes from FALSE to TRUE once again after the instruction execution is completed, the instruction can be re-executed.
- 3. Refer to section10.2 for the relation between *Deceleration and Jerk*.
- 4. Refer to section10.3 for details on *BufferMode*.


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE/FALSE
CommandAbort ed	TRUE when the instruction is aborted.	BOOL	TRUE/FALSE
Error	TRUE when there is an error.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	-

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the deceleration ends and the axis speed is decreased to 0.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When CommandAborted changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When CommandAborted changes to TRUE.</li> </ul>
Command Aborted	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li>CommandAborted changes to TRUE when the instruction is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, CommandAborted changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### Output Update Timing Chart

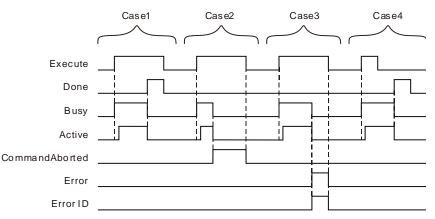

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When the deceleration ends and the axis speed is decreased to 0, *Done* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE.
- **Case 2**: After *Execute* changes from FALSE to TRUE and the instruction is aborted by other instruction, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs such as axis alarms or Offline after *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* change to FALSE and one period later, *Done* changes to FALSE.

### Function

MC\_Halt is used to make the axis decelerate at a given deceleration rate till it stops.

the axis after MC\_Halt execution is over and the axis has stopped.

- The state machine enters DiscreteMotion as MC\_Halt starts being executed. When the axis speed is decreased to 0, Done changes to TRUE and meanwhile, the state machine enters Standstill.
- Compared to MC\_Stop instruction, MC\_Halt instruction can not make the axis locked and thus the controller can perform other motion instruction on it.
  MC\_Halt can be aborted through performing other motion instruction when the axis is decelerated during execution of MC Halt. Other motion instruction can be executed by the controller to restart


## Programming Example

The example of MC\_Halt execution is shown below.

### 1. The variable table and program


Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	

Variable name	Data type	Initial value
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1
Vel_BM	MC_Buffer_Mode	0
Vel_Invel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	
Hlt	MC_Halt	
Hlt_Ex	BOOL	FALSE
HIt_BM	MC_Buffer_Mode	0
Hlt_Done	BOOL	
Hlt_Bsy	BOOL	
Hlt_Act	BOOL	
Hlt_Abt	BOOL	
Hlt_Err	BOOL	
HIt_ErrID	WORD	

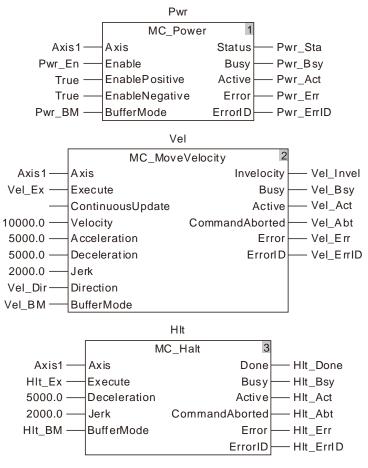

11-33

### 2. Motion Curve and Timing Charts:

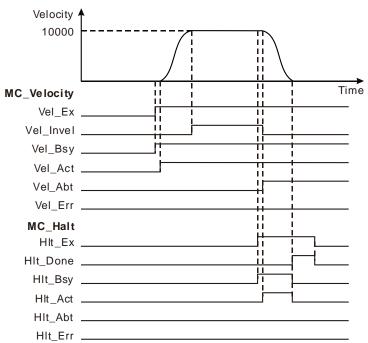

- When Vel\_Ex changes to TRUE, Vel\_Bsy changes to TRUE and one period later, Vel\_Act changes to TRUE and the servo motor starts to move forward. Vel\_Invel changes to TRUE as the servo motor reaches the target velocity.
- When HIt\_Ex changes to TRUE, HIt\_Bsy changes to TRUE and one period later, HIt\_Act changes to TRUE. Meanwhile, Vel\_Invel changes to FALSE and Vel\_Abt changes to TRUE and then the servo motor starts to decelerate.
- When the axis velocity is decreased to 0, HIt\_Done changes to TRUE and meanwhile, HIt\_Bsy and HIt\_Act change to FALSE.
- ✤ As HIt\_Ex changes to FALSE, HIt\_Done changes to FALSE.

### 11.3.5 MC\_Stop

FB/FC	Explanation			Applicable model	
FB	MC_Stop is used to make the axis decrease its speed at a given deceleration rate till it stops and then the axis goes into the Stopping state.				AS524C-B
	MC_Stop_instance				
		MC_Stop			
		Axis	Done		
		Execute	Busy		

Active

Error ErrorID

CommandAborted

Deceleration

Jerk

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

#### Note:


- 1. MC\_Stop instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction changes from TRUE to FALSE in the course of the instruction execution.
- 2. While *Execute* changes from FALSE to TRUE once more in the course of execution of MC\_Halt, there is no impact on the instruction execution and the instruction will continue being executed in the previous way. When *Execute* changes from FALSE to TRUE once again after the instruction execution is completed, the instruction can be re-executed.
- 3. Refer to section 10.2 for the relation between Deceleration and Jerk.

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE/FALSE
CommandAborte d	TRUE when the instruction is aborted.	BOOL	TRUE/FALSE
Error	TRUE when there is an error.	BOOL	TRUE/FALSE

Parameter name	Function		Data type	Valid range
	Contains error codes when an error occurs. to section 12.2 for the corresponding error c		WORD	
Output Updat	te Timing			
Parameter name	Timing for changing to TRUE	Timin	g for changing	to FALSE
Done	When the deceleration ends and the axis speed is decreased to 0.	<ul> <li>FALSE a complete</li> <li>Done cha instructio Execute</li> <li>during the</li> </ul>	d. anges to TRUE n execution is o	ion execution is when the completed after IRUE to FALSE ecution. One
Busy	When Execute changes to TRUE.	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> <li>When <i>Done</i> changes from TRUE to FALSE.</li> </ul>		
Active	When the instruction starts to control the axis.	<ul> <li>When Control</li> <li>TRUE.</li> </ul>	ror changes to optimized by the second se	d changes to
CommandAborted	When the instruction execution is aborted by another MC_Stop.	<ul> <li>When Execute changes from TRUE to FALSE.</li> <li>CommandAborted changes to TRUE when the instruction is aborted by another MC_Stop after Execute changes from TRUE to FALSE during the instruction execution. One period later, CommandAborted changes to FALSE.</li> </ul>		
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	● When <i>Ex</i> FALSE	<i>ecute</i> changes	from TRUE to

### Output Update Timing Chart

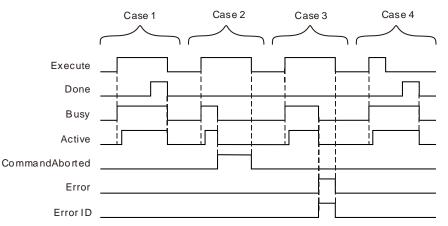

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When the deceleration ends and the axis speed is decreased to 0, *Done* changes to TRUE and *Busy* and *Active* remain TRUE.
- **Case 2**: When the MC\_Stop instruction is aborted by another MC\_Stop instruction after *Execute* changes from FALSE to TRUE, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs such as axis alarm or Offline after *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *Error/D* shows the corresponding error code. And Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Done* changes to TRUE and *Busy* and *Active* remain TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. One period later, *Done, Busy* and *Active* all change to FALSE.

### Function

MC\_Stop is used to make the axis decrease its speed at a given deceleration rate till it stops.

- As long as *Execute* is TRUE after execution of MC\_Stop is completed and the axis velocity is decreased to 0, the axis state will be in the Stopping state all the time. And during that period, other motion instruction can not be executed.
- If there are two MC\_Stop instructions in the program for controlling the same axis, the previously being executed MC\_Stop will be aborted by the later executed MC\_Stop instruction.
- Compared to MC\_Halt instruction, MC\_Stop instruction will make the axis locked and thus the controller cannot perform other motion instruction excluding MC\_Stop during MC\_Stop execution. The controller still cannot perform other motion instructions when the execution of MC\_Stop is finished and the axis has stopped. Other motion instruction can not be executed until *Execute* of MC\_Stop changes from TRUE to FALSE.


### Programming Example 1

The example of MC\_Stop execution is shown as below.


### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0

Variable name	Data type	Initial value
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1
Vel_BM	MC_Buffer_Mode	0
Vel_Invel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	
Stp	MC_Stop	
Stp_Ex	BOOL	FALSE
Stp_Done	BOOL	
Stp_Bsy	BOOL	
Stp_Act	BOOL	
Stp_Abt	BOOL	
Stp_Err	BOOL	
Stp_ErrID	WORD	

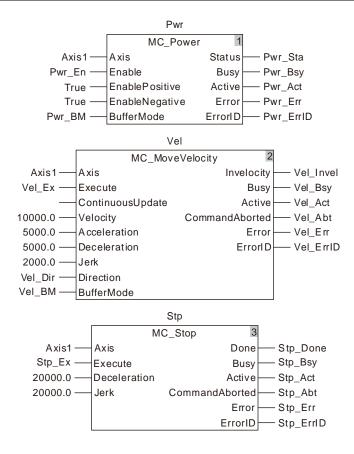

### 2. Motion Curve and Timing Charts:

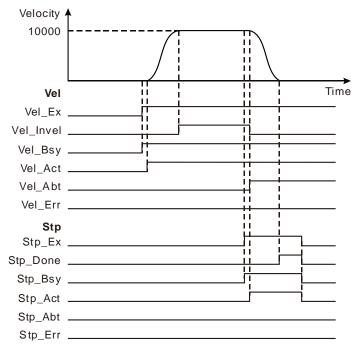

- As Vel\_Ex changes to TRUE, Vel\_Bsy changes to TRUE. One period later, Vel\_Act changes to TRUE and the servo motor starts to move forward. Vel\_Invel changes to TRUE when the servo motor reaches the target velocity.
- As Stp\_Ex changes to TRUE, Stp\_Bsy changes to TRUE. One period later, Stp\_Act changes to TRUE, meanwhile Vel\_Invel changes to FALSE, Vel\_Abt changes to TRUE and the servo motor starts to decelerate.
- When the axis velocity is decreased to 0, Stp\_Done changes to TRUE and meanwhile Stp\_Bsy, Stp\_Act remain TRUE.
- As Stp\_Ex changes to FALSE, Stp\_Done, Stp\_Bsy and Stp\_Act change to FALSE simultaneously.

### 11.3.6 MC\_MoveRelative

FB/FC		Explanation				
FB	MC_MoveRelative is use starting from the comma acceleration and deceler	AS524C-B				
MC_MoveRelative_instance						
	MC_MoveRelative					
		Axis	Done			
		Execute	Busy			
		ContinuousUpdate	Active			
		Distance	CommandAborted			
		Velocity	Error			
		Acceleration	ErrorID			

Deceleration Jerk BufferMode

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpdate	Reserved	-	-	-
Distance	Specify the motion distance from command current position. (Unit: Unit)	LREAL	Negative number, positive number or 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
Velocity	Specify the target velocity. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the target acceleration rate. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered 2: BlendingLow 3: BlendingPrevious 4: BlendingNext 5: BlendingHigh	MC_Buffer _Mode	<ul> <li>0: mcAborting</li> <li>1: mcBuffered</li> <li>2: mcBlendingLo w</li> <li>3: mcBlendingsPr evious</li> <li>4: mcBlendingNe xt</li> <li>5: mcBlendingHig h</li> <li>(0)</li> </ul>	When <i>Execute</i> changes from FALSE to TRUE

### Notes:

- 1. MC\_MoveRelative instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction changes from TRUE to FALSE in the course of execution.
- 2. While the instruction is being executed and *Execute* changes from FALSE to TRUE again, there will be no impact on the instruction execution and the instruction will continue being executed in the previous way. When *Execute* changes from FALSE to TRUE again after the instruction execution is completed, the instruction can be re-executed and started in the conventional way.
- 3. Refer to section 10.2 for the relation among Velocity, Acceleration and Jerk.
- 4. Refer to section 10.3 for details on *BufferMode*.

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled by the instruction.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE while there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to the section 12.2 for corresponding error codes.	WORD	


### • Output Parameters

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When positioning is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Busy	♦ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>TRUE.</li> <li>Done changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>When CommandAborted changes to TRUE.</li> </ul>
CommandA borted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing Chart

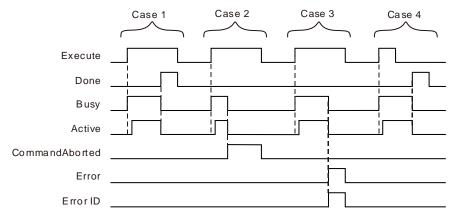


- **Case 1** : *Busy* changes to TRUE when *Execute* changes from FALSE to TRUE and one cycle later, *Active* changes to TRUE. When the positioning is finished, *Done* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and the instruction is aborted by other instruction, *CommandAborted* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. *CommandAborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 3**: When an error occurs such as axis alarm or Offline after *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* change to FALSE and one cycle later, *Done* changes to FALSE.

### • Function

MC\_MoveRelative is used to make the axis move for a given distance by starting from the command current axis position at a given speed, acceleration, deceleration and Jerk.

#### Distance

*Distance* and the start position for reference jointly determine the target position which the axis will reach under control of the instruction. The target position= the start position for reference + *Distance*. When *Distance* is set to 0, the target position for the axis motion is set as current position. The instruction execution is finished in the next cycle since its execution and *Done* changes to TRUE. As illustrated in the following left figure, the start position for reference is 10000. The axis moves in the positive direction and the target position is 20000 (10000+10000) when Distance>0 (10000). In the following right figure, the axis moves in the negative direction and the target position is 0 (10000-10000) when Distance<0(-10000).

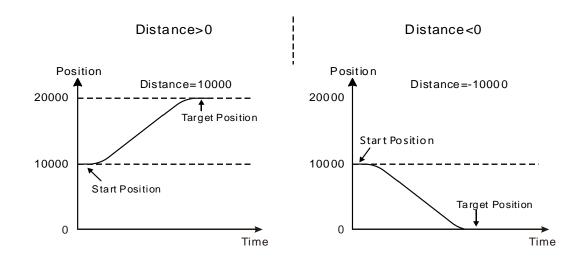


### Programming Example 1


The programming example is as follows when one MC\_MoveRelative instruction is used.

#### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel	MC_MoveRelative	
Rel _Ex	BOOL	FALSE
Rel _BM	MC_Buffer_Mode	0
Rel _Done	BOOL	
Rel _Bsy	BOOL	
Rel _Act	BOOL	
Rel _Abt	BOOL	
Rel _Err	BOOL	
Rel _ErrID	WORD	

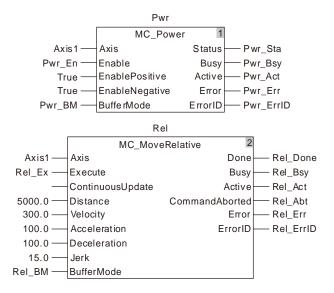

### 2. Motion Curve and Timing Chart

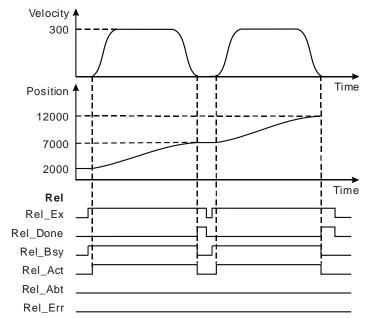


- MC\_MoveRelative instruction is executed for the first time when Rel\_Ex changes from FALSE to TRUE for the first time. At the moment, the current position of the axis is 2000 and the target position is 7000 (7000=2000+5000).
- When the axis position of 7000 is reached, the instruction execution is finished and Done changes to TRUE.
- MC\_MoveRelative instruction starts its second-time execution when Rel\_Ex changes from FALSE to TRUE for the second time. At the moment, the current position of the axis is 7000 and the target position is 12000 (12000=7000+5000).
- When the axis position of 12000 is reached, the second-time execution of the instruction is completed and *Done* changes to TRUE for the second time.

# Programming Example 2


The example is shown below when MC\_MoveRelative which is being executed is aborted.

### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel1	MC_MoveRelative	
Rel1 _Ex	BOOL	FALSE
Rel1 _BM	MC_Buffer_Mode	0
Rel1 _Done	BOOL	
Rel1 _Bsy	BOOL	
Rel1 _Act	BOOL	
Rel1 _Abt	BOOL	
Rel1 _Err	BOOL	
Rel1 _ErrID	WORD	
Rel2	MC_MoveRelative	
Rel2 _Ex	BOOL	FALSE
Rel2 _BM	MC_Buffer_Mode	0
Rel2 _Done	BOOL	
Rel2 _Bsy	BOOL	
Rel2 _Act	BOOL	
Rel2 _Abt	BOOL	
Rel2 _Err	BOOL	
Rel2_ErrID	WORD	

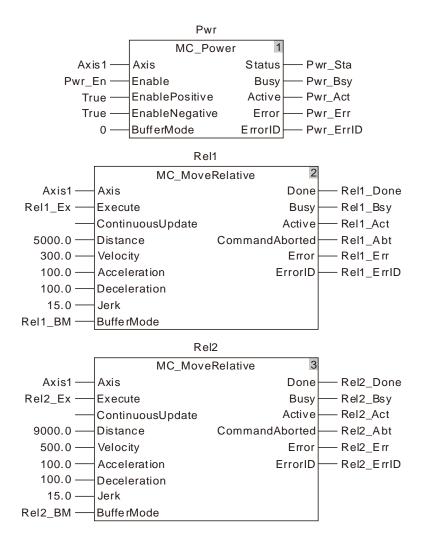


#### 2. Motion Curve and Timing Chart

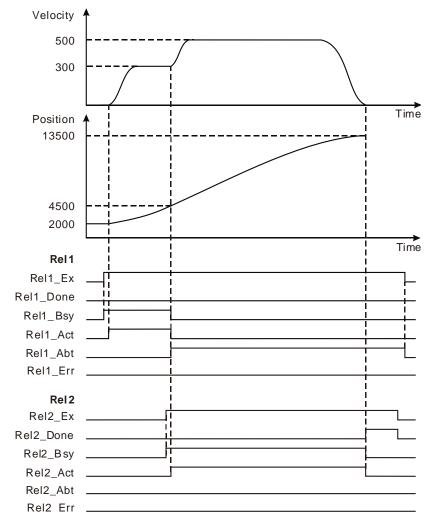

- The first MC\_MoveRelative instruction starts being executed when Rel1\_Ex changes from FALSE to TRUE. At the moment, the current position of the axis is 2000 and the target position is 7000 (7000=2000+5000).
- When the axis position of 4500 is reached, Rel2\_Ex changes from FALSE to TRUE, the second MC\_MoveRelative instruction starts being executed and the execution of the first MC\_MoveRelative is aborted and Rel1\_Abt changes to TRUE.
- When the axis position of 13500 (13500=4500+9000) is reached, the execution of the second MC\_MoveRelative instruction is completed and Rel2\_Done changes to TRUE.

# 11.3.7 MC\_MoveAdditive

FB/FC	Explanation	Applicable model
FB	MC_MoveAdditive is used to make the axis move an additive distance at a given speed, acceleration and deceleration.	AS524C-B

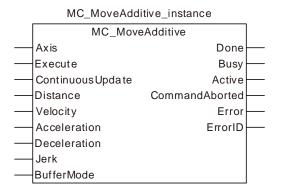

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousU pdate	Reserved	-	-	-
Distance	Specify the additive distance. (Unit: Unit)	LREAL	Negative number, positive number or 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
Velocity	Specify the target velocity. (Unit: Unit/s)	LREAL	Positive number or 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the target acceleration. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
Deceleration	Specify the target deceleration. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
Jerk	Specify the change rate of target acceleration and deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered 2: BlendingLow 3: Blending Previous 4: BlendingNext 5: Blending High	MC_Buffer_ Mode	<ul> <li>0: mcAborting</li> <li>1: mcBuffered</li> <li>2: mcBlendingLow</li> <li>3: mcBlendingPrevio us</li> <li>4: mcBlendingNext</li> <li>5: mcBlendingHigh (0)</li> </ul>	When <i>Execute</i> changes from FALSE to TRUE

Notes:

- 1. MC\_MoveAdditive instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction in the course of execution changes from TRUE to FALSE.
- 2. When *Execute* of the being executed instruction changes from FALSE to TRUE again, there is no impact on the instruction execution and the instruction will go on being executed in the previous way. When *Execute* changes from FALSE to TRUE again after the instruction execution is completed, the instruction can be re-executed and started in the conventional way.
- 3. Refer to section 10.2 for the relation among *Position, Velocity, Acceleration and Jerk*.
- 4. Refer to section 10.3 for details on BufferMode.

•	Output	Parameters
---	--------	------------


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE while there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to the section 12.2.	WORD	

#### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When additive positioning is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is done.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	When Execute changes to TRUE.	<ul> <li>When Done changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>When CommandAborted changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts controlling the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
CommandAborted	<ul> <li>When the instruction execution is aborted by some other motion control instruction</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li><i>CommandAborted</i> is set to TRUE when the instruction execution is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>

## Output Update Timing Chart

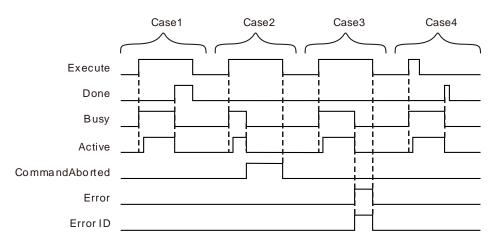

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When positioning is finished, *Done* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and the instruction execution is aborted by some other instruction, *CommandAborted* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When *Execute* changes from FALSE to TRUE and an error occurs such as axis alarm or Offline, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* change to FALSE and one period later, *Done* changes to FALSE.

#### • Function

MC\_MoveAdditive can control the actuator to move an additive distance at a given speed and acceleration.

The execution of the former instruction related with positioning has not been finished yet and the distance which the terminal actuator will move includes the uncompleted distance left by the former instruction and the given distance of this instruction when MC\_MoveAdditive is executed. When the execution of MC\_MoveAdditive is completed, the final position of the terminal actuator is the sum of the given distances of the former instruction and current instruction MC\_MoveAdditive.

If the former instruction is a velocity instruction, MC\_MoveAdditive will abort the execution of the velocity instruction and the terminal actuator will stop after moving a given distance of MC\_MoveAdditive at a given speed, acceleration and deceleration.

If MC\_MoveAdditive is executed while MC\_MoveSuperimposed is individually executed, the instruction will abort MC\_MoveSuperimposed immediately when the value of *BufferMode* of MC\_MoveAdditive is 0. The distance which the terminal actuator will move includes the set distance of this instruction and the uncompleted distance left by MC\_MoveSuperimposed while MC\_MoveAdditive is executed. An error will occur in the instruction right away if the value of *BufferMode* is in the range of 1~5 and the execution of MC\_MoveSuperimposed instruction will continue.

If MC\_MoveAdditive is executed when MC\_MoveSuperimposed is used with a positioning instruction together, the instruction will abort MC\_MoveSuperimposed and the positioning instruction when the value of *BufferMode* of MC\_MoveAdditive is 0. The distance which the terminal actuator will move is the sum of the given distance of MC\_MoveAdditive and the uncompleted distance left by the position instruction which is used with MC\_MoveSuperimposed together, excluding the uncompleted distance left by MC\_MoveSuperimposed while MC\_MoveAdditive is executed. MC\_MoveAdditive instruction will be executed after the execution of the positioning instruction which is used in conjunction with MC\_MoveSuperimposed if the value of *BufferMode* of MC\_MoveAdditive is 1~5.

#### • MC\_MoveAdditive is started while MC\_MoveSuperimposed is being executed.


BufferMode of MC_MoveAdditive	Whether MC_MoveSuperimposed is being executed in conjunction with other position instruction	Description	
0 ( Abort )	Yes	<ul> <li>The execution of MC_MoveSuperimposed and other position instruction will be aborted immediately.</li> <li>When MC_MoveAdditive is executed, the distance that the terminal actuator will travel is the set distance of MC_MoveAdditive plus the uncompleted distance left by MC_MoveSuperimposed plus the uncompleted distance left by the position instruction in conjunction with MC_MoveSuperimposed.</li> </ul>	
	No	<ul> <li>MC_MoveSuperimposed is aborted immediately.</li> <li>When MC_MoveAdditive is executed, the terminal actuator will travel the distance which is the sum of the uncompleted distance left by MC_MoveSuperimposed and the set distance of MC_MoveAdditive.</li> </ul>	
1~5(Buffered)	Yes	<ul> <li>MC_MoveSuperimposed will not be affected and keep being executed.</li> <li>After the execution of the position instruction in conjunction with MC_MoveSuperimposed ends, MC_MoveAdditive will start.</li> </ul>	
	No	<ul> <li>The execution of MC_MoveSuperimposed will continue.</li> <li>MC_MoveAdditive will report an error immediately.</li> </ul>	

# Programming Example 1


Below is an example of one single MC\_MoveAbsolute instruction execution.

## 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Addt	MC_MoveAdditive	
Addt_Ex	BOOL	FALSE
Addt_BM	MC_Buffer_Mode	0
Addt_Done	BOOL	
Addt_Bsy	BOOL	
Addt_Act	BOOL	
Addt_Abt	BOOL	
Addt_Err	BOOL	
Addt_ErrID	WORD	

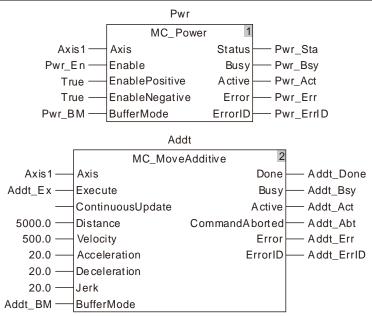

2. Motion Curve and Timing Charts:

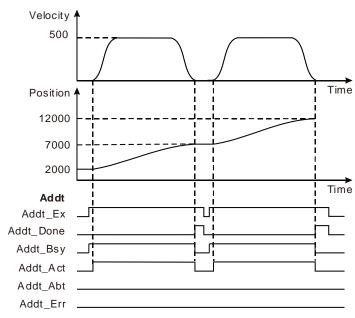

- When Addt\_Ex changes from FALSE to TRUE, the motion controller controls the motion of the servo motor by taking current position as the reference point. Meanwhile, Addt\_Bsy changes to TRUE and one period later, Addt\_Act changes to TRUE. After the set distance is reached by the servo motor, Addt\_Done changes from FALSE to TRUE and meanwhile Addt\_Bsy and Addt\_Act change from TRUE to FALSE.
- When Addt\_Ex changes from TURE to FALSE, Addt\_Done is reset.
- When Addt\_Ex changes from FALSE to TRUE again after the servo motor reaches the set distance, the motion controller controls the motion of the servo motor and Addt\_Done changes from FALSE to TRUE once again after the servo motor reaches the set distance.


# Programming Example 2

Below is an example on the execution of two MC\_MoveAdditive instructions in the same task list.


#### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Addt1	MC_MoveAdditive	
Addt1_Ex	BOOL	FALSE
Addt1_BM	MC_Buffer_Mode	0
Addt1_Done	BOOL	
Addt1_Bsy	BOOL	
Addt1_Act	BOOL	
Addt1_Abt	BOOL	
Addt1_Err	BOOL	

Variable name	Data type	Initial value
Addt1_ErrID	WORD	
Addt2	MC_MoveAdditive	
Addt2_Ex	BOOL	FALSE
Addt2_BM	MC_Buffer_Mode	0
Addt2_Done	BOOL	
Addt2_Bsy	BOOL	
Addt2_Act	BOOL	
Addt2_Abt	BOOL	
Addt2_Err	BOOL	
Addt2_ErrID	WORD	

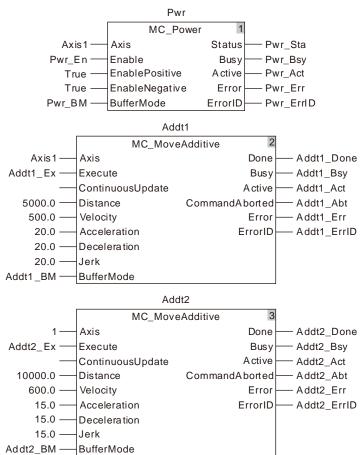

#### 2. Motion Curve and Timing Charts:

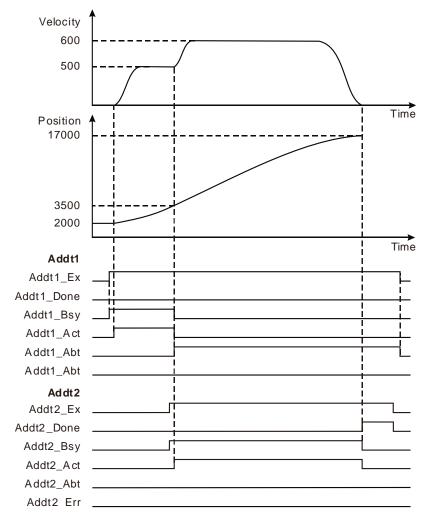

- When Addt1\_Ex changes from FALSE to TRUE, the motion controller controls the motion of the servo motor taking current position as the reference point. When Addt2\_Ex changes from FALSE to TRUE, Addt2\_Bsy changes from FALSE to TRUE and one period later, the first MC\_MoveAdditive instruction is aborted and Addt1\_Abt changes from FALSE to TRUE. Meanwhile, the servo motor moves according to the parameters of the second MC\_MoveAdditive instruction. Addt2\_Done changes from FALSE to TRUE when the servo motor completes the set distance which is the total sum of the two set distances of the two instructions.
- When Addt2\_Ex changes from TRUE to FALSE, Addt2\_Done is reset.

# 11.3.8 MC\_MoveAbsolute

FB/FC	Explanation	FB/FC			
FB	MC_MoveAbsolute is used to make the axis move to the specified absolute target position at the given speed, acceleration and deceleration.	AS524C-B			
	MC_MoveAbsolute_instance				
	MC_MoveAbsolute				



## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpdate	Reserved	-	-	-
Position	Specify the absolute target position. Rotary axis: 0 ≤ Position< Modulo Linear axis: No limit to Position. (Unit: Unit)	LREAL	Negative number, positive number or 0 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
Velocity	Specify the target velocity. (Unit: Unit/s)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the target acceleration. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the target deceleration. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Jerk	Specify the change rate of target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Direction	Specify the rotation direction (which is valid only when the axis is the rotary axis). 1: Positive direction 2: Shortest way 3: Negative direction 4: Current direction	MC_Direction	<ol> <li>1: mcPositiveDirection,</li> <li>2: mcShortestWay,</li> <li>3: mcNegativeDirection ,</li> <li>4: mcCurrentDirection         <ul> <li>(1)</li> </ul> </li> </ol>	When <i>Execute</i> changes from FALSE to TRUE and the axis is in the mode of rotary axis
BufferMode	Specify the behavior when executing two instructions. 0 : McAborting 1 : McBuffered 2 : McBlendingLow 3 : McBlendingPrevious 4 : McBlendingNext 5 : McBlendingHigh	MC_Buffer_ Mode	<ul> <li>0: mcAborting</li> <li>1: mcBuffered</li> <li>2: mcBlendingLow</li> <li>3: mcBlendingPrevious</li> <li>4: mcBlendingNext</li> <li>5: mcBlendingHigh <ul> <li>(0)</li> </ul> </li> </ul>	When Execute changes from FALSE to TRUE

#### Notes:

- 1. MC\_MoveAbsolute instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction in the course of execution changes from TRUE to FALSE.
- 2. When *Execute* of the being executed instruction changes from FALSE to TRUE again, there is no impact on the instruction execution and the instruction will go on being executed in the previous way. When *Execute* changes from FALSE to TRUE again after the instruction execution is completed, the instruction can be re-executed.
- 3. When the axis is a rotary axis, Position can be the value within the range of 0~the value of modulo excluding the value of modulo. An error will occur in the instruction if the absolute value of Position is greater than or equal to the value of modulo. The value of Position is irrelevant to the value of modulo and it can be set to any constant if the axis is a linear axis.
- 4. *Direction* is valid only when the axis is the rotary axis. Refer to Direction in the following Function section for more details on *Direction*.
- 5. Refer to section 10.2 for the relation among *Position, Velocity, Acceleration and Jerk*.
- 6. Refer to section 10.3 for details on *BufferMode*.

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled by the instruction.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE

## • Output Parameters


Parameter name	Function	Data type	Valid range
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for corresponding error codes.	WORD	

1 -

# Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When absolute positioning is completed</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is done.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts controlling the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When the instruction execution is aborted by some other motion control instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> <li>CommandAborted is set to TRUE when the instruction execution is aborted after Execute changes from TRUE to FALSE during the instruction execution. One period later, CommandAborted changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE

## Output Update Timing Chart

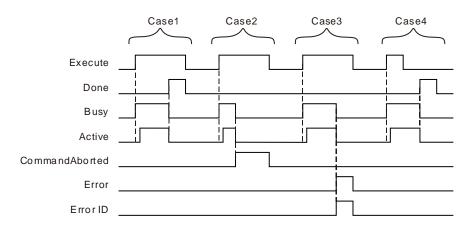

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When positioning is completed, *Done* changes to TRUE and meanwhile, Busy and Active change to FALSE.
- **Case 2**: When the instruction execution is aborted by some other motion instruction after *Execute* changes from FALSE to TRUE, *Abort* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.


- **Case 3**: When *Execute* changes from FALSE to TRUE and an error occurs such as axis alarm or Offline, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. And Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: In the course of execution of the instruction, *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* change to FALSE and one period later, *Done* changes to FALSE.

#### Function

MC\_MoveAbsolute is used to make the axis move to the specified absolute target position at the set speed, acceleration and deceleration.

The start axis position is 10000 when MC\_MoveAbsolute instruction is executed. The axis will move reversely when *Position* >0 (5000). See the figure below when *Position* is 5000.

The axis will move reversely when Position<0 (-5000). See the figure below when Position is -5000.

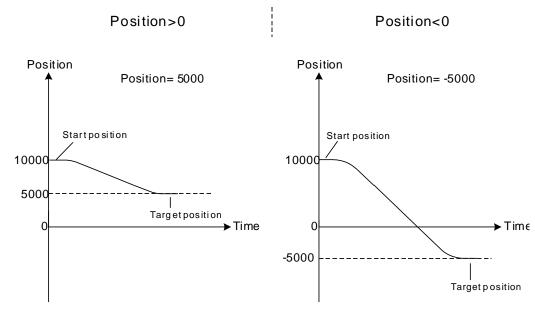


Note: As long as MC\_MoveAbsolute instruction which is being executed is aborted, its uncompleted distance will be discarded and the new instruction will be executed.

#### Direction

*Direction* is valid when the axis is a rotary axis and different motion directions of the axis are listed in the following table based on different Direction value. (Modulo: 360)

11-59

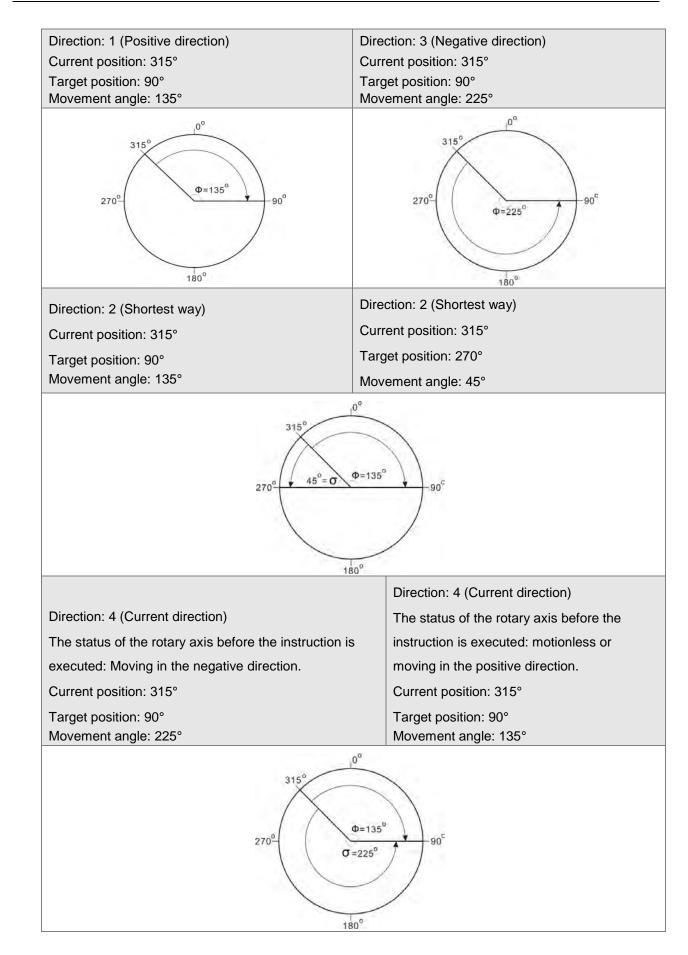


# Programming Example 1


One MC\_MoveAbsolute is executed as follows.

#### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Abs	MC_MoveAbsolute	
Abs_Ex	BOOL	FALSE
Abs_Dir	MC_DIRECTION	0
Abs_BM	MC_Buffer_Mode	0
Abs_Done	BOOL	
Abs_Bsy	BOOL	
Abs_Act	BOOL	
Abs_Abt	BOOL	
Abs_Err	BOOL	
Abs_ErrID	WORD	

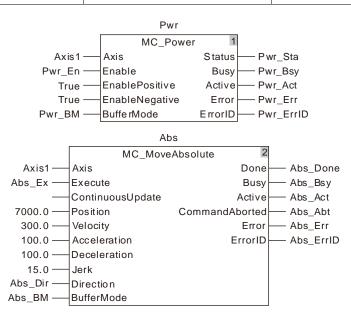

#### 2. Motion Curve and Timing Charts

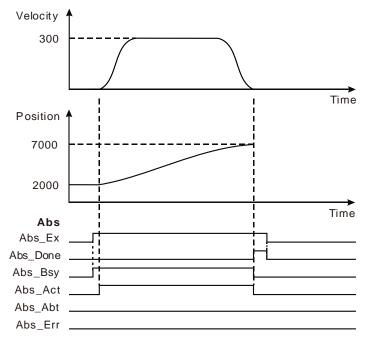

- When Abs\_Ex changes from FALSE to TRUE, MC\_MoveAbsolute instruction starts being executed and at the moment, the current position of the axis is 2000 and target position is 7000.
- The execution of the instruction is completed when the axis reaches 7000.


## 

## Programming Example 2


The example on how one MC\_MoveAbsolute instruction aborts the execution of another MC\_MoveAbsolute instruction is shown below.

#### 1. The variables and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Abs1	MC_Move Absolute	
Abs1_Ex	BOOL	FALSE
Abs1_Dir	MC_DIRECTION	0
Abs1_BM	MC_Buffer_Mode	0
Abs1_Done	BOOL	
Abs1_Bsy	BOOL	
Abs1_Act	BOOL	
Abs1_Abt	BOOL	
Abs1_Err	BOOL	

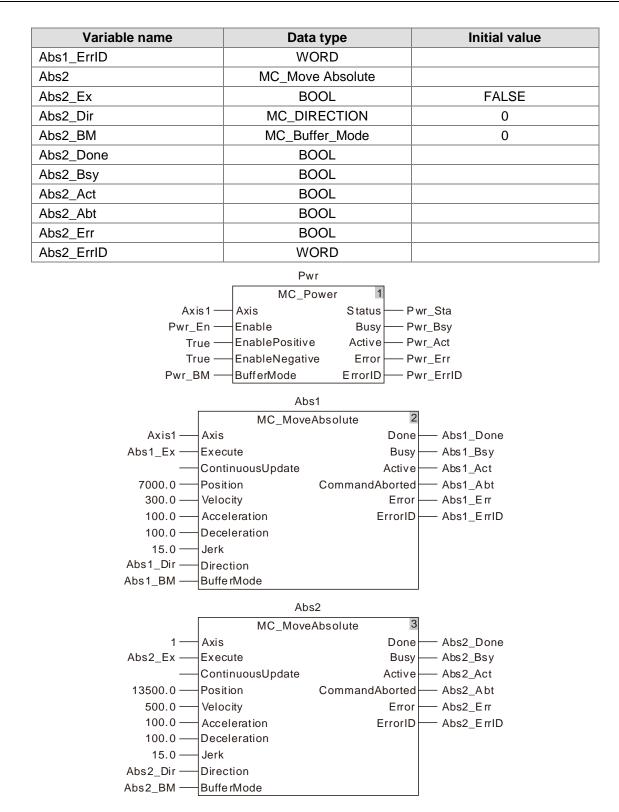

#### 2. Motion Curve and Timing Charts

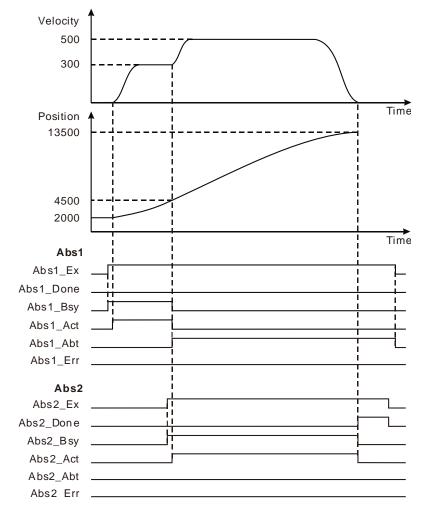

- When Abs1\_Ex changes from FALSE to TRUE, the first MC\_MoveAbsolute instruction starts being executed and at the moment, the current position of the axis is 2000 and target position is 7000.
- When the axis reaches 4500, Abs2\_Ex changes from FALSE to TRUE; the second MC\_MoveAbsolute instruction starts being executed and the first MC\_MoveAbsolute instruction is aborted with its output parameter Abs1\_Abt changing to TRUE.
- When the axis reaches 13500, the execution of the second MC\_MoveAbsolute instruction is completed and its output parameter Abs2\_Done changes to TRUE.

# 11.3.9 MC\_MoveSuperimposed

FB/FC	Explanation	Applicable model
FB	MC_MoveSuperimposed controls the axis to superimpose the set distance on the current motion state according to the set velocity, acceleration and deceleration.	AS524C-B
MC MoveSuperimposed instance		

MC_MoveSuperimposed_instance				
MC_MoveSuperimposed				
	Axis	Done		
	Execute	Busy		
	ContinuousUpdate	Active		
	Distance	CommandAborted		
	Velocity	Error		
	Acceleration	ErrorID		
	Deceleration	CoveredDistance		
	Jerk			

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpdate	Reserved	-	-	-
Distance	The distance to superimpose ( Unit: Unit )	LREAL	Negative number, positive number and 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
Velocity	Specify the target velocity. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the target acceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

## Notes:

1. MC\_MoveSuperimposed instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction changes from TRUE to FALSE during execution of the instruction.

- 2. When *Execute* changes from FALSE to TRUE again during execution of the instruction, there is no impact on the instruction execution and the instruction will go on being executed in the previous way. When *Execute* changes from FALSE to TRUE again after the instruction execution is completed, the instruction can be re-executed.
- 3. Refer to section 10.2 for the relation among Velocity, Acceleration, Deceleration and Jerk.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	-
CoveredDistance	The totally superimposed distance since the instruction is started.	LREAL	Negative number, positive number and 0

#### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the superimposed positioning is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> <li>CommandAborted is set to TRUE when the instruction is aborted after Execute changes from TRUE to FALSE during the instruction execution. One cycle later, CommandAborted changes to FALSE.</li> </ul>

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

### • Output Update Timing Chart

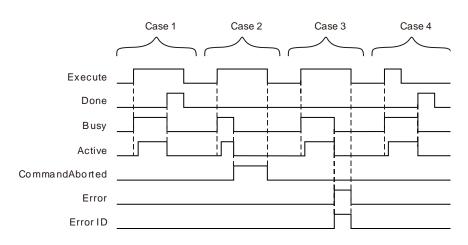

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. One cycle later, *Active* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes to TRUE and the instruction is aborted by other instruction, *CommandAborted* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. *CommandAborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 3**: When an error occurs such as disabled axis as *Execute* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE and the value of *ErrorID* is cleared to 0 when *Execute* changes from TRUE to FALSE.
- **Case 4**: Done changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE during execution of the instruction. Meanwhile, *Busy* and *Active* change to FALSE and one cycle later, *Done* changes to FALSE.

## Function

The MC\_MoveSuperimposed instruction controls the axis to independently superimpose the set distance on the current motion state according to the set velocity, acceleration and deceleration.

- 1. When MC\_MoveSuperimposed instruction is executed, the execution of the previous instruction excluding MC\_MoveSuperimposed and MC\_HaltSuperimposed instructions is not aborted. If the two instructions are executed simultaneously, their distances, velocities, accelerations and decelerations will be respectively added up in real time. When the set velocity of either of the instructions is reached, the acceleration of the instruction will be 0. If the previous instruction execution is finished, the velocities, accelerations and decelerations will not be added up any more and MC\_MoveSuperimposed instruction continues running independently.
- 2. If MC\_MoveSuperimposed instruction is executed when the axis is in Standstill state, the execution effect of MC\_MoveSuperimposed instruction is equivalent to that of MC\_MoveRelative instruction.
- Execute another motion instruction excluding MC\_MoveSuperimposed and MC\_HaltSuperimposed instructions when MC\_MoveSuperimposed instruction and one motion instruction jointly control the axis. If the *Buffermode* value of the lately executed motion instruction is 0, both of the MC\_MoveSuperimposed instruction and the previously executed motion instruction will be aborted.

If the *Buffermode* value of the lately executed motion instruction is another number except 0, the MC\_MoveSuperimposed instruction and the previously executed motion instruction will not be aborted.


- 4. If another MC\_MoveSuperimposed instruction is executed when one MC\_MoveSuperimposed instruction and another motion instruction jointly control the axis, the previous MC\_MoveSuperimposed instruction will be aborted but other motion instruction will not be affected.
- If another MC\_MoveSuperimposed instruction is executed when one MC\_MoveSuperimposed instruction controls the axis independently, the previous MC\_MoveSuperimposed instruction will be aborted.
- 6. If the MC\_HaltSuperimposed instruction is executed in the course of execution of MC\_MoveSuperimposed instruction, the MC\_MoveSuperimposed instruction will be aborted.
- 7. MC\_MoveSuperimposed can be executed on the slave axis specified by MC\_GearIn instruction and MC\_ CamIn instruction.

# Programming Example 1

The programming example is as follows when one MC\_MoveSuperimposed instruction is used.


1.	The variable	table	and	program	
----	--------------	-------	-----	---------	--

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Sup	MC_MoveSuperimposed	
Sup_Ex	BOOL	FALSE
Sup_Done	BOOL	
Sup_Bsy	BOOL	
Sup_Act	BOOL	
Sup_Abt	BOOL	
Sup_Err	BOOL	
Sup_ErrID	WORD	
Sup_Distan	LREAL	

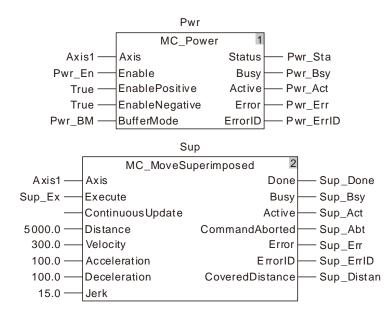

11-69

#### 2. Motion Curve and Timing Chart:

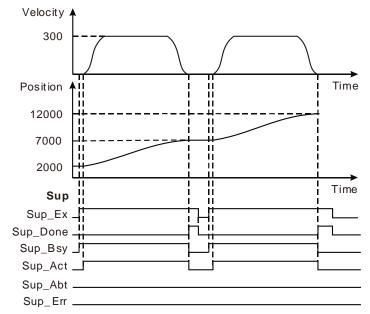

- When Sup\_Ex changes to TRUE, Sup\_Bsy changes to TRUE. One cycle later, Sup\_Act changes to TRUE and the motion controller controls the servo motor to run by using current position as the reference point.
- After the servo motor completes the superimposed positioning, Sup\_Done changes to TRUE and meanwhile Sup\_Bsy and Sup\_Act change to FALSE.
- When Sup\_Ex changes to FALSE, Sup\_Done changes to FALSE.
- When Sup\_Ex changes to TRUE again after the servo motor completes the set distance, the motion controller controls the servo motor to run. When the servo motor completes the set distance, Sup\_Done changes to TRUE again.


# Programming Example 2

Below is the example that MC\_MoveSuperimposed and MC\_MoveRelative instructions are matched.


#### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel	MC_MoveRelative	
Rel_Ex	BOOL	FALSE
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	

Variable name	Data type	Initial value
Sup	MC_MoveSuperimposed	
Sup_Ex	BOOL	FALSE
Sup_Done	BOOL	
Sup_Bsy	BOOL	
Sup_Act	BOOL	
Sup_Abt	BOOL	
Sup_Err	BOOL	
Sup_ErrID	WORD	
Sup_Distan	LREAL	

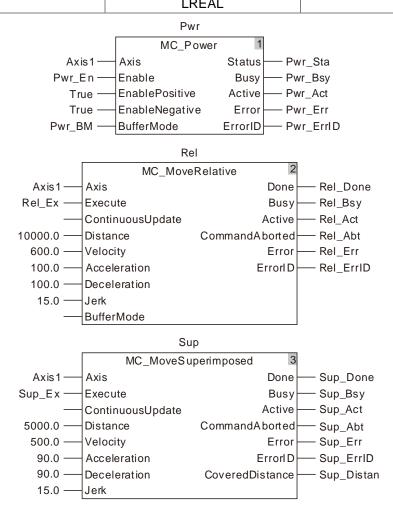

#### 2. Motion Curve and Timing Chart:

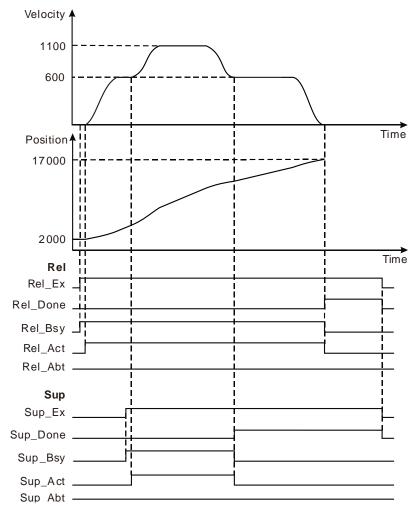

- When Rel\_Ex changes to TRUE, Rel\_Bsy changes to TRUE. One period later, Rel\_Act changes to TRUE and the motion controller controls the servo motor rotation by using the current position as the reference point.
- When Sup\_Ex changes to TRUE, Sup\_Bsy changes to TRUE. One cycle later, Sup\_Act changes to TRUE and the the MC\_MoveSuperimposed instruction starts to control the axis. The velocity and acceleration (0 at the moment) for the servo motor are the sums of the velocities and accelerations of the two instructions respectively.
- When the superimposed distance specified by the MC\_MoveSuperimposed instruction is completed, Sup\_Done changes to TRUE and Sup\_Bsy and Sup\_Act change to FALSE.
- When the distance specified by the MC\_MoveRelative instruction is completed, Rel\_Done changes to TRUE and Rel\_Bsy and Rel\_Act change to FALSE. The final position of the axis is the sum of the distances of the two instructions plus the start position.
- When Rel\_Ex changes to FALSE, Rel\_Done changes to FALSE. When Sup\_Ex changes to FALSE, Sup\_Done changes to FALSE.

FB/FC	Explanation	Applicable model
FB         MC_HaltSuperimposed halts the execution of the MC_MoveSuperimposed instruction.		AS524C-B
	MC_HaltSuperimposed_instance	

# 11.3.10 MC\_HaltSuperimposed



#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
Jerk	Specify the change rate of the target deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

#### Notes:

- 1. MC\_HaltSuperimposed instruction is executed when *Execute* changes from FALSE to TRUE. There is no impact on the instruction execution when *Execute* of the instruction changes from TRUE to FALSE during execution of the instruction.
- 2. Refer to section 10.2 for the relation between Deceleration and Jerk.


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	-

# • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	When Execute changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	When this instruction execution is aborted by other motion control instruction.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

## • Output Update Timing Chart

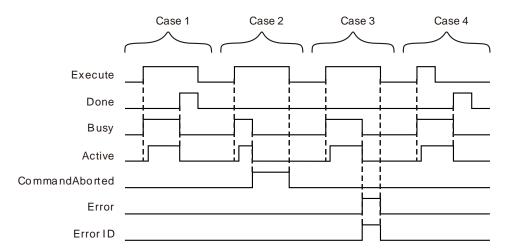

**Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. One cycle later, *Active* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* and *Active* change to FALSE.

- **Case 2**: When *Execute* changes to TRUE and the instruction is aborted by other instruction, *CommandAborted* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. *CommandAborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 3**: When an error occurs such as axis disabled as *Execute* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: Done changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE in the course of execution of the instruction. Meanwhile, *Busy* and *Active* change to FALSE and one cycle later, *Done* changes to FALSE.

# • Function

The MC\_HaltSuperimposed instruction is used to halt the execution of the MC\_MoveSuperimposed instruction.

- The MC\_HaltSuperimposed instruction cannot be executed alone and it can only be used with the MC\_MoveSuperimposed instruction together.
- If the MC\_HaltSuperimposed instruction is executed when the MC\_MoveSuperimposed instruction and other motion instruction jointly control the axis, the MC\_HaltSuperimposed instruction will abort the MC\_MoveSuperimposed instruction but other motion instruction execution will not be affected.
- The MC\_HaltSuperimposed instruction can halt the execution of the MC\_HaltSuperimposed instruction.


# Programming Example

The programming example is as follows when one MC\_HaltSuperimposed instruction is used.


Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel	MC_MoveRelative	
Rel_Ex	BOOL	FALSE
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	
Sup	MC_MoveSuperimposed	
Sup_Ex	BOOL	FALSE
Sup_Done	BOOL	
Sup_Bsy	BOOL	
Sup_Act	BOOL	
Sup_Abt	BOOL	
Sup_Err	BOOL	

#### 1. The variable table and program

Variable name	Data type	Initial value
Sup_ErrID	WORD	
Sup_Distan	LREAL	
HltSup	MC_HaltSuperimposed	
HltSup_Ex	BOOL	FALSE
HltSup_Done	BOOL	
HltSup_Bsy	BOOL	
HltSup_Act	BOOL	
HltSup_Abt	BOOL	
HltSup_Err	BOOL	
HltSup_ErrID	WORD	

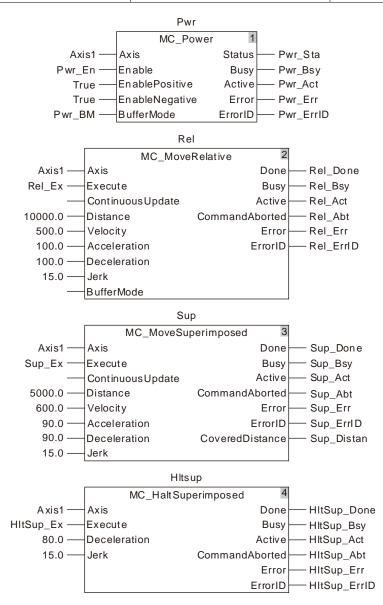

#### 2. Motion Curve and Timing Chart

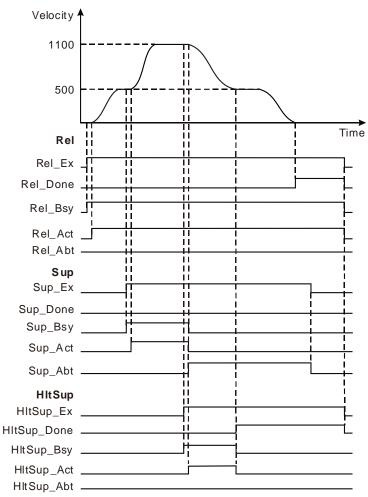

- When Rel\_Ex changes to TRUE, Rel\_Bsy changes to TRUE. One cycle later, Rel\_Act changes to TRUE and the motion controller controls the servo motor rotation by using the current position as the reference point. When Sup\_Ex changes to TRUE, Sup\_Bsy changes to TRUE. One cycle later, Sup\_Act changes to TRUE, the execution of the MC\_MoveSuperimposed instruction starts and the velocities and accelerations (0 at the moment) for the servo motor will be added up respectively.
- When Hltsup\_Ex changes to TRUE, Hltsup\_Bsy changes to TRUE. One cycle later, Hltsup\_Act changes to TRUE, the execution of the MC\_HaltSuperimposed instruction starts, the MC\_MoveSuperimposed instruction is aborted and Sup\_Bsy and Sup\_Act change to FALSE and meanwhile, Sup\_Abt changes to TRUE. The execution of the MC MoveSuperimposed instruction is halted by the MC HaltSuperimposed instruction.
- When Hitsup\_Done changes to TRUE, Hitsup\_Bsy and Hitsup\_Act change to FALSE.
- The execution of the MC\_HaltSuperimposed instruction has no impact on the being executed MC\_MoveRelative instruction.

# 11.3.11 MC\_SetPosition

FB/FC	Explanation	Applicable model	
FB	MC_SetPosition is used to set the position of the axis to a given value and no actual axis motion is brought accordingly.	AS524C-B	
	MC_SetPosition_instance		
	MC_SetPosition		
	Axis Done		

 Axis	Done	
 Execute	Busy	
 Position	Error	
 Relative	ErrorID	
 ReferenceType		
 ExecutionMode		

# • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Position	Specify the target Position. (Unit: Unit)	LREAL	Negative number, positive number or 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
Relative	Specify the relative mode or absolute mode for the target position and current position.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
ReferenceType	Specify the position type for reference.	MC_ ReferenceType	0: mcCommand Position 1: mcActual Position (0)	When <i>Execute</i> changes from FALSE to TRUE
ExecutionMode	Reserved			


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction is completed.	BOOL	TRUE / FALSE
Busy	TRUE while the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When positioning is completed</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is finished.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	When Execute changes to TRUE	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

# • Output Update Timing


# Output Update Timing Chart

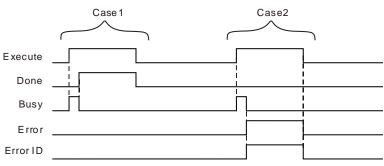

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Done* changes to TRUE and meanwhile, *Busy* changes to FALSE.
- **Case 2**: When an error occurs as *Execute* is TRUE, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. And meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.

## Function

MC\_SetPosition is used to set the position of the axis to a given value and no actual motion of the axis is incurred. MC\_SetPosition execution does not affect the current motion. However, it has an impact on the actual execution effect of the instruction which is executed after MC\_SetPosition execution is completed.

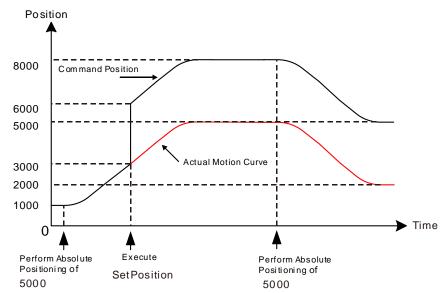


### Relationship between *Position* and *Relative*

*Position, Relative* and reference position which stands for the axis position at the moment when the instruction starts being executed jointly determine the position setting value.

*Relative* is used to define the relationship between *Position* and reference position. When *Relative* is set to TRUE, it is a relative relationship between *Position* and reference position and the position setting value= reference position+ *Position*. When *Relative* is FALSE, it is an absolute relationship between *Position* and reference position and the position setting value equals *Position*.

As shown in the following figures, the reference position is set to10000 and the value of *Position* is 6000 for the instruction execution. The corresponding execution results are respectively illustrated for different *Relative* values as below.

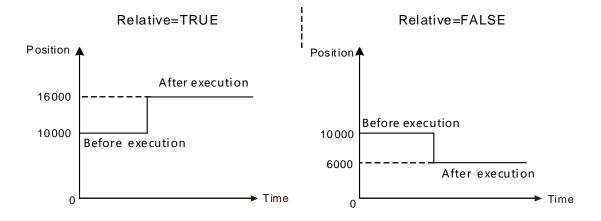

#### ■ ReferenceType

*ReferenceType* is used to select the command position or actual position as the reference position. When *ReferenceType* is 0, the reference position is the command position of the axis. When *ReferenceType* is 1, the reference position is the actual position of the axis.

When the command position is taken as the reference position, the instruction calculates the target command position based on the current command position and the value of *Position* and it revises the command position value into the target position value. Meantime, the actual position of the axis will change accordingly. The law of the change is that the variation amount of the actual position is the same as that of the command position. That is to say that the deviation between the command position and

actual position remains unchanged at the time when the instruction is executed and the instruction execution ends.


The solution for the actual position which is taken as the reference position is the same as that for the command position which is taken as the reference position.

There will be no difference in execution effect between the command position and actual position as the reference position if the axis is in Standstill state as MC\_SetPosition is executed. That is because the difference is 0 between command position and actual position as the axis is still.

The differences in execution effect between command position and actual position as the reference position exist as illustrated below if the axis is in motion as MC\_SetPosition is executed. If not zero, the difference between command position and actual position is caused by the command response time.

When MC\_SetPosition is executed in absolute mode with *Position* set to 6000 while the axis is positioning with the target position of 5000, the command position and actual position of the axis are 3000 and 2300 respectively (difference value  $\triangle P = 700$ ). The command position changes to 6000 and actual position becomes 5300 (5300=6000- $\triangle P$ ) after the instruction is executed if the reference position is the command position as the following left figure shows.

The actual position of the axis changes to 6000 and command position becomes 6700 (6700=6000+ $\triangle$  P) after the instruction is executed if the reference position is the actual position as the following right figure shows.

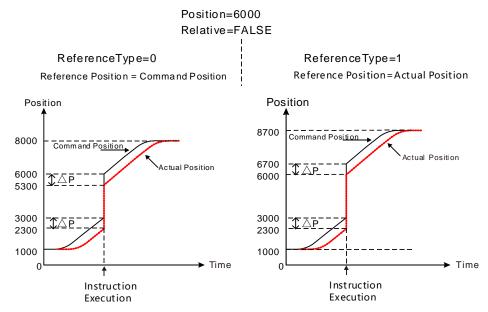



Different axis types are applicable to different reference types as shown in the following table.

Axis type	Reference Type		
Axis type	Command Position	Actual Position	
Real axis	YES	YES	
Encoder axis	YES	YES	
Virtual axis	YES	YES	

There will be an error in the instruction execution if the axis on which MC\_SetPosition is executed does not support the selected Reference Type.

### Explanation of Instruction Application Situation

When MC SetPosition is executed on the master axis which is in the built multi-axis relationship, the master axis position change incurred by the instruction does not affect the slave axis. That is, the slave axis will make any motion accordingly when the master axis position change incurred by MC SetPosition.

When MC\_SetPosition is executed on the slave axis, the slave axis position will change but the original relationship between slave axis and master axis will not be influenced.


MC\_SetPosition will report an error when it is executed in the process of execution of MC\_Stop. But MC\_SetPosition can be executed normally after MC\_Stop execution is completed.

### **Programming Example 1**


The following example shows the impact of MC\_SetPosition execution on the positioning instruction when *Relative* of MC\_SetPosition instruction is TRUE.

### The variable table and program Variable name Initial value Data type Rel MC MoveRelative USINT Axis1 1 Rel Ex BOOL FALSE Rel Done BOOL BOOL Rel\_Bsy BOOL Rel\_Act BOOL Rel Abt Rel\_Err BOOL Rel\_ErrID WORD Τn TON Tn\_In BOOL FALSE SRe SR SRe\_Q BOOL SetPos **SetPosition** BOOL SetPos Ex FALSE SetPos RefTp MC REFERECNE TYPE 0 SetPos\_Done BOOL SetPos Bsy BOOL BOOL SetPos\_Err SetPos\_ErrID WORD

### 1.

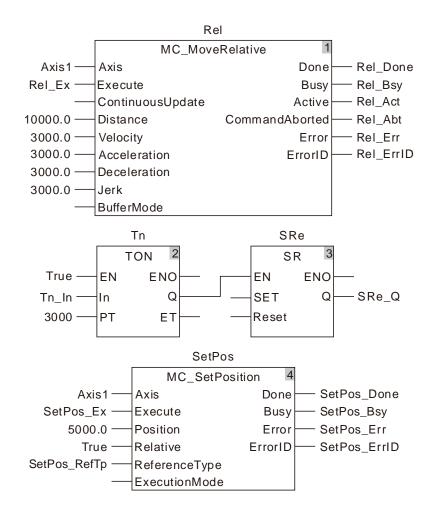

2. Motion Curve and Timing Charts:

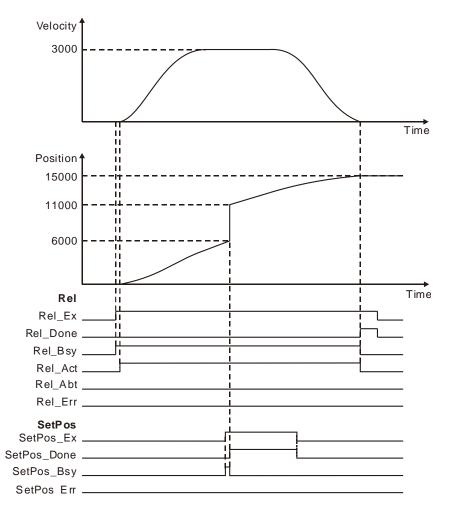

- As Rel\_Ex changes from FALSE to TRUE, the execution of MC\_MoveRelative instruction is started and MC\_SetPosition is executed 3 seconds later after MC\_MoveRelative is executed.
- The command position is 6000 as MC\_SetPosition starts being executed and 11000 (11000=6000+5000) after the instruction execution ends. The position is 15000 as MC\_MoveRelative execution ends.
- MC\_SetPosition does not affect the motion which is being performed through observing the above velocity change curve.


# Programming Example 2

The following example describes the impact of MC\_SetPosition execution on the axis position when *Relative* of MC\_SetPosition instruction is FALSE (the absolute mode is chosen for MC\_SetPosition).


Variable name	Data type	Initial value
Rel	MC_MoveRelative	
Axis1	USINT	1
Rel_Ex	BOOL	FALSE
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	

### 1. The variable table and program

Variable name	Data type	Initial value
Tn	TON	
Tn_In	BOOL	FALSE
SRe	SR	
SRe_Q	BOOL	
SetPos	SetPosition	
SetPos_Ex	BOOL	FALSE
SetPos_RefTp	MC_REFERECNETYPE	0
SetPos_Done	BOOL	
SetPos_Bsy	BOOL	
SetPos_Err	BOOL	
SetPos_ErrID	WORD	

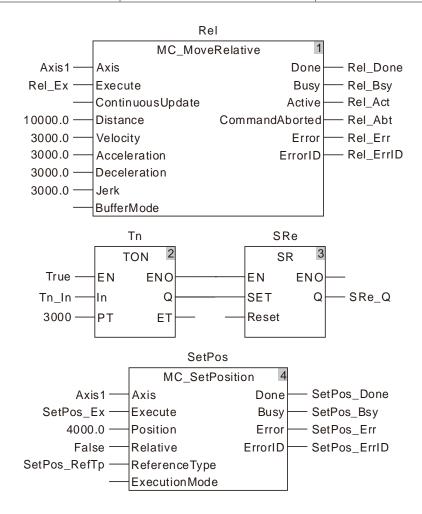

### 2. Motion Curve and Timing Charts:

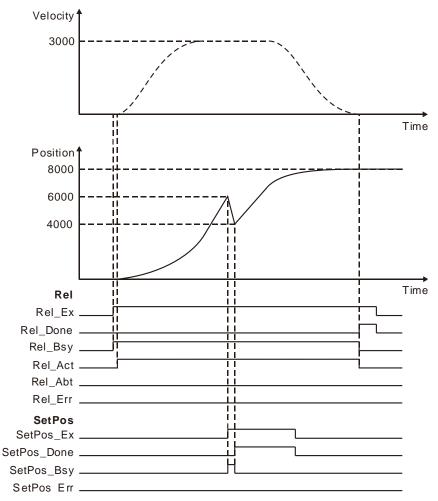

- As Rel\_Ex changes from FALSE to TRUE, MC\_MoveRelative instruction execution starts and MC\_SetPosition is executed 3 seconds later after MC\_MoveRelative is executed.
- The command position is 6000 as MC\_SetPosition starts being executed and 4000 after the instruction execution is completed. The position is 8000 as MC\_MoveRelative execution ends.
- MC\_SetPosition does not affect the motion which is being performed through observing the above velocity change curve.

## Programming Example 3


The following example shows how MC\_SetPosition execution affects MC\_MoveAbsolute instruction which is being executed. The actual execution effect of MC\_MoveAbsolute which is being executed is not be impacted by MC\_SetPosition.

### 1. The variable table and program


Variable name	Data type	Initial value
Abs	MC_MoveAbsolute	
Axis1	USINT	1
Abs_Ex	BOOL	FALSE
Abs_Dir	MC_DIRECTION	1
Abs_Done	BOOL	
Abs_Bsy	BOOL	
Abs_Act	BOOL	

# 11

Variable name	Data type	Initial value
Abs_Abt	BOOL	
Abs_Err	BOOL	
Abs_ErrID	WORD	
Tn	TON	
Tn_In	BOOL	FALSE
SRe	SR	
SRe_Q	BOOL	
SetPos	SetPosition	
SetPos_Ex	BOOL	FALSE
SetPos_RefTp	MC_REFERECNETYPE	0
SetPos_Done	BOOL	
SetPos_Bsy	BOOL	
SetPos_Err	BOOL	
SetPos_ErrID	WORD	

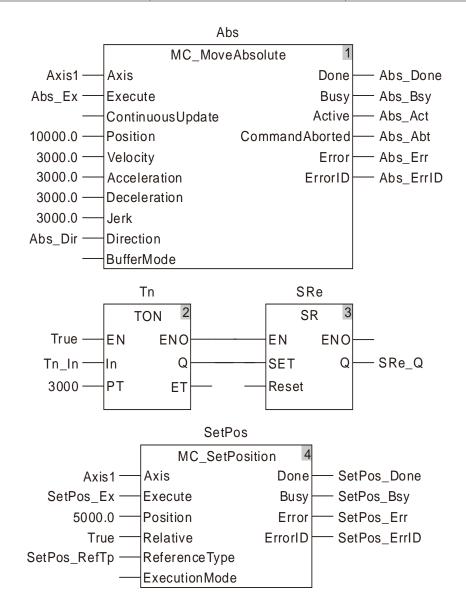

### 2. Motion Curve and Timing Charts:

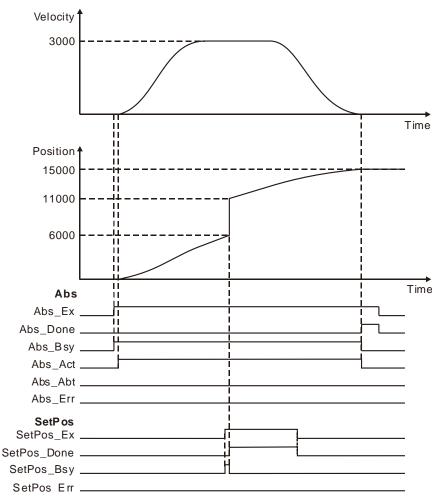

- As Abs\_Ex changes from FALSE to TRUE, the execution of MC\_MoveAbsolute instruction is started and MC\_SetPosition is executed 3 seconds later after MC\_MoveAbsolute is executed.
- The command position is 6000 as MC\_SetPosition starts being executed and 11000 after the instruction execution is completed. The position is 15000 as MC\_MoveAbsolute execution ends.
- It can be seen that MC\_SetPosition does not affect the actual execution effect of MC\_MoveAbsolute which is being executed through observing the above velocity change curve.

# FB/FC Explanation Applicable model FB MC\_SetOverride changes the target velocity for an axis. AS524C-B MC\_SetOverride\_instance MC\_SetOverride\_instance MC\_SetOverride Axis Enable Busy VelFactor Error

ErrorID

VelFactor AccFactor

JerkFactor

# 11.3.12 MC\_SetOverride

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
VelFactor	Velocity override factor (Unit: %)	LREAL	0~500 (100)	When <i>Enable</i> changes to TRUE
AccFactor	Reserved	-	-	-
JerkFactor	Reserved	-	-	-


### • Output Parameters

Parameter name	Function	Data type	Valid range
Enabled	TRUE when the instruction is controlling the axis.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	-

# Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Enabled	<ul> <li>When the instruction starts.</li> </ul>	<ul> <li>When <i>Enable</i> changes to FALSE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Busy	◆ When <i>Enable</i> is TRUE.	<ul> <li>When <i>Enable</i> changes to FALSE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

# • Output Update Timing Chart

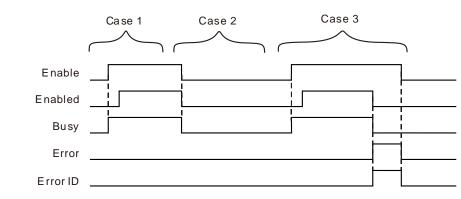

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE. *Enabled* changes to TRUE when the instruction execution is completed.
- Case 2: When Enable changes from TRUE to FALSE, Enabled and Busy change to FALSE.
- **Case 3**: When an error occurs after *Enable* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Enabled* and *Busy* change to FALSE. *Error* changes to FALSE when *Enable* changes from TRUE to FALSE.

## Function

MC\_SetOverride changes the target velocity for an axis.

- If the target velocities of motion instructions are to be modified, use the MC\_SetOverride instruction. Therefore, the instruction has no influence on the instructions without target velocities. However, *Enabled* remains TRUE even if the *Enable* of MC\_SetOverride instruction is set to TRUE for the instructions which are not affected by MC\_SetOverride.
- 2. The instructions of which the target velocities can be modified by MC\_SetOverride are shown in the following table.

MC_MoveAbsolute (Absolute	MC_MoveRelative (Relative
positioning)	positioning)
MC_MoveAdditive ( Additive	MC_MoveVelocity (Velocity
positioning)	instruction)
MC_MoveSuperimposed	
(Superimposed positioning)	

- 3. The new target velocity is calculated as below.
  - The new target velocity after modification= Target velocity of currently executed instruction x Velocity override factor
- 4. The unit of *VelFactor* is %. "100" indicates "100%". The valid range of *VelFactor* is between 0 and 500. An error will occur if the MC\_SetOverride instruction is executed when *VelFactor* value exceeds the valid range.
- 5. The axis will speed up or down till the target velocity after modification is reached according to *Acceleration* or *Deceleration* of the currently executed instruction.
- 6. An error will occur when the target velocity after modification exceeds the maximum velocity in axis parameters.
- If VelFactor value is set to 0, the target velocity changes to 0, the axis decelerates till the velocity is
   0. If the axis operation state need be kept and axis operation need pause, set VelFactor value to 0. At the moment, the axis state will not change.
- 8. When motion instructions are executed or buffered, the VelFactor value can be modified to set the new target velocity.
- 9. If *VelFactor* value is modified when *Enable* is TRUE, the value will be effective immediately without restarting the MC\_SetOverride instruction.

11

- 10. If *VelFactor* value is modified when *Enable* is TRUE and *VelFactor* value exceeds the valid range, an error will occur in MC\_SetOverride and the target velocity will return to that as *VelFactor* value is 100%.
- 11. When *Enable* changes to FALSE, the axis will accelerate or decelerate by taking VelFactor=100 as the target.
- 12. If another MC\_SetOverride instruction is started while one MC\_SetOverride instruction is being executed on the axis, the execution result of the later executed MC\_SetOverride instruction will be regarded as the reference result. The *Enabled* of the two instructions is TRUE.
- If the MC\_SetOverride instruction is used in the course of execution of the MC\_MoveVelocity instruction, *InVelocity* remains TRUE even if MC\_SetOverride is executed after *Invelocity* of MC\_MoveVelocity changes to TRUE.


# 

# Programming Example


The example of how MC\_MoveVelocity is affected by the execution of the MC\_SetOverride instruction is described as below.

### 1. The variable table and program

Variable name	Data type	Initial value
SetOv	MC_SetOverride	
Axis1	USINT	1
SetOv_En	BOOL	FALSE
SetOv_Velt	LREAL	0.0
SetOv_Ena	BOOL	
SetOv_Bsy	BOOL	
SetOv_Err	BOOL	
SetOv_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1
Vel_Invel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	

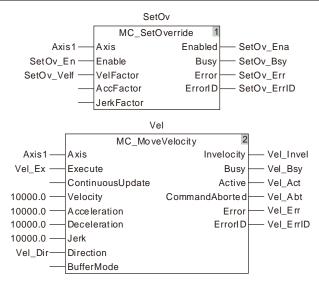


### 2. Motion Curve and Timing Chart

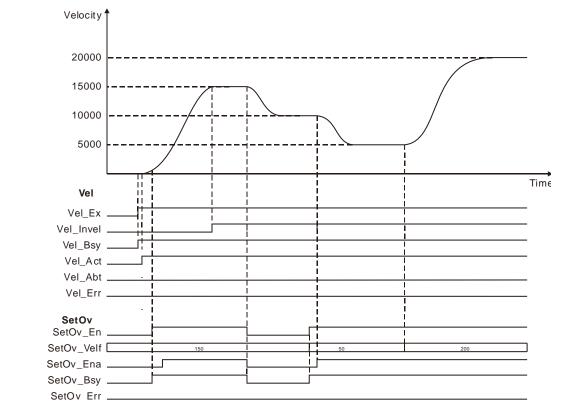

- When Vel\_Ex changes to TRUE, Vel\_Bsy changes to TRUE. One cycle later, Vel\_Act changes to TRUE and the axis starts to run forward. When the target velocity is not reached (Vel\_Invel is not TRUE), SetOv\_En is set to TRUE, MC\_SetOverride is effective and the target velocity of MC\_MoveVelocity changes to the new target velocity. When the new target velocity of MC\_MoveVelocity is reached, Vel\_Invel changes to TRUE. After Vel\_Invel changes to TRUE, Vel\_Invel remains TRUE even if VelFactor value (SetOv\_Velf) is modified.
- When SetOv\_En changes to FALSE, it means the axis starts to decelerate with the velocity of when Vel\_Invel value is 100 as the target velocity.
- SetOv\_Velf value will come to effect immediately if SetOv\_Velf value is modified in the course of execution of MC\_SetOverride. And the target velocity of MC\_MoveVelocity will change accordingly.

# 11.3.13 MC\_Reset

FB/FC	Explanation	Applicable model
FB	<b>FB</b> MC_Reset clears the error states and axis alarm information inside the motion controller.	
	MC_Reset_instance	

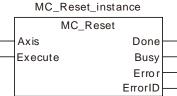

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions in section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

# • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When the input parameter values of the instruction are illegal or the mistake cannot be cleared.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

# Output Update Timing Chart

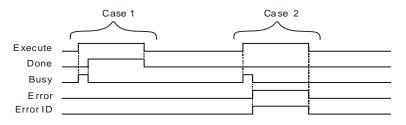

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- Case 2 : When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

### • Function

MC\_Reset clears the error state and axis alarm information about the real axis or virtual axis inside the motion controller. The axis state can be observed via MC\_ReadStatus.The MC\_Reset instruction can be executed to clear the errors when the axis configured in the motion controller enters the ErrorStop state. The instruction can be executed no matter whether the axis enters the ErrorStop state or not. When the errors such as axis alarms, axis offline or state machine switch problems occur, the axis enters the ErrorStop state and the motion instructions which are being executed stop. When the axis alarms, the execution of the instruction can clear the axis alarm information. After the execution of MC\_Reset instruction is completed, the axis state will be determined by MC\_Power instruction and the axis will be in Disabled or Standstill state.

Refer to chapter 9 for explanation of axis states.

After the axis alarm occurs, excluding the alarm which occurs when the axis meets the limit swtich in the course of homing, the alarm axis enters the ErrorStop state inside the motion controller. The axis alarm can be eliminated if *Done* is TRUE after the instruction is executed. If *Error* is TRUE, the axis alarm cannot be eliminated and users should check if the cause of the error still exists.


# Programming Example

When ReadSt\_En is TRUE, the MC\_ReadStatus instruction will detect the status of axis 1. When axis 1 enters the ErrorStop state due to axis offline or alarm, *ErrorStop* of the MC\_ReadStatus instruction will change to TRUE and the MC\_Reset instruction will be executed.

Variable name	Data type	Initial value
ReadSt	MC_ReadStatus	
Axis1	USINT	1
ReadSt_En	BOOL	FALSE
ReadSt_Vald	BOOL	
ReadSt_Bsy	BOOL	
ReadSt_Err	BOOL	
ReadSt_ErrID	WORD	
ReadSt_Disbl	BOOL	
ReadSt_Stpin	BOOL	
ReadSt_Homi	BOOL	
ReadSt_Stans	BOOL	
ReadSt_Dism	BOOL	

### 1. The variable table and program

Variable name	Data type	Initial value
ReadSt_Conm	BOOL	
ReadSt_Sym	BOOL	
AND1_In1	BOOL	FALSE
Rset	MC_Reset	
Rset_Done	BOOL	
Rset_Bsy	BOOL	
Rset_Err	BOOL	
Rset_ErrID	WORD	

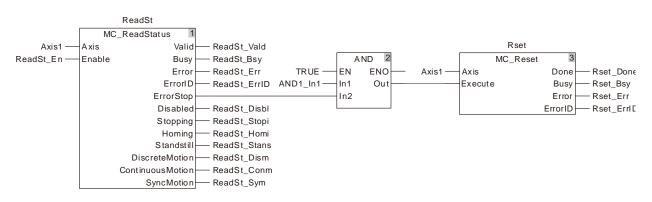

### 2. Timing Chart


ReadSt_En_	
ReadSt_Valid .	
ReadSt_Bsy_	
ReadSt_ErrStp _	
ReadSt_Stans	
AND_In1 _	
Rset_Done_	
Rset_Bsy_	

When ReadSt\_En changes from FALSE to TRUE after the servo axis is enabled, ResdSt\_Vald and ResdSt\_Bsy change to TRUE and the axis is in Standstill state.

AND\_In1 is set from FALSE to TRUE when the axis enters the ErrorStop state and MC\_Reset is executed. Rset\_Busy is TRUE in the first cycle and Rset\_Done is TRUE in the second cycle. Meanwhile, the axis enters the Standstill state from the ErrorStop state.

# 11.3.14 DMC\_SetTorque

FB/FC	Explanation	Applicable model			
FB	DMC_SetTorque sets the torque of the servo axis. The servo axis will work under the torque mode when the instruction is executed.	AS524C-B			
DMC SetTorque instance					

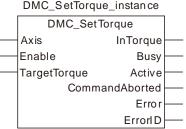

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
TargetTorque	Specify the value of the target torque. The torque is expressed with the permillage of the rated torque of the servo axis. For example, the setting value 30 indicates that the set torque is 30‰ of the rated torque of the servo axis. While <i>Enable</i> is TRUE, modifying the parameter value will change the torque directly.	INT	Negative number, positive number and 0 (0)	When <i>Enable</i> changes to TRUE

Notes:

- 1. If the torque value is a positive number, the effection that the servo produces works in the positive direction. If the torque value is a negative number, the effection that the servo produces works in the negative direction.
- When *Enable* is TRUE, the instruction is always valid and the torque changes accordingly as the torque value is modified. The instruction cannot be aborted by other instructions excluding MC\_Stop. When *Enable* of the instruction is reset to FALSE, the instruction execution stops and other instruction can be executed.

### • Output Parameters


Parameter name	e Function		Valid range
InTorque	TRUE when the target torque is reached.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE

Parameter name Function		Data type	Valid range
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
InTorque	<ul> <li>When the target torque is reached.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
Busy	◆ When <i>Enable</i> changes to TRUE	<ul> <li>When <i>InTorque</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to</li> </ul>	When InTorque changes to TRUE.
Active	control the axis	When Error changes to TRUE.
CommandAborted	When this instruction execution is aborted by other motion control instruction.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted after <i>Enable</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE</li> </ul>

### • Output Update Timing Chart

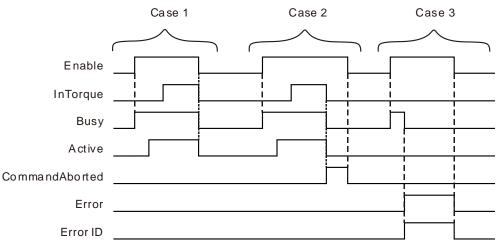

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE in the same cycle. *Active* changes to TRUE in the next cycle and *InTorque* changes to TRUE in the 3<sup>rd</sup> cycle. When *Enable* changes from TRUE to FALSE, *Busy*, *Active* and *InTorque* change to FALSE in the same cycle.
- **Case 2**: When the DMC\_SetTorque instruction is aborted by MC\_Stop after *Enable* changes from FALSE to TRUE, CommandAborted changes to TRUE and meanwhile, *InTorque, Busy* and *Active* change to FALSE. When *Enable* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: The input parameter value is illegal such as the axis number: 0 before the DMC\_SetTorque instruction is executed. *Busy* changes to TRUE when *Enable* changes from FALSE to TRUE. One cycle later, *Error* changes to TRUE, *Busy* changes to FALSE and *ErrorID* shows

corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the content of *ErrorID* is cleared to 0.

### Function


DMC\_SetTorque sets the torque of the servo axis. The servo axis will work under the torque mode when the instruction is executed.

# 📕 Programming Example

The example of executing the DMC\_SetTorque instruction is decribed as follows.


### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
SetTq	DMC_SetTorque	
SetTq_En	BOOL	FALSE
SetTq_InTorque	BOOL	
SetTq_Bsy	BOOL	
SetTq_Act	BOOL	
SetTq_Abt	BOOL	
SetTq_Err	BOOL	
SetTq_ErrID	WORD	

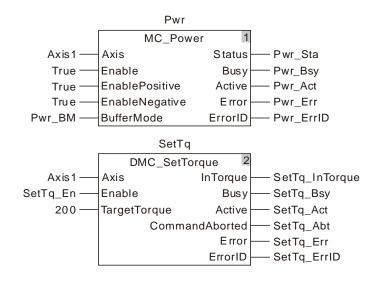

11

### 2. Motion Curve and Timing Chart

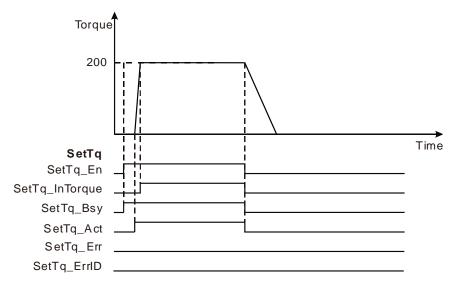

- When SetTq\_En changes from FALSE to TRUE after the servo axis is enabled, SetTq\_Bsy changes to TRUE. One cycle later, SetTq\_Act changes to TRUE and the DMC\_SetTorque instruction starts. When the torque is reached, SetTq\_InTorque changes to TRUE and SetTq\_Bsy and SetTq\_Act remain TRUE.
- SetTq\_InTorque, SetTq\_Bsy and SetTq\_Act change to FALSE when SetTq\_En changes from FALSE to TRUE.

# 11.3.15 MC\_ReadAxisError

FB/FC	Explanation			Applicable model
FB	MC_ReadAxisError is used to read the error information of a servo axis.			AS524C-B
MC_ReadAxisError_instance				
		Enable B	usy —	
		E	rror —	

ErrorID AxisErrorID

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> is TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-


### Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE while the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
AxisErrorID	When <i>Valid</i> is TRUE, the value of <i>ErrorID</i> , xxx (hex) indicates that the servo drive releases an alarm and xxx is the alarm code that the servo drive reports. For example, AL303 of the servo drive means the value of <i>ErrorID</i> is 303 (hex).	WORD	

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When an axis error is read</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When Error changes from FALSE to TRUE</li> </ul>
Busy	◆ When <i>Enable</i> changes to TRUE	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When Error changes from FALSE to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

# • Output Update Timing Chart

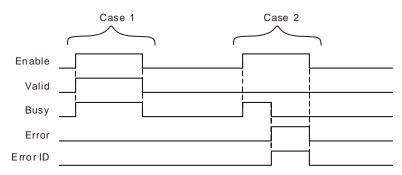


- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE. When *Enable* changes to FALSE, *Valid* and *Busy* change to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile *Busy* changes to FALSE. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared.

### Function

MC\_ReadAxisError is used to read error information of a servo axis such as the alarm code which will show up on the panel of the servo drive and servo axis offline. The instruction is triggered by the high level. Axis errors will be read when *Valid* is TRUE.

# 11.3.16 MC\_ReadActualPosition

FB/FC	Explanation	Applicable model
FB	MC_ReadActualPosition is used to read the actual position of an axis including real axes, virtual axes and encoder axes.	AS524C-B
	MC ReadActualPosition instance	

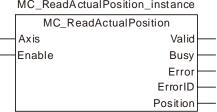

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	-


### Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE while the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Position	The actual position of the axis.	LREAL	

# Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	When the actual position has been read.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
Busy	◆ When <i>Enable</i> changes to TRUE.	<ul> <li>When Done changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

# • Output Update Timing Chart

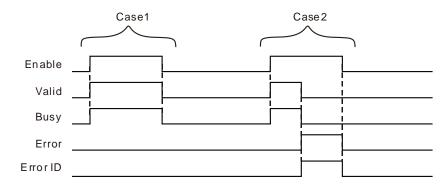

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE simultaneously. When *Enable* changes to FALSE, *Valid* and *Busy* change to FALSE.
- **Case 2**: As an error occurs, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. Meanwhile, *Busy* and Valid change to FALSE. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared.

### Function

MC\_ReadActualPosition is used to read the actual position of an axis including the real axis, virtual axis and encoder axis.

### Actual Position

The unit of the actual position read by MC\_ReadActualPosition is Unit and the unit of the feedback position that the servo drive gives to the controller is Pulse. Thus the actual position is acquired through conversion of the number of position feedback pulses of the servo drive. The servo gear ratio, mechanical gear ratio and units per output rotation among axis parameters are needed in the conversion.

The conversion formula is shown as below.

Units per output rotation ActualPosition = \_\_\_\_\_\_\_ \* The number of servo position (the number of pulses/ rotation) feeddback pulses \*mechanical gear ratio

If the axis is a linear axis, its output *Position* equals ActualPosition above when the instruction is executed.

If the axis is a rotary axis, its output *Position* equals ActualPosition % modulo when the instruction is executed. (*Position* is the remainder got through dividing ActualPosition by the set modulo among the axes parameters). So the value of *Position* varies between 0 and modulo.

### Timing for Updating Actual Position

The timing for updating actual position is related to the cycle time of communication between the controller and servo drive because the actual position comes from the number of feedback position pulses that the servo drive gives. In one communication cycle, the servo sends the number of feedback position pulses to the controller only once. And thus the read actual position remains unchanged within one communication cycle.

For the reasons mentioned above, please use the position capturing function to acquire the more highly real-time position since the instruction reads the less highly real-time actual position of the axis than the position capturing function does.

### The Impact of MC\_SetPosition on Actual Position

The actual position that MC\_ReadActualPosition reads should also include the position offset caused by MC\_SetPosition after MC\_SetPosition is executed.

The conversion formula is shown as below.


ActualPosition = Position offset ActualPosition = MC\_SetPosition \* mechanical gear ratio
Position offset \* The number of servo positior \* feeddback pulses

# Programming Example


This example shows the impact that MC\_SetPosition has on the execution of MC\_ReadActualPosition.

### 1. The variable table and program

Variable name	Data type	Initial value
Rel	MC_MoveRelative	
Axis1	USINT	1
Rel_Ex	BOOL	FALSE
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	
TON1	TON	
SR1	SR	
SetPos	SetPosition	
SetPos_Ex	BOOL	FALSE
SetPos_RefTp	MC_REFERECNETYPE	0
SetPos_Done	BOOL	
SetPos_Bsy	BOOL	
SetPos_Err	BOOL	
SetPos_ErrID	WORD	
ReadAtPos	ReadActualPosition	
ReadAtPos_Vald	BOOL	
ReadAtPos_Bsy	BOOL	
ReadAtPos_Err	BOOL	
ReadAtPos_ErrID	WORD	
ReadAtPos Pst	LREAL	

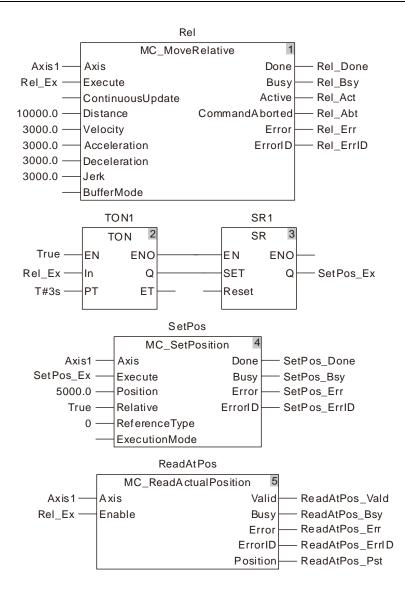

### 2. Motion Curve and Timing Charts:

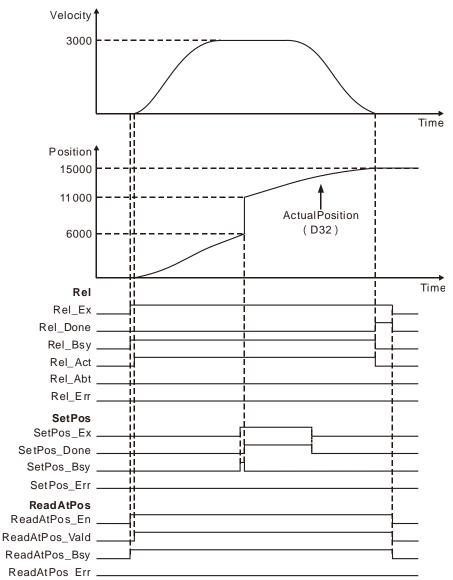

- When Rel\_Ex changes from FALSE to TRUE, the execution of MC\_MoveRelative and MC\_ReadActualPosition is started simultaneously. MC\_SetPosition is executed 3 seconds later after MC\_MoveRelative is executed.
- The actual position is 6000 as MC\_SetPosition starts being executed and 11000 (11000=6000+5000) after the execution is completed. The actual position is 15000 after MC\_MoveRelative execution is completed.
- It can be seen from the above velocity curve chart that MC\_SetPosition does not affect the ongoing motion. But the ActualPosition curve chart reflects that the actual position that MC\_ReadActualPosition reads is affected by MC\_SetPosition.

FB/FC		Explanation		Applicable model
FB	MC_ReadStatus is used to rea	ad the servo axis state in t	he controller.	AS524C-B
		MC_ReadStatus_instance		
		MC_ReadStatus		
		Axis Valid		
		Enable Busy		
		Error		
		ErrorID		
		ErrorStop		
		Disabled		
		Stopping		
		Homing		
		Standstill		
		DiscreteMotion		
		ContinuousMotion		
		SyncMotion	<b> </b>	

# 11.3.17 MC\_ReadStatus

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When Enable changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	-

### • Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE while the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	
ErrorStop		BOOL	TRUE / FALSE
Disabled		BOOL	TRUE / FALSE
Stopping		BOOL	TRUE / FALSE
Homing	Defer to continue 10.4	BOOL	TRUE / FALSE
Standstill	Refer to section 10.4.	BOOL	TRUE / FALSE
DiscreteMotion		BOOL	TRUE / FALSE
ContinuousMotion		BOOL	TRUE / FALSE
SyncMotion		BOOL	TRUE / FALSE

Notes:


1. When *Enable* changes from FALSE to TRUE, the execution of MC\_ReadStatus starts and the axis status is read.

2. When *Enable* changes from TRUE to FALSE, *Valid, Busy* and *Error* change to FALSE, meanwhile *ErrorID* changes to 0 and the outputs of *ErrorStop, Disabled, Stopping, Homing, Standstill, DiscreteMotion, ContinuousMotion* and *SyncMotion* keep the status as *Enable* is TRUE.

# • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When <i>Enable</i> changes to TRUE</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes from FALSE to TRUE</li> </ul>
Busy	<ul> <li>When <i>Enable</i> changes to TRUE</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes from FALSE to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
ErrorStop	<ul> <li>When the axis enters ErrorStop state</li> </ul>	<ul> <li>When the axis is not in ErrorStop state</li> </ul>
Disabled	<ul> <li>When the axis enters Disabled state</li> </ul>	<ul> <li>When the axis is not in Disabled state</li> </ul>
Stopping	<ul> <li>When the axis enters Stopping state</li> </ul>	<ul> <li>When the axis is not in Stopping state</li> </ul>
Homing	<ul> <li>When the axis enters Homing state</li> </ul>	<ul> <li>When the axis is not in Homing state</li> </ul>
Standstill	<ul> <li>When the axis enters Standstill state</li> </ul>	When the axis is not in Standstill
DiscreteMotion	<ul> <li>When the axis enters DiscreteMotion state</li> </ul>	<ul> <li>When the axis is not in DiscreteMotion state</li> </ul>
ContinuousMotion	<ul> <li>When the axis enters ContinuousMotion state</li> </ul>	<ul> <li>When the axis is not in ContinuousMotion state</li> </ul>
SyncMotion	<ul> <li>When the axis enters SyncMotion state</li> </ul>	<ul> <li>When the axis is not in SyncMotion state</li> </ul>

# • Output Update Timing Chart

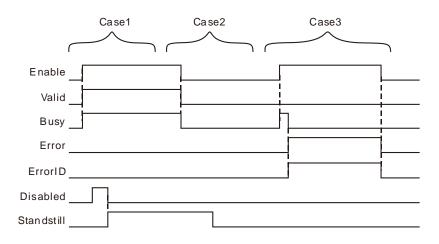

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE simultaneously and *ErrorStop, Disabled, Stopping, Homing, Standstill, DiscreteMotion, ContinuousMotion* and *SyncMotion* will change to TRUE or FALSE according to the axis status.
- **Case 2**: When *Enable* changes from TRUE to FALSE, *Valid* and *Busy* change to FALSE simultaneously and the outputs of *ErrorStop*, *Disabled*, *Stopping*, *Homing*, *Standstill*, *DiscreteMotion*, *ContinuousMotion* and *SyncMotion* will keep the same state as *Enable* is TRUE.
- **Case 3**: When the value of the input parameter Axis is out of the valid range and *Enable* changes from FALSE to TRUE, *Busy* changes from FALSE to TRUE, one cycle later, *Error* changes from FALSE to TRUE and *ErrorID* shows corresponding error codes and *Busy* changes from TRUE to FALSE. When *Enable* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and meanwhile *ErrorID* changes to 0.

### Function

MC\_ReadStatus is used to read the servo axis state in the controller. For the details on axis states, please refer to section 10.4.


# 

# Programming Example

This example of the execution of MC\_ReadStatus is shown as below.


### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel	MC_MoveRelative	
Rel_Ex	BOOL	FALSE
Rel_BM	MC_Buffer_Mode	0
Rel_Done	BOOL	
Rel_Bsy	BOOL	
Rel_Act	BOOL	
Rel_Abt	BOOL	
Rel_Err	BOOL	
Rel_ErrID	WORD	
ReadSt	MC_ReadStatus	
ReadSt_En	BOOL	FALSE
ReadSt_Vald	BOOL	
ReadSt_Bsy	BOOL	
ReadSt_Err	BOOL	
ReadSt_ErrID	WORD	
ReadSt_ErrStp	BOOL	
ReadSt_Disbl	BOOL	
ReadSt_Stpin	BOOL	
ReadSt_Homi	BOOL	

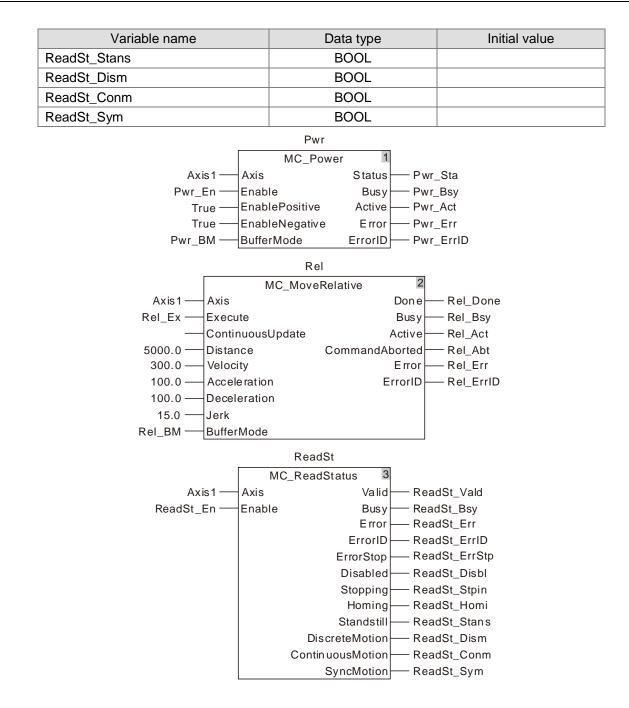

11

### 2. Motion Curve and Timing Charts:

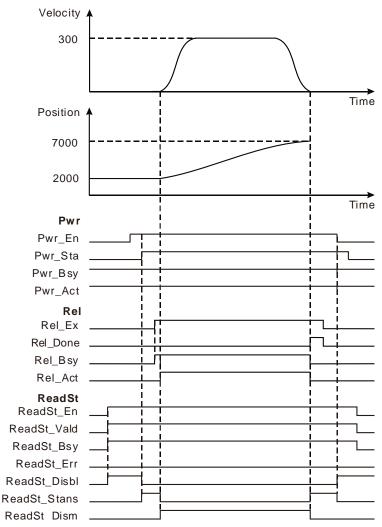

- ReadSt\_Vald, ReadSt\_Bsy and ReadSt\_Disbl change to TRUE as ReadSt\_En changes from FALSE to TRUE.
- When Pwr\_Sta changes from FALSE to TRUE, ReadSt\_Stans changes to TRUE, ReadSt\_Disbl changes to FALSE and the state of the axis changes from Disabled to Standstill.
- The motion controller controls the servo motor to move by starting from current position as Rel\_Act changes from FALSE to TRUE. Meanwhile ReadSt\_Stans changes to FALSE and ReadSt\_Dism changes to TRUE. When the servo motor moves the target distance, Rel\_Done and ReadSt\_Stans change to TRUE; Rel\_Bsy, Rel\_Act and ReadSt\_Dism change to FALSE.
- Rel\_Done also changes to FALSE as Rel\_Ex changes to FALSE.
- When Pwr\_En changes to FALSE, ReadSt\_Disbl changes to TRUE, ReadSt\_Stans changes to FALSE and several cycles later Pwr\_Sta also changes to FALSE.
- When ReadSt\_En changes to FALSE, ReadSt\_Vald and ReadSt\_Bsy change to FALSE and ReadSt\_Disbl remains TRUE.

FB/FC	Explanation			Applicable model	
FB	MC_ReadMotionState is used to read current motion state of the servo axis.			AS524C-B	
	MC_ReadMotionState_instance				
	MC_ReadMotionState				
	Axis Valid				
		Enable	Busy —		
		Source	Error		

ErrorID

ConstantVelocity Accelerating Decelerating DirectionPositive DirectionNegative

# 11.3.18 MC\_ReadMotionState

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Source	Reserved	-	-	-

Notes:

- 1. When Enable changes from FALSE to TRUE, the execution of MC\_ReadStatus starts.
- 2. When MC\_ReadStatus is being executed and *Enable* changes from TRUE to FALSE, the instruction execution stops and the outputs of *ConstantVelocity*, *Accelerating*, *Decelerating*, *DirectionPositive* and *DirectionNegative* keep the status as *Enable* is TRUE.


### Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE while the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE while there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	
ConstantVelocity	TRUE when the axis moves at a constant speed	BOOL	TRUE / FALSE
Accelerating	TRUE when the absolute value of the axis velocity is increased.	BOOL	TRUE / FALSE
Decelerating	TRUE when the absolute value of the axis velocity is decreased.	BOOL	TRUE / FALSE
DirectionPositive	TRUE when the current position value is increased.	BOOL	TRUE / FALSE
DirectionNegative	TRUE when the current position value is decreased.	BOOL	TRUE / FALSE

### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the actual velocity of the axis is read</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes from FALSE to TRUE</li> </ul>
Busy	◆ When <i>Enable</i> changes to TRUE	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes from FALSE to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
ErrorID		
ConstantVelocity	<ul> <li>When the axis velocity is not changed</li> </ul>	<ul> <li>When the axis velocity is changed and <i>Enable</i> is still TRUE</li> </ul>
Accelerating	<ul> <li>When the absolute value of the axis velocity is increased</li> </ul>	<ul> <li>When the axis velocity is not increased any more and <i>Enable</i> is still TRUE</li> </ul>
Decelerating	<ul> <li>When the absolute value of the axis velocity is decreased</li> </ul>	<ul> <li>When the axis velocity is not decreased any more and <i>Enable</i> is still TRUE</li> </ul>
DirectionPositive	<ul> <li>When the current position value is increased</li> </ul>	<ul> <li>When the current position value is not increased any more and <i>Enable</i> is still TRUE</li> </ul>
DirectionNegative	<ul> <li>When the current position value is decreased</li> </ul>	<ul> <li>When the current position value is not decreased any more and <i>Enable</i> is still TRUE</li> </ul>

# • Output Update Timing Chart

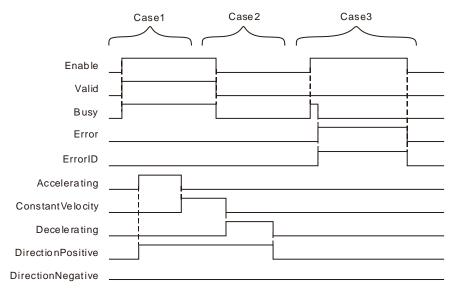

**Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE and ConstantVelocity, Accelerating, Decelerating, DirectionPositive and DirectionNegative change to TRUE or FALSE according to the axis state.

- **Case 2**: When *Enable* changes from TRUE to FALSE, *Valid* and *Busy* change to FALSE and *ConstantVelocity, Accelerating, Decelerating, DirectionPositive* and *DirectionNegative* remain the state for when *Enable* is TRUE.
- **Case 3**: When the value of Axis is out of the valid range and *Enable* changes from FALSE to TRUE, *Busy* changes from FALSE to TRUE, one period later, *Error* changes from FALSE to TRUE and *ErrorID* shows corresponding error codes. Meanwhile, *Busy* changes from TRUE to FALSE. *Error* changes from TRUE to FALSE and the value of *ErrorID* becomes 0 as *Enable* changes from TRUE to FALSE.

### Function

MC\_ReadMotionState is used to read current motion state of the servo axis. The motion state of the servo axis includes the constant motion, acceleration or deceleration, positive rotation and negative rotation.

### 


### Programming Example

This example of the execution of MC\_ ReadMotionState is shown as below.


### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Rel1	MC_MoveRelative	
Rel1_Ex	BOOL	FALSE
Rel1_Done	BOOL	
Rel1_Bsy	BOOL	
Rel1_Act	BOOL	
Rel1_Abt	BOOL	
Rel1_Err	BOOL	
Rel1_ErrID	WORD	
Rel2	MC_MoveRelative	
Rel2_Ex	BOOL	FALSE
Rel2_Done	BOOL	
Rel2_Bsy	BOOL	
Rel2_Act	BOOL	
Rel2_Abt	BOOL	
Rel2_Err	BOOL	
Rel2_ErrID	WORD	
ReadMoSt	MC_ReadMotionState	
ReadMoSt_En	BOOL	FALSE
ReadMoSt_Vald	BOOL	
ReadMoSt_Bsy	BOOL	
ReadMoSt_Err	BOOL	
ReadMoSt_ErrID	WORD	

Variable name	Data type	Initial value
ReadMoSt_ConstVel	BOOL	
ReadMoSt_Accet	BOOL	
ReadMoSt_Decet	BOOL	
ReadMoSt_DirtPos	BOOL	
ReadMoSt_DirtNg	BOOL	

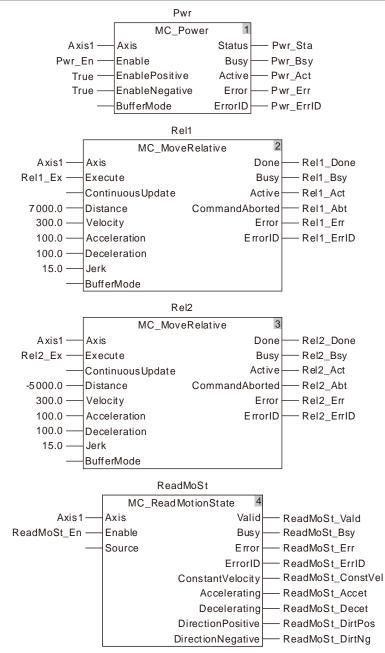

### 2. Motion Curve and Timing Charts:

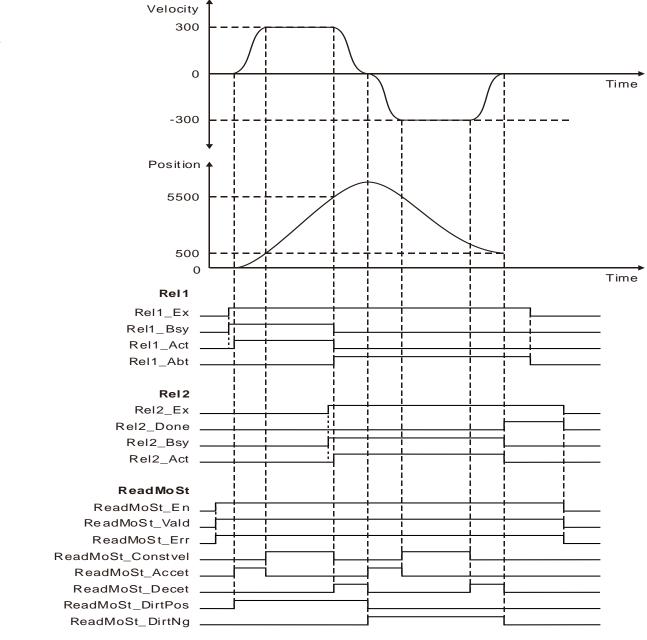

- ReadMoSt\_Vald and ReadMoSt\_Bsy change from FALSE to TRUE as ReadMoSt\_En changes from FALSE to TRUE.
- When Rel1\_Act changes from FALSE to TRUE, the axis starts accelerating in the positive direction and meanwhile, ReadMoSt\_Accet and ReadMoSt\_DirtPos change to TRUE.
- When ReadMoSt\_Constvel changes from FALSE to TRUE, ReadMoSt\_Accet changes from TRUE to FALSE and the axis enters the state of moving at a constant velocity in the positive direction.
- When Rel2\_Act changes from FALSE to TRUE, ReadMoSt\_Decet changes from FALSE to TRUE and the axis starts decelerating in the positive direction.
- When ReadMoSt\_Accet and ReadMoSt\_DirtNg change from FALSE to TRUE, ReadMoSt\_Decet and ReadMoSt\_DirtPos change to FALSE simultaneously and the axis starts accelerating in the negative direction.
- When Rel2\_Done changes from FALSE to TRUE, the axis stops moving and both of ReadMoSt\_Decet and ReadMoSt\_DirtNg change to FALSE.

11

FB/FC	Explanation			Applicable model	
FB	DMC_ReadParameter_Motion reads a slave parameter value.			AS524C-B	
		DMC_ReadParameter_Moti	on_instance		
		DMC_ReadParameter	_Motion		
		Axis	Done		
		Execute	Busy		
		Index	Active		
		SubIndex	Error		

ErrorlD DataType Data

# 11.3.19 DMC\_ReadParameter\_Motion

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the station address of the slave to control.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Index	Index of the parameter to read	UINT	0	When <i>Execute</i> changes from FALSE to TRUE
SubIndex	Subindex of the parameter to read	USINT	0	When <i>Execute</i> changes from FALSE to TRUE

# • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	
DataType	The data type of the read parameter 1 : Byte, 2 : Word, 4 : Double Word.	USINT	
Data	The read parameter value	UDINT	

#### Note: The corresponding index and subindex of a salve parameter

 User-defined parameter is the servo drive parameter which is to be read. The length is specified by users according to the data type of the parameter to read. The length of the byte parameter is 1. The length of the word parameter is 2. The length of the double-word parameter is 4. The calculation of the index and subindex of a servo parameter is shown as follows.

Index = Servo drive parameter (Hex) + 2000 (Hex) Subindex = 0.

**Example:** Calculation of the index of the servo parameter P6-10: 2000 + 060A (the hex. expression of P6-10) = 260A, subindex = 0.

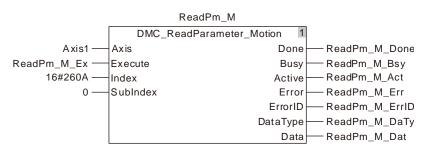


2. For the index and subindex of other slave parameters, refer to the product manual related to CANopen function.

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the reading is completed.	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>

#### • Output Update Timing

#### • Output Update Timing Chart

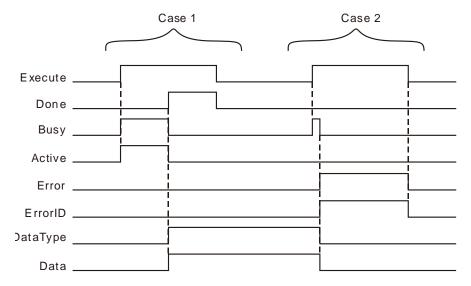

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE. One cycle later, *Done* changes to TRUE and *DataType* and *Data* show corresponding data values. After *Done* changes to TRUE, *Busy* and *Active* change to FALSE in the same cycle. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE and *DataType* and *Data* retain original values. If *Error* changes to TRUE, the values of *DataType* and *Data* will be cleared to 0.
- Case 2 : The input parameter value is illegal such as axis number: 0 before the

DMC\_ReadParameter\_Motion instruction is executed. When *Execute* changes from FALSE to TRUE, *Error* changes to from FALSE to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the content of *ErrorID* is cleared to 0.

#### Function

DMC\_ReadParameter\_Motion reads a slave parameter value. Users can specify the index and subindex of the parameter which is to be read.




#### **Programming Example**

The example of executing the DMC\_ReadParameter\_ Motion instruction is described as follows.


1. The variable table and program

Variable name	Data type	Initial value
ReadPm_M1	DMC_ReadParameter_ Motion	
Axis1	USINT	1
ReadPm_M1_Ex	BOOL	TRUE
ReadPm_M1_Done	BOOL	TRUE
ReadPm_M1_Bsy	BOOL	FALSE
ReadPm_M1_Act	BOOL	FALSE
ReadPm_M1_Err	BOOL	FALSE
ReadPm_M1_ErrID	WORD	FALSE
ReadPm_M1_DaTy	USINT	2
ReadPm_M1_Dat	UDINT	5000
WritePm_M	DMC_WriteParameter_Motion	
WritePm_M_Done	BOOL	TRUE
WritePm_M_Bsy	BOOL	FALSE

Variable name	Data type	Initial value
WritePm_M_Act	BOOL	FALSE
WritePm_M_Err	BOOL	FALSE
WritePm_M_ErrID	WORD	FALSE
ReadPm_M2	DMC_ReadParameter_ Motion	
ReadPm_M2_Done	BOOL	TRUE
ReadPm_M2_Bsy	BOOL	FALSE
ReadPm_M2_Act	BOOL	FALSE
ReadPm_M2_Err	BOOL	FALSE
ReadPm_M2_ErrID	WORD	FALSE
ReadPm_M2_DaTy	USINT	2
ReadPm_M2_Dat	UDINT	1000

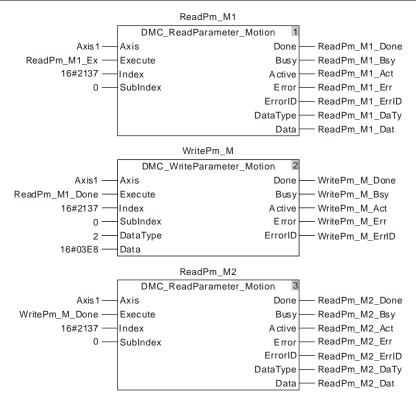

#### 2. Timing Chart

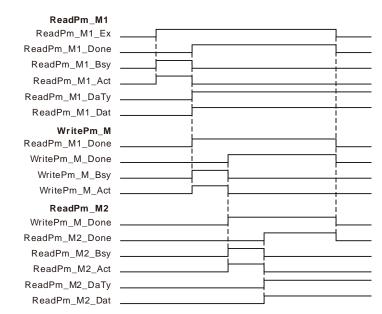

- When ReadPm\_M1\_Ex changes from FALSE to TRUE, executing the first DMC\_ReadParameter\_Motion instruction starts. When the instruction execution is completed, ReadPm\_M1\_Done changes to TRUE, the value of ReadPm\_M1\_DaTy is 2 and ReadPm\_M1\_Dat is 5000. That is, the content of the servo parameter P1-55 which is read is 5000 (The maximum velocity of the servo is limited to 5000rpm.)
- When ReadPm\_M1\_Done changes from FALSE to TRUE, executing the DMC\_WriteParameter\_Motion instruction starts. When the instruction execution is completed, WritePm\_M\_Done changes to TRUE. That means writing 1000 to the servo slave parameter P1-55 is successful. (The maximum velocity of the servo is limited to 1000rpm)
- When WritePm\_M\_Done changes from FALSE to TRUE, executing the second DMC\_ReadParameter\_Motion instruction starts. When the instruction execution is completed, ReadPm\_M2\_Done changes to TRUE, ReadPm\_M2\_DaTy is 2 and ReadPm\_M2\_Dat is 1000. That is, the content of the servo slave parameter P1-55 which is read is 1000. (The maximum velocity of the servo is limited to 1000rpm.)

## 11.3.20 DMC\_WriteParameter\_Motion

FB/FC	Explanation			Applicable model	
FB	DMC_WriteParameter_Motion sets a slave parameter value.		AS524C-B		
	DMC_WriteParameter_Motion_instance				
	DMC_WriteParameter_Motion				
		Axis	Done		
		Execute	Busy —		
		Index	Active		
		SubIndex	Error		

Errorl D

DataType

Data

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the slave to control.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Index	The index of the parameter to write.	UINT		
SubIndex	The subindex of the parameter to write.	USINT		
DataType	The data type of the parameter to write 1 : Byte, 2 : Word, 4 : Double Word.	USINT		
Data	The value of the parameter to write	UDINT		

#### Notes:

- 1. DataType must be the data type of the parameter to write. An error will occur if the filled value is incorrect.
- 2. Refer to Chapter 9 for the calculation of the index and subindex of servo parameters.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the writing is completed.	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes from FALSE to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

#### • Output Update Timing

#### • Output Update Timing Chart

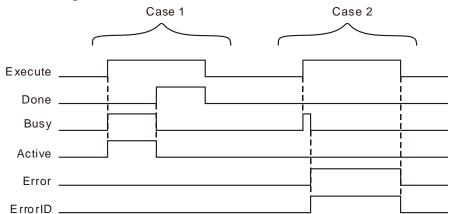

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* and *Active* change to TRUE. One cycle later, *Done* changes to TRUE. After *Done* changes to TRUE, *Busy* and *Active* change to FALSE in the same cycle. When *Execute* changes from TRUE to FALSE, *Done* changes from TRUE to FALSE.
- **Case 2**: The input parameter value is illegal such as axis number: 0 before the DMC\_WriteParameter\_Motion instruction is executed. When *Execute* changes from FALSE to TRUE, *Error* changes to from FALSE to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the content of *ErrorID* is cleared to 0.

#### Function

DMC\_WriteParameter\_Motion sets a slave parameter value. Users can specify the index and subindex of the parameter which is to be set.

## 


## Programming Example

The example of executing the DMC\_WriteParameter\_ Motion instruction is described as follows.

1. The variable table and program

Variable name	Data type	Initial value
ReadPm_M1	DMC_ReadParameter_Motion	
Axis1	USINT	1
ReadPm_M1_Ex	BOOL	TRUE
ReadPm_M1_Done	BOOL	TRUE

Variable name	Data type	Initial value
ReadPm_M1_Bsy	BOOL	FALSE
ReadPm_M1_Act	BOOL	FALSE
ReadPm_M1_Err	BOOL	FALSE
ReadPm_M1_ErrID	WORD	FALSE
ReadPm_M1_DaTy	USINT	2
ReadPm_M1_Dat	UDINT	5000
WritePm_M	DMC_WriteParameter_Motion	
WritePm_M_Done	BOOL	TRUE
WritePm_M_Bsy	BOOL	FALSE
WritePm_M_Act	BOOL	FALSE
WritePm_M_Err	BOOL	FALSE
WritePm_M_ErrID	WORD	FALSE
ReadPm_M2	DMC_ReadParameter_Motion	
ReadPm_M2_Done	BOOL	TRUE
ReadPm_M2_Bsy	BOOL	FALSE
ReadPm_M2_Act	BOOL	FALSE
ReadPm_M2_Err	BOOL	FALSE
ReadPm_M2_ErrID	WORD	FALSE
ReadPm_M2_DaTy	USINT	2
ReadPm_M2_Dat	UDINT	1000

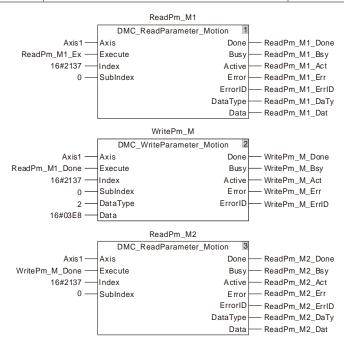


#### 2. Timing Chart

ReadPm_M1 ReadPm_M1_Ex ReadPm_M1_Done ReadPm_M1_Bsy ReadPm_M1_Act ReadPm_M1_DaTy ReadPm_M1_Dat	
WritePm_M ReadPm_M1_Done WritePm_M_Done WritePm_M_Bsy WritePm_M_Act	
ReadPm_M2 WritePm_M_Done ReadPm_M2_Done ReadPm_M2_Bsy ReadPm_M2_Act ReadPm_M2_DaTy ReadPm_M2_Dat	

- When ReadPm\_M1\_Ex changes from FALSE to TRUE, executing the first DMC\_ReadParameter\_Motion instruction starts. After the instruction execution is completed, ReadPm\_M1\_Done changes to TRUE, ReadPm\_M1\_DaTy is 2 and ReadPm\_M1\_Dat is 5000. That is, the content of the servo slave parameter P1-55 which is read is 5000. (The maximum velocity of the servo is limited to 5000rpm.)
- When ReadPm\_M1\_Done changes from FALSE to TRUE, executing DMC\_WriteParameter\_Motion starts. When the instruction execution is completed, WritePm\_M\_Done changes to TRUE. That means the content of the servo slave parameter P1-55 which is set is 1000. (The maximum velocity of the servo is limited to 1000rpm.)
- When WritePm\_M\_Done changes from FALSE to TRUE, executing the second DMC\_ReadParameter\_Motion instruction starts. When the instruction execution is completed, ReadPm\_M2\_Done changes to TRUE, ReadPm\_M2\_DaTy is 2 and ReadPm\_M2\_Dat is 1000. That is, the content of the servo slave parameter P1-55 which is read is 1000. (The maximum velocity of the servo is limited to 1000rpm.)

## 11.3.21 DMC\_TouchProbe

FB/FC	Explanation	Applicable model
FB	DMC_TouchProbe is used for capturing the position of an axis.	AS524C-B
		1

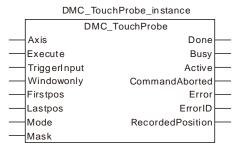

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be operated.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
TriggerInput	Specify one of the input points I0~I7, I10~I17 of the motion controller as the bit for triggering position capture. The values of the parameter 0~15 correspond to input points I0~I7 and I10~I17. The parameter is valid when <i>Mode</i> is 0 and 1 and invalid when <i>Mode</i> is 2, 3 and 4.	MC_Triggerinput	0:mcTriggerinputl0  7: mcTriggerinputl7 8:mcTriggerinputl10  15: mcTriggerinputl17 (0)	
Windowonly	Reserved	-	-	-
Firstops	Reserved	-	-	-
Lastops	Reserved	-	-	-

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Mode	<ul> <li>Mode 0: The trigger signal comes from the rising edge of the input points: IO-I7 and I10-I17 of the motion controller. The input point which is used is specified by <i>TriggerInput</i>. The position is captured through the rising edge of the trigger bit. The captured position is converted from the number of pulses that the external encoder port of the controller receives through axis parameters.</li> <li>Mode 1: The trigger signal comes from the falling edge of one of the input points: IO-I7 and I10-I17 of the motion controller, which is specified by <i>TriggerInput</i>. The captured position is converted from the number of pulses that the external encoder port of the controller receives through axis parameters.</li> <li>Mode 2: The trigger signal comes from the rising edge of the input point of the servo drive. The captured position is converted from the number of pulses which the servo drive through axis parameters.</li> <li>Mode 3: The trigger signal comes from the rising edge of the input point of the servo drive. The captured position is converted from the number of pulses which the servo drive. The captured position is converted from the number of pulses that CN1 port of the servo drive. The captured position is converted from the number of pulses that CN1 port of the servo drive. The captured position is converted from the number of pulses that CN5 port of the servo drive. The captured position is converted from the number of pulses that CN5 port of the servo drive. The captured position is converted from the number of pulses that CN5 port of the servo drive models correspond to different input points as shown in the table below.</li> </ul>	INT		

Parameter name	Function				Data type	Valid range (Default)	Validation timing
	Servo drive model	A2-M	B3-M	A3-M			
	Input point	DI7	DI3	DI7			
Mask	Reserved	1			-	-	-

Notes:

- 1. In Mode 0 and mode 1, the same input point cannot be used for the position capture simultaneously.
- 2. In Mode 2, mode 3 and mode 4, the position capture cannot be performed for the same axis simultaneously.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	
RecordedPosition	The captured position after the completion of the instruction execution. Refer to the following Function for details.	LREAL	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Busy	When Execute changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Active	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandA borted	<ul> <li>When the instruction execution is aborted by some other motion control instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction execution is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

#### Output Update Timing Chart

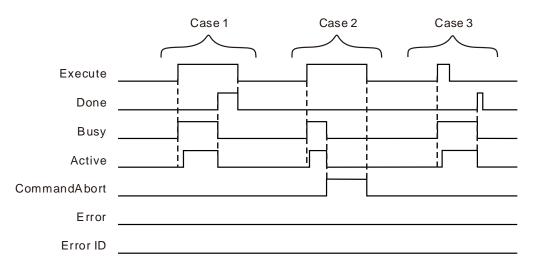

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When positioning is completed, *Done* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and the instruction is aborted by other instruction, *Commandaborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: During execution of the instruction, *Done* changes to TRUE when the instruction execution is completed after *Execute* changes from TRUE to FALSE. Meanwhile, *Busy* and *Active* change to FALSE and one period later, *Done* changes to FALSE.

#### Function

(RecordedPosition) the position that DMC\_TouchProbe captures is converted from other value based on axis parameters. The data sources for conversion are listed in the following table.

Mode	Data source
Mode 0 and mode 1	The number of pulses that the external encoder port of the motion controller receives
Mode 2	The number of pulses that the servo motor feeds back to the servo drive
Mode 3	The number of pulses that the pulse, /pulse, sign and /sign input terminals of CN1 port of the servo drive receive.
Mode 4	The number of pulses that A, /A, B and /B input terminals of CN5 port of the servo drive receive.

- For mode 0, 1 or 2, the range of the data source value is -2147483648~2147483647. When the data source value exceeds 2147483647, it will become -2147483648. With the changing + or sign of the data source value, the + or sign of the value of *RecordedPosition* will not change but the value of *RecordedPosition* will continue to increase.
- For mode 3 or 4, the range of the data source value is -2147483648~2147483647. When the data source value exceeds 2147483647, it will become -2147483648. The value of *RecordedPosition* will change from a positive number to a negative number.

The position captured by the DMC\_TouchProbe instruction is calculated according to axis parameters. For different modes, the data sources are different. "Servo gear ratio setting" and "Mechanism gear ratio setting" in axis parameters are shown in the following table. When *Mode* value of the instruction is equal to 3 (which you can refer to the introduction of mode 3 below), the number of pulses received at pulse, /pulse, sign and /sign of CN1 is 435 and the position captured by the instruction is 65.25. The calculation formula: 435× (3×1000) ÷ (2×10000) =65.25. 10000, 2, 3 and1000 in the formula correspond to 10000, 2, 3, and 1000 in the following table respectively. For other mode, the calculation method for the position captured by the instruction is the same as that described above but only the data source is different.

Servo gear ratio setting	Mechanism gear ratio setting
Unit Numerator: 128	Output rotations of gear: 3
Unit Denominator: 1	Input rotations of gear: 2
Pulses per rotation:10000	Units per output rotation: 1000 units/rotation


When Mode=0 or 1 in DMC\_TouchProbe, the captured position can be calculated according to the method mentioned above as well. In actual application, the position capture is generally performed by building an external encoder axis. When the number of pulses received at the external encoder interface of the motion controller is 638, the position captured by DMC\_TouchProbe is 95.4. The calculation formula: 638× (3×1000) ÷ (2×10000) =95.4. In the formula, 1000 is Units per output rotation, 2 is Input rotations of gear, 3 is Output rotations of gear and 10000 is number of pulses per rotation). When I0 changes from OFF to ON once, the position capture is performed once.

#### Wiring Figure

#### Mode 0 and mode 1


- Mode 0: The external signal triggers I point of the motion controller and the position capture is conducted through the rising edge of the input point specified by *TriggerInput*. The captured position is converted from the number of pulses the external encoder port of the controller receives through axis parameters.
- Mode 1: The external signal triggers I point of the motion controller and the position capture is conducted through the falling edge of the input point specified by *TriggerInput*. The captured position is converted from the number of pulses the external encoder port of the controller receives through axis parameters.

11

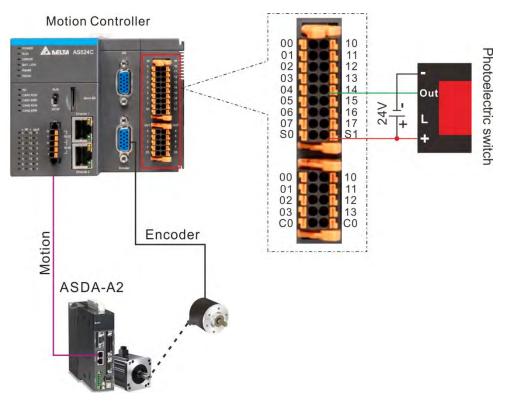


#### Mode 2

The external signal triggers the high-speed input point: DI7 of the servo drive. The position captured is converted from the number of pulses which the servo motor feeds back to the servo drive through axis parameters.

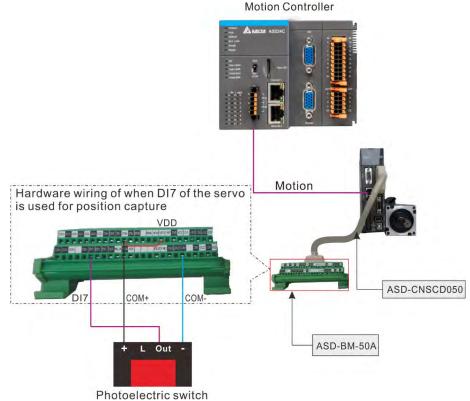

#### Mode 3


The external signal triggers the high-speed input point: DI7 of the servo drive. The captured position is converted from the number of pulses CN1 port of the servo drive receives through axis parameters.

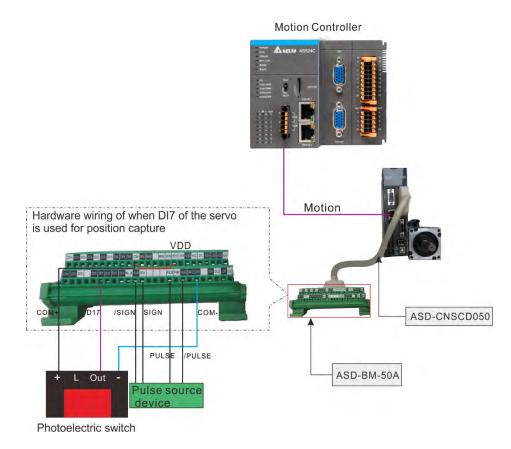

#### Mode 4

11

The external signal triggers the high-speed input point: DI7 of the servo drive. The captured position is converted from the number of pulses CN5 port of the servo drive receives through axis parameters.

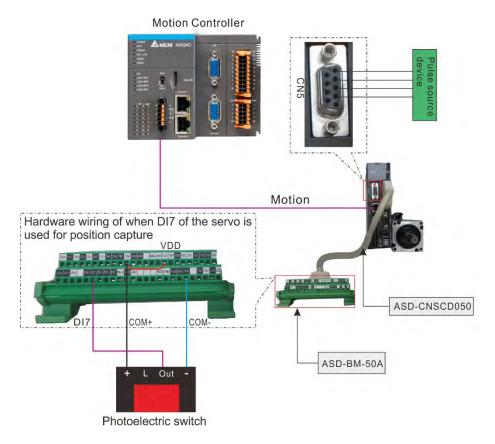


# Reprogramming Example 1


Capture the position of the external encoder axis by using the rising edge of I0 under mode 0.

#### 1. The variable table and program

Variable name	Data type	Initial value
NOT_EN	BOOL	FALSE
NOT_ENO	BOOL	
Touch	DMC_TouchProbe	
Axis1	USINT	3
Touch_Ex	BOOL	FALSE
Touch_Tri	MC_Triggerinput	0
Touch_Mode	INT	0
Touch_Done	BOOL	
Touch_Bsy	BOOL	
Touch_Act	BOOL	
Touch_Abt	BOOL	
Touch_Err	BOOL	
Touch_ErrID	UINT	
Touch_Pos	LREAL	

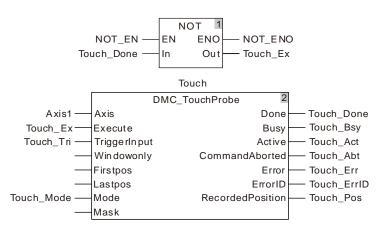

#### 2. Timing Chart

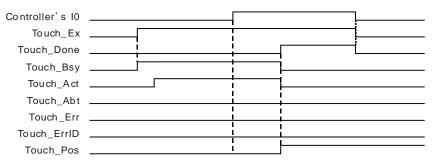

When Touch\_Ex changes from FALSE to TRUE, Touch\_Bsy changes from FALSE to TRUE in the first cycle and Touch\_Act changes from FALSE to TRUE in the second cycle.


When the external signal triggers controller's I0, DMC\_TouchProbe starts to execute. When Touch\_Done changes from FALSE to TRUE, the position Touch\_Pos outputs is converted from the number of pulses that the externam encoder port of the controller receives through axis parameters. Meantime Touch\_Bsy and Touch\_Act change from TRUE to FALSE. When Touch\_Ex changes from TRUE to FALSE, Touch\_Done changes from TRUE to FALSE and the position that Touch\_Pos captures will not be cleared to 0

# Programming Example 2


Capture the position converted from the number of pulses that the servo motor feeds back to the servo drive according to axis parameters when the external signal triggers DI7 of servo's CN1 under Mode 2.

#### 1. The variable table and program

Variable name	Data type	Initial value
NOT_EN	BOOL	FALSE
NOT_ENO	BOOL	
Touch1	DMC_TouchProbe	
Axis2	USINT	1
Touch1_Ex	BOOL	FALSE
Touch1_Tri	MC_Triggerinput	
Touch1_Mode	INT	2
Touch1_Done	BOOL	
Touch1_Bsy	BOOL	
Touch1_Act	BOOL	
Touch1_Abt	BOOL	
Touch1_Err	BOOL	
Touch1_ErrID	UINT	
Touch1_Pos	LREAL	

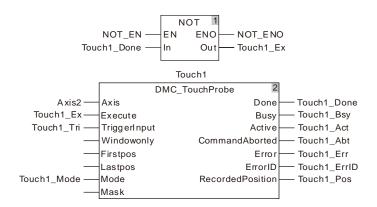

#### 2. Timing Chart

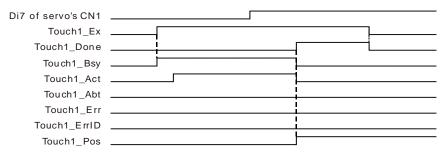

When Touch1\_Ex changes from FALSE to TRUE, Touch1\_Bsy changes from FALSE to TRUE in the first cycle and Touch1\_Act changes from FALSE to TRUE in the second cycle.

When the execution of DMC\_TouchProbe is finished after the external signal triggers DI7 of

servo's CN1, Touch1\_Done changes from FALSE to TRUE and Touch1\_Pos outputs the position converted from the number of pulses which the servo motor feeds back to the servo drive according to the axis parameters. Meantime Touch1\_Bsy and Touch1\_Act change from TRUE to FALSE. When Touch1\_Ex changes from TRUE to FALSE, Touch1\_Done changes from TRUE to FALSE and the position that Touch1\_Pos captures will not be cleared to 0.

# 11.3.22 DMC\_TouchProbeCyclically

FB/FC	Explanation	Applicable model
FB	DMC_TouchProbeCyclically is used for capturing the position of an axis cyclically.	AS524C-B

### DMC\_TouchProbeCyclically\_instance

(		
DMC_Touc	hProbeCyclically	
 Axis	Valid	
 Enable	Busy	
 TriggerInput	Active	
 Windowonly	CommandAborted	
 Firstpos	Error	
 Lastpos	ErrorID	
 Mode	Touched	
 Mask	RecordedPosition	

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be operated.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Enable	The instruction is enabled when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
TriggerInput	Specify one of the input points I0~I7, I10~I17 of the motion controller as the bit for triggering position capture. The values of the parameter 0~15 correspond to input points I0~I7 and I10~I17. The parameter is valid when <i>Mode</i> is 0 and 1 and invalid when <i>Mode</i> is 2, 3 and 4.	MC_Triggerinput	0: mcTriggerinputl0  7: mcTriggerinputl7 8: mcTriggerinputl10  15: mcTriggerinputl17 (0)	
Windowonly	Reserved	-	-	-
Firstops	Reserved	-	-	-
Lastops	Reserved	-	-	-

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Mode	<ul> <li>Mode 0: The trigger signal comes from the rising edge of the input points: IO-I7 and I10-I17 of the motion controller. The input point which is used is specified by <i>TriggerInput</i>. The position is captured through the rising edge of the trigger bit. The captured position is converted from the number of pulses that the external encoder port of the controller receives through axis parameters.</li> <li>Mode 1: The trigger signal comes from the falling edge of one of the input points: IO-I7 and I10-I17 of the motion controller, which is specified by <i>TriggerInput</i>. The captured position is converted from the number of pulses that the external encoder port of the controller receives through axis parameters.</li> <li>Mode 2: The trigger signal comes from the rising edge of the input point of the servo drive. The captured position is converted from the number of pulses which the servo motor feeds back to the servo drive. The captured position is converted from the number of pulses which the servo drive through axis parameters.</li> <li>Mode 3: The trigger signal comes from the rising edge of the input point of the servo drive. The captured position is converted from the number of pulses that CN1 port of the servo drive. The captured position is converted from the number of pulses that CN1 port of the servo drive. The captured position is converted from the number of pulses that CN1 port of the servo drive receives through axis parameters.</li> <li>Mode 4: The trigger signal comes from the rising edge of the input point of the servo drive. The captured position is converted from the number of pulses that CN5 port of the servo drive. The captured position is converted from the number of pulses that CN5 port of the servo drive. The captured position is converted from the number of pulses that cN5 port of the servo drive. The captured position is converted from the number of pulses that cN5 port of the servo drive. The captured position is converted from the number of pulses that cN5 port of the servo drive recei</li></ul>	INT		
	servo drive, different servo drive models correspond to different input points as shown in the table below.			

Parameter name	Function		Data type	Valid range (Default)	Validation timing		
	Servo drive model	A2-M	B3-M	A3-M			
	Input point	DI7	DI3	DI7			
Mask	Reserved	1			-	-	-

Notes:

- 1. In Mode 0 and mode 1, the same input point cannot be used for the position capture simultaneously.
- 2. In Mode 2, mode 3 and mode 4, the position capture cannot be performed for the same axis simultaneously.

•	Output	Parameters
•	Output	Farameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the captured value is valid.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	
Touched	TRUE when one capture is finished by the instruction.		
RecordedPosition	The captured position after the completion of the instruction execution.	LREAL	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the instruction execution is normal as <i>Enable</i> is TRUE.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Busy	◆ When <i>Enable</i> changes to TRUE.	<ul> <li>When Done changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>When CommandAborted changes to TRUE.</li> </ul>
Active	◆ When <i>Enable</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandA borted	<ul> <li>When the instruction execution is aborted by some other motion control instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction execution is aborted after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

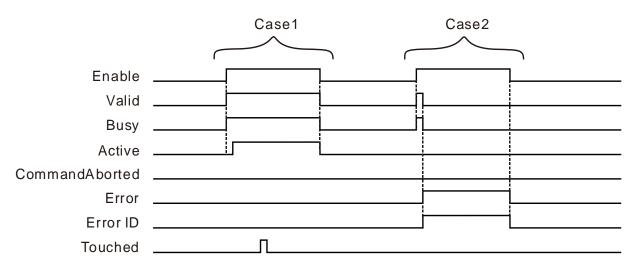

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE. One period later, *Active* changes to TRUE. When one capture is completed, *Touched* changes to TRUE and the TRUE state will last for one period. When *Enable* changes from TRUE to FALSE, *Valid*, *Busy* and *Active* change to FALSE.
- **Case 2**: When an error exists in input parameters and *Enable* changes from FALSE to TRUE, *Busy* and *Valid* change to TRUE. One period later, *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Valid* change to FALSE. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* will be cleared.


#### • Function Explanation

DMC\_TouchProbeCyclically is used for capturing the position of an axis cyclically. The function is similar to that of DMC\_TouchProbe. The difference is that the axis position can be captured cyclically by the instruction as *Enable* changes to TRUE. That is, as an external signal is detected, the instruction performs the position capture immediately without having to be re-triggered.

Refer to <u>DMC\_TouchProbe</u> for details on the functions.

## 11.3.23 DMC\_Jog

FB/FC	Explanation	Applicable model
FB	DMC_Jog jogs an axis.	AS524C-B
	DMC Jog instance	

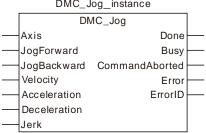

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>JogForward</i> or <i>JogBackward</i> is TRUE
JogForward	The instruction is executed when <i>JogForward</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
JogBackward	The instruction is executed when <i>JogBackward</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Velocity	Specify the target velocity. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>JogForward</i> or <i>JogBackward</i> is TRUE
Acceleration	Specify the target acceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>JogForward</i> or <i>JogBackward</i> is TRUE
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>JogForward</i> or <i>JogBackward</i> is TRUE
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>JogForward</i> or <i>JogBackward</i> is TRUE

#### Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the jogging is finished.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
CommandAborted	TRUE when the instruction is aborted. $^{\circ}$	BOOL	TRUE/FALSE

Parameter name	Function	Data type	Valid range
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE/FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the jogging stops.</li> </ul>	<ul> <li>One period later after the jogging stops.</li> </ul>
Busy	<ul> <li>When JogForward or JogBackward changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE,</li> <li>When <i>Error</i> changes to TRUE,</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>TRUE when the instruction is aborted by other motion instruction.</li> </ul>	<ul> <li>When JogForward or JogBackward changes from TRUE to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When JogForward or JogBackward changes from TRUE to FALSE.</li> </ul>

#### Output Update Timing Chart

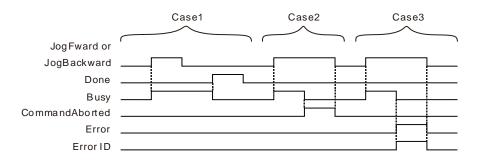

- **Case 1**: When *JogForward* or *JogBackward* changes from FALSE to TRUE, *Busy* changes to TRUE. When the jogging stops, the velocity of the axis is decreased to 0, *Done* changes to TRUE and *Busy* changes to FALSE.
- **Case 2**: When *JogForward* or *JogBackward* changes from FALSE to TRUE, *CommandAborted* changes to TRUE and meanwhile, *Busy* changes to FALSE after the instruction is aborted by other motion instruction. *CommandAborted* changes to FALSE when *JogForward* or *JogBackward* changes from TRUE to FALSE.
- **Case 3**: After *JogForward* or *JogBackward* changes from FALSE to TRUE, *Error* will change to TRUE and *ErrorID* will show corresponding error codes if any error occurs such as axis alarm or Offline. Meanwhile, *Busy* will change to FALSE. *Error* will change to FALSE and the value of *ErrorID* will be cleared to 0 when *JogForward* or *JogBackward* changes from TRUE to FALSE.

#### • Function

DMC\_Jog jogs an axis. The *JogForward* parameter controls the axis to run forward and the *JogBackward* parameter controls the axis to run backward. When the jogging stops, *Done* changes to TRUE and one cycle later, it changes to FALSE. Meawhile, *Busy* changes to FALSE.

## 11.3.24 DMC\_MoveVelocityStopByPos

FB/FC	Explanation	Applicable model			
FB	DMC_MoveVelocityStopByPos is used for making an axis stop at the specified phase.	AS524C-B			
DMC_MoveVelocityStopByPos_instance					
	DMC_MoveVelocityStopByPos				

DMC_MoveVelo	ocityStopByPos
— Axis	In Velocity
Ex_Move	Stop_Done
-Ex_Stop	Busy
Velocity	Active
-Acceleration	CommandAbort —
- Deceleration	Error
— Jerk	ErrorID
-Direction	
RoundPhase	
BufferMode	

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Ex_Move	The instruction controls the axis to run when <i>Ex_Move</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Ex_Stop	The instruction controls the axis to run when <i>Ex_Stop</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Velocity	Specify the target velocity. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Acceleration	Specify the target acceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Deceleration	Specify the target deceleration rate. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Direction	Specify the rotation direction 1: Positive direction 3: Negative direction	MC_Direct ion	1: mcPositiveDirection, 3: mcNegativeDirection (1)	When <i>Ex_Move</i> changes to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
RoundPhase	Specify the modulo that the pitch ( <i>UnitsPerRotation</i> ) corresponds to.	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
StopPhase	Specify a phase in the modulo.	LREAL	0~the setting value of <i>RoundPhase</i> (0)	When <i>Ex_Move</i> changes to TRUE.
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered 2: BlendingLow 3: BlendingPrevious 4: BlendingNext 5: BlendingHigh	MC_Buffer _Mode	0 : mcAborting 1 : mcBuffered 2 : mcBlendingLow 3 : mcBlending _Previous 4 : mcBlending _Next 5 : mcBlending _High (0)	When <i>Ex_Move</i> changes to TRUE.

## • Output Parameters


Parameter name	Function	Data type	Valid range
Invelocity	TRUE when the target velocity is reached.	BOOL	TRUE / FALSE
Stop_Done	TRUE when the stop position is reached.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled by the instruction.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Invelocity	<ul> <li>When the target velocity is reached.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>Invelocity changes to FALSE immediately when Ex_Move changes from FALSE to TRUE again if the input parameter values are revised after the target velocity is reached. If the input parameter values are not changed after the instruction execution is completed, Invelocity changes to FALSE immediately when Ex_Move changes from FALSE to TRUE again. Invelocity will change to TRUE in the next cycle.</li> </ul>
Stop_Done	<ul> <li>When the stop position is reached</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>When Ex_Stop changes to FALSE.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Busy	<ul> <li>When Ex_Move changes to TRUE.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
Active	<ul> <li>When the axis is being controlled by the instruction.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>TRUE when the instruction is aborted by other motion instruction.</li> </ul>	<ul> <li>When Ex_Move changes from TRUE to FALSE.</li> <li>CommandAborted is set to TRUE when the instruction is aborted after Ex_Move and Ex_Stop change from TRUE to FALSE during the instruction execution. One cycle later, CommandAborted changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Ex_Move and Ex_Stop change from TRUE to FALSE.

### Output Update Timing Chart

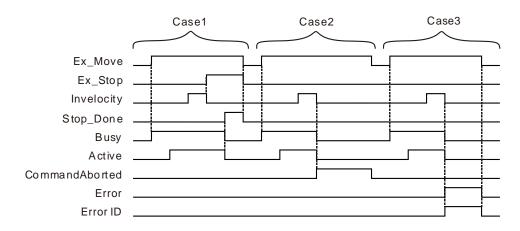

- **Case 1**: When *Ex\_Move* changes from FALSE to TRUE, *Busy* changes to TRUE. When the axis starts being controlled by the instruction, *Active* changes to TRUE. When *Ex\_Stop* changes from FALSE to TRUE, *Invelocity* changes to FALSE. When the position is reached, *Stop\_Done* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. When *Ex\_Move* and *Ex\_Stop* change from TRUE to FALSE, *Stop\_Done* changes to FALSE.
- **Case 2**: When *Ex\_Move* changes to TRUE, the instruction is aborted by other instruction and *CommandAborted* changes to TRUE. Meanwhile, *Invelocity*, *Busy* and *Active* change to FALSE. When *Ex\_Move* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs while *Ex\_Move* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Invelocity*, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Ex\_Move* changes from TRUE to FALSE.


#### Function

DMC\_MoveVelocityStopByPos is used for making an axis stop at a specified phase. *RoundPhase* is the modulo that the pitch (*UnitsPerRotation*) corresponds to. *StopPhase* specifies a phase in the modulo. The value of *StopPhase* should be less than the value of *RoundPhase*.

As **Ex\_Move** changes from FALSE to TRUE, the axis is controlled to run. As **Ex\_Stop** changes from FALSE to TRUE, the axis is controlled to stop at the phase specified by **StopPhase**. The final position where the axis stops equals an integral multiple of the pitch (**UnitsPerRotation**) +**StopPhase** value/**RoundPhase** value\* the pitch value (**UnitsPerRotation**).

The pitch (*UnitsPerRotation*) is 10000, *RoundPhase* is set to 360 and *StopPhase* is set to 90 as shown in the figure below. And the axis can be controlled to stop at the phase specified by *StopPhase* via the DMC\_MoveVelocityStopByPos instruction.

The terminal actuator may stop at the position of 12500 units, 22500 units, 32500 units or 42500 units.

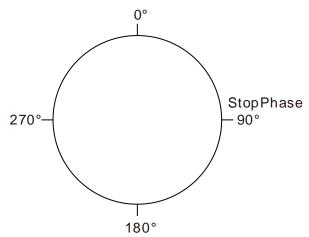

## 11.3.25 DMC\_MoveVelocityStopByLinePos

FB/FC	Explanation				Applicable model
FB	DMC_MoveVelocityStopBy specified position.	DMC_MoveVelocityStopByLinePos is used for making an axis stop at the specified position.			
	DM	C_MoveVelocityS	topByLinePos_instance		
		DMC_MoveVelo	cityStopByLinePos		
		Axis	InVelocity —		
		Ex_Move	Stop_Done		
		Ex_Stop	Busy		
		Velocity	Active		
		Acceleration	CommandAbort —		
		Deceleration	E rror		
		Jerk	Errorl D		
		Direction			
		RoundPhase			
		StopPhase			
		BufferMode			

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Ex_Move	The instruction controls the axis to run when <i>Ex_Move</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Ex_Stop	The instruction controls the axis to run when <i>Ex_Stop</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Velocity	Specify the target velocity. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Acceleration	Specify the target acceleration rate. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Deceleration	Specify the target deceleration rate. (Unit: Unit/s²)	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
Jerk	Specify the change rate of the target acceleration or deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Direction	Specify the rotation direction 1: Positive direction 3: Negative direction	MC_Direction	1: mcPositiveDirection, 3: mcNegativeDirection (1)	When <i>Ex_Move</i> changes to TRUE.
RoundPhase	Specify the modulo.	LREAL	Positive number (The variable value must be set)	When <i>Ex_Move</i> changes to TRUE.
StopPhase	Specify a position in the modulo.	LREAL	0~the setting value of <i>RoundPhase</i> (0)	When <i>Ex_Move</i> changes to TRUE.
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered 2: BlendingLow 3: BlendingPrevious 4: BlendingNext 5: BlendingHigh	MC_Buffer_Mode	0 : mcAborting 1 : mcBuffered 2 : mcBlendingLow 3 : mcBlending _Previous 4 : mcBlending _Next 5 : mcBlending _High (0)	When <i>Ex_Move</i> changes to TRUE.

## • Output Parameters


Parameter name	Function	Data type	Valid range
Invelocity	TRUE when the target velocity is reached.	BOOL	TRUE / FALSE
Stop_Done	TRUE when the stop position is reached.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled by the instruction.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

## Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Invelocity	<ul> <li>When the target velocity is reached.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>Invelocity changes to FALSE immediately when Ex_Move changes from FALSE to TRUE again if the input parameter values are revised after the target velocity is reached. If the input parameter values are not changed after the instruction execution is completed, Invelocity changes to FALSE immediately when Ex_Move changes from FALSE to TRUE again. Invelocity will change to TRUE in the next cycle.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Stop_Done	<ul> <li>When the stop position is reached</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> <li>When Ex_Stop changes to FALSE.</li> </ul>
Busy	<ul> <li>When Ex_Move changes to TRUE.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
Active	<ul> <li>When the axis is being controlled by the instruction.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>TRUE when the instruction is aborted by other motion instruction.</li> </ul>	<ul> <li>When Ex_Move changes from TRUE to FALSE.</li> <li>CommandAborted is set to TRUE when the instruction is aborted after Ex_Move and Ex_Stop change from TRUE to FALSE during the instruction execution. One cycle later, CommandAborted changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Ex_Move and Ex_Stop change from TRUE to FALSE.

### Output Update Timing Chart

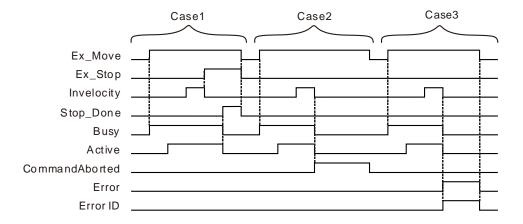

- **Case 1**: When *Ex\_Move* changes from FALSE to TRUE, *Busy* changes to TRUE. When the axis starts being controlled by the instruction, *Active* changes to TRUE. When *Ex\_Stop* changes from FALSE to TRUE, *Invelocity* changes to FALSE. When the position is reached, *Stop\_Done* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. When *Ex\_Move* and *Ex\_Stop* change from TRUE to FALSE, *Stop\_Done* changes to FALSE.
- **Case 2**: When *Ex\_Move* changes to TRUE, the instruction is aborted by other instruction and *CommandAborted* changes to TRUE. Meanwhile, *Invelocity*, *Busy* and *Active* change to FALSE. When *Ex\_Move* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs while *Ex\_Move* is TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Invelocity*, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Ex\_Move* changes from TRUE to FALSE.

#### • Function

DMC\_MoveVelocityStopByLinePos is used for making an axis stop at a specified position. *RoundPhase* sets the specified modulo. *StopPhase* sets a position in the specified modulo. The value

of **StopPhase** should be less than the value of **RoundPhase.** Their units are unit which is the same as that for the pitch (**UnitsPerRotation**).

As *Ex\_Move* changes from FALSE to TRUE, the axis is controlled to run by the instruction. As *Ex\_Stop* changes from FALSE to TRUE, the axis is controlled to stop at the position specified by *StopPhase*. The final position where the axis stops is the position of an integral multiple of *RoundPhase* value+*StopPhase* value.

**RoundPhase** is set to 10000 and **StopPhase** is set to 4000 as shown in the figure below. And the terminal actuator can be controlled to stop at the position specified by **StopPhase** via the DMC\_MoveVelocityStopByLinePos instruction.

The terminal actuator may stop at the position of 4000 units, 14000 units, 24000 units or 34000 units.

	StopPhase	StopPhase	StopPhase	StopPhase
L				
0	4000	10000 14000	20000 24000	30000 34000

## 11.3.26 DMC\_ReadPositionLagStatus

FB/FC	B/FC Explanation					
FB	<b>FB</b> DMC_ReadPositionLagStatus is used for the detection of the position lag.					
	DMC_ReadPositionLagStatus_instance					

DMC_ReadPositionLagStatus		
 Axis	OutOfRange	
 Enable	Busy	
	Error	
	ErrorID	

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> is TRUE.
Enable	he instruction is xecuted when <i>Enable</i> BOOL hanges from FALSE to RUE.		TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.

#### Output Parameters

Parameter name	Function	Data type	Valid range
OutOfRange	TRUE when the position lag is out of the valid range.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
OutOfRange	When the absolute value of the actual position difference of the specified axis has been exceeding the set Lag value within the HoldTime period since it exceeded the Lag value for the first time.	<ul> <li>position difference of the specified axis is less than or equal to the Lag value.</li> <li>When Enable is FALSE.</li> </ul>
Busy	<ul> <li>When the instruction is being executed.</li> </ul>	♦ When <i>Error</i> changes to TRUE.
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When the problem is solved.

### Function

DMC\_ReadPositionLagStatus is used to detect if the absolute value of actual position difference of the specified axis (which is the difference between the command position and feedback position) exceeds

the setting value. The allowed position difference value is set in the DMC\_WritePositionLagSetting instruction.

The *OutOfRange* output will change to TRUE if the actual position difference of the specified axis has been exceeding the *Lag* value within the period specified by *HoldTime* since the *Lag* value was exceeded for the first time. (*Lag* and *HoldTime* are the inputs of DMC\_WritePositionLagSetting.) The *OutOfRange* output will change to FALSE when the absolute value of the actual position difference of the specified axis is less than or equal to the *Lag* value.


When the setting value of *HoldTime* of DMC\_WritePositionLagSetting is 0, the *OutOfRange* output will change to TRUE once the instruction detects that the actual position difference of the specified axis exceeds the *Lag* value and the *OutOfRange* output will change to FALSE once the instruction detects that the absolute value of the actual position difference of the specified axis is less than or equal to the *Lag* value.

The axis will not stop running when the instruction detects that the actual position difference of the specified axis exceeds the *Lag* value. The running of the axis can be stopped by triggering the execution of MC\_Stop or MC\_Halt instruction via the *OutOfRange* output.

## Programming Example

#### 1. The variable table and program

Variable name	Data type	Initial value
DWPLS	DMC_WritePositionLagSetting	
DWPLS_Ex	BOOL	
DWPLS_Lag	LREAL	
DWPLS_H_Time	LREAL	
DWPLS_Done	BOOL	
DWPLS_Bsy	BOOL	
DWPLS_Err	BOOL	
DWPLS_ErrID	WORD	
DRPLS	DMC_ReadPositionLagStatus	
DRPLS_OutfRge	BOOL	
DRPLS_Bsy	BOOL	
DRPLS_Err	BOOL	
DRPLS_ErrID	WORD	
MStop	MC_Stop	
Mstop_DEC	LREAL	
Mstop_Jerk	LREAL	
Mstop_Done	BOOL	
Mstop_Bsy	BOOL	
Mstop_Act	BOOL	
Mstop_Abt	BOOL	
Mstop_Err	BOOL	
Mstop_ErrID	WORD	

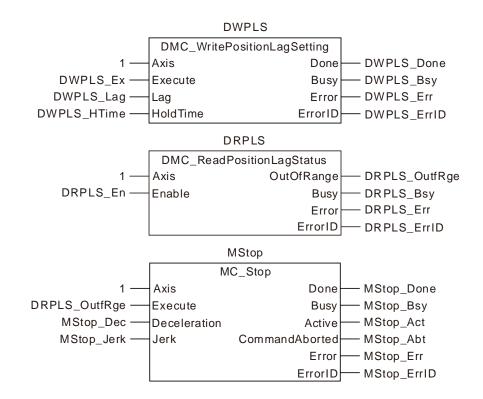

- When DWPLS\_Ex changes from FALSE to TRUE, set the position difference value specified by Lag and the duration value specified by HoldTime for the specified axis. When DWPLS\_Done changes to TRUE, it indicates that the parameters writing is completed.
- When DRPLS\_En changes to TRUE, the DMC\_ReadPositionLagStatus instruction begins to detect whether the actual position difference of the specified axis exceeds the allowed value set in the DMC\_WritePositionLagSetting instruction.

The DRPLS\_OutfRge changes to TRUE when the DMC\_ReadPositionLagStatus instruction detectes that the actual position difference of the specified axis exceeds the setting value and then continues to exceed the setting value within the set period of time.

The axis can stop running by triggering the exection of the MC\_Stop instruction via the DRPLS\_OutfRge output.

DRPLS\_OutfRge changes to FALSE when the DMC\_ReadPositionLagStatus instruction detectes that the actual position difference of the specified axis is less than the setting value.

11.3.27 DM	_WritePositionLagSetting
------------	--------------------------

FB/FC	/FC Explanation			
FB	DMC_WritePositionLagSetting is used for setting the position lag.	AS524C-B		
DMC_WritePositionLagSetting_instance				

DMC_WritePositionLagSetting_Instance				
	DMC_WritePositionLagSetting			
	Axis	Done		
	Execute	Busy		
	Lag	Error		
	HoldTime	ErrorID		

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Lag	Set the allowed value of the difference between the command postion and feedback position.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
HoldTime	A period of time during which the set Lag value is exceeded. (Unit: second)	LREAL	0 or Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.

## Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE/FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the instruction execution is completed.	<ul> <li>When Execute changes to FALSE.</li> </ul>
		◆ When <i>Error</i> changes to TRUE.
Busy	When the instruction is being executed.	◆ When <i>Error</i> changes to TRUE.

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When the error is cleared.

### **Function**

DMC\_WritePositionLagSetting is used to set the allowed position lag value (which is the difference between the command position and feedback position) and the allowed length of time specified by *HoldTime* during which the setting value of *Lag* is exceeded. Whether the actual position difference of a specified axis exceeds the setting value of *Lag* or not is detected by the DMC\_ReadPositionLagStatus instruction.

For further explanation and example, refer to the section of DMC\_ReadPositionLagStatus instruction.

11

<b>FB</b> DMC_ChangeMechanismGearRatio is used for modifying axis parameter AS524C-B	FB/FC	Explanation	Applicable model
values.	FB	DMC_ChangeMechanismGearRatio is used for modifying axis parameter values.	AS524C-B

## 11.3.28 DMC\_ChangeMechanismGearRatio

# DMC\_ChangeMechanismGearRatio\_instance

•		
DMC_ChangeMechanis	smGearRatio	
 Axis	Done	
 Execute	Busy	
 InputRotation	Error	
 Output Rotation	ErrorID	
 UnitsPerRotation		
 AxisType		
 Modulo		

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
InputRotation	This parameter and <i>OutputRotation</i> decide the mechanical gear ratio.	LREAL	Positive integer (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
OutputRotation	<i>InputRotation</i> and this parameter and decide the mechanical gear ratio.	LREAL	Positive integer (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
UnitsPerRotation	The number of units which the terminal actuator moves while output end of the gear box rotates for a circle. (Unit: units/rotation)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
AxisType	Axis type 0: rotary axis 1: linear axis	USINT	0, 1 (0)	When <i>Execute</i> changes from FALSE to TRUE.
Modulo	The cycle used for equally dividing the actual position of the terminal actuator.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.

### Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE

Parameter name	Function	Data type	Valid range
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Execute</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE.</li> </ul>	◆ When <i>Error</i> changes to TRUE.
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### Output Update Timing Chart

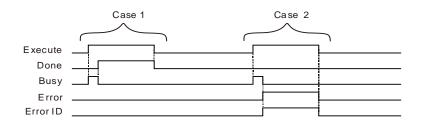

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

#### Function

DMC\_ChangeMechanismGearRatio is used for modifying parameter values for the terminal actuator. The instruction can change axis parameter values so as to make them consistent with actual parameter values, which is more convenient for users to operate.

The instruction can be executed only when the axis is in Disabled or Standstill state.

FB/FC	Explanation	Applicable model
FB	DMC_TorqueControl controls an axis to work under torque mode and carry out the torque output.	AS524C-B
	DMC_TorqueControl_instance	

## 11.3.29 DMC\_TorqueControl

DMC_TorqueControl_instance				
DMC_TorqueControl				
— Axis	InTorque —			
Enable	Busy —			
	Active —			
Torque	CommandAborted —			
	Error —			
	ErrorID			
Acceleration				
Deceleration				
— Jerk				
Direction				
-BufferMode				

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE.
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
ContinuousUpdate	Reserved	-	-	-
Torque	Specify the target torque. The torque is expressed with the permillage of rated torque of the servo axis. For instance, the setting value 30 indicates that the set torque is 30‰ of rated torque of the servo axis. While <i>Enable</i> changes to TRUE, modifying the parameter value will make the torque changed immediately.	INT	Negative number, positive number, 0 (0)	When <i>Enable</i> changes to TRUE.
TorqueRamp	Specify change rate of the torque from current torque to target torque. (Unit: ‰/s)	LREAL	Negative number, positive number (The variable value must be set)	When <i>Enable</i> changes from FALSE to TRUE.
Velocity	When the torque control instruction controls an axis, the velocity of the axis cannot exceed the setting value. (Unit: unit/s)	LREAL	Positive number (The variable value must be set)	When <i>Enable</i> changes from FALSE to TRUE.
Acceleration	Reserved			
Deceleration	Reserved			

11


Parameter name	Function	Data type	Valid range (Default)	Validation timing
Jerk	Reserved			
Direction	Specify the rotation direction for the axis. 1: Positive direction 3: Negative direction	MC_Direc tion	1: mcPositiveDirec- tion, 3: mcNegativeDirec- tion (The variable value must be set)	When <i>Enable</i> changes from FALSE to TRUE.
BufferMode	Reserved			

### • Output Parameters

Function	Data type	Valid range
TRUE when the set target torque is reached.	BOOL	TRUE / FALSE
TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
Contains the error code when an error occurs. Please refer to section 12.2 for the corresponding error ID.	WORD	
	<ul> <li>TRUE when the set target torque is reached.</li> <li>TRUE when the instruction is being executed.</li> <li>TRUE when the axis is being controlled.</li> <li>TRUE when the instruction is aborted.</li> <li>TRUE when an error occurs in execution of the instruction.</li> <li>Contains the error code when an error occurs. Please refer to section 12.2 for the</li> </ul>	TRUE when the set target torque is reached.BOOLTRUE when the instruction is being executed.BOOLTRUE when the axis is being controlled.BOOLTRUE when the instruction is aborted.BOOLTRUE when the instruction is aborted.BOOLTRUE when an error occurs in execution of the instruction.BOOLContains the error code when an error occurs. Please refer to section 12.2 for theWORD

Output Update Timing					
Name	Timing for changing to TRUE	Timing for changing to FALSE			
InTorque	<ul> <li>When the target torque is reached.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>			
Busy	<ul> <li>When <i>Enable</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>InTorque</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>			
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When <i>InTorque</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>			
CommandAborted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When Enable changes from TRUE to FALSE.</li> <li>CommandAborted is set to TRUE when the instruction is aborted by other instruction after Enable changes from TRUE to FALSE during the instruction execution. One cycle later, CommandAborted changes to FALSE.</li> </ul>			
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When <i>Enable</i> changes from TRUE to FALSE.			

### • Output Update Timing Chart

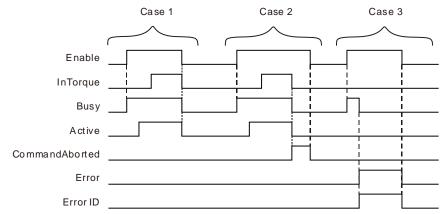

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction starts to control the axis, *Active* changes to TRUE. *InTorque* changes to TRUE when the set target torque is reached. When *Enable* changes from TRUE to FALSE, *Busy*, *Active* and *Intorque* change to FALSE.
- **Case 2**: When the instruction is aborted by MC\_Stop after *Enable* changes from FALSE to TRUE, *CommandAborted* changes to TRUE and meanwhile *InTorque*, *Busy* and *Active* change to FALSE. When *Enable* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- Case 3 : The input parameter is illegal (such as axis number: 0) before the instruction is executed. When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Error* changes to TRUE, *Busy* changes to FALSE and *ErrorID* shows corresponding error codes. When *Enable* changes from TRUE to FALSE, *Error* changes from TRUE to FALSE and the value of *ErrorID* is cleared to 0.

#### Function

DMC\_TorqueControl controls an axis to work under torque mode and carry out the torque output. Based on the set change rate of the torque, axis motion will change in the process from current toque to target torque. If the torque value is modified during the execution of the instruction, the torque of the servo will immediately change according to the change rate of the torque and then the servo will keep the torque value for motion. During the execution of the instruction, the instruction will control the velocity of the axis not to exceed the set maximum velocity.


To stop the instruction, change *Enable* to FALSE or use MC\_Stop to make the instruction aborted. When *Enable* changes from TRUE to FALSE, the axis will exit from the torque mode and the torque will change immediately (the change rate of the torque will be invalid). If the axis needs to stop gradually according to the change rate of the torque, just set the target torque to 0, wait for the actual output torque of the axis to change to 0 and then change *Enable* to FALSE.

## Programming Example


### 2. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_EnPs	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	

Variable name	Data type	Initial value
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
ТС	DMC_TorqueControl	
TC_En	BOOL	FALSE
TC_Tor	INT	30
TC_TorRa	LREAL	5.0
TC_Vel	LREAL	100000.0
TC_Dir	MC_Direction	1
TC_InTor	BOOL	
TC_Bsy	BOOL	
TC_Act	BOOL	
TC_Abt	BOOL	
TC_Err	BOOL	
TC_ErrID	WORD	

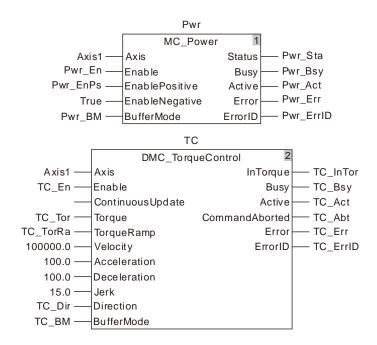


3. Motion Curve and Timing Chart

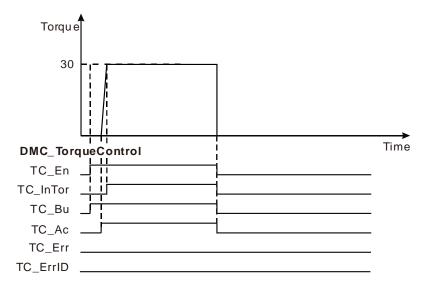

- When TC\_En changes from FALSE to TRUE, DMC\_TorqueControl is executed. Meanwhile TC\_Bsy changes from FALSE to TRUE. When TC\_Act changes to TRUE, the instruction starts to control the axis and the torque value will be increased according to the set change rate of the torque.
- After the value of TC\_Tor is set to 0, the torque value is decreased to 0 according to the set change rate of the torque.
- When TC\_En changes from TRUE to FALSE, TC\_InTor, TC\_Bsy and TC\_Act change from FALSE to TRUE and the servo exits from the torque mode.

### 11.3.30 DMC\_MoveVelocity

FB/FC	Explanation	Applicable model		
FB	DMC_MoveVelocity changes the parameter values of the velocity instruction to make the controlled axis valid immediately during execution of the velocity instruction.	AS524C-B		
DMC_MoveVelocity_instance DMC_MoveVelocity Axis InVelocity				

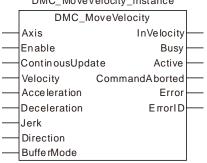

### • Function

DMC\_MoveVelocity changes the velocity and makes the axis velocity valid immediately during execution of the velocity instruction. The function of the instruction is similar to MC\_MoveVelocity instruction. The only difference between the two instructions is that changing the values of *Velocity*, *Acceleration*, *Deceleration*, *Jerk* and *Direction of* the instruction will take effect immediately as *Enable* is TRUE. For details on parameters and data types, refer to MC\_MoveVelocity.

## 11.3.31 DMC\_SwitchSoftLimit

FB/FC	Explanation	Applicable model
FB	DMC_SwitchSoftLimit controls the software limit switch.	AS524C-B

D	DMC_SwitchSoftLimit_instance			
	DMC_SwitchSoftLimit			
	Axis	Done		
	Enable	Error		
	Switch	ErrorID		

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Enable</i> changes to TRUE.
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.
Switch	FALSE: Turn the software limit switch OFF. TRUE: Turn the software limit switch ON.	BOOL-	TRUE or FALSE (FALSE)	When <i>Enable</i> changes to TRUE.

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

### Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done		<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Enable</i> changes from TRUE to FALSE.</li> </ul>
Error	<ul> <li>The input parameters for the instruction are illegal.</li> </ul>	◆ When <i>Enable</i> changes from TRUE to FALSE.

### • Function

DMC\_SwitchSoftLimit controls the software limit switch. When *Switch* is TRUE and the instruction execution is completed, the software limit switch turns ON. When *Switch* is FALSE and the instruction execution is completed, the software limit switch turns OFF.

Also, users could set the switch by clicking Network Configuration-> Motion->Axis Configuration->General in the software without using the instruction.

The maximum position and minimum position need be set through the software.


After the software limit switch is ON, an error will occur if the axis position which is being controlled by motion instructions exceeds the software limit range.

11

## Programming Example

### The variable table and program

Variable name	Data type	Initial value	
SSL	DMC_SwitchSoftLimit		
Axis1	USINT	1	
SSL_En	BOOL	FALSE	
SSL_Swh	BOOL	FALSE	
SSL_Done	BOOL		
SSL_Err	BOOL		
SSL_ErrID	WORD		

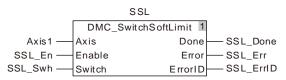


- When SSL\_Swh is TRUE and SSL\_En changes from FALSE to TRUE, the instruction is executed. When the instruction execution is completed, SSL\_Done changes to TRUE and the number 1 software limit switch is enabled.
- When SSL\_Swh is FALSE and SSL\_En changes from FALSE to TRUE, the instruction is executed. When the instruction execution is completed, SSL\_Done changes to TRUE and the number 1 software limit switch is disabled.

11

## 11.4 Multi-axis Instructions

## 11.4.1 MC\_GearIn

FB/FC	Explanation	Applicable model
FB	MC_GearIn is used for establishing the electronic gear relationship between two axes.	AS524C-B

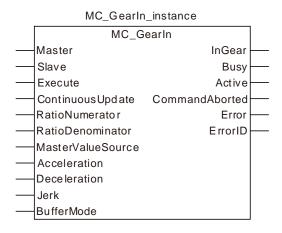

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Master	Specify the number of the master axis which is to be controlled by the instruction	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Slave	Specify the number of the slave axis which is to be controlled by the instruction	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpdate	Reserved	-	-	-
RatioNumerator	Gear ratio Numerator	LREAL	Positive number and negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
RatioDenominator	Gear ratio Denominator	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
MasterValueSource	<ul> <li>Command source selection</li> <li>0 : Command position of the master axis which the slave axis follows</li> <li>1 : Actual position of the master axis which the slave axis follows</li> </ul>	MC_Sourc e	0:mcSetValue 1:mcActualValue (0)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Acceleration	Specify the target acceleration. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the target deceleration. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of target acceleration and deceleration. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
BufferMode	Specify the behavior when executing two instructions. 0: Aborting 1: Buffered	MC_Buffer  Mode	0 : mcAborting 1 : mcBuffered (0)	When <i>Execute</i> changes from FALSE to TRUE

#### Notes:

- 1. The execution of MC\_GearIn is started when *Execute* changes from FALSE to TRUE. No matter whether the execution of the instruction is completed or not, the instruction can be re-executed when *Execute* changes from FALSE to TRUE once again. During re-execution, only *RatioNumerator*, *RatioDenominator*, *MasterValueSource*, *Acceleration*, *Deceleration* and *Jerk* parameters will be effective again.
- 2. The slave axis specified by MC\_GearIn instruction can execute other motion instruction while MC\_GearIn is being executed. While other motion instruction aborts the MC\_GearIn instruction, the gear relationship between the master axis and slave axis will disconnected. MC\_Halt or MC\_Stop can abort the motion of the slave axis.
- 3. Refer to section 10.2 for the relation among *Acceleration*, *Deceleration* and *Jerk*.
- 4. Refer to section 10.3 for details on *BufferMode*.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
InGear	TRUE when the slave axis reaches the synchronous state.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

11

Name	Timing for changing to TRUE	Timing for changing to FALSE
InGear	<ul> <li>When the slave axis enters the synchronous state.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> <li>InGear will change to FALSE immediately when the input parameter is modified after the synchronous state is reached and Execute changes from FALSE to TRUE once more.</li> <li>InGear will change to FALSE immediately when the input parameter is not modified after the instruction execution is finished and Execute changes from FALSE to TRUE once more. And in the next period, InGear changes to TRUE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>
Active	<ul> <li>When the axis starts being controlled by the instruction</li> </ul>	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>
CommandAborted	<ul> <li>When the instruction execution is aborted by other motion instruction</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE in the course of the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

### • Output Update Timing

### • Output Update Timing Chart

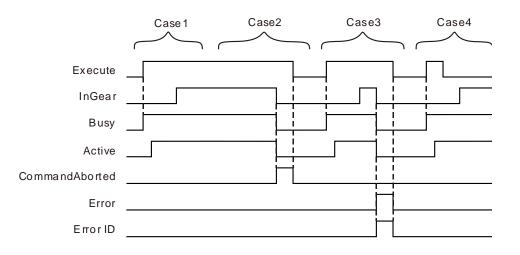

**Case 1**: *Busy* changes to TRUE as *Execute* changes from FALSE to TRUE. One period later, *Active* changes to TRUE. When the synchronous state is reached, *InGear* changes to TRUE and meanwhile *Busy* and *Active* remain TRUE.

- **Case 2**: When *Execute* changes to TRUE and the slave axis is controlled by other instruction, MC\_GearIn instruction is aborted by other instruction and *CommandAborted* changes to TRUE. Meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When *Execute* changes from FALSE to TRUE and an error such as a parameter mistake occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. Meanwhile *InGear, Busy* and *Active* change to FALSE. As *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 4**: After *Execute* changes from TRUE to FALSE in the process of execution of MC\_GearIn, *InGear* changes to TRUE and meanwhile *Busy* and *Active* remain TRUE.

### Function

- 1. MC\_GearIn is used for establishing an electronic gear relationship between two axes. After the MC\_GearIn instruction is executed, the slave axis performs the gear operation with the master axis according to the parameters, *RatioNumerator*, *RatioDenominator*, *Acceleration*, *Deceleration*, *Jerk* and *BufferMode*. The master axis can be a real axis, virtual axis or encoder axis. The salve axis can be a real axis or virtual axis.
- 2. In the instruction execution, the slave axis need be enabled and the master axis can be enabled or disabled.
- 3. If the MC\_GearIn instruction is executed when the e-gear relationship between two axes has not been built yet, the velocity of the slave axis will reach the target velocity according to the values of *RatioNumerator, RatioDenomenator, Acceleration, Deceleration* and *Jerk* specified by the instruction.

```
Acceleration (or Deceleration) of Slave axis= Acceleration (or Deceleration) of Masteraxis X
```

RatioDenominator

After the e-gear relationship between two axes has been built (when *InGear* of the instruction changes to TRUE), the relationship among the velocity of the slave axis, gear ratio numerator, gear ratio denominator and the velocity of the master axis is shown as below.

Gear ration umeberator

Target velocity of Slave axis = Velocity of Master axis X \_\_\_\_\_\_\_ Gear ratio denominator

4. E-gear ratio

RatioNumerator

E-gearratio= RatioDenominator

If the e-gear ratio is a positive number, the motion directions of the slave axis and master axis are same.

If the e-gear ratio is a negative number, the motion directions of the slave axis and master axis are opposite.



### Programming Example

Below is the example of execution of MC\_GearIn instructions.


#### 1. The variable table and program


Variable name	Data type	Initial value
Vel	MC_MoveVelocity	
Axis1	USINT	1
Axis2	USINT	2
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1
Vel_BM	MC_Buffer_Mode	0
Vel_Invel	BOOL	
Vel_Bsy	BOOL	

11

Variable name	Data type	Initial value
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	
GearIn1	MC_GearIn	
GearIn1_Ex	BOOL	FALSE
GearIn1_BM	MC_Buffer_Mode	0
GearIn1_InGear	BOOL	
GearIn1_Bsy	BOOL	
GearIn1_Act	BOOL	
GearIn1_Abt	BOOL	
GearIn1_Err	BOOL	
GearIn1_ErrID	WORD	
GearIn2	MC_GearIn	
GearIn2_Ex	BOOL	FALSE
GearIn2_BM	MC_Buffer_Mode	0
GearIn2_InGear	BOOL	
GearIn2_Bsy	BOOL	
GearIn2_Act	BOOL	
GearIn2_Abt	BOOL	
GearIn2_Err	BOOL	
GearIn2_ErrID	WORD	



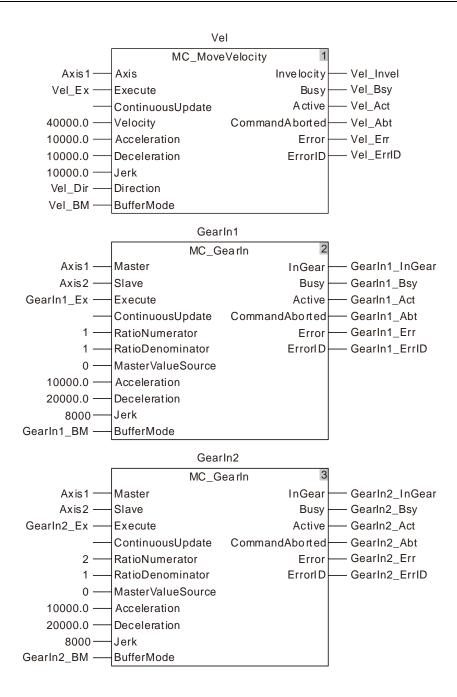

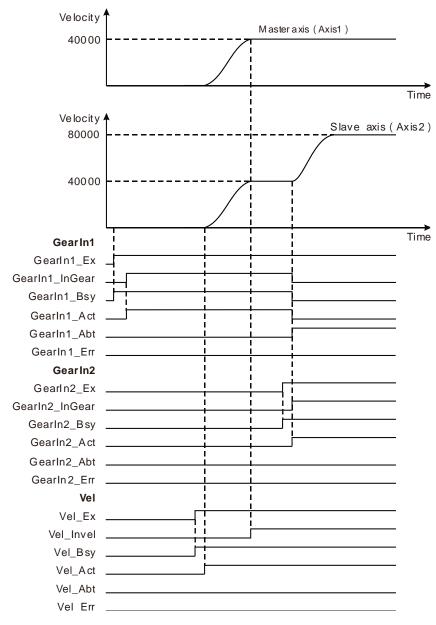


#### 3. Motion Curve and Timing Charts:

- In GearIn1, the values of RatioNumerator and RatioDenomenator are both 1. GearIn1\_Ex changes from FALSE to TRUE and meanwhile GearIn1\_Bsy changes to TRUE. One period later, GearIn1\_InGear changes to TRUE and the e-gear relationship between the master axis and the slave axis is built.
- Vel\_Ex changes from FALSE to TRUE after the e-gear relationship between the master axis and slave axis is built. One period later, Vel\_Act changes to TRUE, the master axis performs the velocity instruction and the slave axis follows the master axis for motion.
- In GearIn2, the values of RatioNumerator and RatioDenomenator are 2 and 1 respectively. GearIn2\_Ex changes from FALSE to TRUE and meanwhile GearIn2\_Bsy changes to TRUE. One period later, GearIn2\_Act and GearIn1\_Abt change to TRUE and the slave axis gets to the target velocity based on the values of RatioNumberator, Ratio Denomenator, MasterValueSource, Acceleration, Jerk and BufferMode specified by the GearIn2 instruction. Since the values of RatioNumerator and RatioDenomenator in GearIn2 are 2 and 1 respectively, the target velocity of the slave axis is twice that of the master axis. When GearIn2\_InGear changes to TRUE, the velocity of the slave axis will be twice that of the master axis.

## 11.4.2 MC\_GearOut

FB/FC	Explanation	Applicable model
FB	MC_GearOut is used for ending the established electronic gear relationship between the master axis and slave axis.	AS524C-B

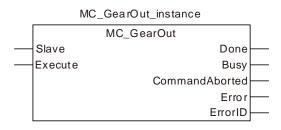

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Slave	Specify the number of the slave axis which is to disconnect from the e-gear relationship.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-

### Notes:

- 1. The slave axis will continue to move at the speed of disconnection if the slave axis disconnects from the e-gear relationship through the MC\_GearOut instruction after the two axes has built the e-gear relationship through the MC\_GearIn instruction.
- 2. The slave axis can execute other motion instructions after the MC\_GearOut instruction execution is completed.
- 3. The relationship between the master axis and slave axis is disconnected through the MC\_GearOut instruction. To stop the motion of the slave axis, MC\_Halt or MC\_Stop instruction can be used.

#### Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the e-gear relationship between the slave axis and master axis is disconnected and the MC_GearOut instruction is controlling the axes.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID Contains the error code when an error occurs. Please refer to section 12.2.		WORD	

#### Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the electronic gear relationship between the slave axis and master axis is disconnected</li> </ul>	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Busy	◆ When <i>Execute</i> changes to TRUE	<ul> <li>When CommandAborted changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>
CommandAborted	<ul> <li>When the instruction execution is aborted by other motion instruction</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE in the course of the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing Chart

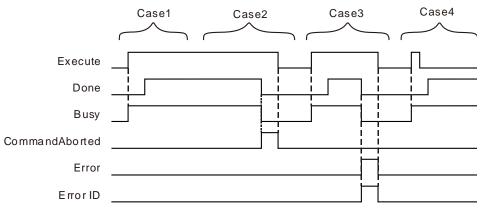

- **Case 1** : *Busy* changes to TRUE as *Execute* changes from FALSE to TRUE. One period later, *Done* changes to TRUE. *Busy* and *Done* remain TRUE after *Execute* changes from TRUE to FALSE.
- **Case 2**: If the MC\_GearOut instruction is aborted by other instruction as *Execute* changes to TRUE, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Done* change to FALSE. *CommandAborted* changes to FALSE as *Execute* changes from TRUE to FALSE.
- **Case 3**: When an error occurs (e.g. the axis is disabled), *Error* changes to TRUE and *ErrorID* shows corresponding error codes after *Execute* changes from FALSE to TRUE. Meanwhile, *Busy* and *Done* change to FALSE. As *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 4** : *Execute* changes from TRUE to FALSE before a period is reached during execution of the MC\_GearOut instruction. *Done* changes to TRUE and *Busy* remains TRUE as a period is reached.


## Programming Example

Below is the example of the execution of the MC\_GearOut instruction.


#### 1. The variable table and program

Variable name	Data type	Initial value
Vel	MC_MoveVelocity	
Axis1	USINT	1
Axis2	USINT	2
Vel_Ex	BOOL	FALSE
Vel_Dir	MC_DIRECTION	1

Variable name	Data type	Initial value
Vel_BM	MC_Buffer_Mode	0
Vel_Invel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	
GearIn	MC_ GearIn	
GearIn_Ex	BOOL	FALSE
GearIn_BM	MC_Buffer_Mode	0
GearIn_InGear	BOOL	
GearIn_Bsy	BOOL	
GearIn_Act	BOOL	
GearIn_Abt	BOOL	
GearIn_Err	BOOL	
GearIn_ErrID	WORD	
GearOut	MC_ GearOut	
GearOut_Ex	BOOL	FALSE
GearOut_Done	BOOL	
GearOut_Bsy	BOOL	
GearOut_Act	BOOL	
GearOut_Abt	BOOL	
GearOut_Err	BOOL	
GearOut_ErrID	WORD	

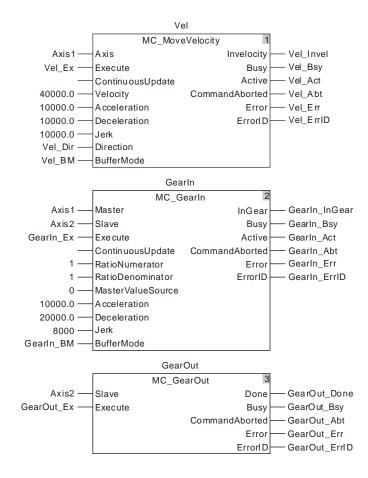

2. Curve and Timing Charts:

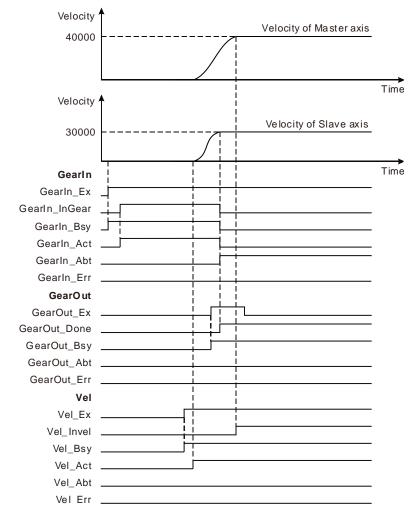

- As GearIn\_Ex changes from FALSE to TRUE, GearIn\_Bsy changes to TRUE. And one period later, GearIn\_InGear changes to TRUE and the gear relationship between the master axis and slave axis is built.
- After the gear relationship between the two axes is built, Vel\_Ex changes from FALSE to TRUE. One period later, Vel\_Act changes to TRUE. The master axis executes the velocity instruction and the slave axis moves by following the motion of the master axis.
- While the master axis is executing the velocity instruction, GearOut\_Ex changes from FALSE to TRUE and GearOut\_Bsy changes to TRUE. One period later, GearOut\_Done and GearIn\_Abt change to TRUE. And the slave axis will continue to move at the current speed.

11

FB/FC		Explanation			Applicable model
FB	MC_CombineAxes outputs the sum or difference of the position variations of two master axes as the slave position variation.		AS524C-B		
		MC_CombineAxes_in	stance		
		MC_CombineAxe	S		
		Master1	InSync		
		Master2	Busy		
		Slave	Active		
		Execute Command	Aborted		
		ContinuousUpdate	Error		
		CombineMode	ErrorID		
		GearRatioNumeratorM1			
		GearRatioDenominatorM			
		GearRatioNumeratorM2			
		GearRatioDenominatorM	2		
		MasterValueSourceM1			
		MasterValueSourceM2			
		Acc			
		Dec			
		Jerk			
		BufferMode			

## 11.4.3 MC\_CombineAxes

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Master1	The position source of axis 1	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Master2	The position source of axis 2	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Slave	The controlled slave	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
ContinuousUpdat e	Reserved	-	-	-
CombineMode	Combining method selection. 0: Sum of two master axis position variations 1: Difference of two master axis position variations	MC_Combin eMode	0: mcAddAxes 1: mcSubAxes (0)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
GearRatioNumer atorM1	Specify the master axis1 gear ratio numerator.	LREAL	Positive number or negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
GearRatioDenom inatorM1	Specify the master axis1 gear ratio denominator.	LREAL	Positive number or negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
GearRatioNumer atorM2	Specify the master axis2 gear ratio numerator.	LREAL	Positive number or negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
GearRatioDenom inatorM2	Specify the master axis2 gear ratio denominator.	LREAL	Positive number or negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
MasterValueSour ceM1	Specify the synchronization position source of master axis 1. 0 : Command position 1 : Actual position	MC_SOURC E	0:mcSetValue 1:mcActualValue (0)	When <i>Execute</i> changes from FALSE to TRUE
MasterValueSour ceM2	Specify the synchronization position source of master axis 2. 0 : Command position 1 : Actual position	MC_SOURC E	0:mcSetValue 1:mcActualValue (0)	When <i>Execute</i> changes from FALSE to TRUE
Асс	Specify the acceleration for the slave axis.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Dec	Specify the deceleration for the slave axis.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Specify the change rate of the acceleration for the slave axis.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
BufferMode	Specify the behavior when executing two instructions. 0 : Aborted 1 : Buffered	MC_Buffer_ Mode	0 : mcAborting 1 : mcBuffered (0)	When <i>Execute</i> changes from FALSE to TRUE

### Notes:

- 1. The instruction execution starts when *Execute* changes from FALSE to TRUE. When *Execute* changes from FALSE to TRUE again no matter whether the instruction execution is completed or not, the instruction cannot be re-executed and the previous setting values will be kept.
- 2. Refer to section 10.2 for the relation among *Position*, *Velocity*, *Acceleration* and *Jerk*.
- 3. Refer to section 10.3 for the details about *BufferMode*.

Parameter name	Function	Data type	Valid range
InSync	TRUE when the slave axis has completed the synchronization action.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	


### Output Parameters

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
InSync	<ul> <li>When the slave axis completes the synchronization action.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>CommandAborted</i> changes to TRUE.</li> </ul>
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When this instruction execution is aborted by other motion control instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> <li>CommandAborted is set to TRUE when the instruction is aborted after Execute changes from TRUE to FALSE during the instruction execution. One cycle later, CommandAborted changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE

11

### **Output Update Timing Chart**

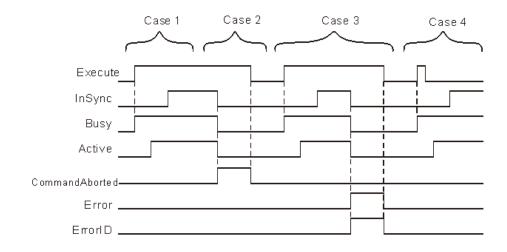

- Case 1 : When Execute changes from FALSE to TRUE, Busy changes to TRUE. One cycle later, Active changes to TRUE. When the slave axis has synchronized with the two master axes, InSync changes to TRUE and Busy and Active remain TRUE.
- Case 2: When Execute is TRUE, Busy is TRUE and Active is TRUE. When the slave have synchronized with the two master axes, InSync is TRUE. At the moment, the instruction is aborted by another instruction, CommandAborted changes to TRUE and meanwhile Invelocity, Busy and Active change to FALSE. When Execute changes from TRUE to FALSE, CommandAborted changes to FALSE.
- Case 3: When Execute changes from FALSE to TRUE, Error changes to TRUE and ErrorID shows corresponding error codes when an error occurs such as axis alarms or offline. Meanwhile, InSync, Busy and Active change to FALSE. When Execute changes from TRUE to FALSE, Error changes to FALSE.
- **Case 4**: The instruction is still executed and the states of Busy and Active do not change after Execute changes from TRUE to FALSE during execution of the instruction. When the slave axis has been synchronized with the two master axes, InSync changes to TRUE and Busy and Active remain TRUE.

### Function

MC CombineAxes outputs the sum or difference of the position variations of two master axes as the slave position variation.


#### **Combine modes: Addition or Subtraction**

The addition or subtraction of the position variations of master axis 1 and master axis 2 are conducted and the calculation result is output as slave axis position variation.

CombineMode is set to 0

#### Position variation of Slave axis = GearRatioNumeratorM1 Position variation of Master axis1 $\times$ -

GearRatioDenominatorM1 GearRatioNumeratorM2 Position variation of Master axis2  $\times \frac{\text{GearRatioNumbergence}}{\text{GearRatioDenominatorM2}}$ 

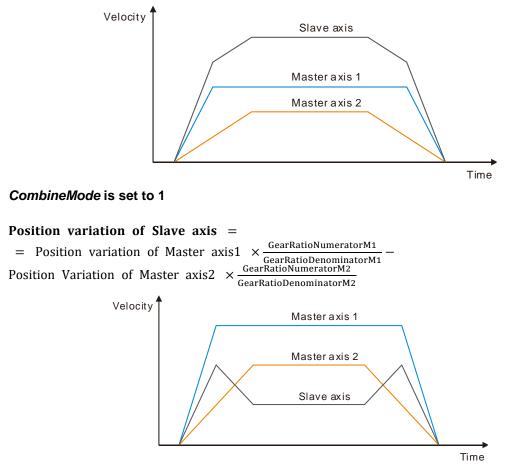

- The master gear ratio numerator and denominator are the factors to adjust the position variations of two master axes. See the formula above.
- MasterValueSource can be set to 0 (command position) and 1 (actual position) so as to specify the source of the position variation. If the value is set to 0, add up the master axis command position variations. If the value is set to 1, subtract one master axis actual position variation from another master axis actual position variation.
- The Acc, Dec and Jerk indicate that the master axis has been in motion before the instruction is executed. If the instruction is executed at the moment, the slave axis will speed up or down according to the set acceleration, deceleration and jerk so as to realize the synchronization with the master position variations. When the synchronization is achieved, *InSync* is TRUE and the instruction execution is completed.
- Use other motion instruction (such as MC\_Stop instruction) for the control over the slave axis so as to end the master-slave axis relationship in the instruction. Set the value of *BufferMode* of other motion instruction which has the *Buffermode* parameter to 0 in order to abort the MC\_CombineAxes instruction and disconnect the master-slave axis relationship.
- If the master axis gear ratio is to be switched during the motion, use another MC\_CombineAxes instruction to abort the MC\_CombineAxes instruction which is being executed.

### Programming Example


The example of executing the MC\_CombineAxes instruction is described as below.

1.	The variable table and program	


Variable name	Data type	Initial value
Pwr1	MC_Power	
Axis1	USINT	1
Pwr1_BM	MC_Buffer_Mode	1
Pwr1_Sta	BOOL	

Variable name	Data type	Initial value
Pwr1_Bsy	BOOL	
Pwr1_Act	BOOL	
Pwr1_Err	BOOL	
Pwr1_ErrID	WORD	
Pwr2	MC_Power	
Axis2	USINT	1
Pwr2 BM	MC Buffer Mode	1
Pwr2_Sta	BOOL	
Pwr2_Bsy	BOOL	
Pwr2 Act	BOOL	
Pwr2_Err	BOOL	
Pwr2 ErrID	WORD	
 Pwr3	MC_Power	
Axis3		1
Pwr3_BM	MC_Buffer_Mode	1
Pwr3 Sta	BOOL	
Pwr3_Bsy	BOOL	
Pwr3 Act	BOOL	
Pwr3_Err	BOOL	
Pwr3_ErrID	WORD	
CombinA	MC_CombineAxes	
CombinA_Ex	BOOL	FALSE
CombinA_BM	MC_Buffer_Mode	1
CombinA_InSync	BOOL	
CombinA_Bsy	BOOL	
CombinA_Act	BOOL	
CombinA_Abt	BOOL	
CombinA_Err	BOOL	
CombinA_ErrID	WORD	
Rel1	MC_MoveRelative	
Rel1_Ex	BOOL	FALSE
Rel1_Dir	MC_DIRECTION	1
Rel1_BM	MC_Buffer_Mode	0
Rel1_Done	BOOL	•
Rel1_Bsy	BOOL	
Rel1_Act	BOOL	
Rel1_Abt	BOOL	
Rel1_Err	BOOL	
Rel1_ErrlD	WORD	
Rel2		
Rel2_Ex	BOOL	FALSE
Rel2_Dir	MC_DIRECTION	1
Rel2_BM	MC_Buffer_Mode	0
Rel2_Done	BOOL	v
Rel2_Bsy	BOOL	
	BOOL	

Variable name	Data type	Initial value
Rel2_Act	BOOL	
Rel2_Abt	BOOL	
Rel2_Err	BOOL	
Rel2_ErrID	WORD	

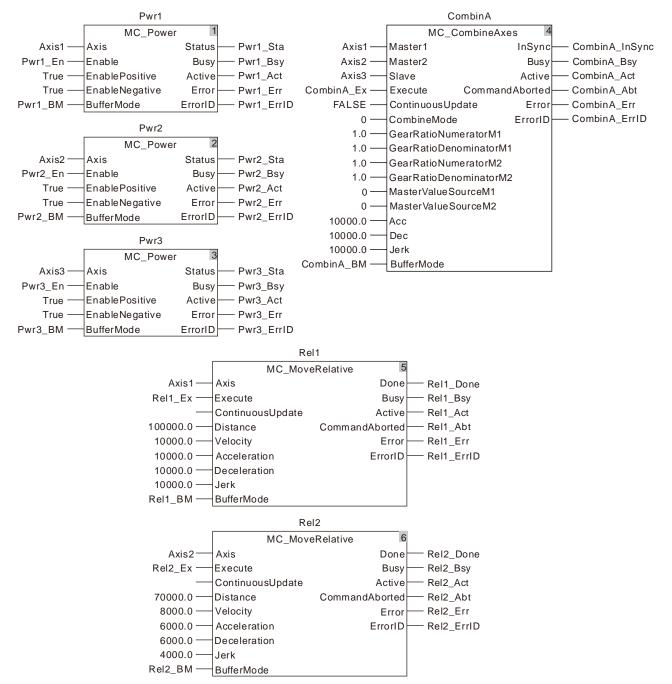

#### 2. Motion Curve and Timing Chart

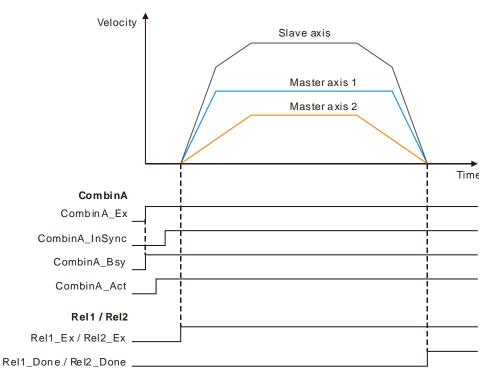

When CombinA\_Ex change from FALSE to TRUE, the execution of the MC\_CombineAxes instruction starts. After a period of time, the instruction execution succeeds, CombinA\_InSync changes to TRUE and three axes can go into the synchronized motion as required. At the moment, *Executes* of MC\_MoveRelatives for the two master axes are set to TRUE and then the two master axes start to run and meanwhile the slave also starts to run according to the sum of two master axis position variations. The slave axis position variation is the sum of the sum of the sum of the unit time.

After the instructions executed for the master axes are completed, the three axes remain in the synchronized state. To abort the synchronization state of the three axes, use MC\_Stop instruction to abort the slave axis motion and disconnect the synchronization state.

### 11.4.4 Introduction of Electronic Cam

The cam is the component with the curve profile or grooves. It transmits the motion to the follower near its edge and the rack will turn periodically following the follower. The cam mechanism consists of a cam, follower and rack. The following figure shows the cam profile made up of point A, B, C, and D. AB' is a follower which is connected to the rack.  $\delta 4$  is an inner angle of repose;  $\delta 2$  is an external angle of repose. The radius of the base circle is r0 and S is the cam curve.

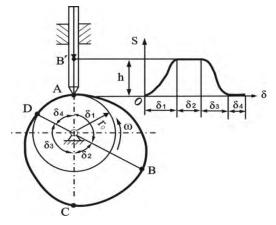


Figure 11.4.4.1

The electronic cam is an analog cam of the mechanical cam through applying computer technology. Compared with the mechanical cam, the electronic cam has many advantages of being easy to design and modify; cost saving; higher efficiency and preciseness. Because the electronic cam is an analog cam, the defects of a mechanical cam like being easy to be damaged and not fit for high-speed rotation and transmission can be avoided for the electronic cam.

The motion controller supports the function of the electronic cam. User can edit the cam curve in the corresponding cam editor software.

The cam curve need be called in the motion control program after being edited. The motion control program can call the cam curve by using the MC\_CamIn instruction.

## 11.4.5 MC\_CamIn

FB/FC	Explanation	Applicable model
FB	MC_CamIn is used to build the cam relationship between two axes according to the set parameters.	AS524C-B

MC_CamIn_instance				
	MC_Ca	amIn		
	Master	InSync		
	Slave	EndOfProfile		
	Execute	Busy		
	ContinuousUpdate	Active		
	CamTable C	CommandAborted		
	Periodic	Error		
	MasterAbsolute	ErrorID		
	SlaveAbsolute			
	MasterOffset			
	SlaveOffset			
	MasterScaling			
	SlaveScaling			
	MasterStartDistance	e		
	MasterSyncPosition	1		
	ActivationPosition			
	ActivationMode			
	StartMode			
	Velocity			
	Acceleration			
	Deceleration			
	Jerk			
	MasterValueSource	e		
	BufferMode			

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
IVIACIAN	Specify the number of the master axis in the electronic cam operation.	USINT		When <i>Execute</i> changes from FALSE to TRUE
Slave	Specify the number of the slave axis in the electronic cam operation.	USINT		When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousU pdate	Reserved			
	Specify the cam table used for building a cam relationship between the master axis and slave axis	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Periodic	Specify whether to execute the specified cam table periodically or just one period.	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
MasterAbsol ute	Specify the position mode of the master axis. TRUE: Absolute position FALSE: Relative position	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
SlaveAbsolut e	Specify the position mode of the slave axis. TRUE: Absolute position FALSE: Relative position	BOOL	TRUE or FALSE (FALSE)	When <i>Execute</i> changes from FALSE to TRUE
MasterOffset	Specify how many units the master axis position shifts by. (Unit: Unit)	LREAL	Negative number, positive number and 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
	Specify how many units the slave axis position shifts by. (Unit: Unit)	LREAL	Negative number, positive number and 0 (0)	When Execute changes from FALSE to TRUE
MasterScalin g	Specify the scaling of the master axis position.	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
SlaveScaling	Specify the scaling of the slave axis position.	LREAL	Positive number or negative number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
MasterStartD istance	Reserved			
MasterSyncP osition	Reserved			
ActivationPo sition	Specify the position of the master axis as the engagement begins. In other words, when the master axis passes the position, the slave axis starts to perform the engagement action.	LREAL	Negative number, positive number and 0 (0)	When <i>Execute</i> changes from FALSE to TRUE
ActivationMo de	Specify the mode of the position where to start the engagement	MC_ACTIV ATION_MO DE	0: mcRelative (Relative axis position) 1: mcAbsolute (Absolute axis position) 2: mcPhase_Axis (Absolute axis phase) 3: mcPhase_CAM (Absolute cam phase) (0)	When Execute changes from FALSE to TRUE
StartMode	Specify the way how the slave axis performs the engagement action.	MC_STAR T_MODE		When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Velocity	Specify the maximum stacking velocity of the slave axis during the period when the slave axis performs the engagement action. (Unit: Unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Acceleration	Specify the maximum acceleration of the slave axis during the period when the slave axis performs the engagement action. (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Deceleration	Specify the maximum deceleration of the slave axis during the period when the slave axis performs the engagement action. (Unit: Unit/second <sup>2</sup> .	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Jerk	Reserved	-	-	-
MasterValue Source	Specify the type of the master axis position in the electronic cam calculation.	MC_SOUR CE	0:mcSetValue 1:mcActualValue (0)	When Execute changes from FALSE to TRUE
BufferMode	Specify the behavior when executing two instructions.	MC_Buffer _Mode	0: mcAborting 1: mcBuffered (0)	When <i>Execute</i> changes from FALSE to TRUE

Note:

- 1. The MC\_CamIn instruction execution starts when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE does not influence the instruction execution during execution of the instruction.
- 2. Changing *Execute* from FALSE to TRUE again does not influence the instruction execution during execution of the instruction. The instruction will keep going in the previous way.
- 3. Refer to Section 10.3 for details on *BufferMode*.


### • Output Parameters

Parameter name	Function	Data type	Valid range
InSync	TRUE when the master axis and slave axis move synchronously based on the cam curve.	BOOL	TRUE / FALSE
EndOfProfile	TRUE when the cam motion reaches the end point.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is being controlled.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to the section 12.2.	WORD	

### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
InSync	When the slave axis and master axis are synchronous in the cam motion.	<ul> <li>When the cam relationship between the slave axis and master axis is disconnected.</li> <li>When the acyclic cam motion is performed (<i>Periodic</i>=FALSE) and <i>EndOfProfile</i> changes to TRUE</li> <li>When <i>CommandAborted</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
EndOfProfile	<ul> <li>When the cam motion reaches the end point in the cam table.</li> </ul>	<ul> <li>One period after EndOfProfile changes to TRUE</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE	<ul> <li>When the acyclic cam motion is performed (<i>Periodic</i>=FALSE) and <i>EndOfProfile</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAborted</i> changes to TRUE</li> </ul>
Active	<ul> <li>When the instruction starts to control axes</li> </ul>	<ul> <li>When the acyclic cam motion is performed (<i>Periodic</i>=FALSE) and <i>EndOfProfile</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAborted</i> changes to TRUE</li> </ul>
CommandAb orted	<ul> <li>When the instruction execution is aborted by other motion instruction</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE in the course of the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

11

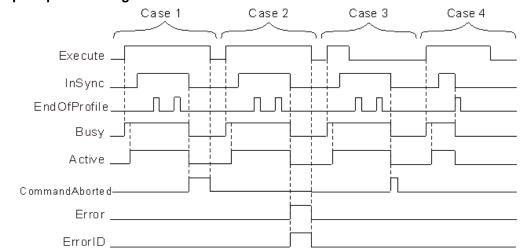

#### Output Update Timing Chart

- **Case 1**: Busy changes to TRUE as Execute changes from FALSE to TRUE. And one period later, Active changes to TRUE. When the slave axis and master axis are in the synchronous motion, InSync changes from FALSE to TRUE. When the final point of the cam cycle is reached, EndOfProfile changes from FALSE to TRUE and changes to FALSE one cycle later. When the cam relationship between the slave axis and master axis is disconnected (e.g. by executing the MC\_CamOut instruction), CommandAborted changes from FALSE to TRUE and InSync, Busy and Active all change from TRUE to FALSE. After that, CommandAborted changes from TRUE to FALSE as Execute changes from TRUE to FALSE.
- **Case 2**: As an error occurs in the execution of the instruction, *Error* changes from FALSE to TRUE, *ErrorID* shows corresponding error codes and *InSync*, *Busy* and *Active* all change from TRUE to FALSE. After that, *Error* changes from TRUE to FALSE and the value of *ErrorID* changes to 0 as *Execute* changes from TRUE to FALSE.
- **Case 3**: The instruction execution still continues after *Execute* changes from TRUE to FALSE during execution of the instruction. The timing for changing the state of *InSync, EndOfProfile, Busy* and *Active* is consistent with what state they are in as *Execute* is TRUE. After that, *InSync, Busy* and *Active* all change from TRUE to FALSE after the cam relationship between the slave axis and master axis is disconnected. Meanwhile CommandAborted changes from FALSE to TRUE and changes to FALSE one cycle later.
- **Case 4**: If the cam motion is performed in the acyclic way (*Periodic*=FALSE), *EndOfProfile* changes from FALSE to TRUE when the end point of the cam cycle is reached. Meanwhile *InSync*, *Busy* and *Active* all change from TRUE to FALSE and *EndOfProfile* changes from TRUE to FALSE one cycle later.


### Function

The *MC\_CamIn* instruction is used for making the slave axis and master axis move synchronously according to the planned cam relationship. The *MC\_CamOut* instruction is used for disconnecting the cam relationship between the two axes.

## About MC\_CamIn Instruction

#### > MC\_CamIn Execution Process

The MC\_CamIn execution process figure:

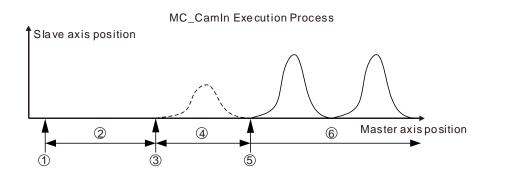

Stage 1: Trigger and execute the MC\_CamIn instruction.

Stage 2: Wait for the start of the engagement.

**Stage 3:** The slave axis starts to perform the engagement action as the master axis reaches the position where the engagement starts.

Stage 4: The engagement is ongoing.

**Stage 5:** The master axis and slave axis achieve the synchronization as the engagement is completed.

Stage 6: The master axis and slave axis are in the synchronous motion.

**Stage 1:** Trigger and execute the MC\_CamIn instruction.

The *MC\_CamIn* instruction is executed at this time and then the slave will enter the state of waiting for the start of the engagement immediately.

**NOTE:** If *ActivationPosition*=0 and *ActivationMode*=0 (relative axis position), the slave axis will move from current speed to SYNC speed. Except in the case above, the slave axis will stop moving immediately! All set input parameters of the *MC\_CamIn* instruction will be read and retained for use in the execution.

Stage 2: Wait for the start of the engagement.

The slave axis waits for the timing for performing the engagement action in the standstill state. The time to start the engagement is when the master axis passes the position specified by the parameter *ActivationPosition*. In different circumstances, the period of time the slave axis waits for is different. If the master axis is at the position specified by *ActivationPosition* as the *MC\_CamIn* instruction is executed, the slave axis starts the engagement action immediately. If the master axis never reaches the position specified by *ActivationPosition*, the slave axis will never start to perform the engagement action and the cam synchronization will never come true. The parameters *ActivationPosition* and *ActivationMode* are used at this stage.

**Stage 3:** The slave axis starts to perform the engagement action when the master axis passes the position specified by *ActivationPosition*. The parameters, *MasterAbsolute, SlaveAbsolute, MasterOffset, SlaveOffset, MasterScaling* and *SlaveScaling* will work at the moment for making sure of the corresponding relationship between the master axis position and slave axis position and the cam phase.

Stage 4: The engagement is ongoing.

The slave axis performs the engagement in the way specified by the *StartMode* parameter. Besides *StartMode*, the parameters *Velocity*, *Acceleration* and *Deceleration* also works at this stage. The motion features about velocity, acceleration/ deceleration of the slave axis are determined by these parameters in the engagement. **Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

The engagement is completed and the slave axis and master axis achieve the cam synchronization if the cam phase that the master axis and slave axis correspond to meets the planned cam relationship after the slave axis starts to perform the engagement action.

**NOTE:** In the figure above, the set master axis position at the time when the engagement begins is greater than the master position at the time when the *MC\_CamIn* instruction execution starts. The similar way is also applied to the circumstance that the set master axis position at the time when the engagement begins is less than or equal to the master position at the time when the *MC\_CamIn* instruction execution starts.

#### ActivationPosition


The ActivationPosition parameter is the start position of the cam engagement, (which is the master axis position). In other words, the slave axis starts to perform the engagement when the master axis reaches the position specified by ActivationPosition after the MC\_CamIn instruction is triggered and executed.

ActivationPosition can be the master axis position, master axis phase, master axis cam phase, which can be selected through the *ActivationMode* parameter.

#### > ActivationPosition: Relative axis position

As ActivationMode=0, ActivationPosition is an axis position which is relative to the master axis position at the time when the *MC\_CamIn* instruction is executed. The master axis position as the actual engagement starts is the value of ActivationPosition plus the master position of when the *MC\_CamIn* instruction execution begins.

For example: The master axis position is 100 and *ActivationPosition* 1000 at the time when the *MC\_CamIn* instruction execution starts. The master axis position is 1100 (1100=100+1000) as the actual engagement begins.

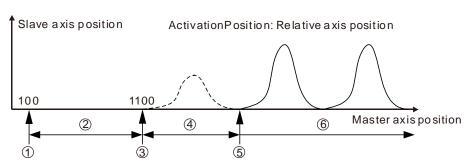

MC\_CamIn Execution Process

**Stage 1:** Trigger and execute the MC\_CamIn instruction. The master axis absolute position is 100 at the moment.

Stage 2: Wait for the start of the engagement.

**Stage 3:** The master axis reaches the position for starting the engagement (1100) and the slave axis starts to perform the engagement action.

Stage 4: The engagement is ongoing.


**Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

Stage 6: The master axis and slave axis are in the synchronous motion.

#### > ActivationPosition: Absolute axis position

When *ActivationMode* =1, *ActivationPosition* is an axis position which is absolute to the master axis position at the time when the *MC\_CamIn* instruction is executed. The master axis position as the actual engagement starts is *ActivationPosition*.

For example: The master axis position is 100 and *ActivationPosition* 1000 at the time when the *MC\_CamIn* instruction execution starts. The master axis position is 1000 (1000= *ActivationPosition*) as the actual engagement begins.

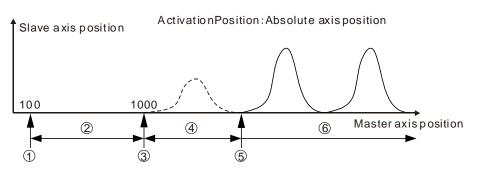



**Stage 1:** Trigger and execute the MC\_CamIn instruction. The master axis absolute position is 100 at the moment.

Stage 2: Wait for the start of the engagement.

**Stage 3:** The master axis reaches the position for starting the engagement (1000) and the slave axis starts to perform the engagement action.

Stage 4: The engagement is being conducted.

**Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

Stage 6: The master axis and slave axis are in the synchronous motion.


### > ActivationPosition: Absolute axis phase


When *ActivationMode* =2, *ActivationPosition* is an absolute axis phase which is the remainder got by dividing the axis absolute position by modulo. The slave axis starts to perform the engagement action as the master axis absolute phase is *ActivationPosition*.

The absolute axis phase is cyclic. Its absolute axis phase may be equal to *ActivationPosition* many times in the motion of the master axis. But the slave axis starts to perform the engagement action only when the absolute axis phase of the master axis is equal to *ActivationPosition* for the first time after the MC\_CamIn instruction is executed.

For example, the master axis modulo is 400, *ActivationPosition*=100 and the master axis position is 1000 at the time when the *MC\_CamIn* instruction is executed. The slave axis will not perform the engagement action because the absolute axis phase of the master axis is 200 (200=1000%400) at the time when the *MC\_CamIn* instruction is executed. The slave axis starts to perform the engagement action as the master axis position is 1300 (Absolute axis phase is 100=1300%400) or 900 (Absolute axis phase is 100=900%400). (% means the mathematic operation to find the remainder)

MC\_CamIn Execution Process

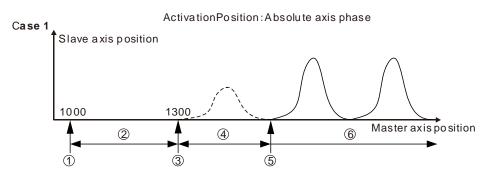

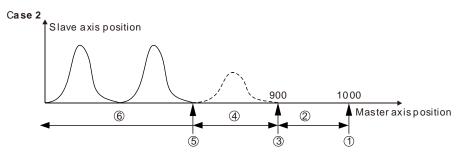

**Stage 1:** Trigger and execute the MC\_CamIn instruction. The master axis absolute position is 1000 at the moment. (The absolute axis phase is 200)

Stage 2: Wait for the start of the engagement.

**Stage 3:** The master axis reaches the position for starting the engagement (1300 in circumstance 1 and 900 in circumstance 2) and the slave axis starts to perform the engagement action.

Stage 4: The engagement is being conducted.

**Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

Stage 6: The master axis and slave axis are in the synchronous motion.

**NOTE:** As *ActivationPosition* is the absolute axis phase, the range of the *ActivationPosition* parameter value is 0~modulo (excluding modulo). If the value of *ActivationPosition* exceeds the valid range, an error will occur and the instruction execution will fail as the *MC\_CamIn* instruction is executed.

#### ActivationPosition: Absolute cam phase

When *ActivationMode* =3, *ActivationPosition* is the absolute cam phase which is the remainder got by dividing the axis absolute position by its cam cycle. The slave axis starts to perform the engagement action as the cam phase of the master axis is *ActivationPosition*.


The cam phase is cyclic. Its cam phase may be equal to *ActivationPosition* many times in the motion of the master axis. But the slave axis starts to perform the engagement action only when the cam phase of the master axis is equal to *ActivationPosition* for the first time after the MC\_CamIn instruction is executed.

For example, the maximum position of the master axis in the cam table is 360,

ActivationPosition=100 and the master axis position is 1000 at the time when the *MC\_CamIn* instruction is executed. The slave axis will not perform the engagement action because the absolute cam phase of the master axis is 280 (280=1000%360) at the time when the *MC\_CamIn* instruction execution begins. Then the slave axis starts to perform the engagement action as the master axis position is 1180 (Absolute cam phase is 100=1180%360) or 820 (Absolute cam phase is 100=820%360).

11

#### MC\_CamIn Execution Process

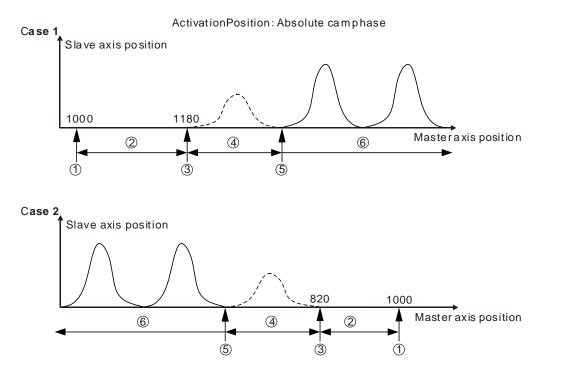

**Stage 1:** Trigger and execute the MC\_CamIn instruction. The master axis absolute position is 1000 at the moment. (The absolute cam phase is 280)

Stage 2: Wait for the start of the engagement.

**Stage 3:** The master axis reaches the position for starting the engagement (The master axis position is 1180 in circumstance 1 and 820 in circumstance 2) and the slave axis starts to perform the engagement action.

Stage 4: The engagement is being conducted.

**Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

Stage 6: The master axis and slave axis are in the synchronous motion.

**Note:** As *ActivationPosition* is the absolute cam phase, the range of the *ActivationPosition* parameter value is 0~ cam cycle value (excluding the cam cycle value). If the value of *ActivationPosition* exceeds the valid range, an error will occur and the execution will fail as the *MC\_CamIn* instruction is executed.

#### Relationship between the master axis position and slave axis position

The cam relationship which is planned in the software is the position relationship between the master axis and slave axis. The "position" mentioned here is the cam phase of the master axis / slave axis instead of the actual axis position. If the cam relationship which is planned is seen as the function CAM as below, the input of the function CAM is the master axis cam phase and the output is the slave axis cam phase. The formula is shown as below.


$$y = CAM(x)$$

x : The master axis cam phase

y : The slave axis cam phase

The cam phase comes from the axis positions and there is a conversion between them. The conversion between the axis position and cam phase is related with the *MasterAbsolute*, *SlaveAbsolute*, *MasterOffset*, *SlaveOffset*, *MasterScaling* and *SlaveScaling* parameters. For details, refer to relevant sections.

The slave axis follows the master axis to make the synchronous cam motion by using the MC\_*CamIn* instruction. In the synchronous cam motion, the corresponding relationship between the master axis position and slave axis position is based on the pre-planned cam relationship (the cam curve or cam table). The process in which the slave axis position is calculated through the master axis position is illustrated as follows.

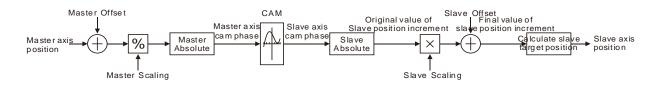

### MasterAbsolute and SlaveAbsolute


The *MasterAbsolute* parameter is used for specifying the corresponding relationship between the master axis position and the cam phase. As *MasterAbsolute* is TRUE, the master axis position and the cam phase are in an absolute relationship. As *MasterAbsolute* is FALSE, the master axis position and the cam phase are in a relative relationship. For *SlaveAbsolute*, the explanation is similar to that of *MasterAbsolute*.

*MasterAbsolute* and *SlaveAbsolute* work at the moment when the engagement starts. That is to say that the corresponding relationship between the axis position and cam phase is built at the beginning of the engagement. (**NOTE:** The corresponding relationship is not built at the time when the *MC\_CamIn* instruction execution begins but when the engagement begins.) After that, the cam phase is calculated according to the corresponding relationship.

#### Relative mode


The master axis position and its cam phase are in the relative relationship as the *MasterAbsolute* parameter is FALSE. That is to say, the master axis position corresponds to its cam phase 0 at the time when the engagement starts. After that, the master cam phase will be calculated according to the corresponding relationship. For example, the master axis is in relative mode, the maximum value of the master axis cam phase in the cam relationship is 360 and the master axis position is 180 at the time when the engagement starts. So the master axis position 180 corresponds its cam phase 0; the master axis position 200 corresponds to its cam phase 20 (20= (200-180) %360) and so on.

In this circumstance, the master axis position corresponds to its cam phase as shown in the following figure.

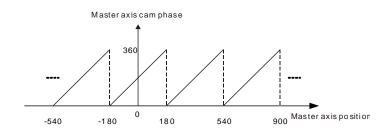

As the *SlaveAbsolute* parameter is FALSE, the slave axis position and its cam phase are in the relative relationship. That is to say, the slave axis cam phase and the master axis cam phase meet the planned cam relationship at the time when the engagement starts. If the slave axis is in relative mode, the method of being sure of the slave axis cam phase is different from the master axis. When the slave axis cam phase is sure, it should meet the condition that the slave axis cam phase and the master axis cam phase meet the planned cam relationship at the time when the engagement starts.


For example, the slave axis is in relative mode, the maximum value of the slave axis cam phase in the cam relationship is 360 and the slave axis position is 100 at the time when the engagement starts. If the master axis cam phase is 0 at the moment (and the slave axis cam phase is 0 as required in the cam relationship), the slave axis position 100 will correspond to its cam phase 0 as shown in the following circumstance 1. If the slave axis cam phase is 200 as required in the cam relationship, the slave axis position 100 will correspond to its cam phase 1. If the slave axis cam phase 200 as shown in the following circumstance 2.

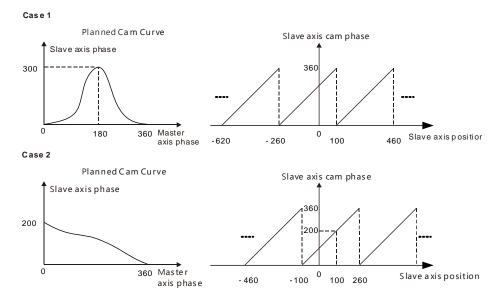

#### Absolute mode

When the *MasterAbsolute* parameter is TRUE, the master axis position and its cam phase are in the absolute relationship. At any time, the master axis cam phase is equal to the remainder got by dividing the master axis position at that time by the maximum value of the master axis cam phase in the cam relationship.

For example, the master axis is in absolute mode and the maximum value of the master axis in the cam relationship is 360. So its cam phase is 100 as the master axis position is 100 (100=100%360); its cam phase is 140 (140=500%360) as the master axis position is 500 and so on. The master axis position corresponds to its cam phase as shown in the figure below.

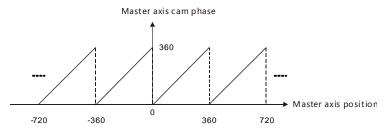

When the *SlaveAbsolute* parameter is TRUE, the slave axis position and its cam phase are in the absolute relationship. At any time, the slave axis cam phase is equal to the remainder got by dividing the slave axis position at that time by the maximum value of the slave axis cam phase in the cam relationship. When the slave axis is in absolute mode, the corresponding relationship between the slave axis position and its cam phase is consistent with that between the master axis position and its cam phase is in absolute mode.

#### Offset and Scaling


The cam relationship between the master axis and slave axis is preplanned. But as the cam motion is executed, the position offset or scaling based on the preplanned cam relationship can be performed through setting the *Offset* and *Scaling* parameters. For example, there are various sizes for the same

11-197


product which is processed. Just one cam relationship need be planned and then changing the values of *Offset* and *Scaling* fits the processing of products of different sizes.

The *MasterOffset* parameter is valid only when the master axis is in absolute or relative mode. (*MasterAbsolute*=TRUE or FALSE). The *SlaveOffset* parameter is valid only as the slave axis is in absolute mode (*SlaveAbsolute*=TRUE). The *SlaveOffset* parameter is invalid as the slave axis is in relative mode (*SlaveAbsolute*=FALSE).

The position offset and scaling of the master axis and slave axis determine the actually executed cam relationship. The effect is described in the following example. The planned cam relationship is shown as the figure below.

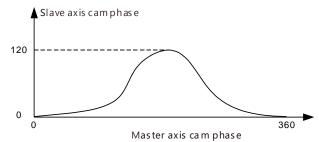


When the master axis and slave axis are both in absolute mode and the engagement begins, the master axis position and slave axis position are both 0. When there is no position offset and scaling (the offset and scaling are default values), the actual master axis position correspond to the actual slave axis position in the execution of the cam motion as shown in the following figure.

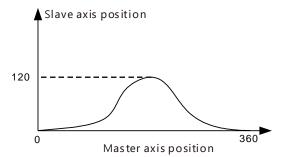


When the offset and scaling are not default values, the corresponding relationship between the actual master axis position and actual slave axis position are affected in the execution of the cam motion as below.

MasterOffset:0 and SlaveOffset:0 and the impact of MasterScaling and SlaveScaling on the cam relationship

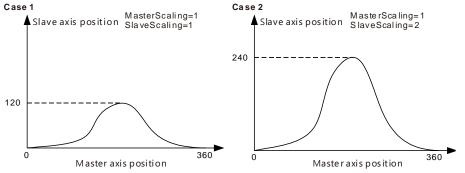


11

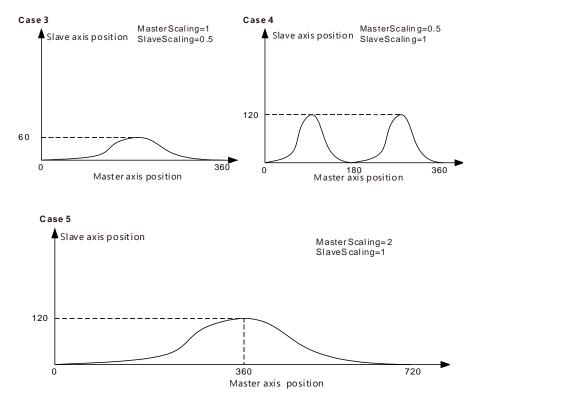

- **Case 1**: The actual cam relationship is consistent with the preplanned one as the values of MasterScaling and SlaveScaling are 1 and their offsets are 0.
- **Case 2**: The slave position corresponding to the master axis position is two times what is planned in the cam relationship as the value of *MasterScaling* is 1, *SlaveScaling* is 2 and their offsets are 0.
- **Case 3**: The slave position corresponding to the master axis position is 1/2 that in the planned cam relationship as the value of MasterScaling is 1, SlaveScaling is 0.5 and their offsets are 0.
- Case 4 : The master axis position corresponding to the slave axis position is 1/2 what is planned as the value of *MasterScaling* is 0.5, *SlaveScaling* is 1 and their offsets are 0. If it is observed from the perspective of the cam phase, the master axis cam phase is 1/2 what is preplanned. That is, the master cam cycle changes from 360 to 180 (180=360\*0.5) and the slave axis cam phase is unchanged.
- **Case 5**: The master axis position corresponding to the slave axis position is 2 times what is planned as the value of *MasterScaling* is 2, *SlaveScaling* is 1 and their offsets are 0. If it is observed from the perspective of the cam phase, the master axis cam phase is two times the original. That is, the master axis cam cycle changes from 360 to 720 (720=360\*2) and the slave axis cam phase is unchanged.
- MasterScaling:1 and SlaveScaling:1 and the impact of MasterOffset and SlaveOffset on the actually executed cam relationship

*MasterOffset* means to make the actual axis position curve shifted horizontally in execution of the cam motion. *SlaveOffset* indicates to make the axis position curve shifted vertically in execution of the cam motion.

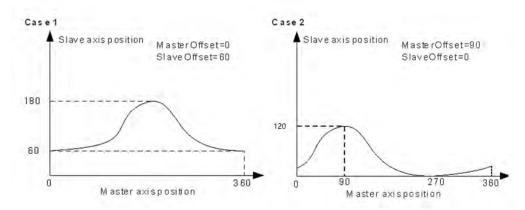

**Case 1**: The slave axis position corresponding to the master axis position will add by 60 based on the planned position as *MasterScaling* and *SlaveScaling* are both 1, *MasterOffset* is 0 and *SlaveOffset* is 60.


For example, in the planned cam relationship, the master axis position 180 corresponds to the slave axis position 120 and in the actual execution, the corresponding slave axis position is 180 (180=120+60).

**Case 2**: The master axis position corresponding to the slave axis position will shift (add) by 90 based on the planned position as *MasterScaling* and *SlaveScaling* are 1, *MasterOffset* is 90 and *SlaveOffset* is 0.

For example, in the planned cam relationship, the master axis position 180 corresponds to the slave axis position 120 and in the actual execution, the master axis position 90 corresponds to the slave axis position 120 which is the slave axis position corresponded to by the master axis position 180 (180=90+90) in the planned cam relationship.

### ■ StartMode

In the engagement, the way how the slave axis moves is specified by the *StartMode* parameter. That is, *StartMode* works at stage 4 in the execution of the *MC\_CamIn* instruction as shown in the following figure.

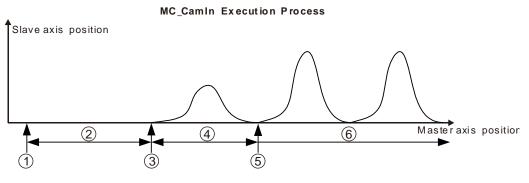

Stage 1: Trigger and execute the MC\_CamIn instruction.

Stage 2: Wait for the start of the engagement.

**Stage 3:** The master axis reaches the position where the engagement begins and the slave axis starts to perform the engagement action.


Stage 4: The engagement is ongoing.

**Stage 5:** The engagement is completed and the master axis and slave axis achieve the synchronization.

Stage 6: The master axis and slave axis are in the synchronous motion.

The cam synchronization requires that the master axis cam phase and the slave axis cam phase meet the defined cam relationship. The engagement process is the process in which the slave axis moves toward the synchronous phase. The synchronous phase and the master axis cam phase meet the defined cam relationship. Since the axis cam phase is cyclic, every cam phase is corresponded to by multiple axis positions. When the engagement occurs, there are many selections for the expected synchronization position. And thus there are several engagement ways for option.

For example, when the engagement starts, the master axis cam phase and slave axis cam phase are 80 and 180 respectively as point O in the following figure. But the defined cam relationship requires that the slave axis cam phase is 40 and thus the synchronous position that the slave axis expects is 40 or 400 (Point A or point B in the following figure) at the moment. The engagement process from Point O to A or Point O to B can be selected via the *StartMode* parameter.

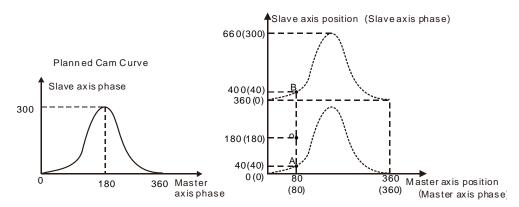

There are three modes of *StartMode* for selection: the shortest way (mcRampInShortest), positive direction (mcRampInPositive) and negative direction (mcRampInNegative). Users can select the right engagement mode according to actual need.

## StartMode=0 (The shortest way)

As *StartMode*=0, in the execution of the engagement action, the slave axis moves toward the position for synchronization by taking the shortest way. At the moment, the motion of the slave axis is affected by the *Velocity, Acceleration Deceleration* and *Jerk* parameters.

### StartMode=1 ( Positive direction )

As *StartMode*=1, in the execution of the engagement action, the slave axis moves toward the position for synchronization in the positive direction. At the moment, the motion of the slave axis is affected by the *Velocity, Acceleration Deceleration* and *Jerk* parameters.

### StartMode=-1 (Negative direction)


As *StartMode*=-1, in the execution of the engagement action, the slave axis moves toward the position for synchronization in the negative direction. At the moment, the motion of the slave axis is affected by the *Velocity, Acceleration Deceleration* and *Jerk* parameters.

**For example,** as the engagement begins, the master axis cam phase and slave axis cam phase are 80 and 180 respectively (as point O below). According to the defined cam relationship, the master axis cam phase is 80 and the slave axis cam phase is 40 (as point A or B below). If the value of *StartMode* is different, the way the slave axis moves is different in the engagement process.

StartMode=0 : The slave axis moves from point O to point A and the synchronization is achieved at point A since the distance from point O to point A is less than that from point O to point B.

*StartMode*=1 : The slave axis gradually moves from point O to point B in the positive direction.

*StartMode*=-1 : The slave axis gradually moves from point O to point A in the negative direction.

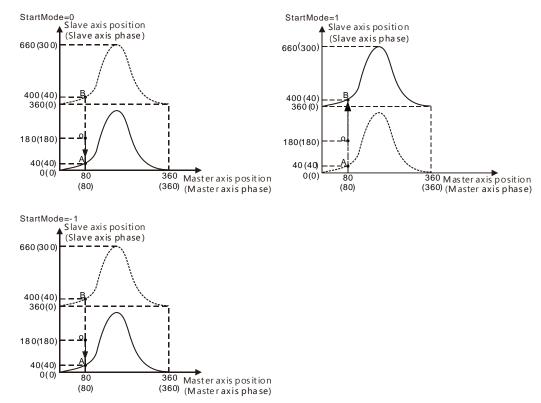


### ■ Periodic/Non-periodic Cam Operation (Periodic)

In the actual application of electronic cams, some may be executed periodically and some just need be executed for one cycle. The *Periodic* parameter is used for choosing one of the two cases for the electronic cam motion.

As *Periodic*=TRUE, the slave axis follows the master axis to periodically perform the cam motion till the cam relationship is disconnected.

As *Periodic*=FALSE, when the end point of the cam cycle is reached after the slave axis and master axis enter the synchronous cam motion, the cam relationship between the slave axis and master axis will be disconnected and the slave axis will stop moving immediately.

If the velocity at the end point of the planned cam relationship is not 0, the slave axis will constantly move at the disconnection speed after the disconnection of the cam relationship.

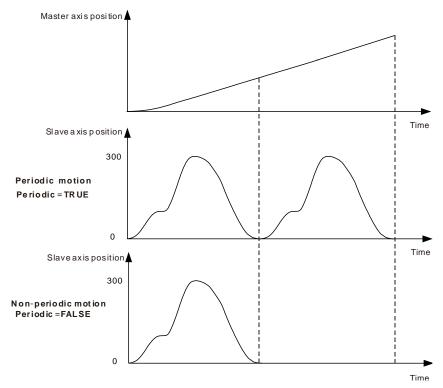

#### The impact of other instructions on cam operation

#### MC\_CamOut

The *MC\_CamOut* instruction can be used to end the cam operation which is being carried out.

#### MC\_SetPosition

The *MC\_SetPosition* instruction has no impact on the being executed motion instructions. Thus, during cam operation, the execution of *MC\_SetPosition* instruction for the master axis and slave axis will not affect the cam operation. If the cam operation is triggered after the *MC\_SetPosition* instruction is executed, the cam will be affected by the axis position change which is incurred by using the *MC\_SetPosition* instruction.

#### > MC\_Stop and MC\_Halt

As the *MC\_Stop* and *MC\_Halt* instructions are executed on the slave axis, the *MC\_CamIn* instruction is aborted, the cam relationship is disconnected and the slave axis decelerates till it stops.

#### MC\_Home

The *MC\_Home* instruction cannot be executed on the slave axis but the master axis. As the *MC\_Home* instruction is executed on the master axis, the master axis position may have a great change in a very short time, which may cause the vibration of the slave axis. Therefore, the *MC\_Home* instruction is recommended to execute after the synchronous relationship between the two axes is disconnected.


#### Other precautions

See the rule for different types of axes working as the master axis or slave axis in the cam relationship in the following table.

Axis type	As cam master axis	As cam slave axis
Servo real axis	ОК	ОК
Encoder	ОК	NO
Virtual axis	ОК	ОК

# Programming Example

The execution effect of the *MC\_CamIn* instruction is described in the following example.
 The cam curve is planned as below.

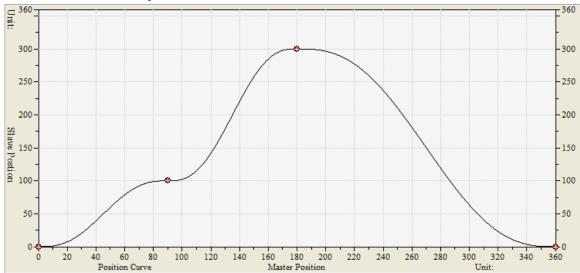

### Key points of the cam curve


No.	Master axis position	Slave axis position	Velocity	Acceleration
1	0	0	0	0
2	90	100	0	0
3	180	300	0	0
4	360	0	0	0


## Explanation:

Cam period of the master axis and slave axis	360
Master Scaling and SlaveScaling	1
MasterOffset and SlaveOffset	0
MasterAbsolute	Relative
SlaveAbsolute	Relative
Periodic	Periodic
ActivationPosition	Relative axis position:100
StartMode	The shortest way

Variable name	Data type	Initial value
CamIn	MC_CamIn	
CamIn_Ex	BOOL	
CamIn_InSync	BOOL	
CamIn_EndOP	BOOL	
CamIn_Bsy	BOOL	
CamIn_Act	BOOL	
CamIn_Abt	BOOL	
CamIn_Err	BOOL	
CamIn_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel _Ex	BOOL	
Vel _InVel	BOOL	
Vel _Bsy	BOOL	
Vel _Act	BOOL	
Vel _Abt	BOOL	
Vel _Err	BOOL	
Vel _ ErrID	WORD	

### The variable table and program

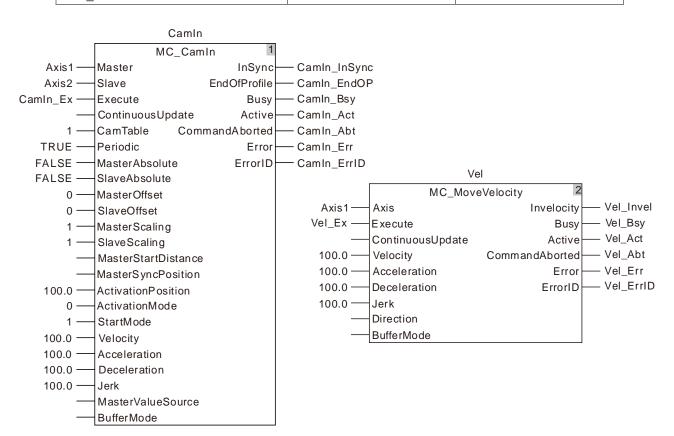

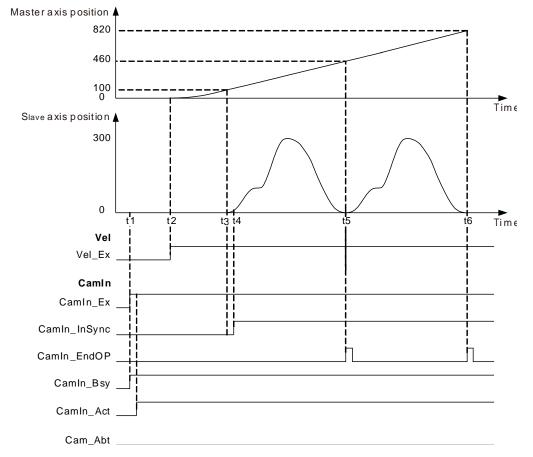


#### Motion curve and timing chart

- As CamIn\_Ex changes from FALSE to TRUE, the MC\_CamIn instruction is executed and at the moment of t1, both of the master axis and slave axis positions are 0. The value of *ActivationPosition* is 100 and *ActivationMode* is 0, so the slave will not start to execute the engagement action until the master axis position is 100 (the master axis position at the time of t1 + *ActivationPosition*).
- As Vel\_Ex changes from FALSE to TRUE, the MC\_MoveVelocity instruction is executed and at the moment of t2, the master axis position is 0 and slave axis continues waiting for the start of the engagement. After that, the master axis will move from 0 in the positive direction under the control of the MC\_MoveVelocity instruction.
- When the master axis passes 100, the position where the engagement begins is reached at the time of t3. The slave axis starts to perform the engagement action according to *StartMode* at the moment of t3. The synchronization is achieved at t4 and the *InSync* output parameter (CamIn1\_InSync) changes from FALSE to TRUE.
- Whenever the synchronous motion reaches the end point in a cam period as shown at t5 and t6, the *EndOfProfile* output parameter (CamIn1\_EndPro) will change to TRUE and it will change to FALSE after a program period.

# 11.4.6 MC\_CamOut

FB/FC	Explanation	Applicable model
FB	MC_CamOut can disconnect the established electronic cam relationship.	AS524C-B
	MC_CamOut_instance	

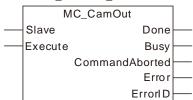

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Slave	Specify the number of the slave axis which is to be disconnected from the cam relationship.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-

## Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to the section 12.2.	WORD	

# Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the electronic cam relationship between the slave axis and master axis is disconnected.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
Busy	When Execute changes to TRUE.	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE	
CommandAborted	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li><i>CommandAborted</i> is set to TRUE when the instruction is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE in the course of the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>	
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>	

### • Output Update Timing Chart

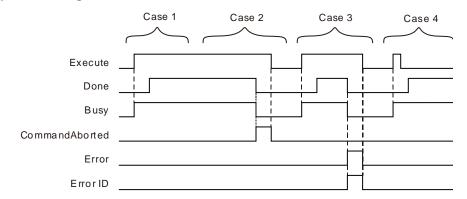

- **Case 1** : *Busy* changes to TRUE as *Execute* changes from FALSE to TRUE. One period later, *Done* changes to TRUE. *Busy* and *Done* remain TRUE after *Execute* changes from TRUE to FALSE.
- **Case 2**: When *Execute* is TRUE, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Done* change to FALSE if the instruction is aborted by other instruction. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3** : As *Execute* changes from FALSE to TRUE and an error occurs (e.g. an axis is disabled), *Error* changes to TRUE and *ErrorID* shows corresponding error codes. Meanwhile *Busy* and *Done* change to FALSE. As *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 4** : *Execute* changes from TRUE to FALSE as the instruction execution lasts for less than one period. After that, *Done* changes to TRUE and *Busy* remain TRUE as one period is reached.

## Functions


MC\_CamOut is used for disconnecting the established electronic cam relationship. The instruction works on the slave axis in the cam operation and the slave axis will continue moving at the speed of when it is disconnected from the cam relationship.

MC\_Halt or MC\_Stop instructions can be executed on the slave axis so as to stop the slave axis motion. The slave axis will stop moving and the cam relationship will be disconnected after the execution of the MC\_Halt instruction or MC\_Stop instruction is completed.



## Programming Example

■ The execution effect of the *MC\_CamOut* instruction is described in the following example. The cam curve is planned as below.

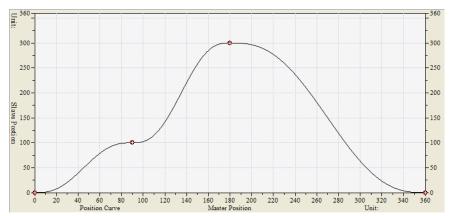

#### ■ The key points of the cam curve

No.	Master axis position	Slave axis position	Velocity	Acceleration
1	0	0	0	0
2	90	100	0	0
3	180	300	0	0
4	360	0	0	0

## Explanation:


Cam period of the master axis and slave axis	360
MasterScaling and SlaveScaling	1
MasterOffset and SlaveOffset	0
MasterAbsolute	Relative
SlaveAbsolute	Relative
Periodic	Periodic
ActivationPosition	Relative axis position: 100
StartMode	The shortest way

## ■ The variable table and program

Variable name	Data type	Initial value
CamIn	MC_CamIn	
CamIn_Ex	BOOL	
CamIn_InSync	BOOL	
CamIn_EndOP	BOOL	
CamIn_Bsy	BOOL	
CamIn_Act	BOOL	
CamIn_Abt	BOOL	
CamIn_Err	BOOL	
CamIn_ErrID	WORD	
Vel	MC_MoveVelocity	
Vel_Ex	BOOL	
Vel_InVel	BOOL	
Vel_Bsy	BOOL	
Vel_Act	BOOL	

11

Variable name	Data type	Initial value
Vel_Abt	BOOL	
Vel_Err	BOOL	
Vel_ErrID	WORD	
CamOut	MC_CamOut	
CamOut_Ex	BOOL	
CamOut_Done	BOOL	
CamOut_Bsy	BOOL	
CamOut_Abt	BOOL	
CamOut_Err	BOOL	
CamOut_ErrID	WORD	

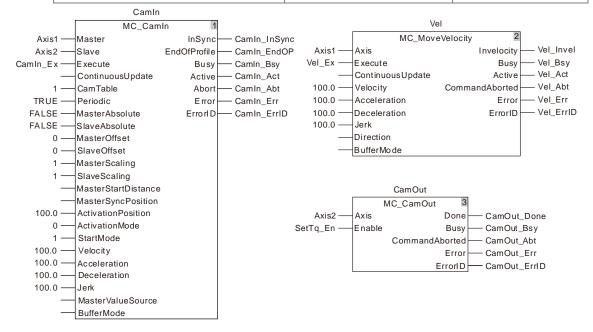

# Master axis position 820 460 100 0 Time Slave axis position 300 0 → Time ť1 tŻ ŧ4 Vel Vel\_Ex 1 CamIn CamIn\_Ex CamIn\_InSync\_ CamIn\_EndOP CamIn\_Bsy \_ CamIn\_Act CamIn\_Abt CamIn\_Err CamIn\_ErrID CamOut CamOut\_Ex CamOut\_Done CamOut\_Bsy \_ CamOut\_Abort \_ CamOut\_Err CamOut ErrID

### Motion curve and timing chart

- As CamIn\_Ex changes from FALSE to TRUE at t1, the MC\_CamIn instruction is executed and at the moment, both of the master axis and slave axis positions are 0. The value of *ActivationPosition* is 100 and *ActivationMode* is 0, so the slave axis will not start to execute the engagement action until the master axis position is 100 (the master axis position at t1 + *ActivationPosition*).
- As Vel\_Ex changes from FALSE to TRUE at t2, the MC\_MoveVelocity instruction execution starts. At the moment, the master axis position is 0 and the slave axis continues waiting for the execution of the engagement action. After that, the master axis moves from 0 in the positive direction under the control of the MC\_MoveVelocity instruction.

- The position where the engagement starts is reached as the master axis passes 100 at t3. The slave axis starts to perform the engagement action according to *StartMode* at t3. The synchronization is achieved at t4 and the *InSync* output parameter (CamIn1\_InSync) changes from FALSE to TRUE.
- 11
- During the synchronous cam motion in which the slave axis follows the motion of the master axis, by executing the MC\_CamOut instruction, the cam relationship is disconnected at t6. After the MC\_CamOut instruction is executed, the slave axis will keep moving at the speed it has when the slave axis is disconnected from the cam relationship.

11

FB/FC	E	Explanation		Applicable model
FB	DMC_CamReadPoint reads the int	formation of a ca	m point.	AS524C-B
	DMC	_CamReadPoint_i	nstance	
		DMC_CamReadPo	pint	
	— Ex(	ecute	Done —	
		mTable	Busy —	
	Ca	mChangedPoint	E r ro r	

ErrorID MasterPos SlavePos SlaveVel SlaveAcc

CamPointNum

## 11.4.7 DMC\_CamReadPoint

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
CamChangedPoint	If CamChangedPoint is FALSE, the instruction reads the cam point information which is before the cam point has been modified. If CamChangedPoint is TRUE, the instruction reads the cam point information which is after the cam point has been modified.	BOOL	TRUE/FALSE	When <i>Execute</i> changes from FALSE to TRUE.
CamPointNum	The number of the cam point which is to be selected.	UINT	1~2048 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
MasterPos	The position of the master axis of the selected electronic cam point.	LREAL	0, positive number


#### AS500C Series Motion Controller Operation Manual

Parameter name	Function	Data type	Valid range
SlavePos	The position of the slave axis of the selected electronic cam point.	LREAL	0, positive number
SlaveVel	The velocity of the slave axis of the selected electronic cam point.	LREAL	0, positive number
SlaveAcc	The acceleration of the slave axis of the selected electronic cam point.	LREAL	0, positive number

#### • Output Update Timing

<u> </u>		
Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes to FALSE.
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

## Output Update Timing Chart

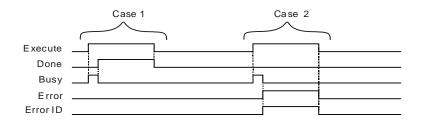

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

## Functions

DMC\_CamReadPoint reads the information of a cam point in an electronic cam table.

If *CamChangedPoint* is FALSE, the instruction reads the parameters of a cam point which is before the cam point information is modified by using DMC\_CamSet.

If *CamChangedPoint* is TRUE, the instruction reads the parameters of a cam point which is after the cam point information is modified by using DMC\_CamSet.

# Programming Example


### 1. The variable table and program

Variable name	Data type	Initial value
CamWr	DMC_CamWritePoint	
CamWr_Ex	BOOL	FALSE
CamWr_CT	USINT	1
CamWr_CP	UINT	2
CamWr_MP	LREAL	180.0
CamWr_SP	LREAL	540.0

Variable name	Data type	Initial value
CamWr_SV	LREAL	0.0
CamWr_SA	LREAL	0.0
CamWr_Done	BOOL	
CamWr_Bsy	BOOL	
CamWr_Err	BOOL	
CamWr_ErrID	WORD	
CamRe	DMC_CamReadPoint	
CamRe_Ex	BOOL	FALSE
CamRe_CT	USINT	1
CamRe_CHP	BOOL	TRUE
CamRe_CPN	UINT	2
CamRe_Done	BOOL	
CamRe_Bsy	BOOL	
CamRe_Err	BOOL	
CamRe_ErrID	WORD	
CamRe_MP	LREAL	
CamRe_SP	LREAL	
CamRe_SV	LREAL	
CamRe_SA	LREAL	


#### CamWr

	DMC_CamWri	tePoint 1	
CamWr_Ex	Execute	Done	— CamWr_Done
CamWr_CT —	CamTable	Busy	— CamWr_Bsy
CamWr_CP	CamPointNum	Error	CamWr_Err
CamWr_MP —	MasterPos	ErrorID	— CamWr_ErrID
CamWr_SP —	SlavePos		
CamWr_SV —	SlaveVel		
CamWr_SA —	SlaveAcc		

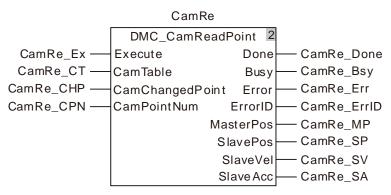

# 11

## 2. The cam curve

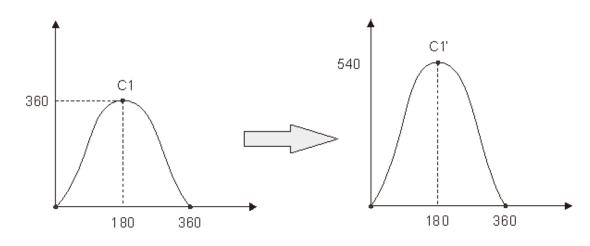

The cam curve C1 is changed to C1'.

- There are three cam points in the cam curve. When CamWr\_Ex changes to TRUE, DMC\_CamWritePoint is executed. When CamWr\_Done changes to TRUE, it indicates that writing cam point information is finished. It is the second cam point of which the information is written.
- When CamRe\_Ex changes to TRUE, DMC\_CamReadPoint is executed. When the parameter CamChangedPoint (variable: CamRe\_CHP) changes to FALSE, the cam point information that the instruction reads is the cam point information before writing is done as shown in the following table.

2 180.0 260.0 0.0 0.0	No.	Master axis position	Slave axis position	Velocity	Acceleration
2 180.0 360.0 0.0 0.0	2	180.0	360.0	0.0	0.0

When the parameter CamChangedPoint (variable: CamRe\_CHP) changes to TRUE, the cam point information that the instruction reads is the cam point information after writing is done as shown in the following table.


No.	Master axis position	Slave axis position	Velocity	Acceleration
2	180.0	540.0	0.0	0.0



11

FB/FC	Explanation	Applicable model
FB	DMC_CamWritePoint is used for setting parameters of one cam point.	AS524C-B
	DMC_CamWritePoint_instance	

# 11.4.8 DMC\_CamWritePoint

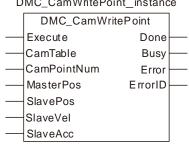

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	the USINT (The variable		When <i>Execute</i> changes from FALSE to TRUE.
CamPointNum	The number of the cam point which is set.	UINT	1~2048 (0)	When <i>Execute</i> changes from FALSE to TRUE.
MasterPos	The position of the master axis of the cam point which is set.	LREAL	0, positive number	
SlavePos	The position of the slave axis of the cam point which is set.	LREAL	0, positive number	
SlaveVel	The velocity of the slave axis of the cam point which is set.	LREAL	0, positive number	
SlaveAcc	The acceleration of the slave axis of the cam point which is set.	LREAL	0, positive number	

## • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE

Parameter name	Function	Data type	Valid range
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

## Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	◆ When <i>Execute</i> changes to FALSE.
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

## • Output Update Timing Chart

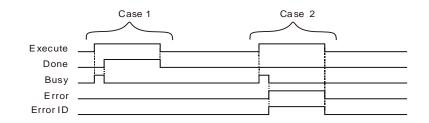


- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

## Functions

DMC\_CamWritePoint is used for setting parameters of a cam point in an electronic cam table. The new cam curve will not be effective immediately after the setting is over until the DMC\_CamSet instruction is executed. Refer to Programming Example in section 11.4.9 DMC\_CamSet for the example on how to use the instruction.

# 11.4.9 DMC\_CamSet

FB/FC	FB/FC Explanation	
FB	DMC_CamSet is used for making the modified cam point information effective.	AS524C-B
	DMC_CamSet_instance	

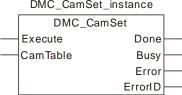

## • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.


## Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes to FALSE.
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

## Output Update Timing Chart

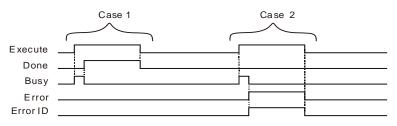

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

#### Functions

DMC\_CamSet is used for making the set cam point information effective. At first, use the DMC\_CamWritePoint instruction to set corresponding cam point information in an electronic cam table. Then execute the DMC\_CamSet instruction to make the new cam point information effective.

If the DMC\_CamSet instruction is executed after the MC\_CamIn instruction is executed, the cam curve after being modified will be effective in the next cycle.

If the DMC\_CamSet instruction is executed before the MC\_CamIn instruction is executed, the cam curve after being modified will take effect immediately.

### Precaution


If DMC\_CamSet is used for making a modified cam curve effective, make sure that the cam curve is called for use by one MC\_CamIn instruction at most. If the cam curve is called for use by multiple MC\_CamIn instructions, the timing for making the set cam curve effective is not sure after DMC\_CamSet is executed.

# Reprogramming Example


#### 1. The variable table and program

Variable name	Data type	Initial value
CamWr	DMC_CamWritePoint	
CamWr_Ex	BOOL	FALSE
CamWr_CT	USINT	1
CamWr_CP	UINT	2
CamWr_MP	LREAL	180.0
CamWr_SP	LREAL	540.0
CamWr_SV	LREAL	0.0
CamWr_SA	LREAL	0.0
CamWr_Done	BOOL	
CamWr_Bsy	BOOL	
CamWr_Err	BOOL	
CamWr_ErrID	WORD	
CamSe	DMC_CamSet	
CamSe_CT	USINT	1
CamSe_Done	BOOL	

## 11

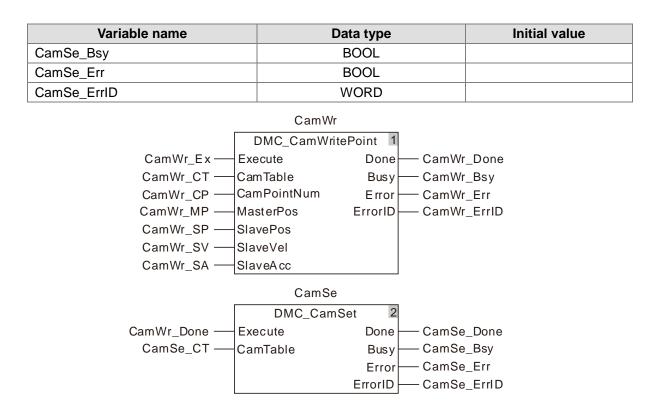

2. Cam Curve

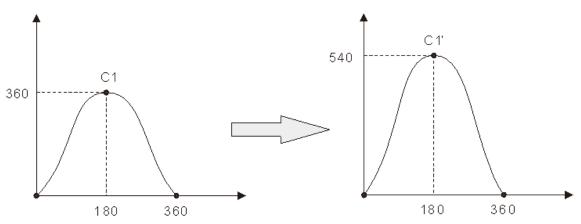

There are three cam points in the cam curve. Change curve C1 into curve C1'.

### The cam point information before modification:


No.	Master axis position	Slave axis position	Velocity	Acceleration
1	0.0	0.0	0.0	0.0
2	180.0	360.0	0.0	0.0
3	360.0	0.0	0.0	0.0

It can be seen from the curve above that the second cam point is modified. The cam curve is changed by executing DMC\_CamWritePoint first and then executing DMC\_CamSet in the program above.

The cam point information after modification:

No.	Master axis position	Slave axis position	Velocity	Acceleration
1	0.0	0.0	0.0	0.0
2	180.0	540.0	0.0	0.0
3	360.0	0.0	0.0	0.0

## 3. Sequence Chart:

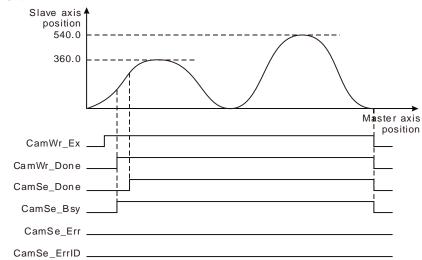

- When CamWr\_Ex changes from FALSE to TRUE, DMC\_CamWritePoint is executed. When CamWr\_Done changes to TRUE, setting cam point information is finished.
- When CamWr\_Done changes from FALSE to TRUE, DMC\_CamSet is executed. When CamSe\_Done changes to TRUE, the execution of DMC\_CamSet is finished. The cam curve after being modified will take effect in the next cycle after current cam cycle is over.

11

FB/FC	Explana	Explanation				
FB	DMC_CamReadTappetStatus is use multiple tappet points.	AS524C-B				
	DMC_CamReadTappetStatus_instance					
	DMC_CamRea	dTappetStatus				
	Enable	Vaild —				
	CamTable	Busy —				
	TappetNum1	Error				
	TappetNum2	ErrorID				
	— TappetNum3	Status1				
	TappetNum4	Status2				
		Status3				
	TappetNum6	Status4				
	TappetNum7	Status5				

Status6 -Status7 -Status8 -

TappetNum8

# 11.4.10 DMC\_CamReadTappetStatus

## Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When <i>Enable</i> is TRUE.
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When Enable is TRUE.
TappetNum1	The number of the first tappet point	UINT	1~128 (The variable value must be set)	When <i>Enable</i> is TRUE.
TappetNum2	The number of the second tappet point	UINT	1~128 (The variable value must be set)	When Enable is TRUE.
TappetNum3	The number of the third tappet point	UINT	1~128 (The variable value must be set)	When <i>Enable</i> is TRUE.
TappetNum4	The number of the forth tappet point	UINT	1~128 (The variable value must be set)	When Enable is TRUE.
TappetNum5	The number of the fifth tappet point.	UINT	1~128 (The variable value must be set)	When Enable is TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
TappetNum6	The number of the sixth tappet point	UINT	1~128 (The variable value must be set)	When <i>Enable</i> is TRUE.
TappetNum7	The number of the seventh tappet point.	UINT	1~128 (The variable value must be set)	When Enable is TRUE.
TappetNum8	The number of the eighth tappet point.	UINT	1~128 (The variable value must be set)	When <i>Enable</i> is TRUE.


# • Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Status1	The status of the first tappet point.	BOOL	TRUE/FALSE
Status2	The status of the second tappet point.	BOOL	TRUE/FALSE
Status3	The status of the third tappet point.	BOOL	TRUE/FALSE
Status4	The status of the forth tappet point.	BOOL	TRUE/FALSE
Status5	The status of the fifth tappet point.	BOOL	TRUE/FALSE
Status6	The status of the sixth tappet point.	BOOL	TRUE/FALSE
Status7	The status of the seventh tappet point.	BOOL	TRUE/FALSE
Status8	The status of the eighth tappet point.	BOOL	TRUE/FALSE

# Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Enable</i> changes to FALSE.
Busy	♦ When <i>Enable</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Enable changes from TRUE to FALSE.

# • Output Update Timing Chart

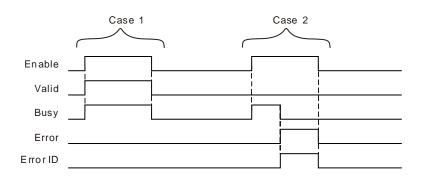

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and Busy change to TRUE. When *Enable* changes to FALSE, *Valid* and *Busy* change to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile *Busy* changes to FALSE. *Error* changes to FALSE when *Enable* changes from TRUE to FALSE and then the value of *ErrorID* is cleared to 0.

#### • Functions

DMC\_CamReadTappetStatus is used for reading the status of eight tappet points.

The DMC\_CamReadTappetStatus instruction is executed to read the status of the tappet points when the master axis passes the tappet points in the positive direction or in the negative direction. The status of every tappet point is determined by the setting of every tappet point. The status of every tappet point will change to FALSE when the master axis passes the final cam point in the positive direction or when the master axis passes the initial cam point in the negative direction.

# Programming Example

#### 1. The variable table and program

Variable name	Data type	Initial value
RTS	DMC_CamReadTappetStatus	
RTS_En	BOOL	FALSE
RTS_CT	USINT	1
RTS_TN1	UINT	1
RTS_TN2	UINT	2
RTS_TN3	UINT	3
RTS_TN4	UINT	4
RTS_TN5	UINT	5
RTS_TN6	UINT	6
RTS_TN7	UINT	7
RTS_TN8	UINT	8
RTS_Va	BOOL	
RTS_Bsy	BOOL	
RTS_Err	BOOL	
RTS_ErrID	WORD	
RTS_Sta1	BOOL	
RTS_Sta2	BOOL	
RTS_Sta3	BOOL	
RTS_Sta4	BOOL	
RTS_Sta5	BOOL	


Variable name	Data type	Initial value
RTS_Sta6	BOOL	
RTS_Sta7	BOOL	
RTS_Sta8	BOOL	

	R	TS	·
	DMC_CamRea	adTappetStatus 1	
RTS_En —	Enable	Vaild	— RTS_Va
RTS_CT	CamTable	Busy	
RTS_TN1 —	TappetNum1	Error	
RTS_TN2 —	TappetNum2	ErrorID	
RTS_TN3 —	TappetNum3	Status1	— RTS_Sta1
RTS_TN4 —	TappetNum4	Status2	
RTS_TN5 —	TappetNum5	Status3	— RTS_Sta3
RTS_TN6 —	TappetNum6	Status4	— RTS_Sta4
RTS_TN7 —	TappetNum7	Status5	— RTS_Sta5
RTS_TN8 —	TappetNum8	Status6	— RTS_Sta6
		Status7	— RTS_Sta7
		Status8	— RTS_Sta8

### Table of tappet points 1.

Index	Master axis position	Slave axis position	Passed in the positive direction	Passed in the negative direction
1	50.0	150.0	PositiveOn	NegativeOff
2	100.0	180.0	PositiveDisable	NegativeOff
3	180.0	250.0	PositiveOff	NegativeOff
4	300.0	100.0	PositiveInvert	NegativeOff


2. Position curve and sequence chart

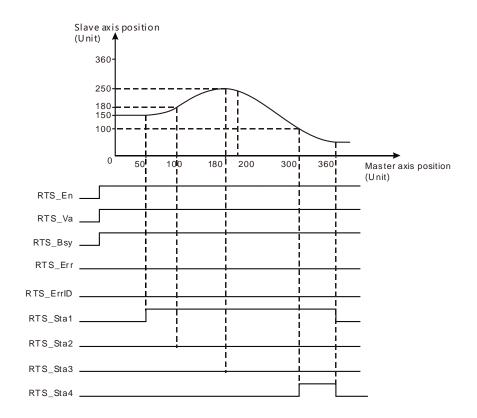

- Add tappet points in the established cam curve as shown in the above figure. Tappet point 1 is set to PositiveOn when it is passed in the positive direction. Tappet point 2 is set to PositiveDisable when it is passed in the positive direction. Tappet point 3 is set to PositiveOff when it is passed in the positive direction. Tappet point 4 is set to PositiveInvert when it is passed in the positive direction.
- When the axis runs forward and RTS\_En changes from FALSE to TRUE, DMC\_CamReadTappetStaus is executed. (Because the first tappet point selects PositiveOn,) RTS\_Sta1 changes from FALSE to TRUE when the axis passes the first tappet point in the cam curve. (Because the second tappet point selects PositiveDisable,) RTS\_Sta2 is FALSE when the second tappet point is passed. (Because the third tappet point selects PositiveOff,) RTS\_Sta3 is FALSE when the third tappet point is passed. (Because the forth tappet point selects PositiveInvert,) RTS\_Sta4 changes from FALSE to TRUE when the forth tappet point is passed.
- RTS\_Sta1 and RTS\_Sta4 change to FALSE when the master axis passes the final point of the cam curve.

FB/FC	Explanation	Applicable model		
FB	DMC_CamReadTappetValue reads the parameters of one tappet point.	AS524C-B		
DMC_CamReadTappetValue_instance				

# 11.4.11 DMC\_CamReadTappetValue

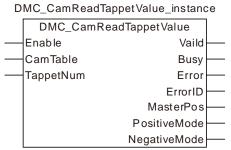

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	When Enable is TRUE.
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Enable</i> is TRUE.
TappetNum	The number of the tappet point to read	UINT	1~128 (The variable value must be set)	When Enable is TRUE.


### • Output Parameters

Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the BOOL BOOL		TRUE / FALSE
ErrorID	rrorID Contains the error code when an error occurs. Please refer to section 12.2. WORD		
MasterPos	Displays the master axis position.	LREAL	
PositiveMode	The status mode selection for the tappet point when the axis passes the tappet point in the positive direction.	PositiveMode_Type	0: PositiveDisable 1: PositiveOn 2: PositiveOff 3: PositiveInvert
NegativeMode	The status mode selection for the tappet point when the axis passes the tappet point in the negative direction.	NegativeMode_Type	0: NegativeDisable 1: NegativeOn 2: NegativeOff 3: NegativeInvert

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Enable</i> changes to FALSE.
Busy	♦ When <i>Enable</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Enable changes from TRUE to FALSE.

### • Output Update Timing

### Output Update Timing Chart

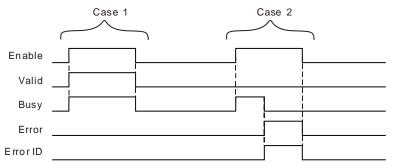

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Valid* and *Busy* change to TRUE. When *Enable* changes to FALSE, *Valid* and *Busy* change to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile *Busy* changes to FALSE. *Error* changes to FALSE when *Enable* changes from TRUE to FALSE and then the value of *ErrorID* is cleared to 0.

### • Functions

The tappet point information includes the master axis position and the modes when the tappet point is passed in the positive direction and in the negative direction. When the axis runs forward, a tappet point can select PositiveDisable, PositiveOn, PositiveOff or PositiveInvert. When the axis runs reversely, a tappet point can select NegativeDisable, NegativeOn, NegativeOff or NegativeInvert. The meanings of modes are listed in the following table.

Mode	Function	Explanation
PositiveDisable	Disabled	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read has no change.
PositiveOn	ON	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is ON.
PositiveOff	OFF	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is OFF.
PositiveInvert Invert		When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the positive direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the positive direction.
NegativeDisable	Disabled	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read has no change.
NegativeOn ON		When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is ON.
NegativeOff OFF		When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is OFF.


Mode	Function	Explanation
NegativeInvert	Invert	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the negative direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the negative direction.

# 📕 Programming Example

### 1. The variable table and program

Variable name	Data type	Initial value
RTV	DMC_CamReadTappetValue	
RTV_En	BOOL	FALSE
RTV_CT	USINT	1
RTV_TN	UINT	2
RTV_Va	BOOL	
RTV_Bsy	BOOL	
RTV_Err	BOOL	
RTV_ErrID	WORD	
RTV_MP	LREAL	
RTV_PM	PositiveMode_Type	
RTV_NM	NegativeMode_Type	

RTV

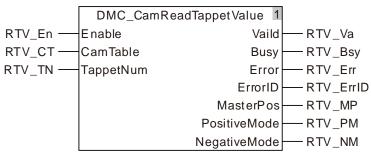

### 2. Table of tappet points

Inde	ex	Master axis position	Slave axis position	Passed in the positive direction	Passed in the negative direction
1		108.0	235.0	PositiveOn	NegativeInvert
2		200.0	250.0	PositiveOff	NegativeOff
3		300.0	192.0	PositiveInvert	NegativeOn

When RTV\_En changes from FALSE to TRUE, DMC\_CamReadTappetValue is executed. When RTV\_Va changes to TRUE, the instruction execution is finished and the tappet point information is read as follows.

Index	Master axis position	Passed in the positive direction	Passed in the negative direction
2	200.0	PositiveOff	NegativeOff

FB/FC	Explanation	Applicable model
FB	DMC_CamWriteTappetValue is used for setting the parameters for a tappet point.	AS524C-B
	DMC_CamWriteTappetValue_instance	

# 11.4.12 DMC\_CamWriteTappetValue

# DMC\_CamWriteTappetValue\_Instance DMC\_CamWriteTappetValue Execute Done CamTable Busy TappetNum Error MasterPos ErrorID PositiveMode NegativeMode

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
TappetNum	The number of the tappet point	UINT	1~128 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
MasterPos	Master position of the tappet point	LREAL	0, positive number	When <i>Execute</i> changes from FALSE to TRUE.
PositiveMode	The mode of the tappet point when the axis runs forward and passes it.	PositiveMode _Type	<ol> <li>PositiveDisable</li> <li>PositiveOn</li> <li>PositiveOff</li> <li>PositiveInvert</li> </ol>	When <i>Execute</i> changes from FALSE to TRUE.
NegativeMode	The mode of the tappet point when the axis runs backward and passes it.	NegativeMode _Type	<ol> <li>0 : NegativeDisable</li> <li>1 : NegativeOn</li> <li>2 : NegativeOff</li> <li>3 : NegativeInvert</li> </ol>	When <i>Execute</i> changes from FALSE to TRUE.

### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE

Parameter name	Function	Data type	Valid range
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

### **Output Update Timing**

Name	Timing for changing to TRUE	Timing for changing to FALSE	
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes to FALSE.	
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>	
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.	

### Output Update Timing Chart

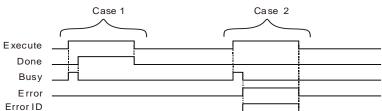

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

### Functions

DMC\_CamWriteTappetValue is used for setting the parameters for a tappet point including the master axis position and the status mode of the tappet point when the tappet point is passed in the positive direction and in the negative direction.

Generally, the setting for a tappet point is conducted in the cam built on the software.For a dynamic change of the tappet point setting, use the DMC\_CamWriteTappetValue instruction.

After the setting for a tappet point is over, use DMC\_CamReadTappetStatus to read the status of the tappet point when the master axis passes the tappet point.

When the axis runs forward, the tappet point can select such a mode as PositiveDisable, PositiveOn, PositiveOff or PositiveInvert. When the axis runs backward, the tappet point can select such a mode as NegativeDisable, NegativeOn, NegativeOff or NegativeInvert.

Mode	Function	Explanation
PositiveDisable	Disabled	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read has no change.
PositiveOn	ON	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is ON.
PositiveOff	OFF	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is OFF.
PositiveInvert	Invert	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the positive direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the positive direction.

The meanings of modes are shown in the following table.

11-232

Mode	Function	Explanation		
NegativeDisable	Disabled	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read has no change.		
NegativeOn	ON	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is ON.		
NegativeOff	OFF	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is OFF.		
Negativelvert	Invert	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the negative direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the negative direction.		


### Precaution

Please make sure that the cam curve is called for use by one MC\_CamIn instruction at most if DMC\_CamWriteTappetValue is used to set the parameters for one tappet point in the cam curve. If the cam curve is called by multiple MC\_CamIn instructions, the tappet point to be modified which is used in the programs will be changed when DMC\_CamWriteTappetValue is used to change the parameters of one tappet point.

# Programming Example

### 1. The variable table and program

Variable name	Data type	Initial value
WTV	DMC_CamWriteTappetValue	
WTV_Ex	BOOL	FALSE
WTV_CT	USINT	1
WTV_TN	UINT	2
WTV_MP	LREAL	200.0
WTV_PM	LREAL	PositiveOff
WTV_NM	LREAL	NegativeOff
WTV_Done	BOOL	
WTV_Bsy	BOOL	
WTV_Err	BOOL	
WTV_ErrID	WORD	
RTV	DMC_CamReadTappetValue	
RTV_En	BOOL	FALSE
RTV_CT	USINT	1
RTV_TN	UINT	2
RTV_Va	BOOL	
RTV_Bsy	BOOL	
RTV_Err	BOOL	
RTV_ErrID	WORD	
RTV_MP	LREAL	
RTV_PM	PositiveMode_Type	
RTV_NM	NegativeMode_Type	

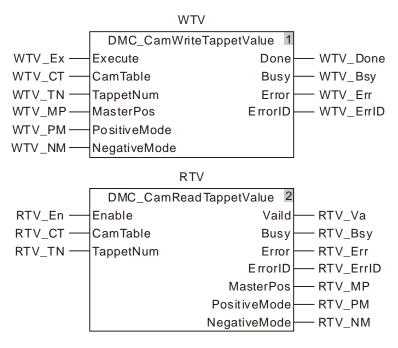

2. Table of tappet points

Index	Master axis position	Slave axis position	Passed in the positive direction	Passed in the negative direction
1	108.0	235.0	ON	Invert
2	200.0	250.0	OFF	OFF
3	300.0	192.0	Invert	ON

When WTV\_Ex changes from FALSE to TRUE, DMC\_CamWriteTappetValue is executed. When WTV\_Done changes to TRUE, the execution of the instruction is finished and the information of the second tappet point is written as below.

Index	Master axis position	Passed in the positive direction	Passed in the negative direction
2	250.0	PositiveOff	NegativeOff

When RTV\_En changes from FALSE to TRUE, DMC\_CamReadTappetValue is executed. When RTV\_Done changes to TRUE, the execution of the instruction is finished and the information of one tappet point which is read is shown as below.

Index	Master axis position	Passed in the positive direction	Passed in the negative direction
2	250.0	PositiveOff	NegativeOff

FB/FC	Explanation			Applicable model
FB	DMC_CamAddTappet is used for adding a tappet point.			AS524C-B
	DMC_CamAddTappet			
		Execute	Done	
		CamTable	Busy —	
		MasterPos	Error	

ErrorID TappetNum

PositiveMode

NegativeMode

# 11.4.13 DMC\_CamAddTappet

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
MasterPos	Master axis position of the tappet point	LREAL	0, positive number	When <i>Execute</i> changes from FALSE to TRUE.
PositiveMode	Status mode of the tappet point when the axis runs forward.	PositiveMode _Type	0: PositiveDisable 1: PositiveOn 2: PositiveOff 3: PositiveInvert	When <i>Execute</i> changes from FALSE to TRUE.
NegativeMode	Status mode of the tappet point when the axis runs backward.	NegativeMode _Type	0: NegativeDisable 1: NegativeOn 2: NegativeOff 3: NegativeInvert	When <i>Execute</i> changes from FALSE to TRUE.


### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
TappetNum	Outputs the number of the added tappet point.	UINT	1~128

### **Output Update Timing**

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes to FALSE.
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### **Output Update Timing Chart**

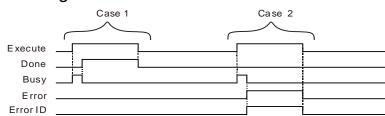

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, Done changes to TRUE and Busy changes to FALSE. When Execute changes to FALSE, Done changes to FALSE.
- Case 2 : When an error occurs, Error changes to TRUE and ErrorID shows corresponding error code. When Execute changes from TRUE to FALSE, Error changes to FALSE and the value of ErrorID is cleared to 0.

### **Functions**

DMC\_CamAddTappet is used for adding a tappet point by setting the master axis position and the status mode of the tappet point when the tappet point is passed in the positive direction and in negative direction. The number of the added tappet point is accumulated on the basis of the numbers of existing tappet points. For example, if the largest number of tappet points is 3 previously, the largest number of tappet points is 4 after the instruction is executed.

When the axis runs forward, the added tappet point can select such a mode as PositiveDisable, PositiveOn, PositiveOff or PositiveInvert. When the axis runs backward, the added tappet point can select such a mode as NegativeDisable, NegativeOn, NegativeOff or NegativeInvert.

Mode	Function	Explanation
PositiveDisable	Disabled	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read has no change.
PositiveOn	ON	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is ON.
PositiveOff	OFF	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read is OFF.
PositiveInvert	Invert	When the master axis passes the tappet point in the positive direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the positive direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the positive direction.
NegativeDisable	Disabled	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read has no change.
NegativeOn	ON	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is ON.
NegativeOff	OFF	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read is OFF.

The meanings of modes are shown in the following table.

Mode	Function	Explanation
NegativeInvert	Invert	When the master axis passes the tappet point in the negative direction, the status of the tappet point which is read will be OFF if the status of the tappet point is ON before the tappet point is passed in the negative direction. Otherwise, the status of the tappet point which is read will be ON if the status of the tappet point is OFF before the tappet point is passed in the negative direction.


### Precaution

Make sure that the cam curve is called for use by one MC\_CamIn instruction at most if DMC\_CamAddTappet is used to add one tappet point in the cam curve. If the cam curve is called by multiple MC\_CamIn instructions, the added tappet point can be used in the programs when DMC\_CamAddTappet is used to add one tappet point.

# Programming Example

### 1. The variable table and program

Variable name	Data type	Initial value
CAT	DMC_CamAddTappet	
CAT_Ex	BOOL	FALSE
CAT_CT	USINT	1
CAT_MP	LREAL	200.0
CAT_PM	LREAL	PositiveOff
CAT_NM	LREAL	NegativeOff
CAT_Done	BOOL	
CAT_Bsy	BOOL	
CAT_Err	BOOL	
CAT_ErrID	WORD	
CAT_TN	UINT	
RTV	DMC_CamReadTappetValue	
RTV_En	BOOL	FALSE
RTV_CT	USINT	1
RTV_TN	UINT	4
RTV_Va	BOOL	
RTV_Bsy	BOOL	
RTV_Err	BOOL	
RTV_ErrID	WORD	
RTV_MP	LREAL	
RTV_PM	PositiveMode_Type	
RTV_NM	NegativeMode_Type	

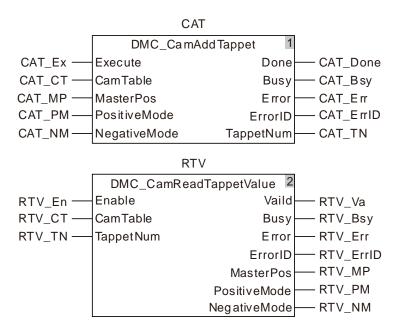

### 2. Table of tappet points

Index	Master axis position	Slave axis position	Passed in the positive direction	Passed in the negative direction
1	108.0	235.0	ON	Invert
2	200.0	250.0	OFF	OFF
3	300.0	192.0	Invert	ON

There are three tappet points which have been added in the established cam curve. Now add the forth tappet point using DMC\_CamAddTappet instruction.

When CAT\_Ex changes from FALSE to TRUE, DMC\_CamAddTappet is executed. When CAT\_Done changes to TRUE, the instruction execution is finished and the information of the forth tappet point which is added is shown as below.

Index	Maatar axia position	Passed in the positive Passed in the ne	
Index	Master axis position	direction	direction
4	250.0	PositiveOff	NegativeOff

When RTV\_En changes from FALSE to TRUE, DMC\_CamReadTappetValue is executed. When RTV\_Done changes to TRUE, the instruction execution is completed and the information of the tappet point which is read is shown as below.

Index	Master axis position	Passed in the positive	Passed in the negative
Index		direction	direction
4	250.0	PositiveOff	NegativeOff

# 11.4.14 DMC\_CamDeleteTappet

FB/FC	Explanation	Applicable model
FB	DMC_CamDeleteTappet is used for deleting a tappet point.	AS524C-B
	DMC_CamDeleteTappet_instance DMC_CamDeleteTappet Execute Done	

Busy Error ErrorID

CamTable

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
CamTable	The number of the cam table based on which the cam relationship between the master axis and slave axis is built.	USINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error in the execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

### Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the instruction execution is completed.</li> </ul>	♦ When <i>Execute</i> changes to FALSE.
Busy	♦ When <i>Execute</i> is TRUE.	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When any of the input parameters for the instruction is illegal.</li> </ul>	When Execute changes from TRUE to FALSE.

### Output Update Timing Chart

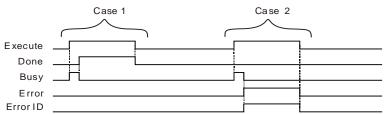

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the instruction execution is completed, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error code. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value of *ErrorID* is cleared to 0.

### • Functions

DMC\_CamDeleteTappet is used for deleting a tappet point which is the tappet point of the largest number. Whenever the instruction is executed one time, one tappet point of the largest number will be deleted.


### Precaution

Make sure that the cam curve is called for use by one MC\_CamIn instruction at most if DMC\_CamDeleteTappet is used to delete one tappet point in the cam curve. If the cam curve is called by multiple MC\_CamIn instructions, the tappet point to be deleted which is used in the programs will be deleted when DMC\_CamDeleteTappet is used to delete one tappet point.

# Programming Example

1. The variable table and program

Variable name	Data type	Initial value
CDT	DMC_CamDeletTappet	
CDT_Ex	BOOL	FALSE
CDT_CT	USINT	1
CDT_Done	BOOL	
CDT_Bsy	BOOL	
CDT_Err	BOOL	
CDT_ErrID	WORD	
RTV	DMC_CamReadTappetValue	
RTV_En	BOOL	FALSE
RTV_CT	USINT	1
RTV_TN	UINT	3
RTV_Va	BOOL	
RTV_Bsy	BOOL	
RTV_Err	BOOL	
RTV_ErrID	WORD	
RTV_MP	LREAL	
RTV_PM	PositiveMode_Type	
RTV_NM	NegativeMode_Type	

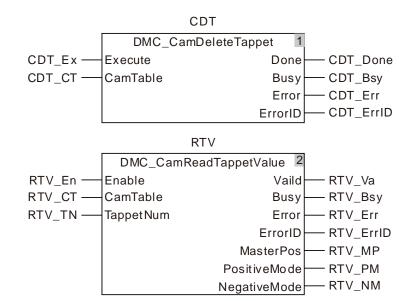

### 2. Table of tappet points

Inc	dex	Master axis position	Slave axis position	Passed in the positive direction	Passed in the negative direction
	1	108.0	235.0	PositiveOn	NegativeInvert
	2	200.0	250.0	PositiveOff	NegativeOff
	3	300.0	192.0	PositiveInvert	NegativeOn


When CDT\_Ex changes from FALSE to TRUE, DMC\_CamDeletTappet is executed. When CDT\_Done changes to TRUE, the execution of the instruction is finished and the last tappet point is deleted.

When RTV\_En changes from FALSE to TRUE, DMC\_CamReadTappetValue is executed. Since the third tappet point does not exist, the instruction alerts the error code 16#5505 (indicating no such a tappet point exists).

# **11.5 Application Instructions**

# 11.5.1 Rotary Cut Technology

Rotary cut is the technology to cut the material in transmission vertically. The knife conducts cutting on the cut surface periodically with the rotation of the rotary cut axis.

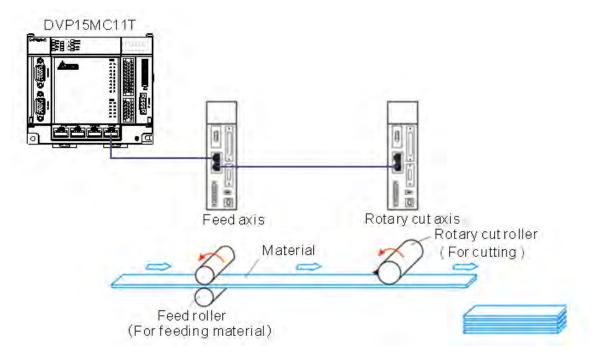


### Note:

The feed axis is to control the feed roller; the rotary cut axis is to control rotary cut roller with the knife mounted on the rotary cut roller. The rotary cut function is usually used for cutting of the thin material or the material of medium thinness and can be applied in packaging machine, cutting machine, punching machine, printing machine etc.

11


# 11.5.2 Rotary Cut Parameters

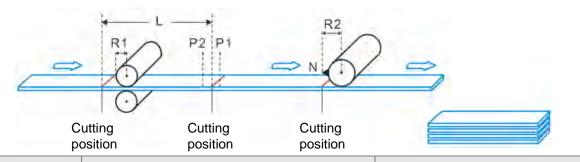

Parameter in the figure	Explanation	Corresponding parameter name of the instruction
L	The cutting length of the processed material	APF_RotaryCut_Init.CutLength
R1	The radius of the feed axis, i.e. the radius length of the feed roller.	APF_RotaryCut_Init.FeedRadius
R2	The radius of the rotary axis, i.e. the distance from the center of the rotary roller to the tool bit.	APF_RotaryCut_Init.RotaryRadius
N	The number of knives of the rotary roller. The number of knives is 1 in the figure above.	APF_RotaryCut_Init.KnifeNum
P1	The starting position of the synchronous area.	APF_RotaryCut_Init.SyncStartPos
P2	The end position of the synchronous area.	APF_RotaryCut_Init.SyncStopPos

# 11.5.3 Control Feature of Rotary Cut Function

Rotary cut function is a type of special electronic cam function. The figure of cam curve is shown below for continuous cutting.

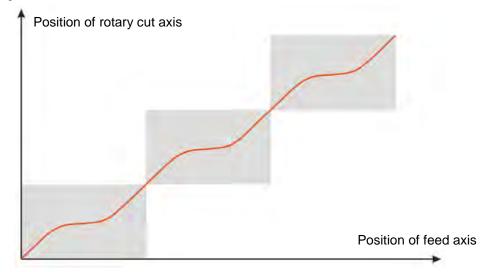

### Features

- 1. Users can set the cutting length freely according to the technological requirement and the cutting length could be less or more than the circumference of the cutter.
- 2. In the SYNC area, the rotary cut axis and feed axis move at a certain speed rate. (Their velocities are usually equal.) And the cutting of material is conducted in the SYN area.
- 3. The motion controller supports the rotary roller with multiple knives.
- 4. The feed axis is able to make the constant motion, acceleration, deceleration and irregular motion because the rotary cut axis moves according to the phase of the feed axis after the rotary cut function is enabled.
- 5. When rotary cut relation is broken off, the knife stops at the zero point of the system, i.e. the entry position for rotary cutting.


# 11.5.4 Introduction to Cam Curve with Rotary Cut Function

The cam curve with the rotary cut function could be divided into the SYNC area and adjustment area.

- **SYNC area**: Feed axis and rotary-cut axis make the motion at a fixed speed ratio (Linear speed of the knife is usually equal to that of the cut surface), and material cutting takes place in SYNC area.
- Adjustment area: Due to different cutting length, positioning need be adjusted accordingly. Adjustment area can be in the following three situations based on various cutting length.

### 1. Short material cutting


When cutting length is less than the knife roller circumference, the rotary-cut curve for any cycle is shown below.

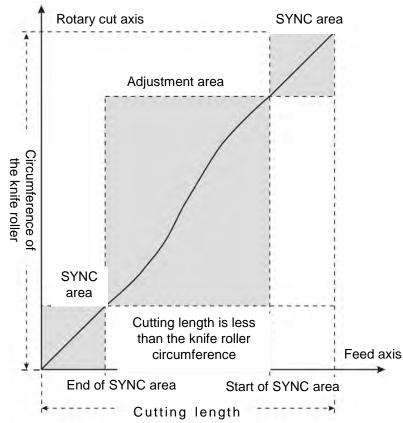

For the cutting of short material, rotary cut axis must accelerate first in the adjustment area, and then decelerate to the synchronous speed.

### 2. Equal-length cutting


When the cutting length is equal to the knife roller circumference, the rotary-cut curve for any cycle is shown below.

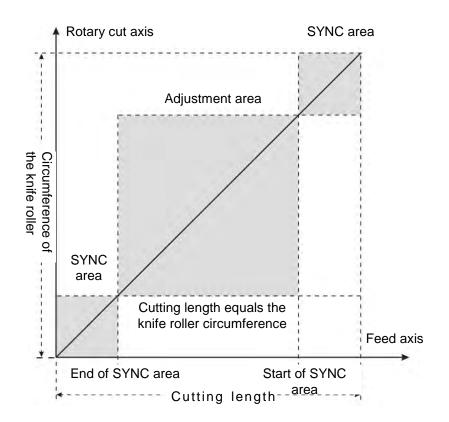

In this situation, the feed axis and rotary cut axis in SYNC area and non-SYNC area keep synchronous in speed. The rotary cut axis does not need to make any adjustment.

### 3. Long material cutting

When the cutting length is greater than the knife roller circumference, the rotary-cut curve for any cycle is shown below.

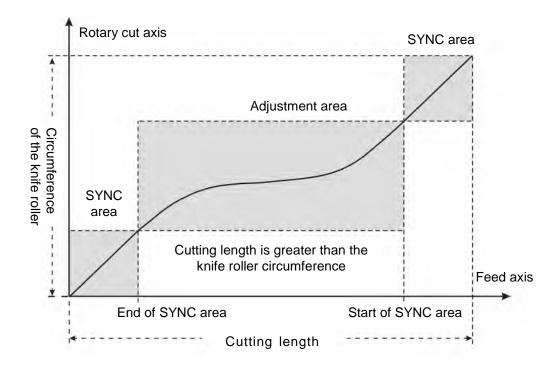


11

In this situation, the rotary cut axis should decelerate first in the adjustment area and then accelerate to the synchronous speed. If the cutting length is far greater than rotary cut roller circumference, the roller may decelerate to 0 and stay still for a while; and then accelerate up to the synchronous speed. The greater the cutting length is, the longer the roller stays.


Additionally, when rotary cut function is started or broken off, the cam curves used are different.

### 4. The entry curve

It is the rotary cut curve when rotary cut function is started.

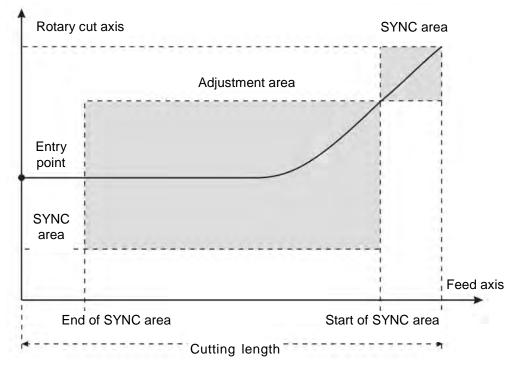


The curve is the rotary cut function entry curve. When the rotary cut function is started up, the rotary cut axis will follow the feed axis to rotate according to the curve. The entry position is based on the rotary cut axis. For the single knife, the cutting position is directly below the rotary cut roller if the entry position is over the rotary cut roller in the following figure. Before the rotary cut function is started up, the knife must be turned to the upper of the rotary roller. Otherwise, the cutting may happen in the adjustment area.

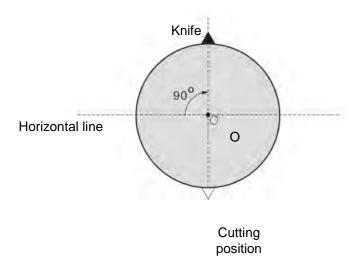

11-247


When the rotary roller is mounted with multiple knives, the distances between knives should be the same and the cutting position is at the center of the distance between knives. See the two-knife figure below.

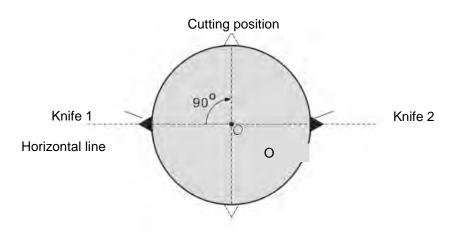

### Cutting position

### 5. The end curve

It is the rotary-cut curve when the rotary cut function is broken away.

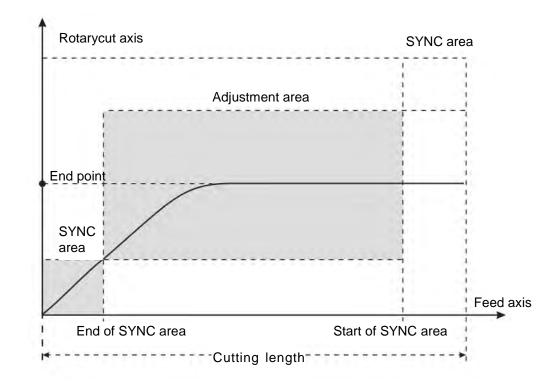

After the instruction "APF\_RotaryCut\_Out" is started up, the system will use the curve to make the rotary cut axis break away from the rotary cut state. Eventually, the knife stops at the end position as shown in the figure above.

The end position is based on the rotary cut axis. For the single knife, the end position is the entry position and it is also right above the rotary cut roller.

11

# 11.5.5 Rotary-cut Instructions

# 11.5.5.1 APF\_RotaryCut\_Init

FB/FC	Explanation	Applicable model		
FB	APF_RotaryCut_Init is used for initializing the radius of the rotary-cut axis and feed axis, the cutting length, synchronous area and etc.	AS524C-B		
APF_RotaryCut_Init_instance				

APF_RotaryCut_Init_instance				
	APF_RotaryCu	ıt_Init		
	Execute	Done		
	RotaryAxisRadius	Busy		
	RotaryAxisKnifeNum	Error		
	FeedAxisRadius	ErrorID		
	CutLength			
	SyncStartPos			
	SyncStopPos			
	RotStartPos			
	FedStartPos			
	RotaryCutID			


### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when Execute changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
RotaryAxisRadius	The radius of the rotary cut axis, i.e. the distance from the center of the rotary cut roller to the knife.	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
RotaryAxisKnifeNum	The number of knives of the rotary cut axis, i.e. the number of knives mounted on the rotary cut roller	USINT	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
FeedAxisRadius	The radius of the feed axis; i.e. the radius length of the feed roller	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
CutLength	The cutting length of material	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
SyncStartPos	The start position of the sync area, i.e. the corresponding feed axis position when the sync area starts.	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
SyncStopPos	The end position of the sync area, i.e. the corresponding feed axis position when the sync area ends.	LREAL	Positive number (The variable value must be set)	When Execute changes from FALSE to TRUE
RotStartPos	Reserved	-	-	-
FedStartPos	Reserved	-	-	-
RotaryCutID	The number for a group of rotary cut instructions; a group of rotary cut instructions use the same number. Setting range: 1~8.	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

### Notes:

The value of "SyncStartPos" in SYNC area is always greater than that of "SyncStopPos" in SYNC area. As shown in the figure below, the cutting length is 320; "SyncStartPos" is 310 and "SyncStopPos" is 10.

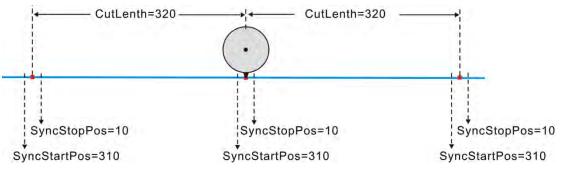

- 2. The limit for SYNC area is that it must not be greater than the half of cutting length. In above figure, SYNC area is 20, and the half of the cutting length is 160.
- 3. The length parameters in the function are RotaryAxisRadius, FeedAxisRadius, CutLenth, SyncStartPos, and SyncStopPos with the same unit. For example, if the unit for one of the parameters is CM (centimeter), the units for other parameters must be CM as well.

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

### • Output Update Timing

11

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When initializing is completed.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>

### Function

Before the rotary-cut relationoship is established, the instruction is used for initializing the radius of the rotary-cut axis and feed axis, cutting length, SYNC area and other parameters. After the instruction execution succeeds, relevant parameters will be downloaded so as to call for use in the established rotary-cut relationship.

After the rotary-cut relationship is established, the instruction can be used to modify the rotary-cut parameters. After the instruction execution is completed, the new parameters will be taken into effect in the next cycle.

### 11.5.5.2 APF\_RotaryCut\_In

FB/FC	Explanation	Applicable model
FB	APF_RotaryCut_In is used for establishing the rotary-cut relationship and specifying the axis No. of the rotary-cut axis and feed axis according to the application requirement.	AS524C-B
	APF_RotaryCut_In_instance	



### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
RotaryAxis	The axis No. of the rotary-cut axis	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
FeedAxis	The axis No. of the feed axis.	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
RotaryCutID	The number for a group of rotary cut instructions; a group of rotary cut instructions use the same number. Setting range: 1~8.	USINT	1~8 (The variable value must be set)	When Execute changes from FALSE to TRUE

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the coupling between the rotary-cut axis and feed axis is completed.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>


### • Output Update Timing

### • Function

APF\_RotaryCut\_In is used for building a rotary cut relationship and specifying the axis No. of the rotary-cut axis and feed axis according to the application requirement. The rotary cut axis will follow the feed axis for motion based on the rotary-cut curve after the instruction execution succeeds.

### 11.5.5.3 APF\_RotaryCut\_Out

FB/FC	Explanation	Applicable model
FB	APF_RotaryCut_Out is used for disconnecting the already established rotary-cut relationship between the rotary-cut axis and feed axis.	AS524C-B

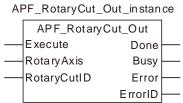

### Input Parameters


Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
RotaryAxis	The axis number of the rotary axis	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When Execute changes from FALSE to TRUE
RotaryCutID	The number for a group of rotary cut instructions; a group of rotary cut instructions use the same number. Setting range: 1~8.	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE

### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

### Notes:

### 1. Control Sequence Chart of Rotary Cut Function

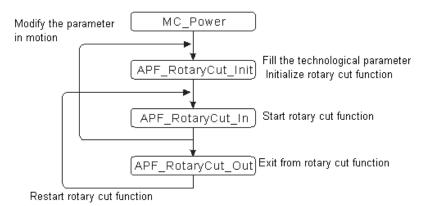

F

2. When the rotary cut function is performed, the rotary cut axis can only execute APF\_RotaryCut\_Out and MC\_Stop instruction and other instructions are invalid.

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When rotary-cut relationship disconnecting is completed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE	<ul> <li>When <i>Done</i> changes to TRUE.</li> <li>When <i>Error</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

### • Output Update Timing

### Function

APF\_RotaryCut\_Out is used for disconnecting the already established rotary-cut relationship between the rotary-cut axis and feed axis. After the rotary-cut relationship is disconnected, the knife of the rotary-cut axis will stop at the entry position and will not follow the feed axis for motion any more. The instruction has no impact on the motion of the feed axis.

# 11.5.6 Application Example of Rotary Cut Instructions

The section explains the setting of rotary cut parameters, establishment and disconnection of rotary cut relationship. The following is the programing example.


See the key parameters in the example as shown in the table below

Parameter name	Current value
RotaryAxis	2
FeedAxis	1
RotaryAxisRadius	10 (Unit: units)
RotaryAxisKnifeNum	1
FeedAxisRadius	20 (Unit: units)
CutLenth	30 (Unit: units)
SyncStartPos	19 (Unit: units)
SyncStopPos	1 (Unit: unit)

# Programming Example

1. As Pwr1\_En is TRUE, the servo of node address 1 turns "Servo On"; as Pwr2\_En is TRUE, the servo of node address 2 turns "Servo On".


Variable name	Data type	Initial value
Pwr1	MC_Power	
Axis1	USINT	1
Pwr1_En	BOOL	TRUE
Pwr1_BM	MC_Buffer_Mode	0
Pwr1_Sta	BOOL	TRUE
Pwr1_Bsy	BOOL	
Pwr1_Act	BOOL	
Pwr1_Err	BOOL	
Pwr1_ErrID	WORD	
Pwr2	MC_Power	
Axis2	USINT	1
Pwr2_En	BOOL	TRUE
Pwr2_BM	MC_Buffer_Mode	0
Pwr2_Sta	BOOL	TRUE
Pwr2_Bsy	BOOL	
Pwr2_Act	BOOL	
Pwr2_Err	BOOL	
Pwr2_ErrID	WORD	

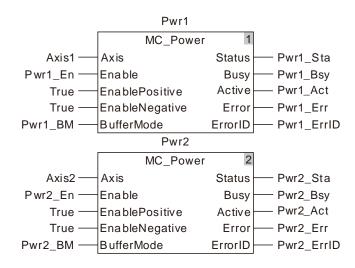

2. Set the rotary cut technology parameters. The radius of the rotary-cut axis is 10, knife quantity of the rotary-cut axis is 1, radius of the feed axis is 20 and cutting length of the feed axis is 30. The start position of SYNC area is 19, end position of SYNC area is 1, and the rotary cut group number is 1. When RotyCut\_Init\_Ex is TRUE, rotary cut technology parameters will be initialized.

### The variable table and program


Variable name	Data type	Initial value
RotyCut_Init	APF_RotaryCut_Init	
RotyCut_Init_Ex	BOOL	TRUE
RotyCut_Init _Done	BOOL	TRUE
RotyCut_Init _Bsy	BOOL	
RotyCut_Init _Err	BOOL	
RotyCut_Init _ErrID	WORD	

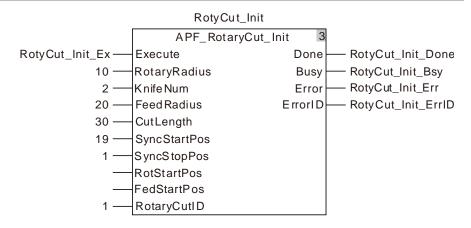

3. When RotyCut\_In\_Ex is TRUE, the rotary-cut relationship starts being established. When RotyCut\_In \_Done is TRUE, it indicates the rotary-cut relationship between the rotary-cut axis and feed axis is made successfully. Servo 1 is the feed axis and servo 2 is the rotary-cut axis.

### The variable table and program

Variable name	Data type	Initial value
RotyCut_In	APF_RotaryCut_In	
RotyCut_In_Ex	BOOL	TRUE
RotyCut_In _Done	BOOL	TRUE
RotyCut_In _Bsy	BOOL	
RotyCut_In _Err	BOOL	
RotyCut_In _ErrID	WORD	

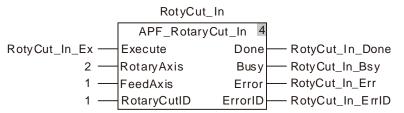

4. When Vel \_Ex is TRUE, the feed axis starts to execute the velocity instruction. At the moment, the rotary-cut axis executes the rotary cut action based on the phase of the feed axis.

### The variable table and program

Variable name	Data type	Initial value
Vel	MC_MoveVelocity	
Axis1	USINT	1
Vel _Ex	BOOL	TRUE
Vel _Dir	MC_DIRECTION	1
Vel _BM	MC_Buffer_Mode	0
Vel _Invel	BOOL	
Vel _Bsy	BOOL	
Vel _Act	BOOL	
Vel _Abt	BOOL	
Vel _Err	BOOL	
Vel _ErrID	WORD	

Vel

	MC_Move	eVelocity 5		
Axis1 —	Axis	Invelocity	— Vel_Invel	
Vel_Ex	Execute	Busy	— Vel_Bsy	
	ContinuousUpdate	Active	— Vel_Act	
10000.0 —	Velocity	CommandAborted	— Vel_Abt	
10000.0 —	Acceleration	Error	— Vel_Err	
10000.0 —	Deceleration	ErrorlD	— Vel_Errid	
10000.0 —	Jerk			
Vel_Dir —	Direction			
Vel_BM —	BufferMode			

11

5. When RotyCut\_Out\_Ex is TRUE, the rotary-cut axis starts to break away from the feed axis. When RotyCut\_Out\_Done is TRUE, it indicates that the rotary-cut axis breaks away successfully. After the rotary-cut axis breaks away from the feed axis, it will return to the entry point and the motion of the feed axis will not impact the rotary-cut axis any more.

Variable name		Data type		Initial value				
RotyCut_Out		APF_RotaryCu	t_Out					
RotyCut_Out_Ex		BOOL		TRUE				
RotyCut_Out_Done		BOOL		TRUE				
RotyCut_Out_Bsy		BOOL						
RotyCut_Out_Err		BOOL						
RotyCut_Out_ErrID		WORD						
RotyCut_Out								
AP		RotaryCut_Out	6					
RotyCut_In_Ex —	Execute	e Don	e – Rot	yCut_Out_Done				
2 —	RotaryA	xis Bus	/ Rot	yCut_Out_Bsy				
1 —	RotaryC	CutID Erro	r — Roty	yCut_Out_Err				
		Errorl	D Rot	yCut_Out_ErrlD				

### The variable table and program

# 11.6 G Code Instructions

# 11.6.1 CNC Introduction

11

As a multi-axis motion controller, the motion controller supports the standard CNC function and can execute G codes statically to achieve the simple numerical control of machine tools and robot control. Beyond that, it could also be applied to the occasions where G codes are used for positioning and path planning. CANopen Builder software provides CNC G code editing function; user could edit G codes in the CNC editor or import the G codes converted by other design software into this editor. When G codes are input in the code list, the three-dimension chart of G codes is output in the preview window.

All G codes will be downloaded to the controller during the program download.

G codes need be called in the motion control program after being edited. Using DMC\_CartesianCoordinate instruction, the servo axis can be controlled for position interpolation.

# 11.6.2 G Code Input Format

G code	Function	Number of axes supported	Format
G0	Quick Positioning	8	Format 1: G0 X_Y_Z_A_B_C_P_Q_
G1	Linear interpolation	8	Format 1: G1 X_Y_Z_A_B_C_P_Q_E_F_
G2	Clockwise circular arc /helical interpolation	8	Format 1: G2 X_ Y_ Z_ A_ B_ C_ P_ Q_ I_ J_ (I_ K_ / J_ K_)T_ E_ F_ Format 2: G2 X_ Y_ Z_ A_ B_ C_ P_ Q_ R_ T_ E_ F_
G3	Anticlockwise circular arc /helical interpolation	8	Format 1: G3 X_Y_Z_A_B_C_P_Q_I_J_(I_ K_/J_K_)T_E_F_ Format 2: G3 X_Y_Z_A_B_C_P_Q_R_T_ E_F_
G4	Delay instruction		Format 1: G4 K_
G17	XY plane for circular interpolation		Format 1: G17
G18	XZ plane for circular interpolation		Format 1: G18
G19	YZ plane for circular interpolation		Format 1: G19
G90	Absolute mode		Format 1: G90
G91	Relative mode		Format 1: G91
G50	Precise stop		Format 1: G50
G51	Round path transition		Format 1: G51 D_
G52	Smooth path transition		Format 1: G52
M0~M99	M Code		Format 1: M_ D_

The G code formats that the motion controller supports are listed in the followint table.

### Note:

The location with an underline is the value of the parameter to be set.

When one G code need be input in the CNC program in the CANopen Builder, N\_ must be put to the left of G code. N\_ means the row number of the G code in the NC program.

Every row has only one G code input.

The input format of G codes in the CANopen Builder software is as follows.

N0 G0 X100 Y100

### 11.6.3 Explanation of G Code Formats

### • G code Unit

The position unit of axis X\_, Y\_, Z\_, A\_, B\_, C\_, P\_, Q\_ in G code is consistent with that of axis parameter. Please set the same physical unit for each axis.

For example, the unit is set as mm. And thus G0 X100.5 Y300 Z30.6 indicates that axis X, Y, Z move to the place of 100.5mm, 300mm, and 30.6mm respectively.

### • G code parameter omitting

- 1. One or more items among X\_, Y\_, Z\_, A\_, B\_, C\_, P\_, Q\_ in G0 instruction can be omitted.
- One or more items among X\_, Y\_, Z\_, A\_, B\_, C\_, P\_, Q\_, E\_, E\_, F\_ in G1 instruction can be omitted.
- One or more items among X\_, Y\_, Z\_, A\_, B\_, C\_, P\_, Q\_, E\_, E\_, F\_ in G2 and G3 instruction can be omitted except I\_, J\_, K\_, R\_.
- 4. The parameters on the right of G4, G51 instruction can not be omitted.
- 5. D\_ can be omitted for M code.
- 6. Only one G code can be written in the same row in CNC editing area in the CANopen Builder software.

### • Special function of G code

### ■ Using %ML register to represent key values in G code

X\_, Y\_, Z\_, A\_, B\_, C\_, P\_, Q\_, E\_, F\_, I\_, J\_, K\_, R\_, T\_, E\_, F\_ all can use %ML register. "%" of "%ML" is deleted and "\$" is added to the right and left of "ML". T is of ULINT type and others are of LREAL type.

Example: N0 G0 XML0 YML1 ZML2 (%ML0=100.0 · %ML1=200.0 · %ML2=300.0) Explanation: After the G code is executed, axis X moves to 100 units; axis Y moves to 200 units and axis Z moves to 300 units.

### G code transition

G code transition mode can be changed via G50/G51/G52. See the transition modes which are usable to G0/G1/G2/G3 as follows.

	G50	G51	G52	
	(Precise stop)	(Round path transition)	(Smooth path transition)	
G0	Usable	The transition mode is invalid and the motion effect is the same as G50.	The transition mode is invalid and the motion effect is the same as G50.	
G1	Usable	Usable	Usable	
G2	Usable	Usable	The transition mode can be used when the straight line or circular arc and circular arc are tangent or are close to the point of tangency.	

	G50	G51	G52
	(Precise stop)	(Round path transition)	(Smooth path transition)
G3	Usable	Usable	The transition mode can be used when the straight line or circular arc and circular arc are tangent or are close to the point of tangency.

#### • Defaults

- 1. <u>Relative, absolute default</u>. The default mode is absolute mode and could be set via G90/G91.
- 2. <u>*Plane default:*</u> The default plane is XY plane and could be switched via G17/G18/G19.
- 3. <u>*Transition mode:*</u> The default plane is an accurate stop mode and could be switched via G50/G51/G52.
- 4. <u>G0-related defaults:</u> The velocity, acceleration, deceleration and jerk are the velocity, acceleration, deceleration and jerk of each axis in the axis group parameters. They can be set via DMC\_SetG0Para instruction.
- 5. <u>G1/G2/G3 defaults:</u> The velocity, acceleration, deceleration and jerk are the velocity, acceleration, deceleration and jerk of terminal actuator. They can be set via DMC\_SetG1Para instruction and modified via E, F parameter. E+ and E- can be input in G code to set the different acceleration and deceleration rate.

Example: G1 X10000 Y32105.6 E+20000 E-90000

Explanation: When the instruction is executed, the cutter moves at the acceleration of 20000 units/second<sup>2</sup> for speeding up and at the deceleration of 90000 units/second<sup>2</sup> for reducing the speed.

### 11.6.4 G Code Functions

#### 11.6.4.1 G90 (Absolute Mode)


- Function: After G90 is executed, the terminal position of each axis in G code is based on 0 unit and G91 can be used to switch into the relative mode in the process. It is absolute mode for NC program by default.
- Format: N\_G90
- Parameter Explanation:
- N\_: The row number of G code in NC program
- Example:

The initial positions of axis X and Y are both 3000 units and the axis parameters are both default values. The G codes to be executed are as follows:

N0 G90

N1 G0 X6000 Y6000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

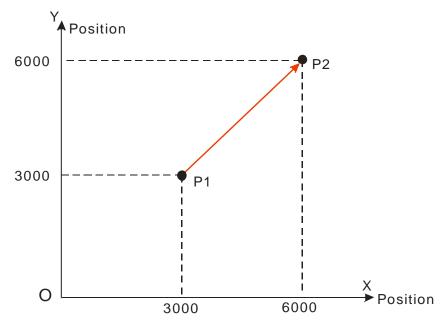

### 11.6.4.2 G91 (Relative Mode)


- Function: After G91 is executed, the terminal position of each axis in G code is counted in incremental method beginning from the current position and G90 can be used to switch into the absolute mode in the process.
- Format: N\_G91
- Parameter Explanation:
- N\_: The row number of G code in NC program
- Example:

The initial positions of axis X and Y are both 3000 units and the axis parameters are both default values. The G codes to be executed are as follows:

N0 G91

### N1 G0 X6000 Y6000


After G codes are executed, the Y/X curve for the whole movement process is shown below:

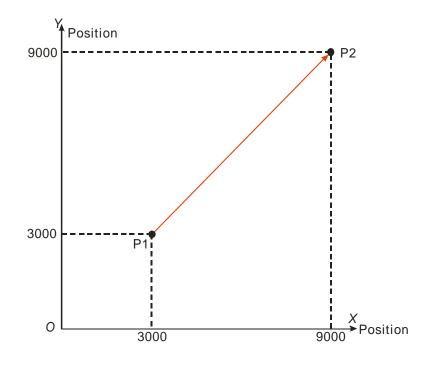

### 11.6.4.3 G0 (Rapid Positioning)

#### • Function:

Each axis moves from current position to the terminal position at the given speed. Maximum 8 axes can be controlled and each axis is independent with each other in motion. And the motion path figure is displayed below.

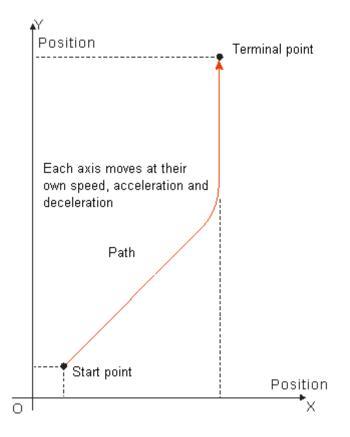

- Format: N\_G0 X\_Y\_Z\_A\_B\_C\_P\_Q\_
- Parameter explanation:
  - N\_: The row number of G code in NC program.
  - X\_: Specify the terminal position of axis X, Unit: unit, data type: LREAL.
  - Y\_: Specify the terminal position of axis Y, Unit: unit, data type: LREAL.
  - Z\_: Specify the terminal position of axis Z, Unit: unit, data type: LREAL.
  - A\_: Specify the terminal position of axis A, Unit: unit, data type: LREAL.
  - B\_: Specify the terminal position of axis B, Unit: unit, data type: LREAL.
  - C\_: Specify the terminal position of axis C, Unit: unit, data type: LREAL.
  - P\_: Specify the terminal position of axis P, Unit: unit, data type: LREAL.
  - Q\_: Specify the terminal position of axis Q, Unit: unit, data type: LREAL.
- Instruction explanation:
  - 1. G0 can control one or more axes and other axis can be omitted.
  - 2. The speed, acceleration, deceleration and jerk of each axis in motion depend on axis-related parameters in axis group parameters. They can be set via DMC\_SetG0Para instruction.
  - 3. Absolute mode decided by G90: The terminal position of G0 is based on 0 unit.
  - 4. Relative mode decided by G91: The terminal position of G0 is an incremental value beginning

from the current position.

Absolute mode example:


The initial positions of axis X, Y are both 10000 units and their axis parameters are both default values.

The G codes to be executed are:


N0 G90

N1 G0 X50000 Y100000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

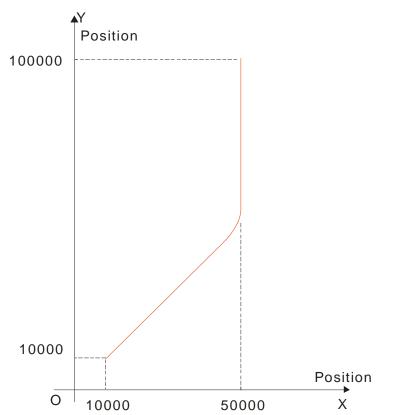

After G codes are executed, the Position/Time curve for the whole movement process is shown below: 11

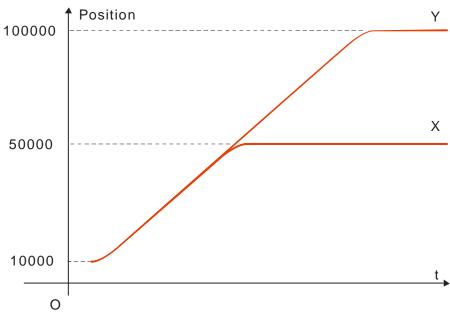


Relative mode example:

The initial positions of axis X, Y are both 10000 units and their axis parameters are both default values. The G codes to be executed are:

N0 G91


N1 G0 X50000 Y100000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

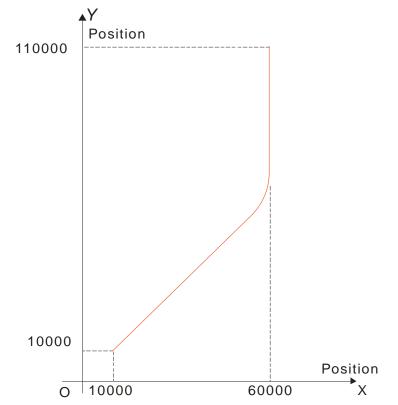

After G codes are executed, the Position/Time curve for the whole movement process is shown below:


11

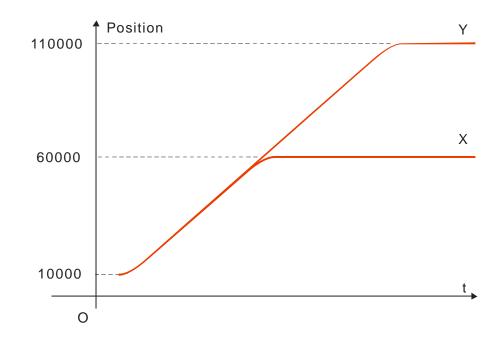

# **11.6.4.4** G1 (Linear Interpolation)


#### • Function:

The cutter starts off from one point and moves straight to the target position at a given speed. The instruction can control up to 8 axes and all axes start up or stop simultaneously. Three axes control the position of the cutter together as the figure shows below.

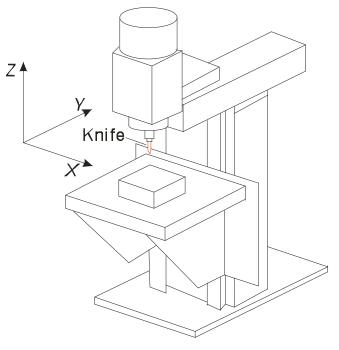

Vertical Milling Machine

Motion path figure:

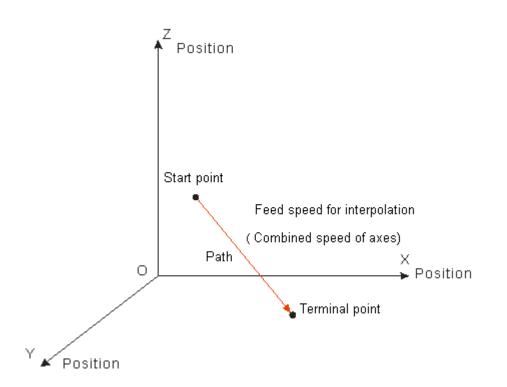

- Format: N\_G1 X\_Y\_Z\_A\_B\_C\_P\_Q\_E\_E\_F\_
- Parameter explanation:

N\_: The row number of G code in NC program

- X\_: Specify the terminal position of axis X, Unit: unit, data type: LREAL.
- Y\_: Specify the terminal position of axis Y, Unit: unit, data type: LREAL.
- Z\_: Specify the terminal position of axis Z, Unit: unit, data type: LREAL.
- A\_: Specify the terminal position of axis A, Unit: unit, data type: LREAL.
- B\_: Specify the terminal position of axis B, Unit: unit, data type: LREAL.
- C\_: Specify the terminal position of axis C, Unit: unit, data type: LREAL.
- P\_: Specify the terminal position of axis P, Unit: unit, data type: LREAL.
- Q\_: Specify the terminal position of axis Q, Unit: unit, data type: LREAL.

E\_: Specify the acceleration and deceleration of the cutter. The positive number refers to the acceleration; the negative number refers to the deceleration; unit: unit/second<sup>2</sup>; data type: LREAL.

F\_: Specify the feed speed of the cutter, unit: unit/second, data type: LREAL.

When the cutter moves at a constant speed, the combined speed of all axes in G code is equal to F value.

The method of calculation is shown as below.

When two axes exist,  $F = \sqrt{V_1^2 + V_2^2}$ .

When three axes exist,  $F = \sqrt{V_1^2 + V_2^2 + V_3^2}$ 

For more axes, F value could be calculated in the same way as above.

#### Instruction explanation:

- 1. G1 can control one or more axes and other axis can be omitted.
- 2. Both of E and F can be omitted.

If there is only one row of code in the CNC editing area and E, F are omitted, the velocity, acceleration, deceleration and jerk are decided by the axis group parameters. They can be set via DMC\_SetG1Para. If there are multiple rows of codes and E and F in G1 code are omitted, the velocity, acceleration, deceleration of the cutter are based on valid E and F in the previous rows of codes. If the previous rows of G codes have not specified E and F, the axis group parameters will prevail.


- 3. Absolute mode decided by G90: The terminal position of G1 is based on 0 unit.
- Relative mode decided by G91: The terminal position of G1 is an incremental value beginning from the current position.
  - > Absolute mode example:

The initial positions of axis X, Y, Z are all 20000 units and their axis parameters are all default values. The G codes to be executed are:


N0 G90

N1 G1 X50000 Y60000 Z70000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

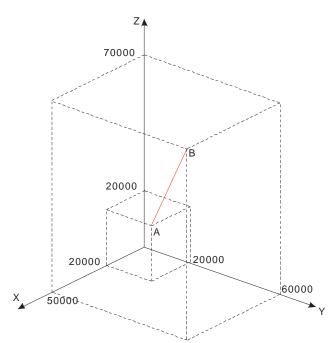


After G codes are executed, the Position/Time curve for the whole movement process is shown below:

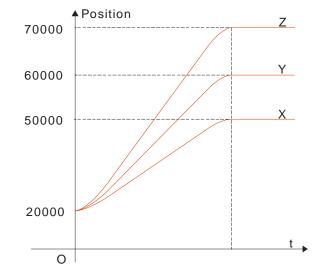

Relative mode example: The initial positions of axis X, Y, Z are all 20000 units and their axis parameters are all default value. The G codes to be executed are: N0 G91


N1 G1 X50000 Y60000 Z70000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

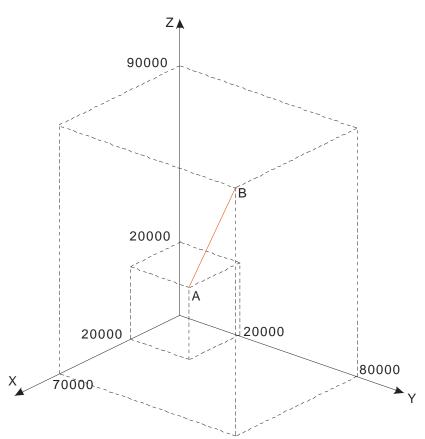

After G codes are executed, the Position/Time curve for the whole movement process is shown below:

11

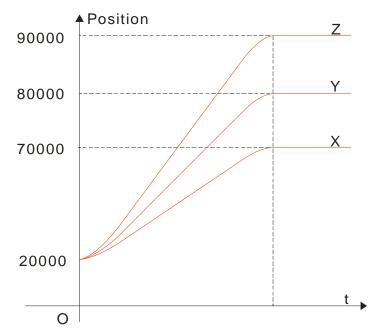


### 11.6.4.5 G2 (Clockwise Circular/ Helical Interpolation)

• Function:

Circular interpolation: The cutter conducts the cutting of the processed object in the clockwise direction at the feed speed given by parameter F on the circular arc with the fixed radius or the fixed center of a circle of the specified plane.

Helical interpolation: The cutter moves in the clockwise direction on the circular arc of the specified plane, which is circular interpolation and simultaneously moves in the vertical direction of the specified plane at the feed speed given by parameter F, which is linear interpolation.

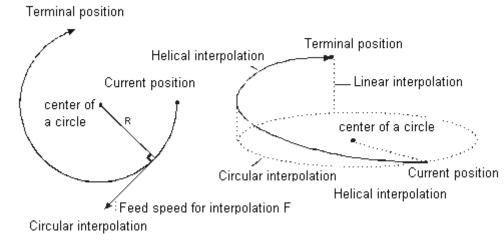

- Format: Format 1: N\_G2 X\_Y\_Z\_A\_B\_C\_P\_Q\_I\_J\_(I\_K\_/J\_K\_)T\_ E\_E\_F\_ Format 2: N\_G2 X\_Y\_Z\_A\_B\_C\_P\_Q\_R\_T\_ E\_E\_F\_
- Parameter explanation:

N\_: The row number of G code in NC program

X\_Y\_Z\_: Specify the terminal positions of axis X, Y and Z corresponding to the terminal point of circular arc; Unit: unit, data type: LREAL.

A\_B\_C\_P\_Q\_: Specify the terminal position of each added axis, Unit: unit, data type: LREAL.

I\_J\_: Specify the coordinate position of the center of a circle of XY plane, Unit: unit, data type: LREAL. I\_K\_: Specify the coordinate position of the center of a circle of XZ plane, Unit: unit, data type: LREAL. J\_K\_: Specify the coordinate position of the center of a circle of YZ plane, Unit: unit, data type: LREAL.


T\_: Specify the quantity of full circles, Unit: circle, data type: ULINT.

E\_: Specify the acceleration and deceleration of the cutter. The positive number refers to the acceleration; the negative number refers to the deceleration; Unit: unit/second<sup>2</sup>; data type: LREAL. F: Specify the feed speed of the cutter, Unit: unit/second, data type: LREAL.


- Instruction explanation:
  - 1. Two axes among axis X, Y and Z make the circular interpolation on the plane specified by instruction G17/G18/G19. The 3rd axis makes the linear interpolation in the direction vertical on the specified plane.
  - 2. The added axis A, B, C, P and Q make the linear interpolation. The linear interpolation and circular interpolation start up or stop simultaneously.
  - 3. Both of E and F can be omitted. If there is only one row of code in the CNC editing area and E, F are omitted, the velocity, acceleration, deceleration are decided by axis group parameters. They can be set via DMC\_SetG1Para instruction. If there are multiple rows of codes and E and F in G2 code are omitted, the velocity, acceleration, deceleration of the cutter are based on valid E and F in the previous rows of codes above the row where G2 is. If the previous rows of G codes have not specified E and F,

"maximum velocity", "maximum acceleration" and "maximum deceleration" among axis group parameters will prevail.

- 4. In absolute mode for G90, the terminal point of circular arc is the absolute coordinate value regarding 0 unit in their own directions as reference. In relative mode for G91, the terminal point of circular arc is the incremental value relative to the start point of circular arc.
- 5. No matter whether in the absolute mode or in relative mode, the coordinates of the center of a circle I\_J\_(I\_K\_/J\_K\_) are always relative coordinates with the start point as reference
- 6. T is the number of full circles; the path is a length of arc when T=0; it is the circle number of full circles plus the arc length when T is a constant.
- 7. Different from format 1, format 2 decides a circular arc via the start point, terminal point and radius. If the input value on the right of R parameter is a positive number (R+), the circular arc is the minor arc less than 180 degrees; if the input value on the right of R parameter is a negative number (R-), the circular arc is the major arc more than 180 degrees.
- 8. The following full lines are the motion path when G2 selects R+ and R- and the arrows on the arc indicate the motion direction.

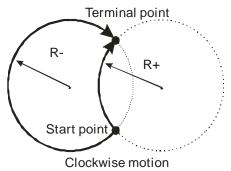


• The coordinate relations on different planes:

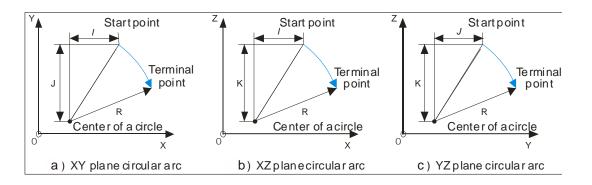

Please note the relations among the coordinate planes and I, J, K. Only two of I, J and K exist in one circular arc instruction. Which two exist depends on corresponding plane, e.g. on XY plane, only I and J show up.


The coordinate plane can be set by G17, G18 and G19. The circular and helical motion paths for G2 on different coordinate planes are shown as below.

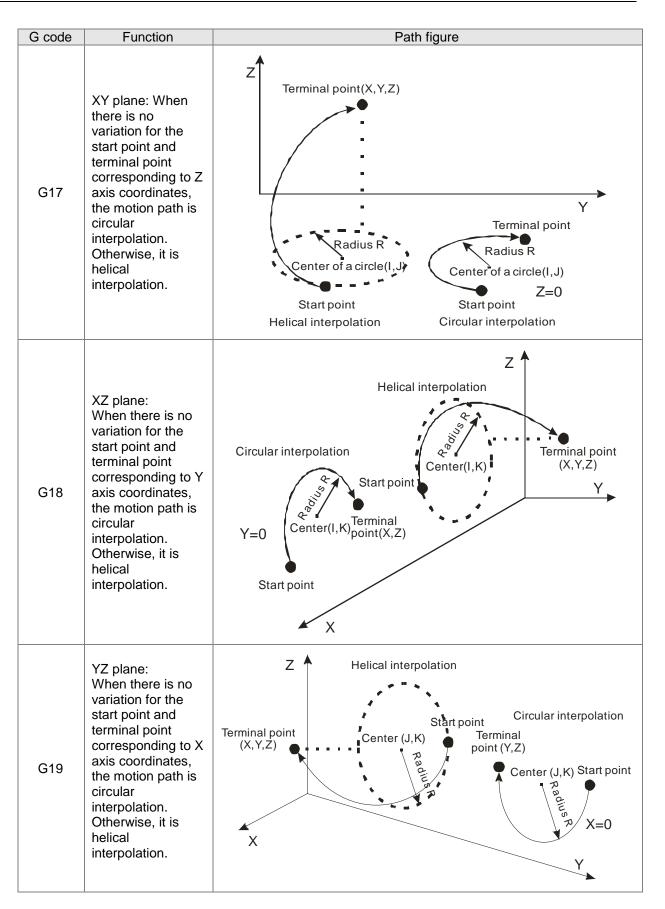

11

# Example 1

- Specify the center of a circle and conduct a circular interpolation in absolute mode
  - Current position (1000, 3000), axis parameters: default values, the G codes to be executed: N00 G90
     N01 G17
    - N02 G2 X4000 Y2000 I1000 J-2000 E5000 F5000
  - After G codes are executed, the Y/X curve for the whole movement process is shown below:

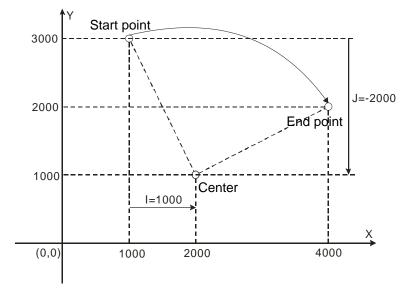


## Example 2:

- Specify the center of a circle and conduct a circular interpolation in relative mode
  - Current position (1000, 3000), axis parameters: default values, the G codes to be executed: N00 G91
    - N01 G17


N02 G2 X3000 Y-1000 I1000 J-2000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

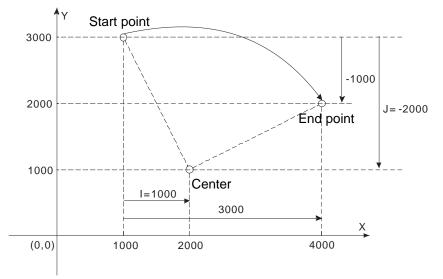

# Example 3:

- Specify the center of a circle and conduct a circular interpolation with T in relative mode
  - Current position (2000, 0), axis parameters: default values, the G codes to be executed: N00 G91
    - N01 G17
    - N02 G2 X-2000 Y2000 I0 J2000 T3
    - After G codes are executed, the path of the circular arc is 3 circles plus thick 1/4 of a circle. The Y/X curve for the whole movement process is shown below:

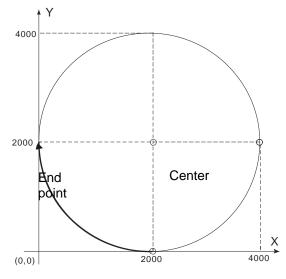

## Example 4:

Start point

#### • The helical interpolation with the center specified by XY plane

Current position (0, 0), axis parameters: default values, the G codes to be executed:


N00 G17

N01 G91

N02 G2 X200 Y200 Z200 I100 J100 E+10000 E-20000 F1000

#### Instruction explanation:


While G2 is being executed, axis regards 0 as the start point and axis coordinate parameters as the end points; the circular arc is drawn in clockwise direction; the final motion path is a helical curve. The projection on XY plane is an half of the circle with the center (100,100).

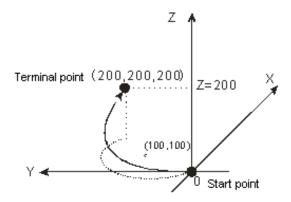

### Example 5:

Omission format

The G codes to be executed are: N00 G0 X0 Y0 Z0 N01 G1 X100 Y100 Z100 N02 G2 I100 J100 N03 G91 N04 G2 I50 J50

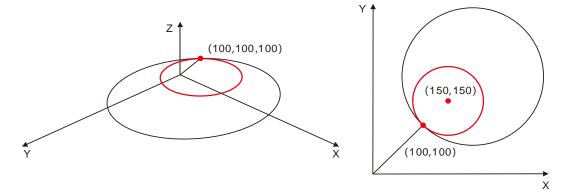

• Instruction explanation:

- 1. The axis position is (100, 100, 100) after execution of N01 row of instruction is finished;
- In N02 row of instruction, there are only I and J parameters and for other omitted parameter values, they are based on those valid in the last instruction. In other words, the N02 instruction is equivalent to: N02 X100 Y100 Z100 I100 J100. So both of the start point and end point are (100, 100, 100) and the motion path is a full circle.
- N03 row of instruction is G91 and the following coordinates are relative. Since X, Y and Z are omitted in N04 row of instruction, the terminal position are an absolute position (100, 100, 100). Thus the N04 path is a full circle with the start point (100,100,100) and end point of (100,100,100) and the center is (150,150).

#### Example 6:

Helical interpolation with the radius specified by XY plane (Current position: 0)

The G codes to be executed are:


N00 G2 X200 Y200 Z200 R-200

N01 G0 X0 Y0 Z0

N02 G2 X200 Y200 Z200 R200

#### • Instruction explanation:

The motion path is a major arc while the first G2 code is executed and it is a minor arc while the second G2 code is executed.

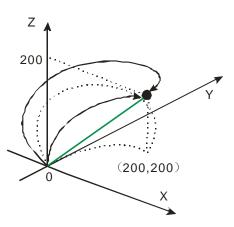


# Example 7:

The helical interpolation with T and the center specified on XY plane (Current position: 0)
 The G codes to be executed are:

N00 G2 X100 Y100 Z100 I50 J50 T2

#### • Instruction explanation:

The motion path is a helical curve and the projection on XY plane is a full circle with the center (50, 50).

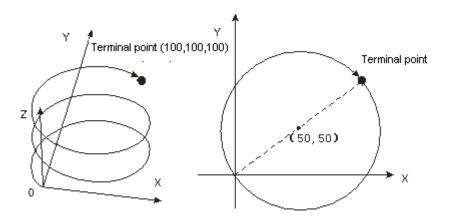


### 11.6.4.6 G3 (Anticlockwise Circular /Helical Interpolation)

• Function explanation:

Circular interpolation: The cutter conducts the arc cutting of the processed object in the anticlockwise direction at the feed speed given by parameter F on the circular arc with the fixed radius or the fixed center on the specified plane.

Helical interpolation: The cutter moves in the anticlockwise direction on the circular arc of the specified plane, which is a circular interpolation and simultaneously moves in the direction vertical to the specified plane at the feed speed given by parameter F, which is linear interpolation.

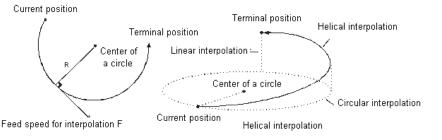

- Circular interpolation
- Format: Format1: N\_G3 X\_Y\_Z\_A\_B\_C\_P\_Q\_I\_J\_(I\_K\_/J\_K\_)T\_ E\_E\_F\_ Format2: N\_G3 X\_Y\_Z\_A\_B\_C\_P\_Q\_R\_T\_ E\_E\_F\_
- Parameter explanation:

N\_: The row number of G code in NC program

X\_Y\_Z\_: Specify the terminal positions of axis X, Y and Z corresponding to the terminal point of circular arc; Unit: unit, data type: LREAL.

A\_B\_C\_P\_Q\_: Specify the terminal positions of added axes, Unit: unit, data type: LREAL.

I\_J\_: Specify the coordinate position of the specified center on XY plane, Unit: unit, data type: LREAL. I\_K\_: Specify the coordinate position of the specified center on XZ plane, Unit: unit, data type: LREAL. J\_K\_: Specify the coordinate position of the specified center on YZ plane, Unit: unit, data type: LREAL. LREAL.

T\_: Specify the circle number of full circles, Unit: circle, data type: ULINT.


E\_: Specify the acceleration and deceleration of the cutter. The positive number indicates the acceleration; the negative number indicates the deceleration, Unit: unit/second<sup>2</sup>, data type: LREAL. F: Specify the feed speed of the cutter, Unit: unit/second, data type: LREAL.

- Instruction explanation:
  - Two axes among axis X, Y and Z make the circular interpolation on the plane specified by G17/G18/G19. The 3rd axis makes the linear interpolation in the direction vertical to the specified plane.
  - The added axis A, B, C, P and Q make the linear interpolation. The linear interpolation and circular interpolation start up or stop simultaneously.
  - Both of E and F can be omitted. If there is only one row of code in the CNC editing area and E, F are omitted, the velocity, acceleration and deceleration are decided by the axis group parameters.


If there are multiple rows of codes and E and F in G3 code are omitted, the velocity, acceleration and deceleration of the cutter are based on valid E and F in the previous rows of codes above the row where G3 is. If the previous rows of G codes have not specified E and F, "maximum velocity", "maximum acceleration" and "maximum deceleration" among axis group parameters will prevail.

- In absolute mode for G90, the terminal point of a circular arc is of absolute coordinate values regarding 0 unit in their respective directions as reference. In relative mode for G91, the terminal point of a circular arc is of incremental values relative to the start point of the circular arc.
- No matter whether in the absolute mode or in relative mode, the coordinates of the center of a circle I\_J\_(I\_K\_/J\_K\_) are always the relative coordinates with the start point as reference.
- T is the number of full circles; the path is a length of arc when T=0; the path is the corresponding full circles plus the arc length when T is a constant.
- Different from format 1, format 2 determines a length of circular arc via the start point, terminal point and radius. If the input value on the right of R parameter is a positive number (R+), the circular arc is a minor arc less than 180 degrees; if the input value on the right of R parameter is a negative number (R-), the circular arc is a major arc more than 180 degrees.

The following full lines are the motion paths when G3 selects R+ and R- and the arrows on the arcs refer to the motion direction.

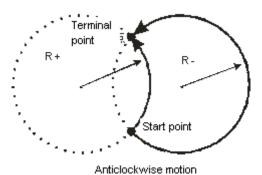


The coordinate relations on different planes:

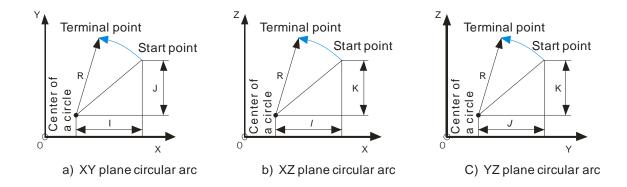

Please note the relations among the coordinate planes and I, J, K. Only two of I, J and K exist in one circular arc instruction. Which two exist depends on the corresponding plane, e.g. on XY plane, only I and J exist.

The coordinate plane can be set by G17, G18 and G19. The circular and helical motion paths for G3 on different coordinate planes are shown as below.

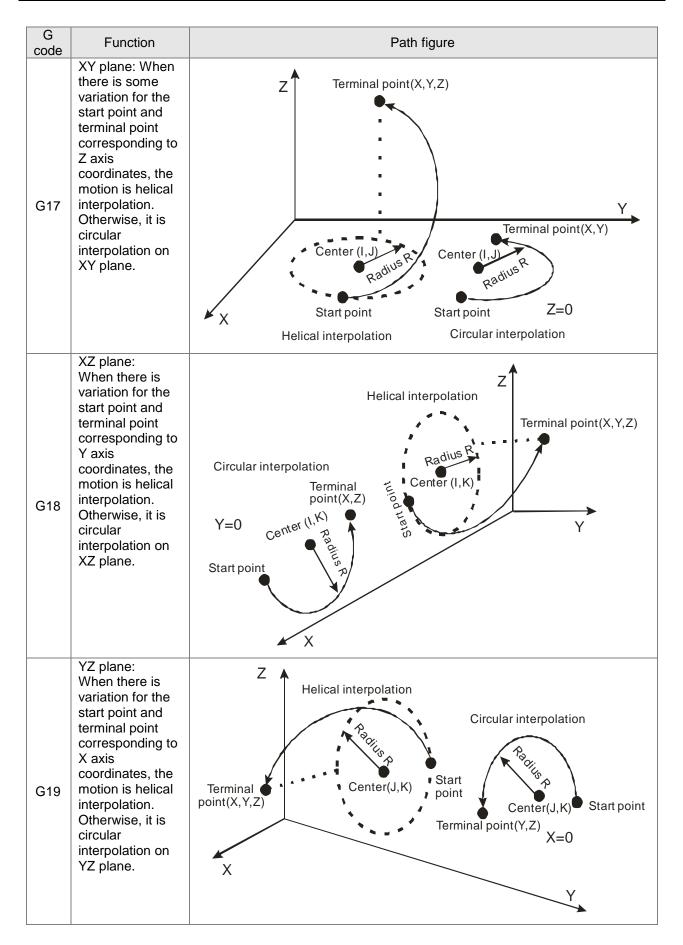




### 📕 Example 1

Specify the center of a circle and circular interpolation in absolute mode Current position (4000, 2000), axis parameters: default values, the G codes to be executed are: N0 G90

N1 G17

N2 G3 X1000 Y3000 I-2000 J-1000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

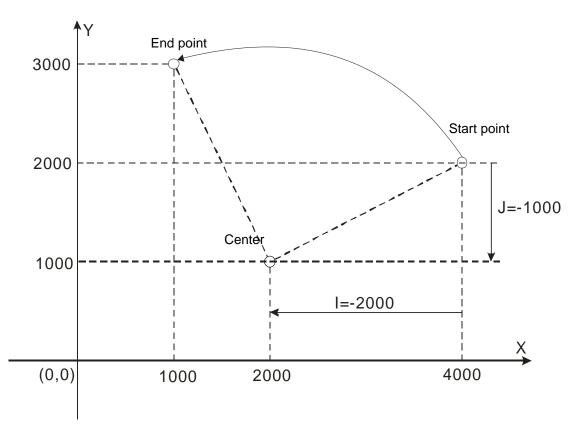


# 📕 Example 2

Specify the center of a circle and circular interpolation in relative mode Current position (4000, 2000), axis parameters: default values, the G codes to be executed are: N0 G91 N1 G17

N2 G3 X-3000 Y1000 I-2000 J-1000

After G codes are executed, the Y/X curve for the whole movement process is shown below:

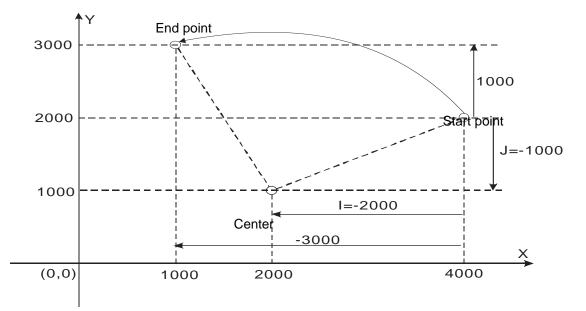

#### Example 3

• Specify the center of a circle and circular interpolation with T in relative mode


Current position (2000, 0), axis parameters: default values, the G codes to be executed are: N0 G91

N1 G17

N2 G3 X-2000 Y2000 I0 J2000 T3

• Instruction explanation:

After G codes are executed, the motion path is the arc on XY plane and the arc length is (3+3/4) times the circumference of a circle.

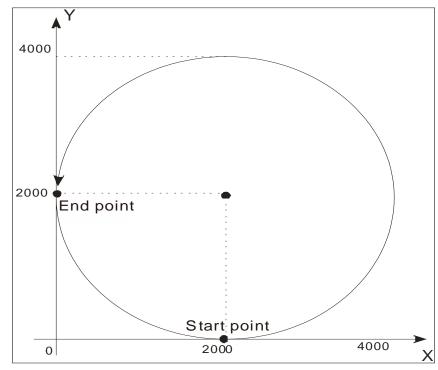

## Example 4

The helical interpolation with the center of a circle specified

Current position (0, 0), axis parameters: default values, the G codes to be executed are:


N0 G17

N1 G3 X100 Y100 Z100 I50 J50 T2

Instruction explanation:

Since the variation of Z axis is 100, the motion path is helical curve and the projection on XY plane is a full circle.

If there is no variation for Z axis, the motion path is the circular arc on XY plane with the center (50,50) and the arc length of 2.5 times the circumference of a full circle.

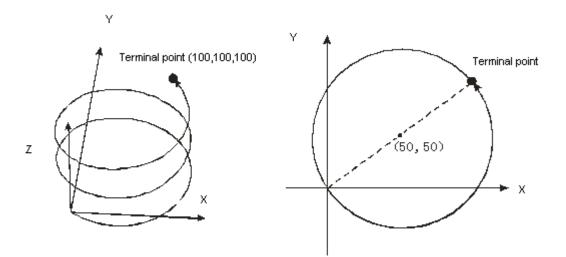


### 11.6.4.7 G17/G18/G19 (Specify Circular Interpolation Plane)

• Function:


The three instructions are used for deciding the selection of circular interpolation or helical interpolation plane and have no impact on the linear interpolation.

While the program is being executed, the three work planes can be switched with each other. If no plane option is set, the initial state of system is XY plane (G17).

- Format: N\_G17
   N\_G18
   N\_G19
- Parameter Explanation:
  - N\_: The row number of G code in NC program
- The figure of planes is shown as follows:

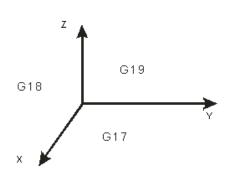

### 11.6.4.8 G4 (Dwell Instruction)

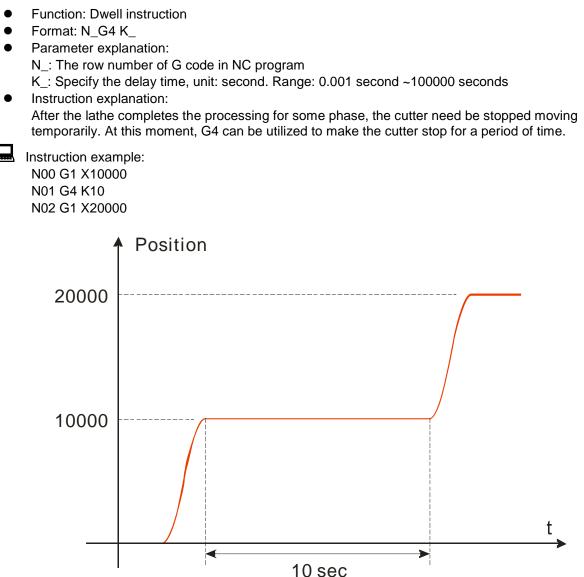

After execution of the instruction of number N0 is finished, the program will be delayed for 10 seconds and afterwards, the instruction of number N2 will continue to be executed.


### 11.6.4.9 G50 (Precise Stop)

- Function: Change the transition mode into precise stop. And the following transition modes are always precise stop. G51/G52 can be used for the switch in the execution process. The terminal actuator will reduce its speed to 0 between G codes.
- Format: N\_ G50
- Parameter Explanation:

N\_: The row number of G code in NC program

Example

N0 G50 N1 G1 X100 Y100 N2 G1 X300 Y100

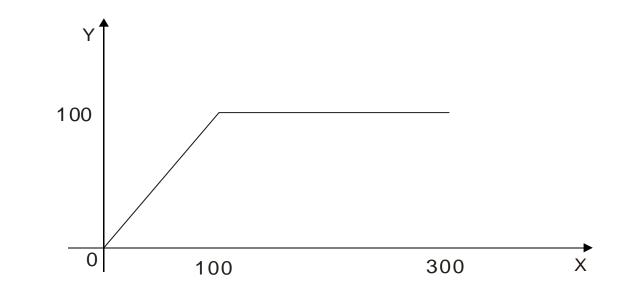

### 11.6.4.10 G51 (Round path transition)

- Function: To change the transition mode into arc transition. The following transition modes are always arc transition. G50/G52 can be used for the switch of transition modes in the execution process. The terminal actuator will not reduce its speed between G codes and the transition curve is an arc. In this mode, the speed of the first G code prevails as the entire motion speed and F can not be used for changing the speed in the motion. VelOverride parameter of DMC\_CartesianCoordinate instruction can be set to control the speed of terminal actuator.
- Format: N\_ G51 D\_
- Parameter Explanation:


N\_: The row number of G code in NC program


D\_: Radius of the arc



Example 1

N0 G51 D40 N1 G1 X100 Y100 N2 G1 X300 Y100

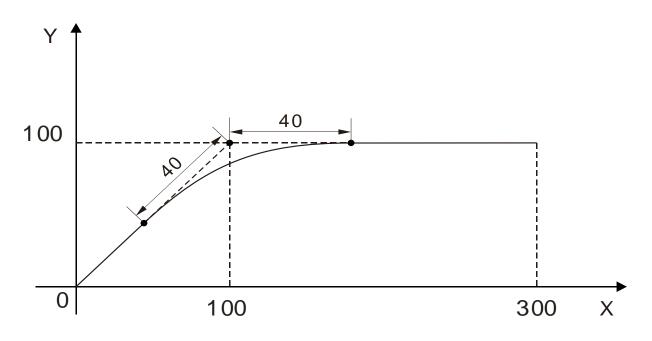

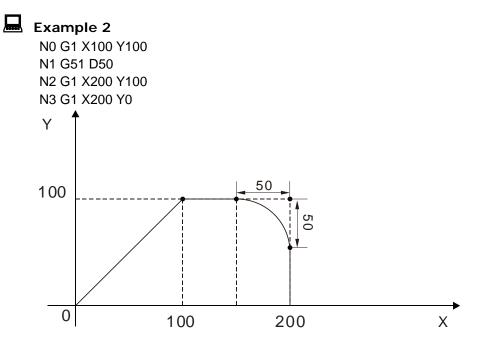

### 11.6.4.11 G52 (Smooth path transition)

- Function: To change the transition mode into smooth path transition. The following transition modes are always smooth path transition. G50/G51 can be used for the switch of transition modes in the execution process. The terminal actuator will not reduce its speed between G codes. It is suitable for continual interpolation of small segments. In this mode, the speed of the first G code prevails as the entire motion speed and F can not be used for changing the speed in the motion. VelOverride parameter of DMC\_CartesianCoordinate instruction can be set to control the speed of terminal actuator.
- Format: N\_ G52
- Parameter Explanation:


N\_: The row number of G code in NC program

### 📕 Example

Draw a part of a sin curve.

Draw a part of a sin curve.	
N0 G52	N1 G1 X0 Y0 E5 E-5 F5
N2 G1 X0.1 Y0.06282151816	N3 G1 X0.2 Y0.1255810391
N4 G1 X0.3 Y0.1882166266	N5 G1 X0.4 Y0.2506664671
N6 G1 X0.5 Y0.3128689301	N7 G1 X0.6 Y0.3747626292
N8 G1 X0.7 Y0.4362864828	N9 G1 X0.8 Y0.4973797743
N10 G1 X0.9 Y0.5579822121	N11 G1 X1 Y0.6180339887
N12 G1 X1.1 Y0.6774758405	N13 G1 X1.2 Y0.7362491054
N14 G1 X1.3 Y0.7942957813	N15 G1 X1.4 Y0.8515585831
N16 G1 X1.5 Y0.9079809995	N17 G1 X1.6 Y0.9635073482
N18 G1 X1.7 Y1.018082832	N19 G1 X1.8 Y1.07165359
N20 G1 X1.9 Y1.124166756	N21 G1 X2 Y1.175570505
N22 G1 X2.1 Y1.225814107	N23 G1 X2.2 Y1.274847979
N24 G1 X2.3 Y1.322623731	N25 G1 X2.4 Y1.369094212
N26 G1 X2.5 Y1.414213562	N27 G1 X2.6 Y1.457937255
N28 G1 X2.7 Y1.500222139	N29 G1 X2.8 Y1.541026486
N30 G1 X2.9 Y1.580310025	N31 G1 X3 Y1.618033989
N32 G1 X3.1 Y1.654161149	N33 G1 X3.2 Y1.688655851

N34 G1 X3.3 Y1.721484054	N35 G1 X3.4 Y1.75261336
N36 G1 X3.5 Y1.782013048	N37 G1 X3.6 Y1.809654105
N38 G1 X3.7 Y1.835509251	N39 G1 X3.8 Y1.859552972
N40 G1 X3.9 Y1.881761538	N41 G1 X4 Y1.902113033
N42 G1 X4.1 Y1.920587371	N43 G1 X4.2 Y1.937166322
N44 G1 X4.3 Y1.951833524	N45 G1 X4.4 Y1.964574501
N46 G1 X4.5 Y1.975376681	N47 G1 X4.6 Y1.984229403
N48 G1 X4.7 Y1.991123929	N49 G1 X4.8 Y1.996053457
N50 G1 X4.9 Y1.999013121	N51 G1 X5 Y2
N52 G1 X5.1 Y1.999013121	N53 G1 X5.2 Y1.996053457
N54 G1 X5.3 Y1.991123929	N55 G1 X5.4 Y1.984229403
N56 G1 X5.5 Y1.975376681	N57 G1 X5.6 Y1.964574501
N58 G1 X5.7 Y1.951833524	N59 G1 X5.8 Y1.937166322
N60 G1 X5.9 Y1.920587371	N61 G1 X6 Y1.902113033
N62 G1 X6.1 Y1.881761538	N63 G1 X6.2 Y1.859552972
N64 G1 X6.3 Y1.835509251	N65 G1 X6.4 Y1.809654105
N66 G1 X6.5 Y1.782013048	N67 G1 X6.6 Y1.75261336
N68 G1 X6.7 Y1.721484054	N69 G1 X6.8 Y1.688655851
N70 G1 X6.9 Y1.654161149	N71 G1 X7 Y1.618033989
N72 G1 X7.1 Y1.580310025	N73 G1 X7.2 Y1.541026486
N74 G1 X7.3 Y1.500222139	N75 G1 X7.4 Y1.457937255
N76 G1 X7.5 Y1.414213562	N77 G1 X7.6 Y1.369094212
N78 G1 X7.7 Y1.322623731	N79 G1 X7.8 Y1.274847979
N80 G1 X7.9 Y1.225814107	N81 G1 X8 Y1.175570505
N82 G1 X8.1 Y1.124166756	N83 G1 X8.2 Y1.07165359
N84 G1 X8.3 Y1.018082832	N85 G1 X8.4 Y0.9635073482
N86 G1 X8.5 Y0.9079809995	N87 G1 X8.6 Y0.8515585831
N88 G1 X8.7 Y0.7942957813	N89 G1 X8.8 Y0.7362491054
N90 G1 X8.9 Y0.6774758405	N91 G1 X9 Y0.6180339887
N92 G1 X9.1 Y0.5579822121	N93 G1 X9.2 Y0.4973797743
N94 G1 X9.3 Y0.4362864828	N95 G1 X9.4 Y0.3747626292
N96 G1 X9.5 Y0.3128689301	N97 G1 X9.6 Y0.2506664671
N98 G1 X9.7 Y0.1882166266	N99 G1 X9.8 Y0.1255810391
N100 G1 X9.9 Y0.06282151816	N101 G1 X10 Y0

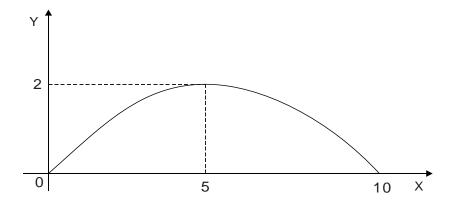



#### 11.6.4.12 M Code

- Function: Interacts with general programs.
- Format: N\_ M\_ D\_
- Parameter Explanation:
  - N\_ : The row number of M code in NC program
  - M\_: The number of M code, range: 0~99
  - D\_: Output parameter, data type: LREAL.
- Instruction Explanation:
  - 1. D\_ can be omitted and then no paramter is output after M code is executed.
  - 2. Two methods of using M code: one is to write it outside the row of G code; the other is to write it in the row of G code.
  - 3. When M code and G code are not in the same row, e.g. N0 M10 D10.02 ; N1 G1 X100 Y100. When arriving at the row N0, G code exution will stop. Meanwhile, DMC\_ReadMFunction is used to read the state of M code, MFuntion is TRUE and the value of MFunctionValue is 10.02. After M code is reset by using DMC\_ResetMFunction intruction, G code execution will continue and then N1 row will be executed.
  - 4. When M code and G code are in the same row and M code can only be placed after G code, e.g. N0 G1 X100 M10 D10.02. When the execution arrives at N0 row, G1 is executed. Meanwhile, DMC\_ReadMFunction is used to read the state of M code, MFunction is TRUE and the value of MFunctionValue is 10.02. The following execution will continue after G1 execution is finished and reset instruction will no be needed to reset M code.

# 🔜 Example

N0 G1 X100 Y50 N1 M20 N2 G1 X200 Y50 M21 D3.14 N3 G1 X300 Y150

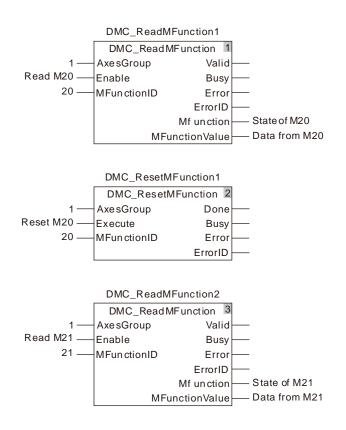

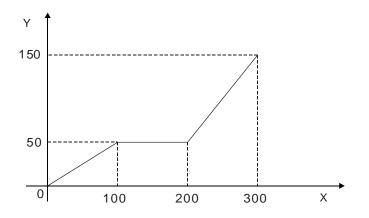

When the two variables "Read M20" and "Read M21" are TRUE, G code execution starts and the terminal actuator stops at the position  $(100 \cdot 50)$ . At the moment, the variable "State of M20" is TRUE. After the execution of other actions is finished, the variable "Reset M20" changes to TRUE and M code is reset. Then G code execution continues. The terminal actuator starts to move to (200, 50). Meanwhile, the variable "state of M21" changes to TRUE and the value of "Data from M21" variable is 3.14. The terminal actuator will not stop at that time. After reaching the position (200, 50), it will keep moving till the poition (300, 150) is reached and the execution is completed.

11

# 11.6.5 G Code Instructions

## 11.6.5.1 DMC\_CartesianCoordinate

FB/FC	Explanation	Applicable model
FB	DMC_CartesianCoordinate is used for controlling the Cartesian- coordinate robotic arm to make the interpolation in accordance with G code.	AS524C-B

#### ${\sf DMC\_CartesianCoordinate\_instance}$

DMC_CartesianCoordinate		
 Execute	Done	
 Pause	Busy	
 Stop	Active	
 VelOverride	CommandAborted	
 Depth	Error	
 NCFile	ErrorID	
 AxesGroup	CurrentLine	
 Mode		
 Res		

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Pause	When <i>Pause</i> changes from FALSE to TRUE, the Cartesian-coordinate robotic arm stops executing G code temporarily.	BOOL	TRUE or FALSE (FALSE)	
Stop	When <i>Stop</i> changes from FALSE to TRUE, the Cartesian-coordinate robotic arm terminates the executio of G code.	BOOL	TRUE or FALSE (FALSE)	
VelOverride	Velocity override (%)	LREAL	0~500 (0)	When <i>Execute</i> changes from FALSE to TRUE.
Depth	Fill 1 for internal reservation	UINT	1	When <i>Execute</i> changes from FALSE to TRUE.
NCFile	The number of the NC file	UINT	1~64 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
AxesGroup	The number of the axes group	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Mode	Fill 0 for internal reservation	INT	0	When <i>Execute</i> changes from FALSE to TRUE.

11-291

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Res	Reserved			

### Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the axis is under control of the instruction.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
CurrentLine	The number of the row where the G code is being executed currently.	UDINT	

## Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the G code execution is finished.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is done.</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>TRUE when the instruction is controlling axes.</li> </ul>	-
CommandAborted	<ul> <li>TRUE when the instruction execution is aborted by other instruction.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li><i>CommandAborted</i> changes to TRUE when the instruction execution is aborted by other instruction after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One period later, <i>CommandAborted</i> changes to FALSE.</li> </ul>
Error	<ul> <li>The input parameters for the instruction are illegal or an error occurs in the instruction execution.</li> </ul>	When Execute changes from TRUE to FALSE

•

#### Output Update Timing Chart

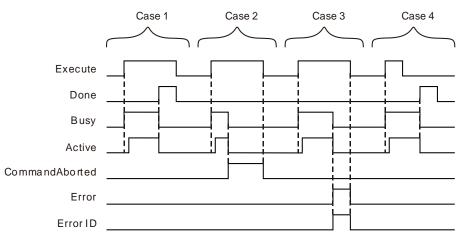

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Active* changes to TRUE. When positionging is done, *Done* changes to TRUE. Meanwhile *Busy* and *Active* change to FALSE.
- **Case 2**: If the instruction is aborted by MC\_Stop or MC\_Halt after *Execute* changes from FALSE to TRUE, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs after *Execute* changes from FALSE to TRUE, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.
- **Case 4**: When the instruction execution is finished after *Execute* changes from TRUE to FALSE during the instruction execution, *Done* changes to TRUE and meanwhile, *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.

#### Function

DMC\_CartesianCoordinate instruction is used for controlling the Cartesian-coordinate robotic arm to make the interpolation in accordance with G code. It is applied to the engraving machine and sewing machine which regard the Cartesian coordinate robot as <u>mathematical model</u>. The firmware of V1.01 and above supports the function.

- 1. Pause is used for temporarily stopping the execution of G code. After Pause is set to TRUE, the terminal actuator wil reduce its velocity to 0 according to the specified deceleration rate. When pausing is finished, Pause is set to FALSE. The terminal actuator will speed up at the specified acceleration rate till the target velocity is reached and the G code interpolation will continue.
- 2. Stop is used to terminate the execution of G code. Once Stop is set to TRUE, the terminal actuator will stop immediately and meanwhile *Done* of the instruction changes to TRUE and the G code execution is terminated.
- 3. VelOverride is used for changing the velocity of the terminal actuator ranging from 0~500 with the unit: %. "100" means "100%". The velocity of the terminal actuator after modification= The velocity of the terminal actuator before modification x override value. The axis will accerate or decelerate till the target velocity after modification is reached according to the acceration rate and deceleration rate of the G code which is being executed currently.
- 4. *NCFile* is used to specify the NC file number for execution. The number is the ID of the CNC file built in the programming software.
- 5. AxesGroup is to specify the number of the axes group which is to perform G code.
- 6. Before using the DMC\_CartesianCoordinate instruction, the axes in the axes group must be in standstill. Otherwise, there will be an error in the instruction execution.

7. Before the instruction controls axes motion, axes should be adjusted with single-axis instructions to the position where G code execution starts first. Then DMC\_AddAxisToGroup is used to add individual axes to the axes group. Afterwards, DMC\_SetG0Para and DMC\_SetG1Para are used to set relevant parameters of G0 and G1/G2/G3. Finally the DMC\_CartesianCoordinate instruction is executed to control axes for interpolation along the path planned via G codes.


# Programming Example

#### 1. The variable table and program

Variable name	Data type	Initial value
Pwr	MC_Power	
Axis1	USINT	1
Pwr_En	BOOL	FALSE
Pwr_BM	MC_Buffer_Mode	0
Pwr_Sta	BOOL	
Pwr_Bsy	BOOL	
Pwr_Act	BOOL	
Pwr_Err	BOOL	
Pwr_ErrID	WORD	
Pwr1	MC_Power	
Axis2	USINT	2
Pwr1_BM	MC_Buffer_Mode	0
Pwr1_Sta	BOOL	
Pwr1_Bsy	BOOL	
Pwr1_Act	BOOL	
Pwr1_Err	BOOL	
Pwr1_ErrID	WORD	
ATG	DMC_AddAxisToGroup	
Axes1	USINT	1
ATG_Ex	BOOL	FALSE
ATG_Done	BOOL	
ATG_Bsy	BOOL	
ATG_Err	BOOL	
ATG_ErrID	WORD	
ATG1	DMC_AddAxisToGroup	
ATG1_Ex	BOOL	FALSE
ATG1_Done	BOOL	
ATG1_Bsy	BOOL	
ATG1_Err	BOOL	
ATG1_ErrID	WORD	
SG1 DMC_SetG1Para		
SG1_AG	USINT	1
SG1_Ex	BOOL	FALSE
SG1_Vel	LREAL	10000
SG1_Acc	LREAL	5000
SG1_Dec	LREAL	5000
SG1_Jer	LREAL	5000


Variable name	Data type	Initial value
SG1_Done	BOOL	
SG1_Bsy	BOOL	
SG1_Err	BOOL	
SG1_ErrID	WORD	
CC	DMC_CartesianCoordinate	
CC_Ex	BOOL	FALSE
CC_Pa	BOOL	FALSE
CC_St	BOOL	FALSE
CC_Done	BOOL	
CC_Bsy	BOOL	
CC_Act	BOOL	
CC_Abt	BOOL	
CC_Err	BOOL	
CC_ErrID	WORD	
CC_CL	UDINT	


G code: N0 G1 X1000 Y1000 N1 G1 X5200 Y3500

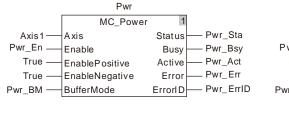


	DMC_AddAxis		
Axes1 —	AxesGroup	Done	— ATG_Done
Axis1 —		Busy	— ATG_Bsy
ATG_Ex —	Execute	Error	ATG_Err
1 —	IdenthGroup	ErrorID	— ATG_ErrID

SG 1			
	DMC_SetG1Para 5		
A xes1 — A	xesGroup	Done	
SG1_Ex — E	xecute	Busy	— SG1_Bsy
SG1_Vel -V	/elocity	Error	- SG1_Err
SG1_Acc A	cceleration	ErrorID	- SG1_ErrID
SG1_Dec -D	Deceleration		
SG1_Jer — Je	erk		

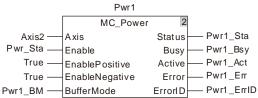


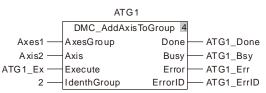

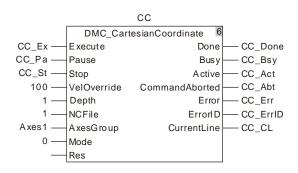

11

#### 2. Motion Curve

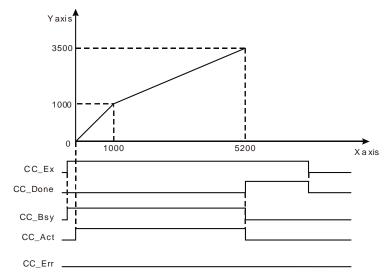

- When Pwr\_En is set to TRUE, MC\_Power instruction is executed to enable two axes. Then ATG\_Ex and ATG1\_Ex are set to TRUE and DMC\_AddAxisToGroup instruction is executed to add Axis1 and Axis2 to the axes group Axes1. Afterwards, set SG1\_Ex to TRUE to execute DMC\_SetG1Para instruction and set the default velocity of G1/G2/G3. At last, CC\_Ex is set to TRUE and DMC\_ CartesianCoordinate instruction is executed to control axis 1 and axis 2 for the interpolation based on the path planned via G codes.
- When CC\_Ex changes from FALSE to TRUE, DMC\_CartesianCoordinate instruction is executed. In the same cycle, CC\_Bsy changes from FALSE to TRUE. In the second cycle, CC\_Act changes from FALSE to TRUE, the robot will move according to the path planned via G code. After G code execution is completed, the output CC\_Done changes from FALSE to TRUE and meanwhile CC\_Bsy and CC\_Act change from TRUE to FALSE.
- When CC\_Ex changes from TRUE to FALSE, CC\_Done changes from TRUE to FALSE.

FB/FC	Explanation			Applicable model
FB	DMC_ReadMFunction is used for ResetMFunction			AS524C-B
DMC_ReadMFunction_instance				
		DMC_ReadMFunction		
		AxesGroup	Valid —	
		Enable	Busy —	
		MFunctionID	Error	
			Errorl D —	
		MFunction —		
		MFunctionValue		

## 11.6.5.2 DMC\_ReadMFunction

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The number of the axes group	USINT	1~8 (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
MFunctionID	The number of a M code	USINT	0~99 (The variable value must be set)	When <i>Enable</i> changes to TRUE

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-
MFunction	TRUE when the M code is reached during G code execution.	BOOL	TRUE / FALSE
MFunctionValue	The value of M code parameter is output here when the output <i>MFunction</i> is TRUE.	LREAL	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the instruction reads the state of M code.</li> </ul>	◆ When <i>Enable</i> changes from TRUE to FALSE.
Busy	<ul> <li>When Enable changes to TRUE.</li> </ul>	<ul> <li>When Valid changes to TRUE</li> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an input parameter is illegal or an error occurs during the instruction execution.</li> </ul>	

11

#### **Output Update Timing Chart**

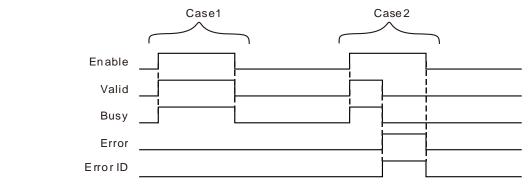

- Case 1 : When Enable changes from FALSE to TRUE, Valid and Busy change to TRUE simultaneously. When Enable changes to FALSE, Valid and Busy both change to FALSE.
- **Case 2**: When an error occurs, *Error* changes to TRUE and *ErrorID* shows corresponding error codes. Meanwhile Busy and Valid change to FALSE. When Enable changes from TRUE to FALSE, Error changes to FALSE and the value in ErrorID is cleared.

#### **Function**


DMC\_ReadMFunction is used for reading the state of M code and the data from it. When the G code execution reaches where the M code set by the instruction is, MFunction changes to TRUE and meanwhile MFunctionValue outputs the parameter value after M code. The firmware of V1.01 and above supports the function.

1.	I he variable table and program					
	Variable name	Data type	Initial value			
	RMF	DMC_ReadMFunction				
	Axes1	USINT	1			
	RMF_En	BOOL	FALSE			
	RMF_MID	USINT	0			
	RMF_Va	BOOL				
	RMF_Bsy	BOOL				
	RMF_Err	BOOL				
	RMF_ErrID	WORD				
	RMF_MF	BOOL				
	RMF_MFV	LREAL				


#### **Programming Example**

#### The variable table and program 1



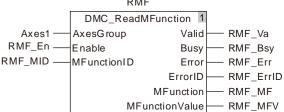

#### 2. Timing Chart

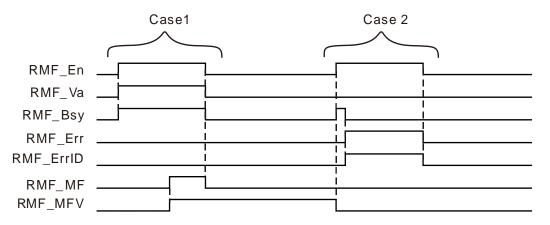

- When RMF\_En changes from FALSE to TRUE and DMC\_ReadMFunction instruction is executed, RMF\_Va and RMF\_Bsy change from FALSE to TRUE in the first cycle. When G code execution reaches where the set M code is, RMF\_MF changes from FALSE to TRUE and meanwhile RMF\_MFV outputs M code parameter value. When RMF\_En changes from TRUE to FALSE, RMF\_Va, RMF\_Bsy and RMF\_MF change from TRUE to FALSE in the same cycle and the M code parameter value of RMF\_MFV is not cleared.
- When RMF\_En changes from FALSE to TRUE, an error in the instruction parameter input occurs, RMF\_Bsy changes from FALSE to TRUE in the first cycle and the M code parameter value which was executed last time is cleared. In the second cycle, RMF\_Err changes from FASLE to TRUE, meanwhile RMF\_Bsy changes from TRUE to FALSE and RMF\_ErrID outputs corresponding error codes. When RMF\_En changes from TRUE to FALSE, RMF\_Err changes from TRUE to FALSE and meanwhile the value in RMF\_ErrID is cleared.

# 11.6.5.3 DMC\_ResetMFunction

FB/FC	Explanation	Applicable model AS524C-B	
FB	DMC_ResetMFunction instruction resets the state of M code.		

#### $\mathsf{DMC}\_\mathsf{Reset}\mathsf{MFunction}\_instance$

DMC_ResetMFunction		
 AxesGroup	Done	
 Execute	Busy	
 MFunctionID	Error	
	ErrorlD	

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The number of the axes group	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
MFunctionID	The number of the M code	USINT	0~99 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done TRUE when the instruction execution is completed.		BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.		TRUE / FALSE
Error	Error TRUE when an error occurs in execution of the instruction.		TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

# Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When resetting M code is finished.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an input parameter is illegal or an error occurs during the instruction execution.</li> </ul>	When Execute changes from TRUE to FALSE

#### Output Update Timing Chart

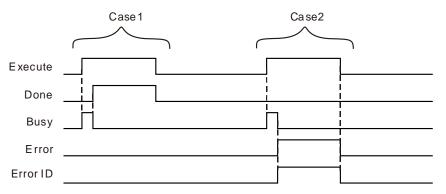

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.


#### Function

DMC\_ResetMFunction instruction resets the state of M code. When G code execution reaches where M code set by the intruction is, the output state of M code is TRUE and DMC\_ResetMFunction instruction is executed. The output state of M code is reset to FALSE and G code execution will continue. The firmware of V1.01 and above supports the function.

# **Programming Example**

#### 1. The variable table and program

Variable name	Data type	Initial value
RMF	DMC_ReadMFunction	
Axes1	USINT	1
RMF_En	BOOL	FALSE
RMF_MID	USINT	0
RMF_Va	BOOL	
RMF_Bsy	BOOL	
RMF_Err	BOOL	
RMF_ErrID	WORD	
RMF_MF	BOOL	
RMF_MFV	LREAL	
REM	DMC_ResetMFunction	
REM_Ex	BOOL	FALSE
REM_MID	USINT	0
REM_Done	BOOL	
REM_Bsy	BOOL	
REM_Err	BOOL	
REM_ErrID	WORD	

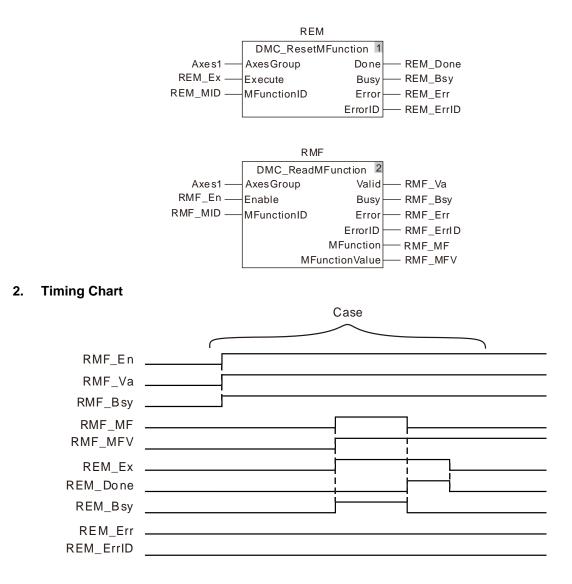

- When RMF\_En changes from FALSE to TRUE, DMC\_ReadMFunction instruction is executed. In the same cycle, RMF\_Va and RMF\_Bsy change from FALSE to TRUE. When G code execution reaches where the set M code is, RMF\_MF changes from FALSE to TRUE and meanwhile RMF\_MFV outputs M code parameter value.
- When REM\_Ex changes from FALSE to TRUE, DMC\_ResetMFunction instruction is executed. In the same cycle, REM\_Bsy changes from FALSE to TRUE. In the second cycle, REM\_Done changes from FALSE to TRUE. Meanwhile the output RMF\_MF of DMC\_ReadMFunction changes from TRUE to FALSE and REM\_Bsy changes from TRUE to FALSE. When REM\_Ex changes from TRUE to FALSE, REM\_Done changes from TRUE to FALSE in the same cycle.

11

# FB/FC Explanation Applicable model FB DMC\_SetG0Para is used for setting the velocity, acceleration, deceleration and jerk of G0. AS524C-B

# 11.6.5.4 DMC\_SetGOPara

DMC_SetG0Para_instance		
DMC_SetG0Para		
 AxesGroup	Done	
 Execute	Busy	
 Velocity	Error	
 Acceleration	ErrorlD	
 Deceleration		
 Jerk		

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The number of the axes group	USINT	1~8 (The variable value	When <i>Execute</i> changes from
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to	BOOL	must be set) TRUE or FALSE (FALSE)	FALSE to TRUE.
Velocity	TRUE. Specify the target speed (Unit: unit/second)	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Acceleration	Specify the target acceleration rate. (Unit: Unit/s <sup>2</sup> )	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Specify the target jerk. (Unit: Unit/s <sup>3</sup> )	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	rror TRUE when an error occurs in execution of the instruction.		TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

#### • Output Update Timing

Name	Timing for changing to TRUE		:	Timing for changing to FALSE
Done	♦ When the	e setting is	s ′	When Execute changes from TRUE to FALSE after the
Done	completed.			instruction execution is completed.

Name	Timing for changing to TRUE	Timing for changing to FALSE
Buoy	♦ When <i>Execute</i> changes to	When Done changes to TRUE
Busy	TRUE.	<ul> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an input parameter is illegal or an error occurs during the instruction execution.</li> </ul>	When Execute changes from TRUE to FALSE

#### Output Update Timing Chart

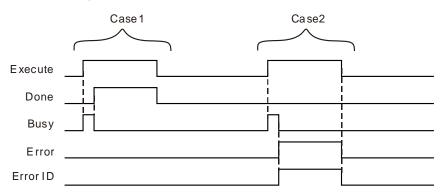

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and meanwhile *Busy* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.


#### Function

DMC\_SetG0Para is used for setting the velocity, acceleration, deceleration and jerk of G0. When G0 of G codes is executed, the velocity, acceleration, deceleration and jerk will be performed according to the parameters set by DMC\_SetG0Para instruction. The firmware of V1.01 and above supports the function.


# 📕 Programming Example

#### 1. The variable table and program

Variable name	Data type	Initial value
SG0	DMC_SetG0Para	
Axes1	USINT	1
SG0_Ex	BOOL	FALSE
SG0_Vel	ARRAY[18]OF LREAL	
SG0_Acc	ARRAY[18]OF LREAL	
SG0_Dec	ARRAY[18]OF LREAL	
SG0_Jer	ARRAY[18]OF LREAL	
SG0_Done	BOOL	
SG0_Bsy	BOOL	
SG0_Err	BOOL	
SG0_ErrID	WORD	

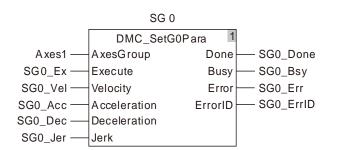

#### 2. Timing Chart

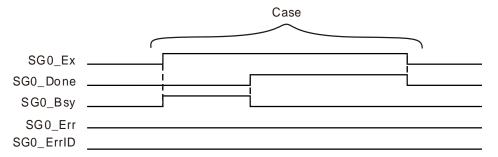

- When SG0\_Ex changes from FALSE to TRUE, DMC\_SetG0Para instruction is executed. In the same cycle, SG0\_Bsy changes from FALSE to TRUE. In the second cycle, SG0\_Done changes from FALSE to TRUE and meanwhile SG0\_Bsy changes from TRUE to FALSE. So G0 among G codes will be executed according to the velocity, acceleration, deceleration and jerk which are set by the instruction.
- When SG0\_Ex changes from TRUE to FALSE, SG0\_Done changes from TRUE to FALSE.

# 11.6.5.5 DMC\_SetG1Para

FB/FC	Explanation	Applicable model
FB	DMC_SetG1Para instruction sets the default velocity, acceleration, deceleration and jerk for G1/G2/G3.	AS524C-B
	DMC_SetG1Para_instance	

DMC_SetG1Para			
 AxesGroup	Done		
 Execute	Busy		
 Velocity	Error		
 Acceleration	ErrorlD		
 Deceleration			
 Jerk			

#### **Input Parameters**

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The number of the axes group	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Velocity	Specify the target speed (Unit: unit/second)	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Acceleration	Specify the target acceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Specify the target deceleration rate. (Unit: Unit/s <sup>2</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Specify the target jerk. (Unit: Unit/s <sup>3</sup> )	LREAL	Positive number (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.

#### **Output Parameters** •


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

# Output Update Timing

Name	Timing for changing to TRUE					Timing for changing to FALSE
Done	♦ When	the	setting	is	٠	When <i>Execute</i> changes from TRUE to FALSE after the

Name	Timing for changing to TRUE	Timing for changing to FALSE
	completed.	instruction execution is completed.
Busy	◆ When Execute changes to	When Done changes to TRUE
Busy	TRUE.	<ul> <li>When Error changes to TRUE</li> </ul>
Error	<ul> <li>When an input parameter is illegal or an error occurs during the instruction execution.</li> </ul>	

#### Output Update Timing Chart

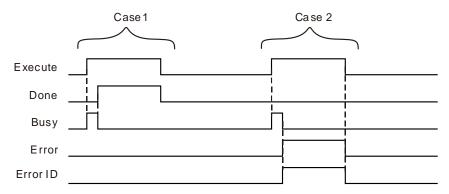

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.


#### Function

DMC\_SetG1Para instruction sets the default velocity, acceleration, deceleration and jerk for G1/G2/G3. When G codes execution reaches G1/G2/G3, G1/G2/G3 will be performed according to the velocity, acceleration and deceleration set by the instruction if E and F values are not specified. Otherwise, they will run based on the filled E and F values in G codes. The firmware of V1.01 and above supports the function.

# Programming Example

#### 1. The variable table and program

Variable name	Data type	Initial value
SG1	DMC_SetG1Para	
Axes1	USINT	1
SG1_Ex	BOOL	FALSE
SG1_Vel	LREAL	5000
SG1_Acc	LREAL	1000
SG1_Dec	LREAL	1000
SG1_Jer	LREAL	1000
SG1_Done	BOOL	
SG1_Bsy	BOOL	
SG1_Err	BOOL	
SG1_ErrID	WORD	

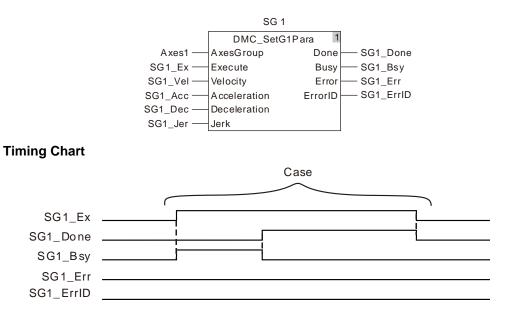

- When SG1\_Ex changes from FALSE to TRUE, DMC\_SetG1Para instruction is executed. In the same cycle, SG1\_Bsy changes from FALSE to TRUE. In the second cycle, SG1\_Done changes from FALSE to TRUE and meanwhile SG1\_Bsy changes from TRUE to FALSE. So G1 among G codes will be executed according to the velocity, acceleration, deceleration and jerk which are set by the instruction.
- When SG1\_Ex changes from TRUE to FALSE, SG1\_Done changes from TRUE to FALSE.

2.

FB/FC	Explanation	Applicable model
FB	DMC_SetStartPosition instruction sets the start positions of axes of G code.	AS524C-B
	DMC_SetStartPosition_instance	
	DMC_SetStartPosition	
	AxesGroup Done	
	Execute Busy	
	X_StartPos Error	
	-Y_StartPos ErrorID	
	Z_Start Pos	
	— A_StartPos	
	B_StartPos	
	C_StartPos	
	P_StartPos	

Q\_StartPos

# 11.6.5.6 DMC\_SetStartPosition

# Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The number of the axes group	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
X_StartPos	Specify the start positionof X axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
Y_StartPos	Specify the start positionof Y axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
Z_StartPos	Specify the start positionof Z axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
A_StartPos	Specify the start positionof A axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
B_StartPos	Specify the start positionof B axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
C_StartPos	Specify the start positionof C axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
P_StartPos	Specify the start positionof P axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.

11

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Q_StartPos	Specify the start positionof Q axis.	LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	-

#### Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the setting is completed.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE after the instruction execution is completed.</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an input parameter is illegal or an error occurs during the instruction execution.</li> </ul>	When Execute changes from TRUE to FALSE.

#### Output Update Timing Chart

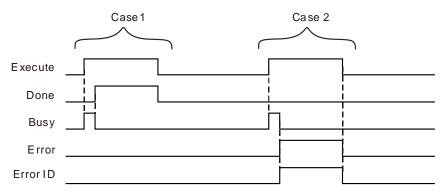

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.

#### Function

DMC\_SetStartPosition instruction sets the start positions of 8 axes of G code. After the instruction is executed, the motion begins from the start positions of X, Y, Z, A, B, C, P and Q axes specified by the instruction. For example, the start position of X axis is set to 10000 and G code is G0 X1000. So if G code is to be executed, for X axis, the motion will begin from the position 10000 and get to 1000. The firmware of V1.01 and above supports the function.

The start positions need not be set with the instructon if the DMC\_CartesianCoordinate instruction is used to perform G code. The DMC\_CartesianCoordinate instruction will set the start positions

automatically.

# Programming Example


1. The variable table and program

Variable name	Data type	Initial value
SSP	DMC_SetStartPosition	
Axes1	USINT	1
SSP_Ex	BOOL	FALSE
SSP_X	LREAL	1000
SSP_Y	LREAL	1000
SSP_Z	LREAL	1000
SSP_A	LREAL	1000
SSP_B	LREAL	1000
SSP_C	LREAL	1000
SSP_P	LREAL	1000
SSP_Q	LREAL	1000
SSP_Done	BOOL	
SSP_Bsy	BOOL	
SSP_Err	BOOL	
SSP_ErrID	WORD	

SSP

	DMC_SetStartPo	osition 1	
Axes1 —	AxesGroup	Done	
SSP_Ex	Execute	Busy	— SSP_Bsy
SSP_X	X_StartPos	Error	
SSP_Y	Y_StartPos	ErrorID	— SSP_Errl D
SSP_Z —	Z_StartPos		
SSP_A	A_StartPos		
SSP_B	B_StartPos		
SSP_C	C_StartPos		
SSP_P —	P_StartPos		
SSP_Q —	Q_StartPos		

#### 2. **Timing Chart**

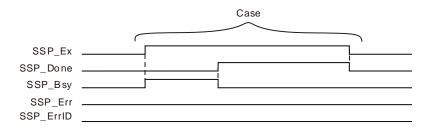

- When SSP\_Ex changes from FALSE to TRUE, DMC\_SetStartPosition instruction is executed. \* In the same cycle, SSP\_Bsy changes from FALSE to TRUE. In the second cycle, SSP\_Done changes from FALSE to TRUE and meanwhile SSP\_Bsy changes from TRUE to FALSE. So the start positions of axes in G codes for the motion is the start positions set by the instruction.
- When SSP\_Ex changes from TRUE to FALSE, SSP\_Done changes from TRUE to FALSE. \*

# **11.7 Axes Group Instructions**

# 11.7.1 DMC\_AddAxisToGroup

FB/FC	Explanation		Applicable model	
FB	DMC_AddAxisToGroup	is used to add an	axis to an axes group.	AS524C-B
	DMC_AddAxisToGroup_instance			
		DMC_AddAxis	sToGroup	
		AxesGroup	Done —	
		Axis	Busy —	
		Execute	Error	
		IdentInGroup	ErrorID —	

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Axis	The axis number of the axis which is added to the axes group	USINT	Refer to Functions of Section 2.2. (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
IdentInGroup	The Identity number of an axis in the axes group	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When adding the axis to the axes group is finished.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing

#### • Output Update Timing Chart

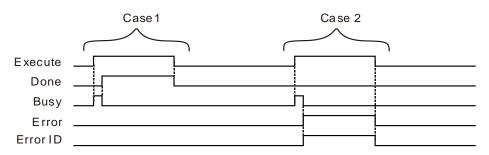

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE and the value in ErrorID is cleared to 0 when *Execute* changes from TRUE to FALSE.

#### Function

DMC\_AddAxisToGroup is used to add an axis to an axes group and set the number of the axis in the axes group. The firmware of V1.01 and above supports the function.

- 1. When *Done* of DMC\_AddAxisToGroup changes to TRUE, it means the axis is added to the axes group successfully. Changing *Execute* to FALSE can not remove the axis from the axis group. To remove the axis from the axes group, DMC\_RemoveAxisFromGroup instruction is needed. Refer to section 11.7.2 for more details about explanation of DMC\_RemoveAxisFromGroup instruction.
- 2. *IdentInGroup* is the identity number of an axis in the axes group. Range:1~8. 1: X axis, 2: Y axis, 3: Z axis, 4: A axis, 5: B axis, 6: C axis, 7: P axis and 8: Q axis.
- 3. DMC\_AddAxisToGroup instruction can be executed only before the axes group is enabled. If the instruction is executed after the axes group is enabled, an error will occur in the instruction.

#### 11.7.2 DMC\_RemoveAxisFromGroup

FB/FC	Explanation	Applicable model
FB	DMC_RemoveAxisFromGroup is used to remove an axis from an axes group.	AS524C-B

#### DMC\_RemoveAxisFromGroup\_instance

DMC_RemoveAxisFromGroup		
 AxesGroup	Done	
 Execute	Busy	
 IdentInGroup	Error	
	ErrorID	

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
IdentInGroup	The identity number of the axis to be removed from the axes group	INT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the axis is removed from the axes group.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Busy	<ul> <li>When the instruction is being executed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

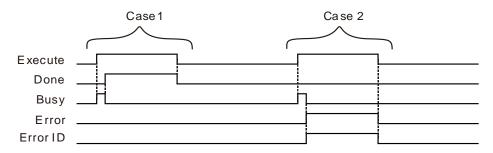

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- **Case 2**: When there is an error in the input parameters of the instruction or the axes group is not disabled and *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Error* changes to TRUE and *ErrorID* shows error codes and meawhile *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.

#### Function

DMC\_RemoveAxisFromGroup is used to remove an axis from an axes group. The value of the input parameter *IdentInGroup* should be within the ranges of 1~8. If the range is exceeded, an error will occur. The firmware of V1.01 and above supports the function.

As the instruction is executed, an error in the instruction will occur immedately if the axes group is enabled. The instruction can be used only when the axes group is not enabled.

1

# 11.7.3 DMC\_UngroupAllAxes

FB/FC	Explanation	Applicable model
FB	DMC_UngroupAllAxes is used to remove all axes in an axes group.	AS524C-B
	DMC_UngroupAllAxes_instance	
	DMC_UngroupAllAxes	
	AxesGroup Done	
	Execute Busy	

Error Errorl D

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

## • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the axes group is ungrouped.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>
Busy	When the instruction is executed.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> <li>When <i>DONE</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

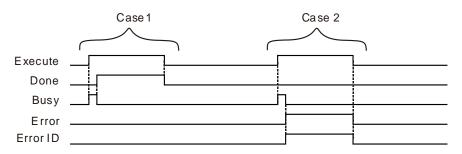

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- **Case 2**: When there is an error in the input parameters of the instruction or the axes group is not disabled and *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one cycle later, *Error* changes to TRUE and *ErrorID* shows error codes and meawhile *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.

#### • Function

DMC\_UngroupAllAxes is used to remove all axes in an axes group. Whe the axes group is enabled, an error will occur immediately after the instruction is used. The firmware of V1.01 and above supports the function.

## 11.7.4 DMC\_GroupEnable

FB/FC	FB/FC Explanation					
FB	DMC_GroupEnable is used to enable an axes group.	AS524C-B				
	DMC_GroupEnable					
	AxesGroup Status					
	Enable Busy					
	MoveDirectVelocity CommandAborted					

ErrorID

MoveDirectDeceleration

MoveDirectJerk

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Enable</i> changes to TRUE
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
MoveDirectV elocity	The velocities of axes for quick positioning	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Enable</i> changes to TRUE.
MoveDirectA cceleration	The accelerations of axes for quick positioning	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Enable</i> changes to TRUE.
MoveDirectD eceleration	The decelerations of axes for quick positioning	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Enable</i> changes to TRUE.
MoveDirectJ erk	The jerks of all axes for quick positioning	ARRAY [18] OF LREAL	Positive number (The variable value must be set)	When <i>Enable</i> changes to TRUE.

**Note:** An axes group can not be controlled to make corresponding action unless it has been enabled. The quick positioning, linear interpolation and circular interpolation could not be conducted when the axes group is not enabled.

#### • Output Parameter


Parameter name	Function		Valid range
Status	TRUE when the axes group is enabled.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
CommandAb orted	TRUE when the instruction execution is aborted.	BOOL	TRUE/FALSE

Parameter name	Function	Data type	Valid range
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Status	<ul> <li>When the specified axes group has been enabled.</li> </ul>	<ul> <li>When the specified axes group is disabled</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Busy	When the instruction is being executed.	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
CommandAbort ed	<ul> <li>When the instruction execution is aborted.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

#### • Output Update Timing Chart

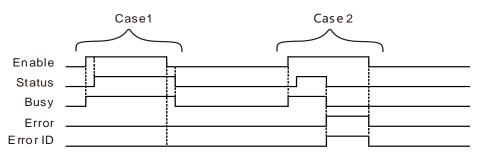

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE. After the axes group is enabled successfully, *Status* changes to TRUE. After *Enable* changes from TRUE to FALSE and the axes group is disabled, *Busy* and *Status* change from TRUE to FALSE.
- **Case 2**: When the DMC\_GroupEnable instruction is aborted during the execution, *CommandAborted* changes to TRUE, meanwhile *Status* and *Busy* change to FALSE and the axes group is disabled. When *Enable* changes to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs during the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meawhile *Status* and *Busy* change to FALSE. When *Enable* changes to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.

#### • Function

DMC\_GroupEnable is used to enable or disable an axes group. The firmware of V1.01 and above supports the function.

- 1. Before the DMC\_GroupEnable instruction is executed, all axes in an axes group must be in the StandStill state so that the DMC\_GroupEnable instruction can be executed normally. The MC\_Power instruction must be used to enable axes and make them enter the StandStill state.
- When axes are in StandStill state, *Status* changes to TRUE after *Enable* is set to TRUE. Please
  make sure that *Status* has changed to TRUE before the axes group motion is controlled.
  After *Status* changes to TURE, axes enter the Discrete Motion state. *Enable* need be set to FALSE

in order to execute other motion instructions which can be executed only when axes are in StandStill state.

- 3. After *Enable* changes from TRUE to FALSE, the axes group is disabled and axes are in the StandStill state. If *Enable* changes from TRUE to FALSE as an axes group instruction such as DMC\_MoveDirectAbsolute is being executed, the axes group instruction will report an error, all axes in the axes group will stop running and axes will be in the StandStill state.
- 4. If a single-axis instruction is executed during the execution of the axes group instruction and the value of *BufferMode* of the single-axis instruction is set to 0 (mcAbroting), the single-axis instruction will abort the axes group instruction and the axes group will be disabled. If the value of *BufferMode* of the single-axis instruction is set to a non-zero number (1~5), the single-axis instruction will not be executed.
- 5. Before the DMC\_GroupEnable instruction is executed, all axes in an axes group must be in the StandStill state so that the DMC\_GroupEnable instruction can be executed normally.

FB/FC		Applicable model			
FB	DMC_GroupStop is use	d to stop the motion of the current axes group.			AS524C-B
L	1				
		AxesGroup	Done		
		Execute	Busy		
		Deceleration	Active	<u> </u>	
	Jerk CommandAborted				
	BufferMode Error				
	ErrorID			<u> </u>	

# 11.7.5 DMC\_GroupStop

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	Specify the number of the axes group which is to be controlled	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Deceleration	Reserved	-	-	-
Jerk	Reserved	-	-	-
BufferMode	Specify the behavior when executing two instructions. 0: Abort	MC_Buffer_ Mode	0: mcAborting	When <i>Execute</i> changes from FALSE to TRUE

#### Note:

- 1. Deceleration and Jerk are reserved and their setting values are invalid.
- 2. *BufferMode* does not support any mode except mode 0 (mcAborting). If any mode else is selected, an error will occur during the execution of the instruction.


#### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axes group is being controlled.	BOOL	TRUE/FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE/FALSE
Error	TRUE when there is an error.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the axes group motion is stopped.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li>When <i>Error</i> changes from TRUE to FALSE.</li> </ul>
Busy	<ul> <li>When <i>Execute</i> changes to TRUE</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li>When <i>CommandAborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
Active	<ul> <li>When the instruction is controlling the axes group.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> <li>When <i>CommandAborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>
CommandAborted	<ul> <li>When the instruction execution is aborted.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	When Execute changes from TRUE to FALSE.

#### Output Update Timing

#### Output Update Timing Chart

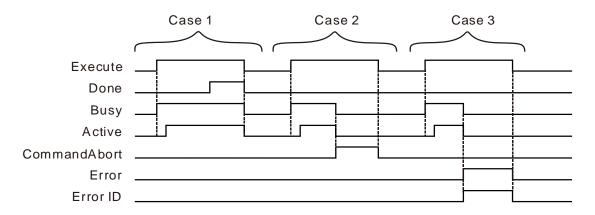

- **Case 1:** When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE and one period later, *Active* changes to TRUE. When the motion of the axes group is stopped successfully, *Done* changes to TRUE and *Busy* and *Active* remain TRUE. When *Execute* changes from TRUE to FALSE, *Done*, *Busy* and *Active* change to FALSE.
- **Case 2:** When the DMC\_GroupStop instruction is aborted during the execution, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes to FALSE, *CommandAborted* changes to FALSE.

**Case 3:** When an error occurs in the course of the instruction execution, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. Meanwhile, *Busy* and *Active* change to FALSE. *Error* changes to FALSE and the value in *ErrorID* is cleared to 0 when *Execute* changes to FALSE.

#### • Function

DMC\_GroupStop is used to stop the motion of the current axes group.

- 1. The input parameters *Deceleration* and *Jerk* of the DMC\_GroupStop instruction are reserved and the input values for them are invalid. When the DMC\_GroupStop instruction is executed, all axes in the axes group will stop running immediately.
- 2. The DMC\_GroupStop instruction can be executed only while the axes group instructions such as DMC\_MoveDirectAbsolute, DMC\_MoveDirectAbsolute, DMC\_MoveLinearAbsolute, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute and DMC\_MoveCircularRelative are being executed. After the instruction execution is completed, all axes in the axes group will stop running and the axis status will still be the Discrete Motion state. Before other motion instructions which can be executed only when axes are in StandStill state are executed, *Enable* of the DMC\_ GroupEnable instruction must be set to FALSE.
- 3. When *Execute* of the DMC\_GroupStop instruction changes from FALSE to TRUE, the instruction is executed. After the instruction execution is completed, the axes group instructions DMC\_MoveDirectAbsolute, DMC\_MoveDirectRelative, DMC\_MoveLinearAbsolute, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute and DMC\_MoveCircularRelative all can not be executed. These instructions can be executed only after *Execute* of the DMC\_GroupStop instruction changes into FALSE.




#### Programming Example


The example of how to use DMC\_GroupStop instruction is described as follows.

- Variable name Data type Initial value TRUE M1 BOOL DMC\_AddAxisToGroup0 DMC\_AddAxisToGroup ADDAXIS\_Ex BOOL ADDAXIS\_Done BOOL ADDAXIS\_Bsy BOOL ADDAXIS\_Err BOOL ADDAXIS Eid WORD DMC\_AddAxisToGroup DMC\_AddAxisToGroup1 ADDAXIS Done1 BOOL ADDAXIS\_Bsy1 BOOL ADDAXIS\_Err1 BOOL ADDAXIS\_Eid1 WORD DMC\_GroupEnable0 DMC\_GroupEnable GE\_EN BOOL GE\_VEL ARRAY [1..8] OF LREAL [10000,10000] GE ACC ARRAY [1..8] OF LREAL [10000,10000] GE DEC ARRAY [1..8] OF LREAL [10000,10000] **GE\_JERK** ARRAY [1..8] OF LREAL [10000,10000] GE\_Status BOOL GE\_Bsy BOOL GE\_Abt BOOL GE\_Err BOOL GE Eid WORD DMC\_MoveLinearAbsolute0 DMC\_MoveLinearAbsolute LA\_Ex BOOL LA Pos ARRAY [1..8] OF LREAL [200000,200000] LA Done BOOL
- 1. The variable table and program

11


Variable name	Data type	Initial value
LA_Bsy	BOOL	
LA_Act	BOOL	
LA_Abt	BOOL	
LA_Err	BOOL	
LA_Eid	WORD	
DMC_GroupStop0	DMC_GroupStop	
GS_Ex	BOOL	
GS_Done	BOOL	
GE_Bsy	BOOL	
GE_Act	BOOL	
GE_Abt	BOOL	
GS_Err	BOOL	
GS_Eid	WORD	

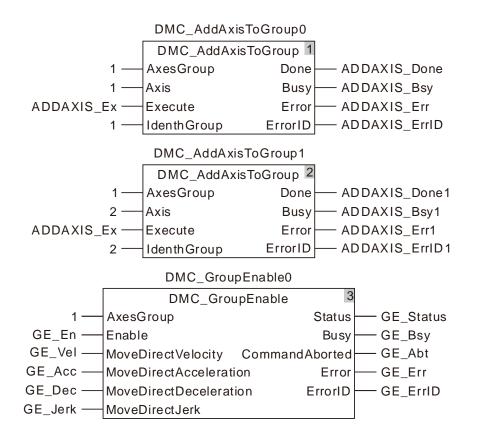

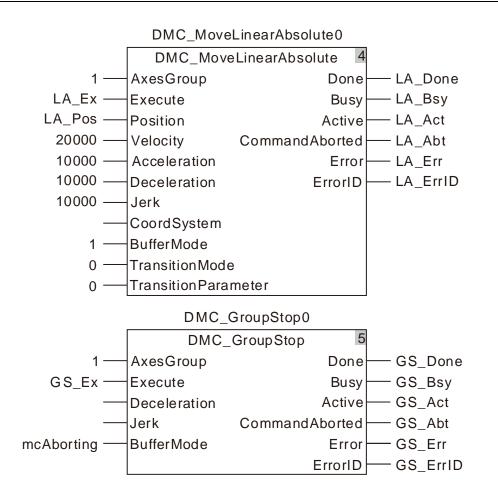

### 11

#### 3. Motion Curve and Timing Chart:

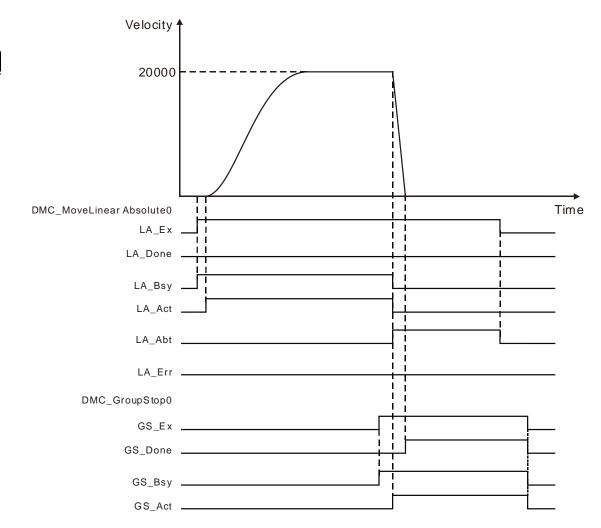

- DMC\_AddAxisToGroup is executed and then DMC\_GroupEnable is executed to enable the axes group. After the axes group is enabled, DMC\_MoveLinearAbsolute is executed.
- DMC\_GroupStop is executed during the execution of DMC\_MoveLinearAbsolute. At the moment, the velocity of the axes group becomes 0 rapidly and DMC\_MoveLinearAbsolute is aborted. After the axes group stops running, *Done* of DMC\_GroupStop changes to TRUE.

# 11.7.6 DMC\_GroupInterrupt

FB/FC	Explanation	Applicable model	
FB	DMC_GroupInterrupt is used to pause the motion of the current axes group for a period of time.	AS524C-B	
DMC_GroupInterrupt_instance			

DMC_GroupInterrupt_instance		
DMC_GroupInterrupt		
 AxesGroup	Done	
 Execute	Busy	
 Deceleration	CommandAborted	
 Jerk	Error	
	ErrorID	

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	Specify the number of the axes group which is to be enabled	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Deceleration	Reserved	-	-	-
Jerk	Reserved	-	-	-

#### Note:

Deceleration and Jerk are reserved and their setting values are invalid.

# Output Parameter


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	

# • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the axes group is paused successfully.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Busy	♦ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> <li>When <i>CommandAborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
		TRUE.
CommandAborted	<ul> <li>When the instruction execution is aborted.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>
Error	When an error occurs in the instruction execution or the input parameters for the instruction are illegal.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

#### • Output Update Timing Chart

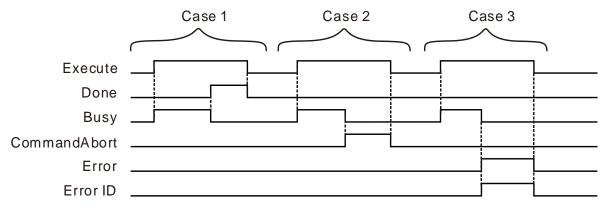

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. When the axes group is paused successfully, *Done* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- **Case 2**: When the instruction execution is aborted, *CommandAborted* changes to TRUE and *Busy* changes to FALSE. When *Execute* changes to FALSE, *CommandAborted* changes to FALSE.
- **Case 3**: When an error occurs in the course of the instruction execution, *Error* changes to TRUE and *ErrorID* shows the corresponding error code. Meanwhile, *Busy* changes to FALSE. *Error* changes to FALSE and the value in *ErrorID* is cleared to 0 when *Execute* changes to FALSE.

#### • Function

DMC\_GroupInterrupt is used to pause the motion of the current axes group for a period of time.

- 1. The input parameters *Deceleration* and *Jerk* of the DMC\_GroupInterrupt instruction are reserved and the input values for them are invalid. When the DMC\_GroupInterrupt instruction is executed, the PLC will decelerate at the deceleration rate of the axes group instruction controlling the motion of the axes group until the axes group stops running.
- The DMC\_GroupInterrupt instruction can be executed only while the axes group instructions DMC\_MoveDirectAbsolute, DMC\_MoveDirectRelative, DMC\_MoveLinearAbsolute, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute and DMC\_MoveCircularRelative are being executed normally.
- 3. DMC\_GroupContinue can be used to restore the axes group to the state before being paused after DMC\_GroupInterrupt is executed.
- 4. The execution results are consistent when several DMC\_GroupInterrupt instructions are executed simultaneously.


# Programming Example


The example of using DMC\_GroupInterrupt with DMC\_GroupContinue together is described as follows.

1. The variable table and program


Variable name	Data type	Initial value
M1	BOOL	TRUE
DMC_AddAxisToGroup0	DMC_AddAxisToGroup	
ADDAXIS_Ex	BOOL	
ADDAXIS_Done	BOOL	
ADDAXIS_Bsy	BOOL	
ADDAXIS_Err	BOOL	
ADDAXIS_ErrID	WORD	
DMC_AddAxisToGroup1	DMC_AddAxisToGroup	
ADDAXIS_Done1	BOOL	
ADDAXIS_Bsy1	BOOL	
ADDAXIS_Err1	BOOL	
ADDAXIS_ErrID1	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	[10000,10000]
GE_Acc	ARRAY [18] OF LREAL	[10000,10000]
GE_Dec	ARRAY [18] OF LREAL	[10000,10000]
GE_Jerk	ARRAY [18] OF LREAL	[10000,10000]
GE_Status	BOOL	
GE_Buy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
DMC_MoveLinearAbsolute0	DMC_MoveLinearAbsolute	
LINABS_Ex	BOOL	
LINABS_Pos	ARRAY [18] OF LREAL	[200000,200000]
LINABS_Done	BOOL	
LINABS_Bsy	BOOL	
LINABS_Act	BOOL	
LINABS_Abt	BOOL	
LINABS_Err	BOOL	
LINABS_ErrID	WORD	
DMC_GroupInterrupt0	DMC_GroupInterrupt	
GI_Ex	BOOL	
GI_Done	BOOL	
GI_Bsy	BOOL	
GI_Abt	BOOL	
GI_Err	BOOL	
GI_ErrID	WORD	
DMC_GroupContinue0	DMC_GroupContinue	
GC_Ex	BOOL	

Variable name	Data type	Initial value
GC_Done	BOOL	
GC_Bsy	BOOL	
GC_Abt	BOOL	
GC_Err	BOOL	
GC_ErrID	WORD	

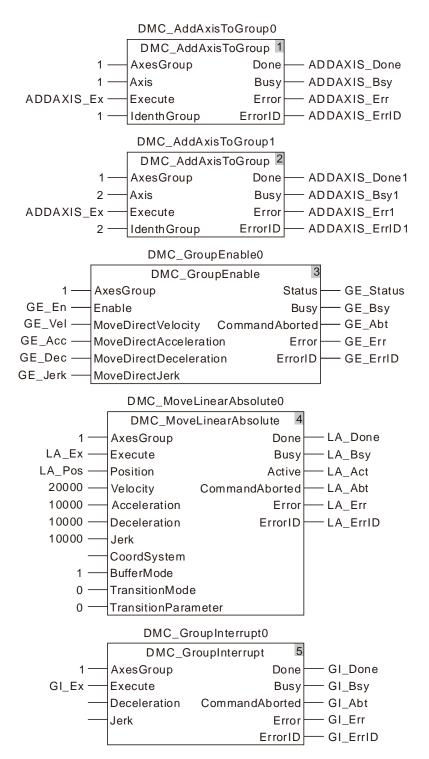

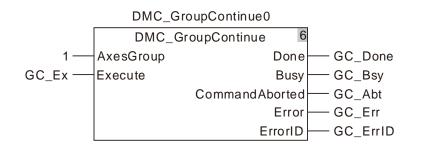

#### 2. Motion Curve and Timing Chart:

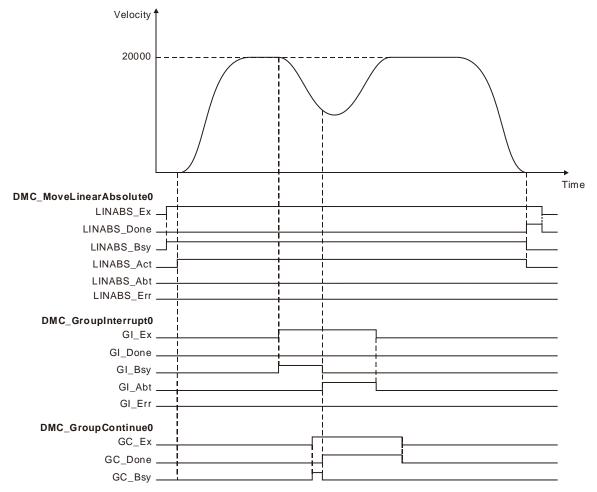


- DMC\_AddAxisToGroup is executed and then DMC\_GroupEnable is executed to enable the axes group. After the axes group is enabled, DMC\_MoveLinearAbsolute is executed.
- DMC\_GroupInterrupt is executed during the execution of DMC\_MoveLinearAbsolute. After DMC\_GroupInterrupt is executed, the axes group starts to decelerate at the deceleration rate of DMC\_MoveLinearAbsolute instruction. But the DMC\_MoveLinearAbsolute instructon is not aborted.
- DMC\_GroupContinue is executed in the process of deceleration of the axes group. DMC\_GroupContinue stops the execution of DMC\_GroupInterrupt immediately. Meanwhile the DMC\_MovelinearAbsolute execution continues.

# 11.7.7 DMC\_GroupContinue

FB/FC	Explanation	Applicable model
FB	DMC_GroupContinue is used to make the paused axes group continue to run.	AS524C-B

#### DMC\_GroupContinue\_instance

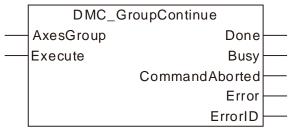

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	Specify the number of the axes group which is to be enabled	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	

#### • Output Parameter

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction is aborted.	BOOL	TRUE / FALSE
Error	TRUE when there is an error.	BOOL	TRUE / FALSE
ErrorID	Contains error codes when an error occurs. Please refer to section 12.2 for the corresponding error code.	WORD	


#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE	
Done	<ul> <li>When the axes group continues to run.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>	
Busy	When Execute changes to TRUE.	<ul> <li>When <i>Done</i> changes from FALSE to TRUE.</li> <li>When <i>CommandAborted</i> changes from FALSE to TRUE.</li> <li>When <i>Error</i> changes from FALSE to TRUE.</li> </ul>	

<u>11</u>

Name	Timing for changing to TRUE	Timing for changing to FALSE	
CommandAborted	<ul> <li>When the instruction execution is aborted.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>	
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>	

#### • Output Update Timing Chart

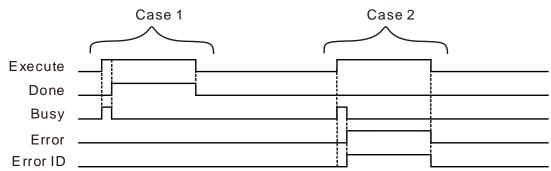

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. One period later, Done changes to TRUE, Busy changes to FALSE and the axes group motion is not paused. When *Execute* changes from TRUE to FALSE, *Done* changes to FALSE.
- **Case 2**: When an error occurs during the instruction execution and *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. One period later, *Error* changes to TRUE, *ErrorID* shows corresponding error codes and *Busy* changes to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.

#### Function

DMC\_GroupContinue is used to make the paused axes group continue to run.

- DMC\_GroupContinue executed 1. can be only when the instructions axes group DMC MoveLinearAbsolute, DMC\_MoveDirectAbsolute, DMC\_MoveDirectRelative, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute and DMC\_MoveCircularRelative are interrupted by DMC\_GroupInterrupt.
- 2. After DMC\_GroupContinue is executed, the axes group will not be paused and continue to perform the the action before being paused.

# 11.7.8 DMC\_MoveDirectAbsolute

FB/FC	Explanation	Applicable model
FB	DMC_MoveDirectAbsolute is used to control all axes in the axes group to move from current position to end position at the specified velocity.	AS524C-B

#### DMC\_MoveDirectAbsolute\_instance

DMC_MoveDirectAbsolute	
AxesGroup Done	
Execute Busy	
Position Active	
CoordSystem CommandAborted	
BufferMode Error	
TransitionMode ErrorID	
TransitionParameter	

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Position	The end positions of axes	ARRAY [18] OF LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
CoordSyste m	Reserved			
BufferMode	Specify the buffer mode between two axes group instructions 1 : Buffered	MC_Buffer_ Mode	1: mcBuffered	When <i>Execute</i> changes from FALSE to TRUE.
TransitionM ode	Specify the transition mode between two axes group instructions 0 : No transition curve insert	MC_Transitio n_Mode	0: mcTMNone	When <i>Execute</i> changes from FALSE to TRUE.
TransitionP arameter	Set the transition parameter for specific transition mode	LREAL	Positive, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

Note:

1. The execution of DMC\_MoveDirectAbsolute instruction starts when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.

- 2. The value of input parameter Position[1] ~ Position[8] means the end positions for quick positioning.
- 3. The input *BufferMode* of DMC\_MoveDirectAbsolute only supports mcBuffered mode. If other mode is selected, an error will occur when the instruction is executed. For details on BufferMode, refer to section 10.3.
- 4. The input *TransitionMode* of DMC\_MoveDirectAbsolute only supports mcTMNone mode. If other mode is selected, an error will occur when the instruction is executed.
- 5. The value of the input *TransitionParameter* of DMC\_MoveDirectAbsolute instruction is invalid.


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.BOOLTRUE /		TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling axes.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the end position is reached	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When axes start being controlled by the insruction</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

# Output Update Timing Chart

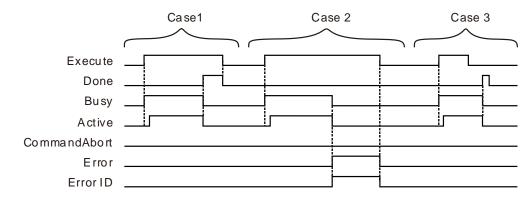

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Two cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Active* and *Busy* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.

### • Function

DMC\_MoveDirectAbsolute is used for an axes group to conduct quick positioning and one or more axes in the axes group can be controlled. The firmware of V1.01 and above supports the function.


Axes are relatively independent with each other during the motion. The velocities, accelerations, decelerations and jerks of axes depend on the input values of DMC\_GroupEnable: MoveDirectVelocity, MoveDirectAcceleration, MoveDirectDeceleration and MoveDirectJerk.

### Programming Example


The example in which one DMC\_MoveDirectAbsolute instruction is executed is as follows.

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	

Variable name	Data type	Initial value
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
DIRABS	DMC_MoveDirectAbsolute	
DIRABS_Ex	BOOL	
DIRABS_Pos	ARRAY [18] OF LREAL	
DIRABS_Done	BOOL	
DIRABS_Bsy	BOOL	
DIRABS_Act	BOOL	
DIRABS_Abt	BOOL	
DIRABS_Err	BOOL	
DIRABS_ErrID	WORD	

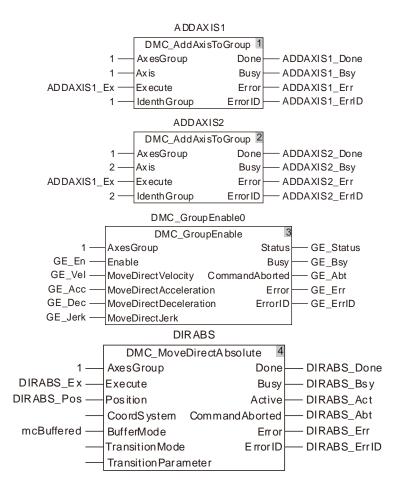

### 2. X axis-Y axis Motion Curve and Timing Chart

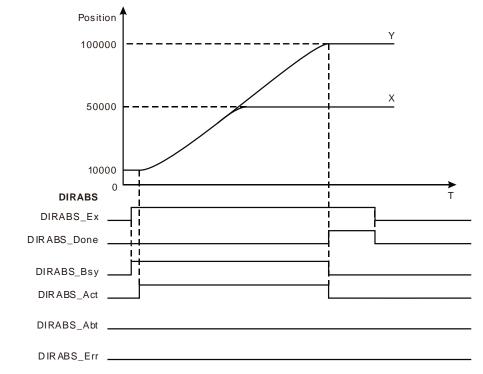

- The start positions of X axis and Y axis are both 10,000. The inputs DIRABS\_Pos[1] and DIRABS\_Pos[2] of DMC\_MoveDirectAbsolute are set to 50,000 and 100,000 respectively.
- When DIRABS\_Ex changes to TRUE, DIRABS\_Bsy changes to TRUE. Two cycles later, DIRABS\_Act changes to TRUE and the axes group starts to run.
- X axis and Y axis are operating according to the set velocities, accelerations and decelerations of DMC\_GroupEnable. When X axis moves to 50,000, X axis stops running. At the moment, Y axis keeps going. When Y axis gets to 100,000, the instruction execution is completed.

# 11.7.9 DMC\_MoveDirectRelative

FB/FC	Explanation	Applicable model
FB	DMC_MoveDirectRelative is used to control the axes in an axes group to move corresponding distances from current positions at specified velocities.	AS524C-B

# $\mathsf{DMC}\_\mathsf{MoveDirectRelative\_instance}$

DMC_MoveDirectRelative		
 AxesGroup	Done	
 Execute	Busy	
 Distance	Active	
 CoordSystem	CommandAborted	
 BufferMode	Error	
 TransitionMode	ErrorID	
 TransitionParar	neter	

# • Input Parameters

Parameter name	Function	Data type	Valid range	Parameter name
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Distance	Set the distances that axes move	ARRAY [18] OF LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
CoordSystem	Reserved			
BufferMode	Specify the buffer mode between two axes group instructions 1 : Buffered	MC_Buffer_Mo de	1: mcBuffered	When <i>Execute</i> changes from FALSE to TRUE.
TransitionMode	Specify the transition mode between two axes group instructions 0 : No transition curve insert	MC_Transition _Mode	0: mcTMNone	When <i>Execute</i> changes from FALSE to TRUE.
TransitionParamet er	Set the transition parameter for specific transition mode	LREAL	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

### Note:

- 1. The execution of DMC\_MoveDirectRelative instruction starts when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.
- 2. The value of input parameter Distance[1] ~ Distance[8] means the motion distances from start positions to end positions for axes.
- 3. The input *BufferMode* of DMC\_MoveDirectRelative only supports mcBuffered mode. If other mode is selected, an error will occur when the instruction is executed. For details on BufferMode, refer to section 10.3.
- 4. The input *TransitionMode* of DMC\_ MoveDirectRelative only supports mcTMNone mode. If other mode is selected, an error will occur when the instruction is executed.
- 5. The value of the input *TransitionParameter* of DMC\_MoveDirectRelative instruction is invalid.


### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling axes.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the end positions are reached.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When the instruction starts controlling axes.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	When Execute changes from TRUE to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE

# • Output Update Timing Chart

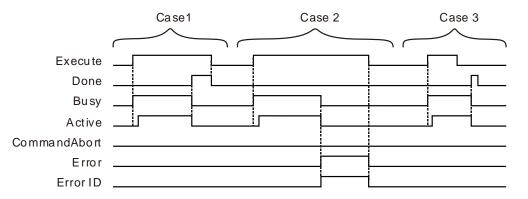

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Two cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy and Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.

### Function

DMC\_MoveDirectRelative is used for an axes group to conduct quick positioning and one or more axes in the axes group can be controlled. The firmware of V1.01 and above supports the function.

Axes are relatively independent with each other during the motion. The velocities, accelerations, decelerations and jerks of axes depend on the input values of DMC\_GroupEnable: MoveDirectVelocity, MoveDirectAcceleration, MoveDirectDeceleration and MoveDirectJerk.


# 

### Programming Example


The example in which one DMC\_MoveDirectRelative nstruction is executed is as follows.

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	

Variable name	Data type	Initial value
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
DIRREL	DMC_MoveDirectRelative	
DIRREL_Ex	BOOL	
DIRREL_Dis	ARRAY [18] OF LREAL	
DIRREL_Done	BOOL	
DIRREL_Bsy	BOOL	
DIRREL_Act	BOOL	
DIRREL_Abt	BOOL	
DIRREL_Err	BOOL	
DIRREL_ErrID	WORD	

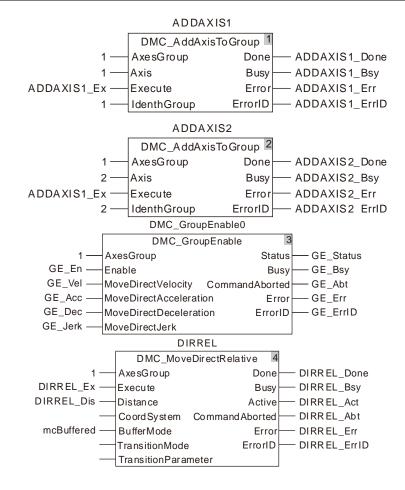



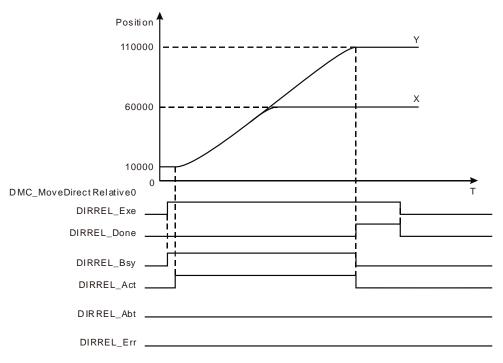

- The start positions of X axis and Y axis are both 10,000. The inputs DIRREL\_Dis[1] and DIRREL\_Dis[2] of DMC\_MoveDirectRelative are set to 50,000 and 100,000 respectively.
- When DIRREL\_Ex changes to TRUE, DIRREL\_Bsy changes to TRUE. Two cycles later, DIRREL\_Act changes to TRUE and the axes group starts to run.
- X axis and Y axis are operating according to the set velocities, accelerations and decelerations of DMC\_GroupEnable. When X axis moves to 60,000, the axis stops running. At the moment, Y axis keeps going. When Y axis gets to 110,000, the instruction execution is completed.

# 11.7.10 DMC\_MoveLinearAbsolute

FB/FC	Explanation	Applicable model
FB	DMC_MoveLinearAbsolute controls axes to perform the linear interpolation motion. The end positions of axes are absolute positions.	AS524C-B

### DMC\_MoveLinearAbsolute\_instance

DMC_MoveLinearAbsolute		
 AxesGroup	Done	
 Execute	Busy	
 Position	Active	
 Velocity	CommandAborted	
 Acceleration	Error	
 Deceleration	ErrorID	
 Jerk		
 CoordSystem		
 BufferMode		
 TransitionMode		
 - TransitionParameter		

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Position	Specify end positions for linear interpolation	ARRAY [18] OF LREAL	Negative number, Positive number, 0, ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
Velocity	Set the maximum resultant velocity. (Unit: Unit/second)	LREAL	Positive number (0)	When Execute changes from FALSE to TRUE.
Acceleration	Set the maximum resultant acceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Set the maximum resultant deceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Set the maximum resultant jerk (Unit: Unit/second <sup>3</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
CoordSystem	Reserved			

11

Parameter name	Function	Data type	Valid range (Default)	Validation timing
BufferMode	Specify the buffer mode between two axes group instructions 1: Buffered 3: Blended with the speed of previous instruction	MC_Buffer _Mode	1: mcBuffered 3: mcBlending- Previous	When <i>Execute</i> changes from FALSE to TRUE.
TransitionMode	<ul> <li>Specify the transiton mode between two axes group instructions</li> <li>0: No transition curve inserted</li> <li>2: Make the transition at the set constant speed</li> <li>3: Make the transition based on the specified corner distance</li> </ul>	MC_Transit ion_Mode	0: mcTMNone 2: mcTMCons- tantVelocity 3: mcTMCorner- Distance	When <i>Execute</i> changes from FALSE to TRUE.
TransitionParameter	Set the transition parameter for specific transition mode	LREAL	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

### Note:

- 1. DMC\_MoveLinearAbsolute instruction starts being executed when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.
- 2. The value of input parameter Position[1] ~ Position[8] means the end positions for linear interpolation.
- 3. Refer to section 10.2 for the relationship among Velocity, Acceleration, Deceleration and Jerk .
- 4. For details on BufferMode, refer to section 10.3.
- 5. The value of the input *TransitionParameter* of DMC\_MoveLinearAbsolute instruction is invalid unless mcTMCornerDistance is selected asTransitionMode.


### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling axes.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

# • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the end positions are reached.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	Whhen Execute changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When axes start being controlled by the insruction.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>

# Output Update Timing Chart

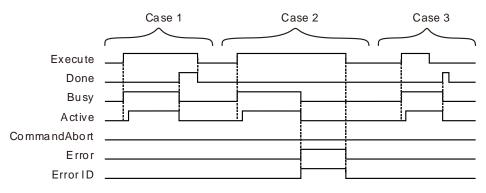

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Two cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.

### Function

1. DMC\_MoveLinearAbsolute is used for an axes group to conduct linear interpolation and one or more axes in the axes group can be controlled. The firmware of V1.01 and above supports the function.

The input *Velocity* of DMC\_MoveLinearAbsolute is the target velocity of the terminal actuator. The velocity of the terminal actuator and velocities of axes have the following relationship.

# Square of terminal actuator's velocity= Sum of squares of velocities of axes

The inputs *Acceleration* and *Deceleration* of DMC\_ MoveLinearAbsolute are the target acceleration and target deceleration of the terminal actuator. The acceleration and deceleration of the terminal actuator and acceleration and deceleration of axes have the following relationship.

Terminal actuator's acceleration(deceleration) = Sum of squares of acceleration(deceleration) of axes

- 2. The *Jerk* of DMC\_MoveLinearAbsolute instruction is reserved.
- 3. See the relationship among *BufferMode*, *TransitionMode* and *TransitionParameter* as follows. If mcBuffered is selected as *BufferMode*, *TransitionMode* supports mcTMNone only. If mcBlendingPrevious is selected as *BufferMode*, *TransitionMode* supports the two modes: mcTMConstantVelocity and mcTMCornerDistance.


BufferMode value	TransitionMode value	Description
mcBuffered(1)	mcTMNone(0)	Wait until the previous interpolation instruction execution is finished and then execute current instruction immediately.
	mcTMConstant- Velocity(2)	Smooth transition: Wait till the previous interpolation instruction execution is completed and then execute current instruction immediately. The transition velocity is the resultant velocity of the previous instruction. After the instruction switch, the terminal actuator conducts the smooth transition and then makes the linear motion as illustrated in the following example 2.
mcBlending- Previous(3)	mcTMCorner- Distance(3)	Corner-distance transition: Wait till the previous interpolation instruction execution is completed and then execute current instruction immediately. When the distance between the terminal actuator position and the final position of the previous interpolation instruction equals the value of <i>TransitionParameter</i> during the execution of the previous interpolation instruction, the previous interpolation instruction execution is completed immediately and then current instruction execution starts. During the execution of the current instruction, the terminal actuator moves for a circular path and then makes a linear interpolation. The distance between the end point of the circular arc and the end point of the previous interpolation instruction is still equal to the value of <i>TransitionParameter</i> as illustrated in the following example 3.

# Programming Example 1

The example in which one DMC\_MoveLinearAbsolute instruction is executed is as follows.


Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	

Variable name	Data type	Initial value
ADDAXIS 2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
ADDAXIS3	DMC_AddAxisToGroup	
ADDAXIS3_Done	BOOL	
ADDAXIS3_Bsy	BOOL	
ADDAXIS3_Err	BOOL	
ADDAXIS3_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINABS	DMC_MoveLinearAbsolute	
LINABS_Ex	BOOL	
LINABS_Pos	ARRAY [18] OF LREAL	
LINABS_Done	BOOL	
LINABS_Bsy	BOOL	
LINABS_Act	BOOL	
LINABS_Abt	BOOL	
LINABS_Err	BOOL	
LINABS_ErrID	WORD	

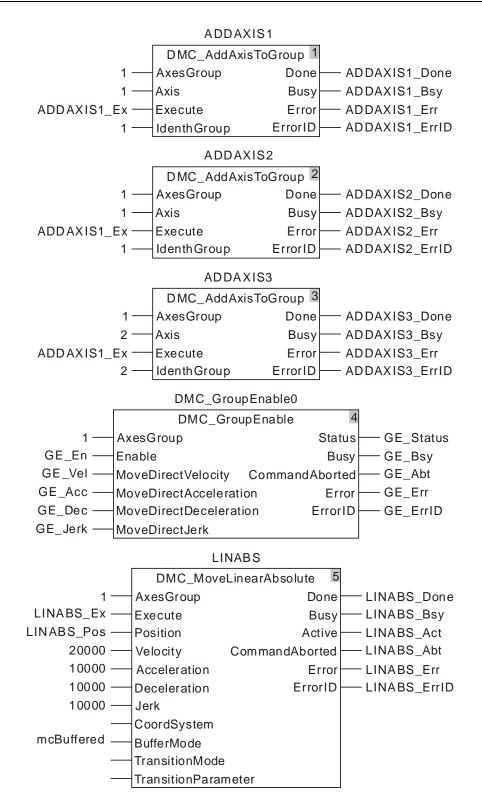


11

2. See the entire motion process after the instruction is executed.

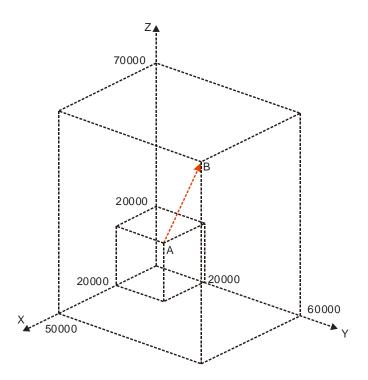

### 3. X axis-Y axis-Z axis Motion Curve and Timing Chart

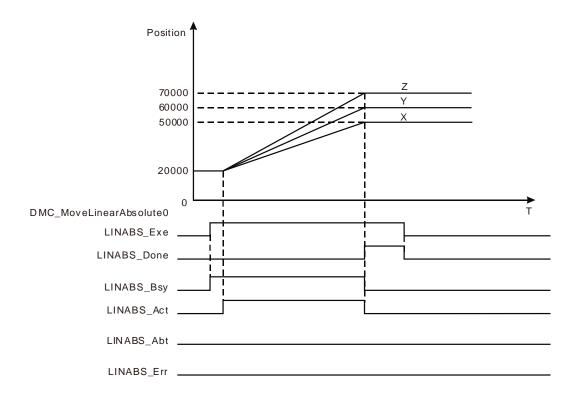

The start positions of X axis, Y axis and Z axis are all 20,000. LINABS\_Pos[1], LINABS\_Pos[2] and LINABS\_Pos[3] of DMC\_MoveLinearAbsolute are set to 50,000, 60,000 and 70,000 respectively.

- When LINABS\_Ex changes to TRUE, LINABS\_Bsy changes to TRUE. Two cycles later, LINABS\_Act changes to TRUE and the axes group starts to run.
- X axis, Y axis and Z axis reach respecitve target positions simultaneously, LINABS\_Done changes to TRUE and LINABS\_Bsy and LINABS\_Act change to FALSE when the execution of DMC\_MoveLinearAbsolute instruction is completed.

# Programming Example 2


The example in which there are two DMC\_MoveLinearAbsolute instructions and the transition mode between them is mcTMConstantVelocity is as follows.

### 1. The variable table and program


Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINABS1	DMC_MoveLinearAbsolute	
LINABS1_Ex	BOOL	
LINABS1_Pos	ARRAY [18] OF LREAL	
LINABS1_Done	BOOL	
LINABS1_Bsy	BOOL	
LINABS1_Act	BOOL	
LINABS1_Abt	BOOL	
LINABS1_Err	BOOL	

11

Variable name	Data type	Initial value
LINABS1_ErrID	WORD	
LINABS2	DMC_MoveLinearAbsolute	
LINABS2_Pos	ARRAY [18] OF LREAL	
LINABS2_Done	BOOL	
LINABS2_Bsy	BOOL	
LINABS2_Act	BOOL	
LINABS2_Abt	BOOL	
LINABS2_Err	BOOL	
LINABS2_ErrID	WORD	

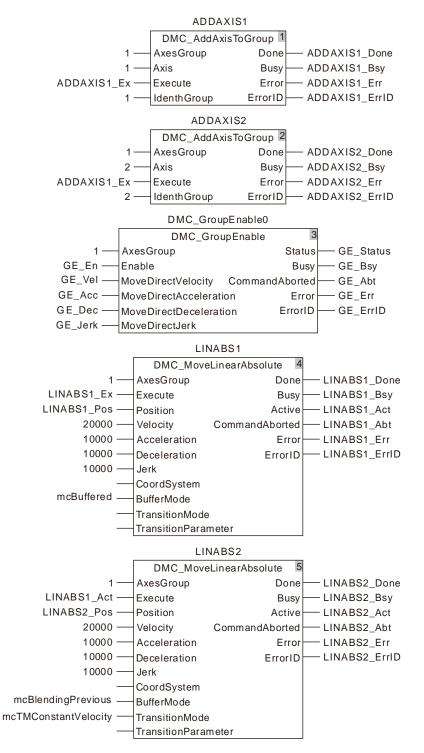

#### 2. See the motion curve and timing chart of the terminal actuator.

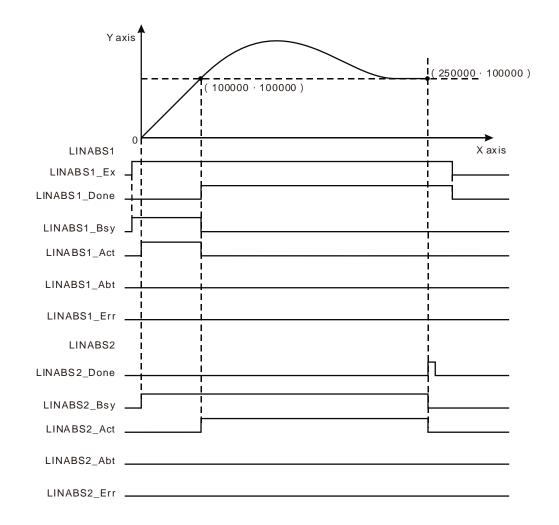

- Set BufferMode to mcBlendingPrevious and TransitionMode to mcTMConstantVelocity for LINABS2.
- The values of LINABS1\_Pos [1] and LINABS1\_Pos [2] of LINABS1 are both set to 100,000. And the values of LINABS2\_Pos [1] and LINABS2\_Pos [2] of LINABS2 are set to 250,000 and 100,000 respectively.
- ADDAXIS1 and ADDAXIS2 are executed first and then DMC\_GroupEnable0 is executed. When the axes group is enabled, LINABS1 is excecuted and then LINABS2 is executed immediately.
- When the terminal actuator gets to the coordinates (100,000, 100,000), LINABS1\_Done changes to TRUE. Meanwhile LINABS2\_Act changes to TRUE and LINABS2 starts to execute. At the moment, the speed of the terminal actuator is the target speed 20, 000 of the previous instruction.
- The terminal actuator conducts the smooth transition and then makes a linear motion after LINABS2 is executed. The instruction execution is completed once the terminal actuator reaches the coordinates (250,000, 100,000).


# 


# Programming Example 3

The example in which there are two DMC\_MoveLinearAbsolute instructions and the transition mode between them is mcTMCornerDistance is as follows.

11

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINABS1	DMC_MoveLinearAbsolute	
LINABS1_Ex	BOOL	
LINABS1_Pos	ARRAY [18] OF LREAL	
LINABS1_Done	BOOL	
LINABS1_Bsy	BOOL	
LINABS1_Act	BOOL	
LINABS1_Abt	BOOL	
LINABS1_Err	BOOL	
LINABS1_ErrID	WORD	
LINABS2	DMC_MoveLinearAbsolute	
LINABS2_Pos	ARRAY [18] OF LREAL	
LINABS2_Done	BOOL	
LINABS2_Bsy	BOOL	
LINABS2_Act	BOOL	
LINABS2_Abt	BOOL	
LINABS2_Err	BOOL	
LINABS2_ErrID	WORD	

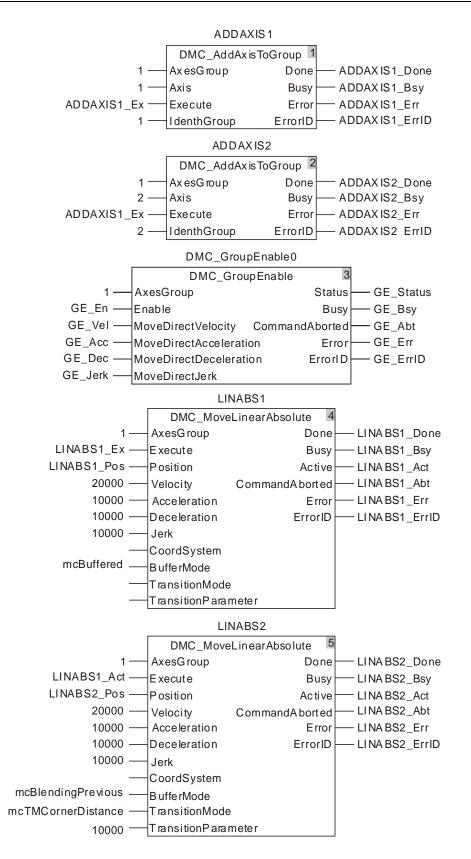

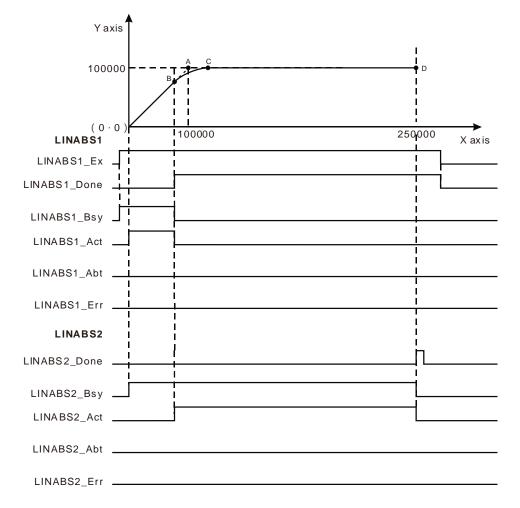

2. See the motion curve and timing chart of the terminal actuator.

- Set BufferMode to mcBlendingPrevious, TransitionMode to mcTMCornerDistance and TransitionParameter to 10000 for LINABS2.
- The values of LINABS1\_Pos [1] and LINABS1\_Pos [2] of LINABS1 are both set to 100,000. And the values of LINABS2\_Pos [1] and LINABS2\_Pos [2] of LINABS2 are set to 250,000 and 100,000 respectively.
- ADDAXIS1 and ADDAXIS2 are executed first and then DMC\_GroupEnable0 is executed. When the axes group is enabled, LINABS1 is excecuted and then LINABS2 is executed immediately.
- When the terminal actuator gets to point B in the coordinate system, LINABS1\_Done changes to TRUE. Meanwhile LINABS2\_Act changes to TRUE and LINABS2 starts to execute.
- After LINABS2 is executed, the terminal actuator moves along an arc path till it reaches point C. Afterward it continues to make the linear interpolation.
- The distance from point B to point A equals that from point C to point A. It is also equal to 10,000, the value of the input *TransitionParameter* of LINABS2.

# 11.7.11 DMC\_MoveLinearRelative

FB/FC	Explanation	Applicable model
FB	DMC_MoveLinearRelative controls axes to perform the linear interpolation motion. The end positions of axes are relative positions.	AS524C-B

### DMC\_MoveLinearRelative\_instance

DMC MoveLinearRelative		
 AxesGroup	Done	
 Execute	Busy	
 Distance	Active	
 Velocity	CommandAborted	
 Acceleration	Error	
 Deceleration	ErrorID	
 Jerk		
 CoordSystem		
 BufferMode		
 TransitionMode		
 TransitionParameter		

### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
Distance	Set the distances that axes move	ARRAY [18] OF LREAL	Negative number, Positive number, 0, ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
Velocity	Set the maximum resultant velocity. (Unit: Unit/second)	LREAL	Positive (0)	When <i>Execute</i> changes from FALSE to TRUE.
Acceleration	Set the maximum resultant acceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive (0)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Set the maximum resultant deceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive (0)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Set the maximum resultant jerk (Unit: Unit/second <sup>3</sup> )	LREAL	Positive (0)	When <i>Execute</i> changes from FALSE to TRUE.
CoordSystem	Reserved			

11

Parameter name	Function	Data type	Valid range (Default)	Validation timing
BufferMode	Specify the buffer mode between two axes group instructions 1: Buffered 3: Blended with the speed of previous instruction	MC_Buffer_ Mode	1: mcBuffered 3: mcBlending- Previous	When <i>Execute</i> changes from FALSE to TRUE.
TransitionMode	<ul> <li>Specify the transiton mode between two axes group instructions</li> <li>0: No transition curve inserted</li> <li>2: Make the transition at the set constant speed</li> <li>3: Make the transition based on the specified corner distance</li> </ul>	MC_Transitio n_Mode	0: mcTMNone 2 : mcTMCons- tantVelocity 3: mcTMCorner- Distance	When <i>Execute</i> changes from FALSE to TRUE.
TransitionParamet er	Set the transition parameter for specific transition mode	LREAL	Positive, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### Note:

- 1. DMC\_MoveLinearRelative instruction starts being executed when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.
- 2. The value of input parameter Distance[1] ~ Distance[8] means the end positions for linear interpolation.
- 3. Refer to section 10.2 for the relationship among Velocity, Acceleration, Deceleration and Jerk .
- 4. For details on BufferMode, refer to section 10.3.
- 5. The value of the input *TransitionParameter* of DMC\_MoveLinearRelative instruction is invalid unless mcTMCornerDistance is selected asTransitionMode .


### • Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling axes.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	When the end positions are reached.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When axes start being controlled by the insruction.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

# • Output Update Timing Chart

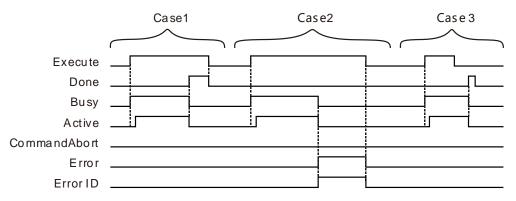

- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Two cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy and Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.

### • Function

DMC\_MoveLinearRelative is used for an axes group to conduct linear interpolation and one or more axes in the axes group can be controlled. The firmware of V1.01 and above supports the function.

1. The input *Velocity* of DMC\_MoveLinearRelative instruction is the target velocity of the terminal actuator. The velocity of the terminal actuator and velocities of axes have the following relationship. Square of terminal actuator's velocity= Sum of squares of velocities of axes

The inputs *Acceleration* and *Deceleration* of DMC\_MoveLinearRelative are the target acceleration and target deceleration of the terminal actuator. The acceleration and deceleration of the terminal actuator and accelerations and decelerations of axes have the following relationship.

Terminal actuator 's acceleration (deceleration) = Sum of squares of acceleration (deceleration) of axes

- 2. The Jerk of DMC\_MoveLinearRelative instruction is reserved.
- 3. See the relationship among *BufferMode*, *TransitionMode* and *TransitionParameter* as follows. If mcBuffered is selected as *BufferMode*, *TransitionMode* supports mcTMNone only. If mcBlendingPrevious is selected as *BufferMode*, *TransitionMode* supports the two modes: mcTMConstantVelocity and mcTMCornerDistance.


BufferMode value	TransitionMode value	Description
mcBuffered(1)	mcTMNone(0)	Wait until the previous interpolation instruction execution is finished and then execute current instruction immediately.
	mcTMConstant- Velocity(2)	Smooth transition: Wait till the previous interpolation instruction execution is completed and then execute current instruction immediately. The transition velocity is the resultant velocity of the previous instruction. After the instruction switch, the terminal actuator conducts the smooth transition and then makes the linear motion as illustrated in the following example 2.
mcBlending- Previous(3)	mcTMCorner- Distance(3)	Corner-distance transition: Wait till the previous interpolation instruction execution is completed and then execute current instruction immediately. When the distance between the terminal actuator position and the final position of the previous interpolation instruction equals the value of <i>TransitionParameter</i> during the execution of the previous interpolation instruction, the previous interpolation instruction execution is completed immediately and then current instruction execution starts. During the execution of the current instruction, the terminal actuator moves for a circular arc and then makes a linear interpolation. The distance between the end point of the circular arc and the end point of the previous interpolation instruction is still equal to the value of <i>TransitionParameter</i> as illustrated in the following example 3.

# Programming Example 1

The example in which one DMC\_MoveLinearRelative instruction is executed is as follows.


Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	

Variable name	Data type	Initial value
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
ADDAXIS3	DMC_AddAxisToGroup	
ADDAXIS3_Done	BOOL	
ADDAXIS3_Bsy	BOOL	
ADDAXIS3_Err	BOOL	
ADDAXIS3_ErrID	WORD	
DMC_GroupEnable	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINREL	DMC_MoveLinearRelative	
LINREL_Ex	BOOL	
LINREL_Dis	ARRAY [18] OF LREAL	
LINREL_Done	BOOL	
LINREL_Bsy	BOOL	
LINREL_Act	BOOL	
LINREL_Abt	BOOL	
LINREL_Err	BOOL	
LINREL_ErrID	WORD	

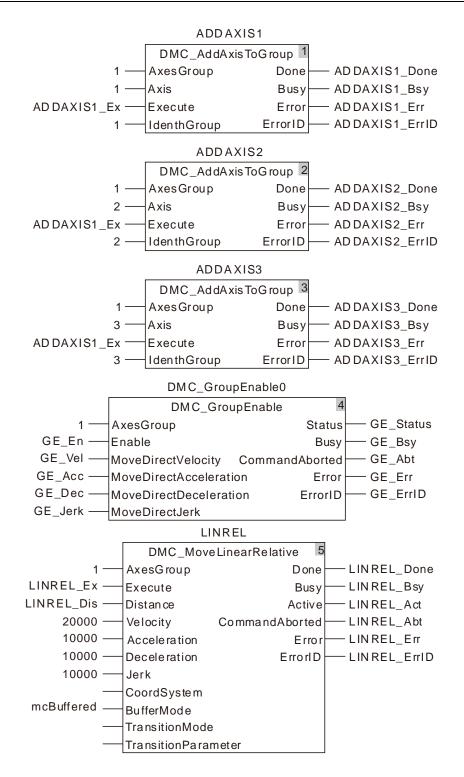


### 11

2. See the entire motion process after the instruction is executed.

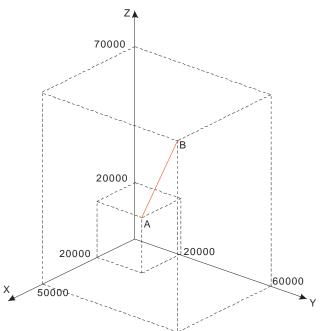

3. X axis-Y axis-Z axis Motion Curve and Timing Chart

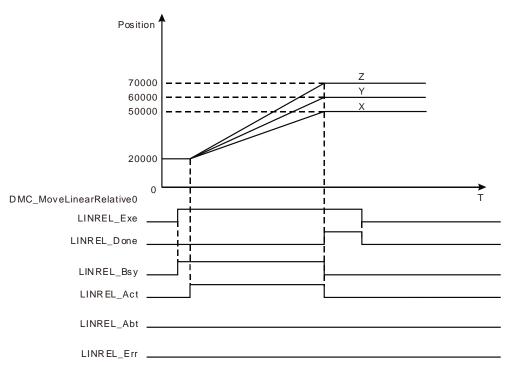


- The start positions of X axis, Y axis and Z axis are all 20,000. LINREL\_Dis[1], LINREL\_Dis[2] and LINREL\_Dis[3] of DMC\_MoveLinearRelative are set to 30,000, 40,000 and 50,000 respectively.
- When LINREL\_Ex changes to TRUE, LINREL\_Bsy changes to TRUE. Two cycles later, LINREL\_Act changes to TRUE and the axes group starts to run.
- X axis, Y axis and Z axis reach respecitve target positions simultaneously, LINREL\_Done changes to TRUE and LINREL\_Bsy and LINREL\_Act change to FALSE when the execution of DMC\_MoveLinearRelative instruction is completed.

# Programming Example 2


See the following example in which there are two DMC\_MoveLinearRelative instructions and the transition mode between them is mcTMConstantVelocity.

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINREL1	DMC_MoveLinearRelative	
LINREL1_Ex	BOOL	
LINREL1_Dis	ARRAY [18] OF LREAL	
LINREL1_Done	BOOL	
LINREL1_Bsy	BOOL	
LINREL1_Act	BOOL	
LINREL1_Abt	BOOL	
LINREL1_Err	BOOL	
LINREL1_ErrID	WORD	
LINREL2	DMC_MoveLinearRelative	
LINREL2_Dis	ARRAY [18] OF LREAL	

Variable name	Data type	Initial value
LINREL2_Done	BOOL	
LINREL2_Bsy	BOOL	
LINREL2_Act	BOOL	
LINREL2_Abt	BOOL	
LINREL2_Err	BOOL	
LINREL2_ErrID	WORD	

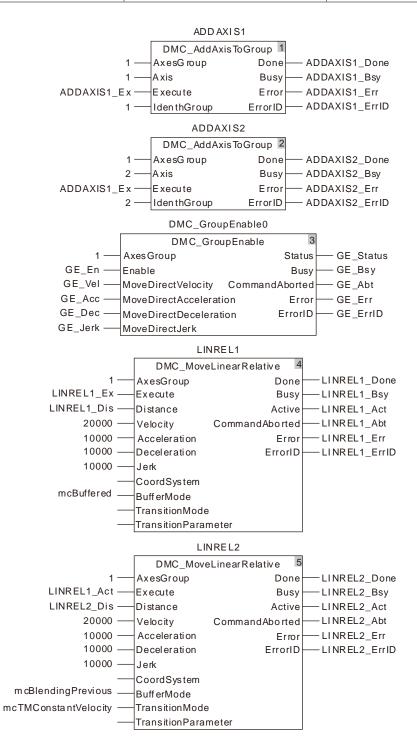

### 11

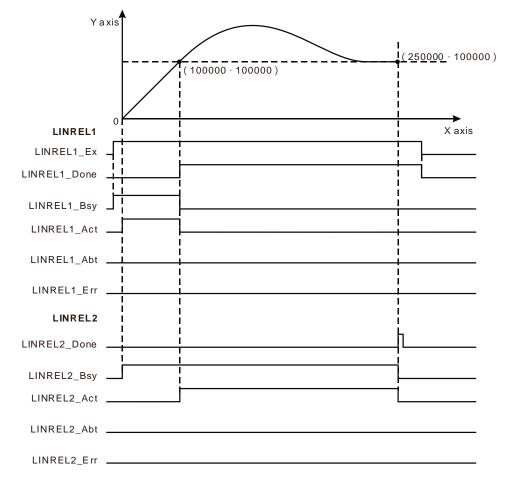

2. Motion Curve and Timing Chart of the terminal actuator


- Set BufferMode to mcBlendingPrevious and TransitionMode to mcTMConstantVelocityand for LINREL2.
- LINREL1\_Dis [1] and LINREL1\_Dis [2] of LINREL1 are both set to 100,000. LINREL2\_Dis [1] and LINREL2\_Dis [2] of LINREL2 are set 150,000 and 0.
- ADDAXIS1 and ADDAXIS2 are executed first and then DMC\_GroupEnable0 is executed. When the axes group is enabled, LINREL1 is excecuted and then LINREL2 is executed immediately.
- When the terminal actuator gets to (100,000, 100,000) in the coordinate system, LINREL1\_Done changes to TRUE. Meanwhile LINREL2\_Act changes to TRUE and LINREL2 starts to execute. At the moment the velocity of the terminal actuator is the target velocity of the previous instruction, 20,000.
- After LINREL2 is executed, the terminal actuator conducts the smooth transition and then makes the linear motion. The instruction execution is completed when the terminal actuator reaches the coordinates (250,000,100,000).

# Programming Example 3

The example in which there are two DMC\_MoveLinearRelative instructions and the transition mode between them is mcTMCornerDistance is as follows.

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	

Variable name	Data type	Initial value
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
LINREL1	DMC_MoveLinearRelative	
LINREL1_Ex	BOOL	
LINREL1_Dis	ARRAY [18] OF LREAL	
LINREL1_Done	BOOL	
LINREL1_Bsy	BOOL	
LINREL1_Act	BOOL	
LINREL1_Abt	BOOL	
LINREL1_Err	BOOL	
LINREL1_ErrID	WORD	
LINREL2	DMC_MoveLinearRelative	
LINREL2_Dis	ARRAY [18] OF LREAL	
LINREL2_Done	BOOL	
LINREL2_Bsy	BOOL	
LINREL2_Act	BOOL	
LINREL2_Abt	BOOL	
LINREL2_Err	BOOL	
LINREL2_ErrID	WORD	

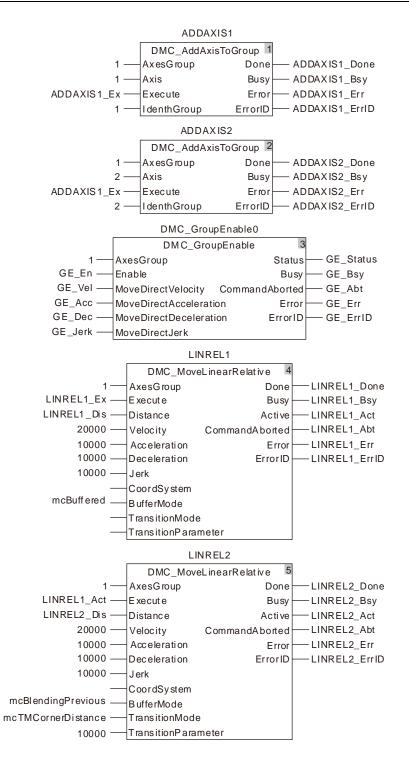

Ya	axis		
1000		D	
(0 <b>LINREL1</b> LINREL1_Ex	· 0)	000	X axis
LINREL1_Done			
LINREL1_Bsy			
LINREL1_Act			
LINREL1_Abt			
LINREL1_Err			
LINREL2_Done			
LINREL2_Bsy			
LINREL2_Act			
LINREL2_Abt			
LINREL2_Err			

#### 2. Motion Curve and Timing Chart of the terminal actuator

- Set BufferMode to mcBlendingPrevious, TransitionMode to mcTMCornerDistance and TransitionParameter to 10000 for LINREL2.
- LINREL1\_Dis [1] and LINREL1\_Dis [2] of LINREL1 are both set to 100,000. LINREL2\_Dis [1] and LINREL2\_Dis [2] of LINREL2 are set 150,000 and 0.
- ADDAXIS1 and ADDAXIS2 are executed first and then DMC\_GroupEnable0 is executed. When the axes group is enabled, LINREL1 is excecuted and then LINREL2 is executed immediately.
- When the terminal actuator gets to point B in the coordinate system, LINREL1\_Done changes to TRUE. Meanwhile LINREL2\_Act changes to TRUE and LINREL2 starts to execute.
- After LINREL2 is executed, the terminal actuator moves along an arc and then continues to make the linear interpolation after passing by point C.
- The distance from point B to point A equals that from point C to point A. It is also equal to 10,000, the value of *TransitionParameter* of LINREL2.

FB/FC	Explanation		Applicable model
FB	DMC_MoveCircularAbsolute controls axes to per interpolation. The end positions of axes are abso		AS524C-B
	DMC_MoveCircularAbsolut	e_instance	
	DMC_MoveCircularAbs	solute	
	AxesGroup	Done	
	Execute	Busy	
	CircMode	Active	
	AuxPoint Comman	dAborted —	
	EndPoint	Error	
	MultiTurn	ErrorID	
	PathChoice		
	Velocity		
	Acceleration		
	Deceleration		
	Jerk		
	CoordSystem		
	BufferMode		
	TransitionMode		
	TransitionParameter		

## 11.7.12 DMC\_MoveCircularAbsolute

### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
CircMode	<ul> <li>Set the mode of circular interpolation</li> <li>O: Draw an arc via a center on XY plane.</li> <li>1: Draw an arc via a center on ZX plane.</li> <li>2: Draw an arc via a center on YZ plane.</li> <li>3: Draw an arc via the radius on XY plane.</li> <li>4: Draw an arc via the radius on ZX plane.</li> <li>5: Draw an arc via the radius on YZ plane.</li> </ul>	INT	0~5 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Aux Point	It is the coordinates for the center when an arc is drawn via a center. Auxpoint[1] means the radius and AuxPoint[2] is meaningless when an arc is drawn via a radius.	ARRAY [12] OF LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
EndPoint	Positions on coordinate axes for the end point of an arc	ARRAY [18] OF LREAL	Positive number, 0, negative number ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
MultiTurn	Set the number of turns for helical interpolation	UINT	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.
PathChoice	The direction for circular interpolation 0: Clockwise 1: Counterclockwise	INT	0、1 (0)	When <i>Execute</i> changes from FALSE to TRUE.
Velocity	Set the maximum velocity (Unit: unit/second)	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Acceleration	Set the maximum acceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Set the maximum deceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Set the maximum jerk (Unit: Unit/second <sup>3</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
CoordSystem	Reserved			
BufferMode	<ul><li>Specify the buffer mode between two axes group instructions.</li><li>1: Buffered</li><li>3: Blending with the speed of previous instruction</li></ul>	MC_Buffe r_Mode	1: mcBuffered 3: mcBlendingPrevious	When <i>Execute</i> changes from FALSE to TRUE.
TransitionMode	<ul> <li>Specify the transiton mode between two axes group instructions</li> <li>0: No transition curve inserted</li> <li>3: Make the transition based on the specified corner distance</li> </ul>	MC_Tran sition_Mo de	0: mcTMNone 3: mcTMCornerDistance	When <i>Execute</i> changes from FALSE to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
TransitionParam eter	Set the transition parameter for specific transition mode	LREAL	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

#### Note:

- 1. DMC\_MoveCircularAbsolute instruction starts being executed when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.
- 2. When drawing an arc by adopting the center method, the values of AuxPoint[1] and AuxPoint[2] are the coordinate differences between the center and start point of an circular arc. When drawing an arc by adopting the radius method, the value of the input AuxPoint[1] is the radius. The value of AuxPoint[2] is meaningless.
- 3. The value of input parameter EndPoint[1]~EndPoint[8] means the coordinates for the end point of an arc on axes.
- 4. Refer to section 10.2 for the relationship among Velocity, Acceleration, Deceleration and Jerk .
- 5. For details on BufferMode, refer to section 10.3.

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling axes.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the end positions are reached.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When axes start being controlled by the insruction.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE</li> </ul>

#### Output Update Timing Chart

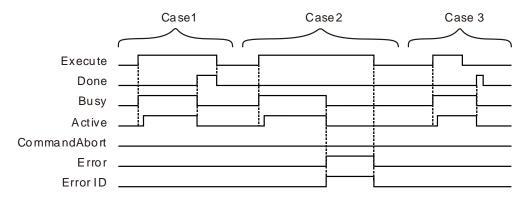


- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Three cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.


#### • Function


DMC\_MoveCircularAbsolute is used for axes to perform the circular interpolation. The firmware of V1.01 and above supports the function.

CirMode (Circular interpolation mode)

There are six CirMode modes as follows.

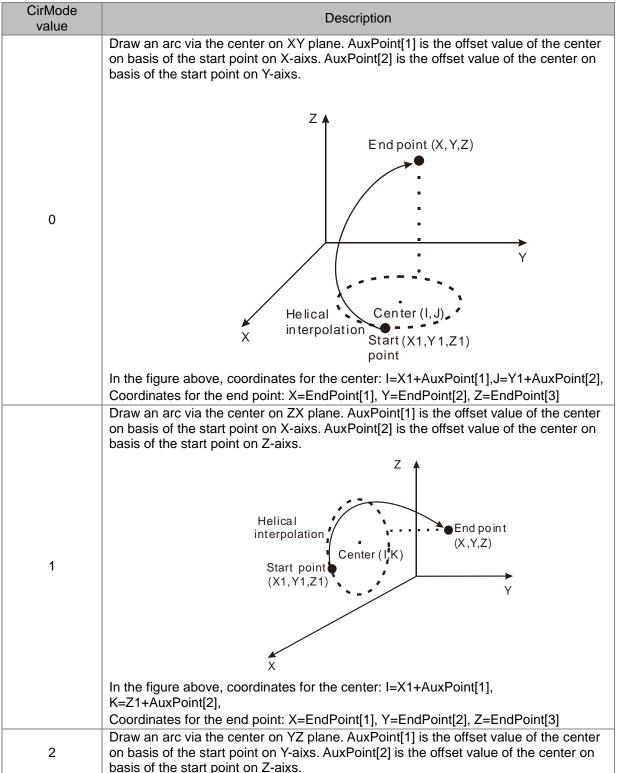


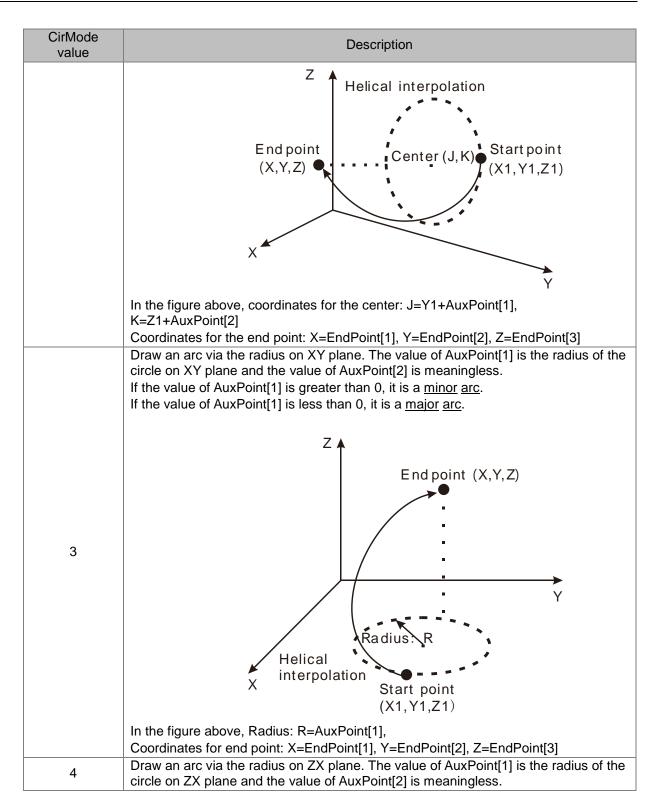

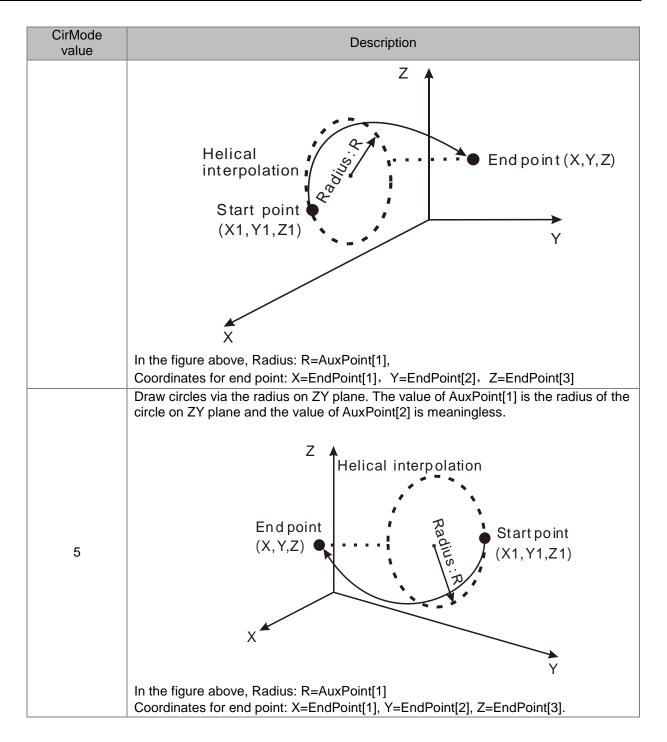

#### PathChoice

The parameter determines the direction for circular interpolation. See the details as follows.

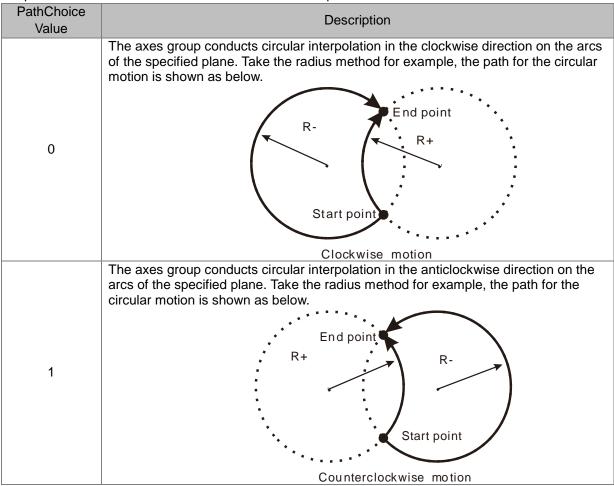

#### BufferMode

Specify the buffer mode between current instruction and previous interpolation instruction. See the details as follows.

BufferMode value	Description
mcBuffered (1)	Current instruction will wait and not be executed till the previous interpolation instruction execution is finished.
mcBlendingPrevious(3)	The transition between current instruction and previous interpolation instruction is conducted in the mode specified by <i>TransitionMode</i> . The <i>BufferMode</i> of DMC_MoveCircularRelative can select this mode only when current instruction is a linear interpolation instruction.


### Programming Example


The example of executing one DMC\_MoveCircularAbsolute instruction is shown as follows.

#### 1. The variable table and program

Variable name	Data type	Initial value
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	
ADDAXIS1_Done	BOOL	

Variable name	Data type	Initial value
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
CIRABS	DMC_MoveCircularAbsolute	
CIRABS_Ex	BOOL	
CIRABS_Mode	INT	0
CIRABS_Auxp	ARRAY [12] OF LREAL	
CIRABS_Endp	ARRAY [18] OF LREAL	
CIRABS_T	UINT	0
CIRABS_PC	INT	0
CIRABS_Done	BOOL	
CIRABS_Bsy	BOOL	
CIRABS_Act	BOOL	
CIRABS_Abt	BOOL	
CIRABS_Err	BOOL	
CIRABS_ErrID	WORD	

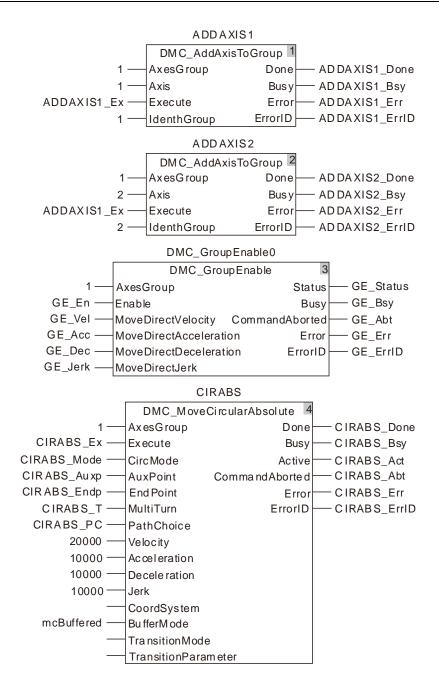

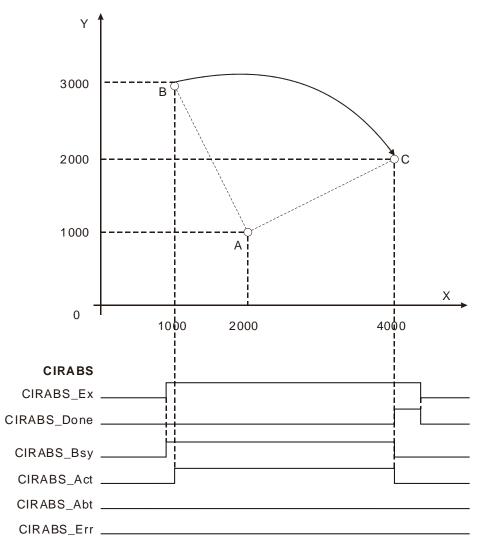

2. Motion Curve in the X-Y Coordinate System and Timing Chart

- The value of CIRABS\_Auxp[1] is set to 1000, the value of CIRABS\_Auxp[2] is set to -2000, the value of CIRABS\_Endp[1] is set to 4000, the value of CIRABS\_Endp[2] is set to 2000 and the value of CIRABS\_Mode is set to 0.
- Point B is the start point of the arc with coordinates (1000, 3000). Point A is the center of the circle where the arc is with the coordinates (1000+CIRABS\_Auxp[1]=2000, 3000+CIRABS\_Auxp[2]=1000). Point C is the end point of the arc with coordinates (CIRABS\_Endp[1]=4000, CIRABS\_Endp[2]=2000).
- After DMC\_MoveCircularAbsolute instruction is executed, the clockwise circular interpolation is conducted by starting from point B and regarding point A as the center. The instruction execution is finished when point C is reached.

## 11.7.13 DMC\_MoveCircularRelative

FB/FC	Explanation	Applicable model
FB	DMC_MoveCircularRelative controls axes to perform the circular interpolation. The end positions of axes are relative positions.	AS524C-B
	DMC MoveCircularRelative instance	

	DMC_Move	CircularRelative		
	AxesGroup	Done		
	Execute	Busy		
	CircMode	Active		
	AuxPoint	CommandAborted		
	EndPoint	Error		
	MultiTurn	ErrorID		
	PathChoice			
	Velocity			
	Acceleration			
	Deceleration			
	Jerk			
	CoordSystem			
	BufferMode			
	TransitionMode	•		
	TransitionPara	meter		
	•			

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE.
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
CircMode	<ul> <li>Set the mode of circular interpolation.</li> <li>0: Draw an arc via a center on XY plane.</li> <li>1: Draw an arc via a center on ZX plane.</li> <li>2: Draw an arc via a center on YZ plane.</li> <li>3: Draw an arc via the radius on XY plane.</li> <li>4: Draw an arc via the radius on ZX plane.</li> <li>5: Draw an arc via the radius on YZ plane.</li> </ul>	INT	0~5 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AuxPoint	It is the coordinates for the center when an arc is drawn via a center. Auxpoint[1] means the radius and AuxPoint[2] is meaningless when an arc is drawn via a radius.	ARRAY [12] OF LREAL	Positive number, 0, negative number ( 0 )	When Execute changes from FALSE to TRUE.
EndPoint	Coordinate differences on axes between the end point and start point of an arc	ARRAY [18] OF LREAL	Positive number, 0, negative number ( 0 )	When Execute changes from FALSE to TRUE.
MultiTurn	Set the number of turns for helical interpolation	UINT	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.
PathChoice	The direction for circular interpolation 0: Clockwise 1: Counterclockwise	INT	0, 1 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE.
Velocity	Set the maximum velocity (Unit: unit/second)	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Acceleration	Set the maximum acceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Deceleration	Set the maximum deceleration (Unit: Unit/second <sup>2</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
Jerk	Set the maximum jerk (Unit: Unit/second <sup>3</sup> )	LREAL	Positive number (0)	When <i>Execute</i> changes from FALSE to TRUE.
CoordSyste m	Reserved			
BufferMode	Specify the buffer mode between two axes group instructions. 1: Buffered 3: Blending with the speed of previous instruction	MC_Buffer_Mo de	1: mcBuffered 3: mcBlendingPrevious	When <i>Execute</i> changes from FALSE to TRUE.

Parameter name	Function	Data type	Valid range (Default)	Validation timing
TransitionMo de	Specify the transiton mode between two axes group instructions 0: No transition curve inserted 3: Make the transition based on the specified corner distance	MC_Transition _Mode	0: mcTMNone 3: mcTMCornerDistance	When <i>Execute</i> changes from FALSE to TRUE.
TransitionPar ameter	Set the transition parameter for specific transition mode	LREAL	Positive number, 0 (0)	When <i>Execute</i> changes from FALSE to TRUE.

Note:

- 1. DMC\_MoveCircularRelative instruction starts being executed when *Execute* changes from FALSE to TRUE. Changing *Execute* from TRUE to FALSE during the instruction execution will have no impact on the instruction execution.
- 2. When drawing an arc by adopting the center method, the values of AuxPoint[1] and AuxPoint[2] are the coordinate differences between the center and start point of an circular arc. When drawing an arc by adopting the radius method, the value of the input AuxPoint[1] is the radius. The value of AuxPoint[2] is meaningless.
- 3. The value of input parameter EndPoint[1]~EndPoint[8] means the coordinate diferences between end point and start point on axes.
- 4. Refer to section 10.2 for the relationship among Velocity, Acceleration, Deceleration and Jerk .
- 5. For details on BufferMode, refer to section 10.3.


•			
Parameter name	Function	Data type	Valid range
Done	TRUE when the instruction execution is completed.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Active	TRUE when the instruction is controlling the axes group.	BOOL	TRUE / FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

#### • Output Parameters

#### • Output Update Timing

Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When the end positions are reached.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE after the instruction execution is completed</li> <li><i>Done</i> changes to TRUE when the instruction execution is completed after <i>Execute</i> changes from TRUE to FALSE during the instruction execution. One cycle later, <i>Done</i> changes to FALSE.</li> </ul>
Busy	<ul> <li>When Execute changes to TRUE.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
Active	<ul> <li>When axes start being controlled by the insruction.</li> </ul>	<ul> <li>When <i>Done</i> changes to TRUE</li> <li>When <i>Error</i> changes to TRUE</li> <li>When <i>CommandAbort</i> changes to TRUE</li> </ul>
CommandAbort	<ul> <li>When the instruction execution is aborted by other motion instruction.</li> </ul>	When Execute changes from TRUE to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	When Execute changes from TRUE to FALSE

#### • Output Update Timing Chart

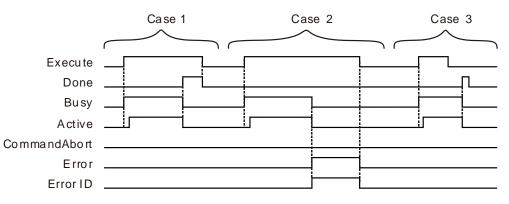


- **Case 1**: When *Execute* changes from FALSE to TRUE, *Busy* changes to TRUE. Three cycles later, *Active* changes to TRUE. When the axes group reaches the end position, *Done* changes to TRUE, *Busy* and *Active* change to FALSE.
- **Case 2**: When *Execute* changes from FALSE to TRUE and an error occurs (such as error in state machine of the axes group), *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes from TRUE to FALSE, *Error* changes to FALSE.
- **Case 3**: After *Execute* changes from TRUE to FALSE in the instruction execution, *Done* changes to TRUE when the instruction execution is completed. Meantime *Busy* and *Active* change to FALSE. One cycle later, *Done* changes to FALSE.


#### • Function


DMC\_MoveCircularRelative is used for axes to perform the circular interpolation. The firmware of V1.01 and above supports the function.

CirMode (Circular interpolation mode)

There are six CirMode modes as follows.

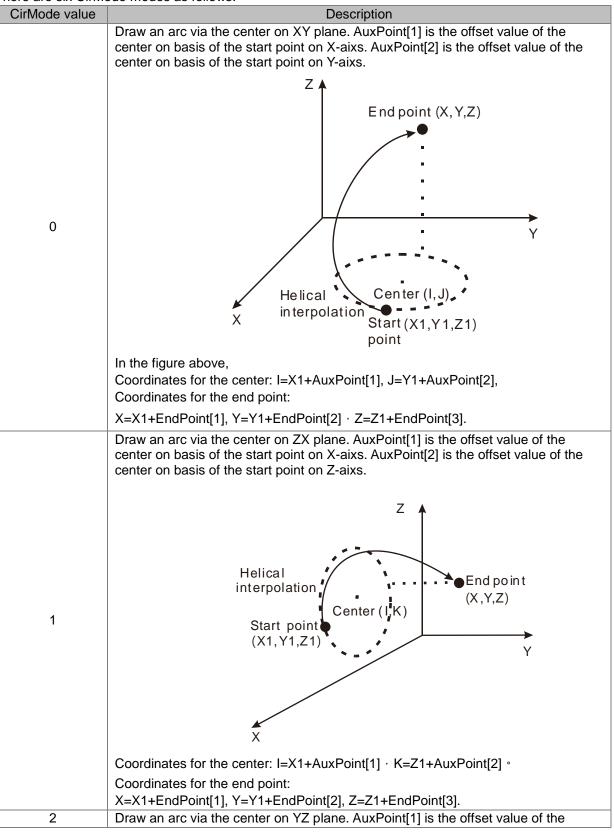


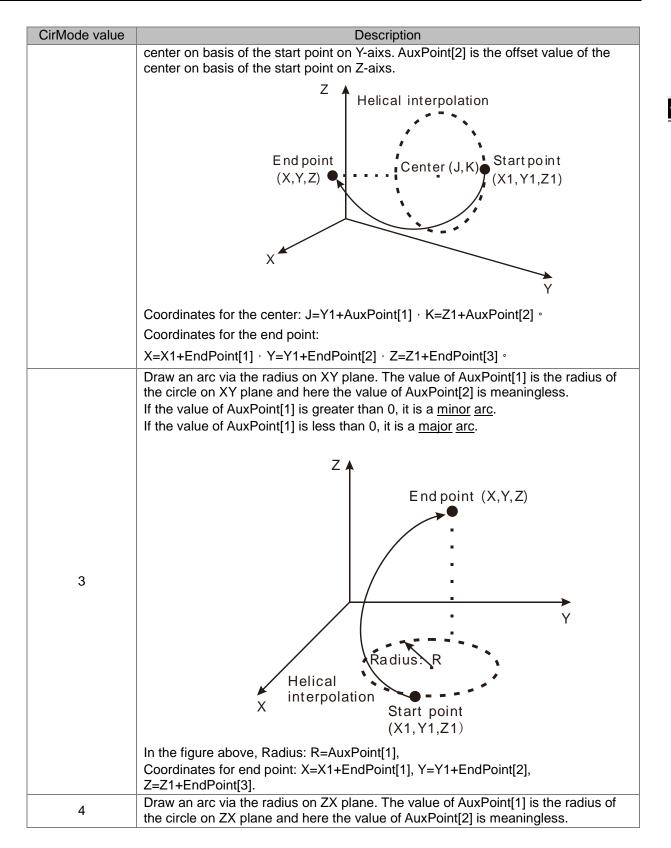

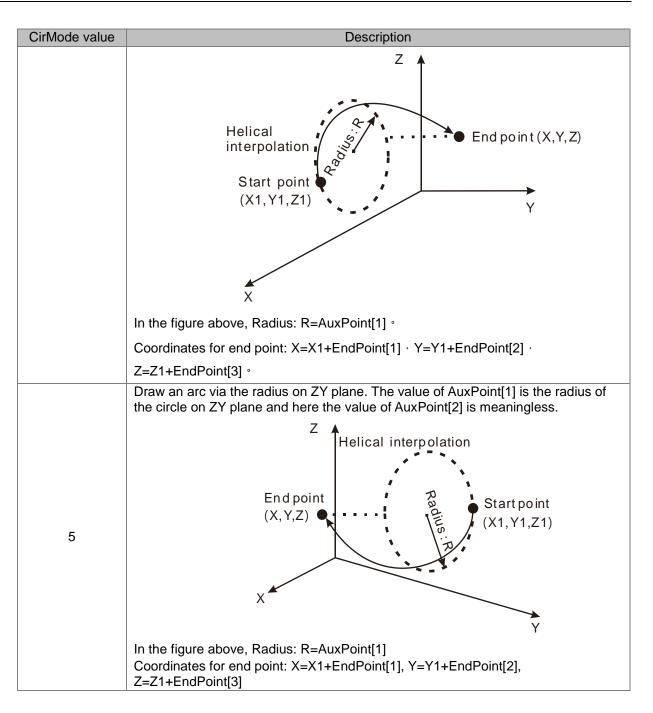

#### PathChoice

The parameter determines the direction for circular interpolation. See the details as follows.

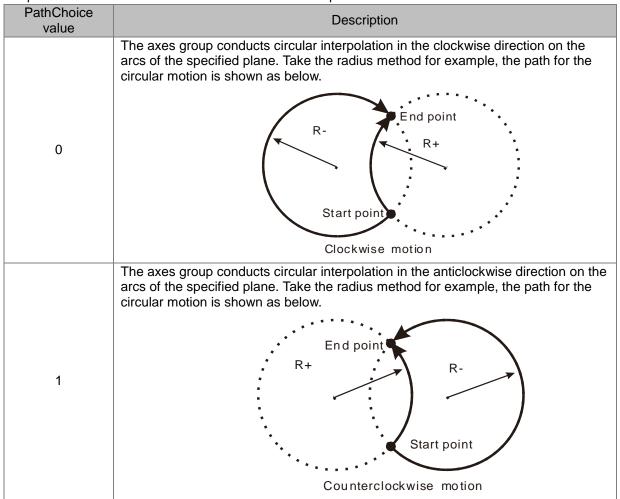

#### BufferMode

Specify the buffer mode between current instruction and previous interpolation instruction. See the details as follows.

BufferMode Value	Description
mcBuffered (1)	Current instruction will wait and not be executed till the previous interpolation instruction execution is finished.
mcBlendingPrevious (3)	The transition between current instruction and previous interpolation instruction is conducted in the mode specified by <i>TransitionMode</i> . The <i>BufferMode</i> of DMC_MoveCircularRelative can select this mode only when current instruction is a linear interpolation instruction.


## Programming Example


The example of executing one DMC\_MoveCircularRelative instruction is shown as follows.

#### 1. The variable table and program

Variable name	Data type	Initial value
M1	BOOL	
ADDAXIS1	DMC_AddAxisToGroup	
ADDAXIS1_Ex	BOOL	

Variable name	Data type	Initial value
ADDAXIS1_Done	BOOL	
ADDAXIS1_Bsy	BOOL	
ADDAXIS1_Err	BOOL	
ADDAXIS1_ErrID	WORD	
ADDAXIS2	DMC_AddAxisToGroup	
ADDAXIS2_Done	BOOL	
ADDAXIS2_Bsy	BOOL	
ADDAXIS2_Err	BOOL	
ADDAXIS2_ErrID	WORD	
DMC_GroupEnable0	DMC_GroupEnable	
GE_En	BOOL	
GE_Vel	ARRAY [18] OF LREAL	
GE_Acc	ARRAY [18] OF LREAL	
GE_Dec	ARRAY [18] OF LREAL	
GE_Jerk	ARRAY [18] OF LREAL	
GE_Status	BOOL	
GE_Bsy	BOOL	
GE_Abt	BOOL	
GE_Err	BOOL	
GE_ErrID	WORD	
CIRREL	DMC_MoveCircularRelative	
CIRREL_Ex	BOOL	
CIRREL_Mode	INT	0
CIRREL_Auxp	ARRAY [12] OF LREAL	
CIRREL_Endp	ARRAY [18] OF LREAL	
CIRREL_T	UINT	0
CIRREL_PC	INT	0
CIRREL_Done	BOOL	
CIRREL_Bsy	BOOL	
CIRREL_Act	BOOL	
CIRREL_Abt	BOOL	
CIRREL_Err	BOOL	
CIRREL_ErrID	WORD	

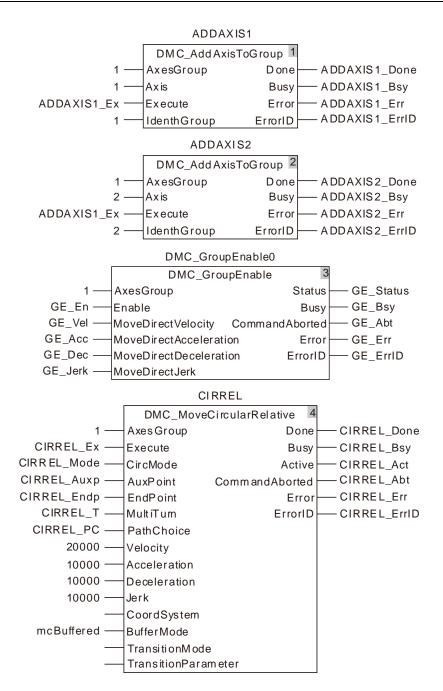

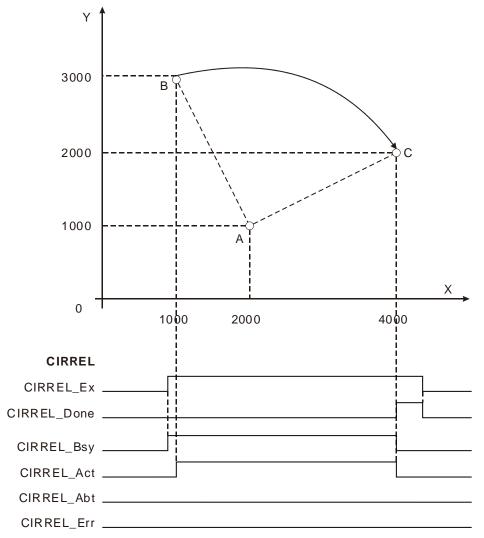

2. Motion Curve in the X-Y coordinate system and Timing Chart

- The value of CIRREL\_Mode is set to 0. The value of CIRREL\_Auxp[1] is set to 1000. The value of CIRREL\_Auxp[2] is set to -2000. The value of CIRREL\_Endp[1] is set to 3000. The value of CIRREL\_Endp[2] is set to -1000. The value of CIRREL\_Mode is set to 0.
- Point B is the start point of the arc with coordinates (1000, 3000). Point A is the center of the circle where the arc is with the coordinates (1000+CIRREL\_Auxp[1]=2000, 3000+CIRREL\_Auxp[2]=1000). Point C is the end point of the arc with coordinates (1000+CIRREL\_Endp[1]=4000, 3000+CIRREL\_Endp[2]=2000).
- After DMC\_MoveCircularRelative instruction is executed, the clockwise circular interpolation is conducted by starting from point B and regarding point A as the center. The instruction execution is finished when point C is reached.

FB/FC	Explanation	Applicable model
FB	DMC_GroupSetOverride instruction is used to set the value of override for the coordinated motion of an axes group.	AS524C-B

## 11.7.14 DMC\_GroupSetOverride

#### DMC\_GroupSetOverride\_instance DMC\_GroupSetOverride AxesGroup Enabled Enable Busy VelFactor Error AccFactor ErrorlD JerkFactor

#### Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Enable</i> changes to TRUE.
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
VelFactor	Override value, unit: %, e.g."100" means 100%.	LREAL	0~500 (The variable value must be set)	When <i>Enable</i> changes to TRUE.
AccFactor	Reserved	-	-	-
JerkFactor	Reserved	-	-	-


#### Output Parameters

Parameter name	Function	Data type	Valid range
Enabled	TRUE when the axes group is being controlled.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	

Name	Timing for changing to TRUE	Timing for changing to FALSE
Enabled	<ul> <li>When the instruction starts being executed.</li> </ul>	<ul> <li>When <i>Enable</i> changes to FALSE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Busy	When Enable changes to TRUE	<ul> <li>When <i>Enable</i> changes to FALSE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

#### Output Update Timing

#### • Output Update Timing Chart

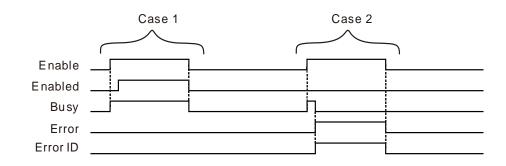

- **Case 1**: When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE. One cycle later, *Enabled* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Enabled* and *Busy* change to FALSE.
- **Case 2**: When an error occurs in the instruction execution, *Error* changes to TRUE and *ErrorID* shows corresponding error codes and meanwhile *Busy* changes to FALSE. When *Enable* changes to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.

#### Function

DMC\_GroupSetOverride instruction is used to set the value of override for the coordinated motion of a axes group. The firmware of V1.01 and above supports the function.

- 1. The target velocities of these instructions can be changed including DMC\_MoveDirectAbsolute, DMC\_MoveDirectRelative, DMC\_MoveLinearAbsolute, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute and DMC\_MoveCircularRelative.
- 2. The unit of *VelFactor* is %. "100" means "100%". The valid range of VelFactor value is 0~500. If the range is exceeded, an error will occur in the instruction execution.
- The target velocities of axes in the axes group = target velocities of current axes \* override value if the instruction DMC\_MoveDirectAbsolute or DMC\_MoveDirectRelative is being executed after the DMC\_GroupSetOverride instruction is executed.

The new maximum velocity of the axes group = current maximum velocity of the axes group\* override value if the instruction DMC\_MoveLinearAbsolute, DMC\_MoveLinearRelative, DMC\_MoveCircularAbsolute or DMC\_MoveCircularRelative is being executed after the DMC\_GroupSetOverride instruction is executed.

- 4. After DMC\_GroupSetOverride instruction is executed, the axes group will accelerate or decelerate according to the acceleration rate or deceleration rate of currently being executed instruction till the target velocity after modification is reached.
- 5. An error will occur in axes if the target velocity after modification exceeds the maximum rotation velocity.


- 6. The target velocity becomes 0 and the axes group acts at the velocity 0 when the value of *VelFactor* is set 0.
- 7. When *Enable* changes to TRUE, the newly modified VelFactor value will take effect immediately and users do not need to restart the instruction. When *Enable* changes to TRUE, an error will occur in the instruction and the target velocity will return to 100% if the value of *VelFactor* exceeds valid range.
- 8. When *Enable* changes to TRUE, the modified value of *Velfactor* will take effect immediately and there will be no need to restart the instruction. When *Enable* changes to TRUE, an error will be alerted immediately in the instruction and the target velocity will return to 100% if the modified value of *Velfactor* exceeds valid range.
- 9. When *Enable* changes to FALSE, the axes group will speed up or slow down regarding VelFactor=100 as the target.

## Programming Example


The example of executing DMC\_GroupSetOverride instruction is as follows.

#### 1. The variable table and program

Variable name Data type		Initial value
M1	BOOL	
SetOv	DMC_GroupSetOverride	
SetOv_En	BOOL	
SetOv_Velf	LREAL	
SetOv_Ena	BOOL	
SetOv_Bsy	BOOL	
SetOv_Err	BOOL	
SetOv_ErrID	WORD	
LINABS	DMC_MoveLinearAbsolute	
LINABS_Ex	BOOL	
LINABS_Pos	ARRAY [18] OF LREAL	
LINABS_Done	BOOL	
LINABS_Bsy	BOOL	
LINABS_Act	BOOL	
LINABS_Abt	BOOL	
LINABS_Err	BOOL	
LINABS_Eid	WORD	

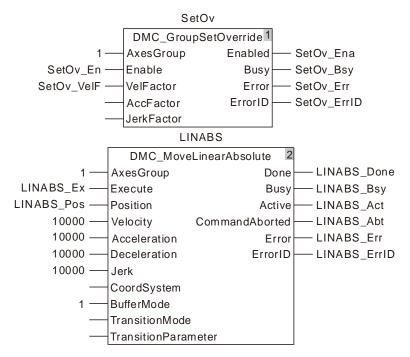

#### 2. Motion Curve and Timing Chart

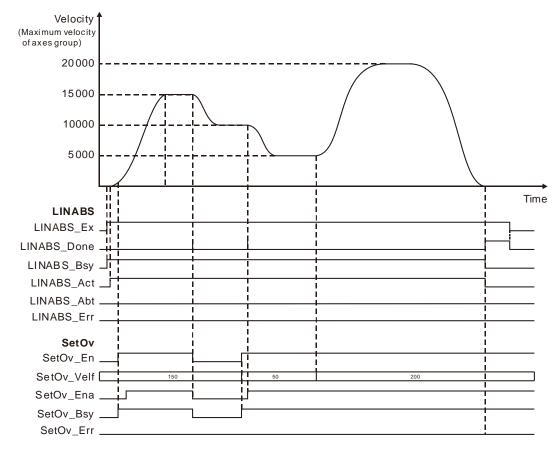

- When LINABS\_Ex changes to TRUE, LINABS\_Bsy changes to TRUE. Two cycles later, LINABS\_Act changes to TRUE and the axes group starts to move. When the axes group has not reached the target velocity and SetOv\_En is set to TRUE, the DMC\_GroupSetOverride instruction takes effect and the target velocity of the axes group becomes the new target velocity.
- When SetOv\_En changes to FALSE, the target velocity of the axes group becomes10,000.
- If the value of SetOv\_Velf is modified in the execution of DMC\_GroupSetOverride instruction, the value of SetOv\_Velf will take effect immediately. The target velocity of the DMC\_MoveLinearAbsolute instruction will change accordingly.

### 11.7.15 DMC\_GroupReadActualPosition

FB DMC_GroupReadActualPosition instruction can be used to read the position of axes in the axes group. AS524C-B	FB/FC	Explanation	Applicable model
	FB	DMC_GroupReadActualPosition instruction can be used to read the position of axes in the axes group.	AS524C-B

#### DMC\_GroupReadActualPosition\_instance

DMC_GroupReadAct	ualPosition	
 AxesGroup	Valid	
 Enable	Busy	
 CoordSystem	Error	
	ErrorID	
	Position	

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
AxesGroup	The axes group number	USINT	1~8 (The variable value must be set)	When <i>Enable</i> changes to TRUE.
Enable	The instruction is executed when <i>Enable</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
CoorSystem	Reserved	-	-	-

#### • Output Parameters


Parameter name	Function	Data type	Valid range
Valid	TRUE when the output of the instruction is valid.	BOOL	TRUE / FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE / FALSE
Error	TRUE when an error occurs in execution of the instruction.	BOOL	TRUE / FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Position	Positions of axes in an axis group	ARRAY [18] OF LREAL	

#### • Output Update Timing

		1
Name	Timing for changing to TRUE	Timing for changing to FALSE
Valid	<ul> <li>When the instruction reads the positions of axes in the axes group</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>
Busy	When the instruction is executed	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> <li>When <i>Error</i> changes to TRUE</li> </ul>

Name	Timing for changing to TRUE	Timing for changing to FALSE
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Enable</i> changes from TRUE to FALSE</li> </ul>

#### Output Update Timing Chart

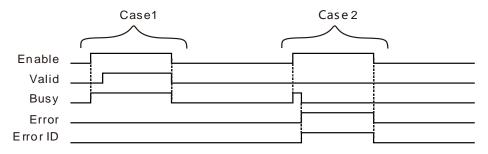

- 3. When *Enable* changes from FALSE to TRUE, *Busy* changes to TRUE. One cycle later, *Valid* changes to TRUE. When *Enable* changes from TRUE to FALSE, *Valid* and *Busy* change to FALSE simultaneously.
- 4. When there is an input error in the instruction and *Enable* changes from FALSE to TRUE, Busy changes to TRUE, one cycle later, *Error* changes to TRUE and *ErrorID* shows error codes and meanwhile *Busy* changes to FALSE. When *Enable* changes from TRUE to FALSE, *Error* changes to FALSE and the value in *ErrorID* is cleared to 0.


#### • Function

DMC\_GroupReadActualPosition instruction is used to read current positions of axes in the axes group. The value of the output *Position* is an array. Every member of the array corresponds to one axis position. E.g. Position[1] corresponds to the position on X-axis, Position[2] corresponds to the position on Y-axis and so on. The firmware of V1.01 and above supports the function.

## **11.8 Coordination Instructions**

## 11.8.1 DMC\_ControlAxisByPos

FB/FC	Explanation	Applicable model
FB	DMC_ControlAxisByPos controls the motion of an axis by sending an incremental position to the axis.	AS524C-B
	DMC_CAByPos_instance	

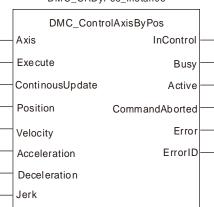

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Axis	Specify the number of the axis which is to be controlled.	USINT	Refer to <u>"Axis No.</u> <u>Ranges that</u> <u>Controllers</u> <u>Correspond to"</u> . (The variable value must be set)	When <i>Execute</i> changes from FALSE to TRUE
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
ContinuousUpd ate	Reserved	_	-	_
Position	Specify the incremental position.	LREAL	Positive number, Negative number and 0	When <i>Execute</i> changes from FALSE to
			(0)	TRUE
			Positive number	
Velocity	Specify the target speed	LREAL	( The variable	
			value must be set )	
			Positive number	
Acceleration	Specify the target acceleration.	LREAL	( The variable	
			value must be set)	
			Positive number	
Deceleration	Specify the target deceleration.	LREAL	( The variable	
			value must be set )	

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Jerk	Specify the change rate of target acceleration or deceleration.	LREAL	Positive number ( The variable value must be set )	


#### Output Parameters

Parameter name	Function	Data type	Valid range
InControl	TRUE when the axis is under control of the instruction.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the axis is being controlled by the instruction.	BOOL	TRUE/FALSE
CommandAborted	TRUE when the instruction execution is aborted.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE
ErrorID	Contains error codes when an error occurs. Please refer to the section 12.2 for corresponding error codes.	WORD	

### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
InControl	• When the axis is controlled by the instruction.	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts to control the axis.</li> </ul>	<ul> <li>When CommandAborted changes to TRUE.</li> <li>When Error changes to TRUE.</li> </ul>
CommandAborted	<ul> <li>When this instruction is aborted in process of being executed.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>

### • Output Update Timing Chart

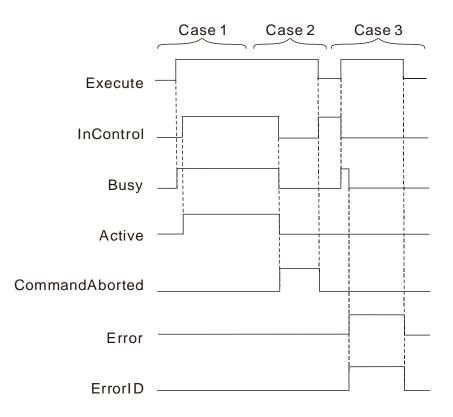

- Case 1 : *Busy* changes to TRUE when *Execute* changes to TRUE. Several cycles later, *Active* and *InControl* change to TRUE.
- Case 2 : When *Execute* changes from FALSE to TRUE and the instruction is aborted by other instruction, *CommandAborted* changes to TRUE and meanwhile *Busy* and *Active* change to FALSE. *CommandAborted* changes to FALSE when *Execute* changes from TRUE to FALSE.
- Case 3 : When an error occurs such as axis alarm or Offline after *Execute* changes from FALSE to TRUE, *Error changes* to TRUE and *ErrorID* shows corresponding error codes. Meanwhile, *Busy* and *Active* change to FALSE and *InControl* changes to FALSE. *Error* changes to FALSE when *Execute* changes from TRUE to FALSE.

#### • Function


- 1. DMC\_ControlAxisByPos instruction is executed by changing *Execute* from FALSE to TRUE. Changing *Execute* of the instruction from TRUE to FALSE during the instruction execution does not affect the instruction execution.
- 2. While *Execute* changes from FALSE to TRUE once more during the execution of DMC\_ControlAxisByPos, there is still no impact on the instruction execution.
- 3. The velocity, acceleration and deceleration must be greater than 0. None of them are used in the calculation of the position control.
- 4. The *Position* in this instruction means a relative incremental position. The reference position for the incremental position is what the value of *Postion* is when *Execute* of the instruction changes from FALSE to TRUE.


For example, the value of *Position* is 5000 and the axis position is 500. Change *Execute* of the instruction from FALSE to TRUE. Then the axis remains motionless and the axis position remains unchanged. Change the value of *Position* to 6000 (which has increased by 1000), the axis completes the motion in one SYNC cycle. The axis position is 1500 ( which has increased by 1000) after the travel is completed.

# Programming Example

The programming example is as follows when one DMC\_ControlAxisByPos instruction is used.

Variable name	Data type	Initial value	
Pwr	MC_Power		
Axis1	USINT	1	
Pwr_Sta	BOOL	FALSE	
Pwr_Bsy	BOOL	FALSE	
Pwr_Act	BOOL	FALSE	
Pwr_Err	BOOL	FALSE	
Pwr_ErrID	WORD	0	
CAByPos	DMC_ControlAxisByPos		
CAByPos_Ex	BOOL	FALSE	
CAByPos_Ex_Pos	LREAL		
CAByPos_Ex_Vel	LREAL	1	
CAByPos_Ex_Acc	LREAL	1	
CAByPos_Ex_Dec	LREAL	1	
CAByPos_Ex_Jerk	LREAL	1	
CAByPos_InC	BOOL	FALSE	
CAByPos_Bsy	BOOL	FALSE	
CAByPos_Act	BOOL	FALSE	
CAByPos_Abt	BOOL	FALSE	
CAByPos_Err	BOOL	FALSE	
CAByPos_ErrID	WORD	0	

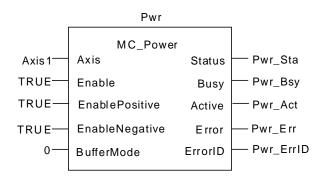

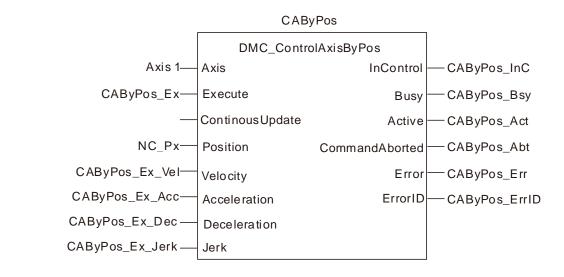

CAByPos\_Ex changes to TRUE after the axis is power on. Meanwhile CAByPos\_Bsy is TRUE in the same cycle. CAByPos\_Act is TRUE in the next cycle. Then increase the value of CAByPos\_Ex\_Pos by 10 per cycle. Suppose the SYNC cycle is 2ms, there are 500 SYNC cycles within 1 second and the axis command velocity is 10\*500=5000 units/second.

FB/FC		Explanation		Applicable model
FB	DMC_NC Instruction is used to CNC file every SYNC cycle.	n is used to parse out the position of each axis in the		AS524B-C
		DMC	_NC	
		Execute	Done	
	_	Pause	Busy	
		Stop	Active	
	—	Veloverride	Error	
	_	Depth	ErrorID	
	_	NcFile	Bypass	
		AxesGroup	CurrentLine	
		Mode	Pos_X	
		Res	Pos_Y	
			Pos_Z	
			Pos_A	
			Pos_B	
			Pos_C	
			Pos_P	
			Pos_Q	

## 11.8.2 DMC\_NC

#### • Input Parameters

Parameter name	Function	Data type	Valid range (Default)	Validation timing
Execute	The instruction is executed when <i>Execute</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	-
Pause	Parsing the CNC file by DMC_NC is stopped temporarily when <i>Pause</i> changes from FALSE to TRUE.	BOOL -	TRUE or FALSE (FALSE)-	-
Stop	Parsing the CNC file by DMC_NC is aborted when <i>Stop</i> changes from FALSE to TRUE.	BOOL	TRUE or FALSE (FALSE)	
VelOverride	Velocity override, Unit: %, e.g. "100" means 100%	LREAL	Negative, 0-500 ( 0 )	When <i>Execute</i> is TRUE
Depth	Enter 1 here; Reserved.	LREAL	1-50 (0)	When <i>Execute</i> changes from FALSE to TRUE

Parameter name	Function	Data type	Valid range (Default)	Validation timing
NCFile	CNC file Number	LREAL	1-64 (0)	When <i>Execute</i> changes from FALSE to TRUE
AxesGroup	The number of an axes group	LREAL	1-8 ( 0 )	When <i>Execute</i> changes from FALSE to TRUE
Mode	Enter 0 here; Reserved.			
Res	Reserved			


#### Output Parameters

Parameter name	Function	Data type	Valid range
Done	TRUE when parsing the CNC file is complete.	BOOL	TRUE/FALSE
Busy	TRUE when the instruction is being executed.	BOOL	TRUE/FALSE
Active	TRUE when the instruction is parsing the CNC file.	BOOL	TRUE/FALSE
Error	TRUE when an error occurs in the instruction execution.	BOOL	TRUE/FALSE
ErrorID	Contains the error code when an error occurs. Please refer to section 12.2.	WORD	
Bypass	Reserved	BOOL	
CurrentLine	The number of the row where the G code is being executed currently.	UDINT	
Pos_X	The X-axis position which is parsed out	LREAL	
Pos_Y	The Y-axis position which is parsed out	LREAL	
Pos_Z	The Z-axis position which is parsed out	LREAL	
Pos_A	The A-axis position which is parsed out	LREAL	
Pos_B	The Baxis position which is parsed out	LREAL	
Pos_C	The C-axis position which is parsed out	LREAL	
Pos_P	The P-axis position which is parsed out	LREAL	
Pos_Q	The Q-axis position which is parsed out	LREAL	

#### • Output Update Timing

Parameter Name	Timing for changing to TRUE	Timing for changing to FALSE
Done	<ul> <li>When parsing the CNC file is over.</li> <li>The <i>Stop</i> input changes to TRUE.</li> </ul>	<ul> <li>When <i>Execute</i> changes from TRUE to FALSE.</li> </ul>
Busy	◆ When <i>Execute</i> changes to TRUE.	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes to TRUE.</li> </ul>
Active	<ul> <li>When the instruction starts parsing the CNC file.</li> </ul>	<ul> <li>When <i>Error</i> changes to TRUE.</li> <li>When <i>Done</i> changes to TRUE.</li> </ul>
Error	<ul> <li>When an error occurs in the instruction execution or the input parameters for the instruction are illegal.</li> </ul>	<ul> <li>When Execute changes from TRUE to FALSE.</li> </ul>

#### Case 4 : Output Update Timing Chart

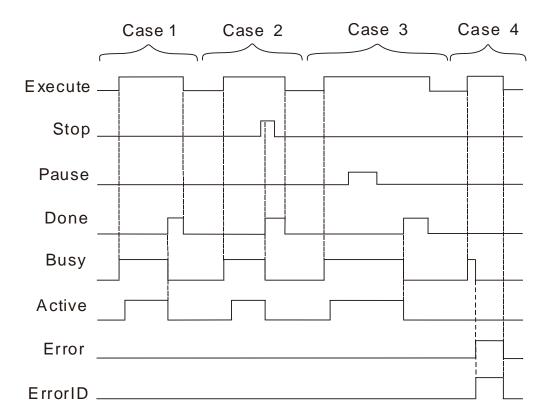

- **Case 1**: Busy changes to TRUE when *Execute* changes to TRUE. Several cycles later, *Active* changes to TRUE. When parsing the CNC file is complete, *Done* changes to TRUE. Meanwhile *Busy* and *Active* change to FALSE. When *Execute* changes to FALSE, *Done* changes to FALSE.
- Case 2 : Busy changes to TRUE when Execute changes to TRUE. Several cycles later, Active changes to TRUE. Change the state of Stop to TRUE while the CNC file is being parsed. In the next cycle, Done changes to TRUE, meanwhile Busy and Active change to FALSE, the CNC file parsing ends and CurrentLine and axis position outputs stop. Changing the state of Stop to FALSE, Done remains TRUE. When Execute changes to FALSE, Done changes to FLASE.
- **Case 3** : *Busy* changes to TRUE when *Execute* changes to TRUE. Several cycles later, *Active* changes to TRUE. change the state of *Pause* to TRUE while the CNC file is being parsed. The instruction

stops parsing the CNC file temporarily and *CurrentLine* and axis position outputs stop. Changing the state of *Pause* to FALSE, the parsing of the CNC file continues and *CurrentLine* and axis position outputs are recovered. When the *parsing* is complete, *Done* changes to TRUE. Meanwhile *Busy* and *Active* change to FALSE. *Done* changes to FALSE by changing *Execute* to FALSE.

**Case 4**: When *Execute* changes to TRUE and one of the parameter values for the instruction is incorrect, *Busy* changes to TRUE. One cycle later, *Error* changes to TRUE, *ErrorID* outputs error ID and *Busy* changes to FALSE. When *Execute* changes to FALSE, *Error* changes to FALSE and the vlaue of *ErrorID* changes to 0.

#### Case 5 : Function

DMC\_NC Instruction is used to parse the CNC file.

The instruction analyzes the position of each axis and outputs each axis position to corresponding output parameters of the instruction (e.g. Pos\_X, Pos\_Y, etc.) every SYNC cycle. Actually the values of Pos\_X and Pos\_Y do not control the axes and they are only the positions which are parsed out. If you want to control any axis through this instruction, the position which is parsed out by the instruction can be assigned to *Position* of the DMC\_ControlAxisByPos instruction by using the DMC\_NC instruction together with the DMC\_ControlAxisByPos instruction. By doing so, the axis motion can be controlled according to the path planned in the CNC file.

- 1. The DMC\_NC Instruction is executed by changing *Execute* from FALSE to TRUE. There is no impact on the instruction execution by changing *Execute* of the instruction from TRUE to FALSE in the course of the instruction execution.
- 2. Changing *Execute* from FALSE to TRUE once more during the execution of DMC\_NC Instruction does not affect the instruction execution.
- 3. By setting *Stop* to TRUE during the DMC\_NC instruction execution, the CNC file parsing will end and *Done* changes to TRUE.
- 4. By setting *Pause* to TRUE during the DMC\_NC instruction execution, the CNC file parsing will stop for a while and will continue after *Pause* is set to FALSE.
- 5. The *NCFile* input specifies the number of the CNC file to be executed, i.e. it is the ID of the CNC file created in the programming software.
- 6. The AxesGroup input specifies the number of the axes group which is to execute the CNC file.

#### 

#### Programming Example

Axes are controlled to move according to the path planned in the CNC file by using DMC\_NC and DMC\_ControlBypos instructions. Axis 1 and axis 2 are configured in the program. The initial positions of the two axes are both 10000 units. Axis 1 is X axis and axis 2 is Y axis.


A new CNC file is created in the program with the file ID set to 1. See the program as follows. N00 G91 N01 G0 X40000 Y90000

CNC file execution result:


After G91 is executed, the end position of each axis in the G codes below G91 is calculated by the incremental value starting from the current position. After G0 is executed, X axis moves 40000 units from the current position (10000) to the end position (50000). Y axis moves 90000 units from current position (10000) to end position (100000)

Variable name	Data type	Initial value
CAByPos	DMC_ControlAxisByPos	


Variable name	Data type	Initial value
Axis1	USINT	1
CAByPos_Ex	BOOL	FALSE
CAByPos_Ex_Vel	LREAL	1
CAByPos_Ex_Acc	LREAL	1
CAByPos_Ex_Dec	LREAL	1
CAByPos_Ex_Jerk	LREAL	1
CAByPos_InC	BOOL	FALSE
CAByPos_Bsy	BOOL	FALSE
CAByPos_Act	BOOL	FALSE
CAByPos_Abt	BOOL	FALSE
CAByPos_Err	BOOL	FALSE
CAByPos_ErrID	WORD	0
CAByPos1	DMC_ControlAxisByPos	
Axis2	USINT	2
CAByPos1_Ex	BOOL	FALSE
CAByPos1_Ex_Vel	LREAL	1
CAByPos1_Ex_Acc	LREAL	1
CAByPos1_Ex_Dec	LREAL	1
CAByPos1_Ex_Jerk	LREAL	1
CAByPos1_InC	BOOL	FALSE
CAByPos1_Bsy	BOOL	FALSE
CAByPos1_Act	BOOL	FALSE
CAByPos1_Abt	BOOL	FALSE
CAByPos1_Err	BOOL	FALSE
CAByPos1_ErrID	WORD	0
NC	DMC_NC	
NC_EX	BOOL	FALSE
NC_Pau	BOOL	FALSE
NC_Stop	BOOL	FALSE
NC_Ver	LREAL	100
 NC_Dep	UINT	1
NC_File	UINT	1
NC_Axes	UINT	1
NC_Mode	INT	0
NC_Res	LREAL	0
NC_Act	BOOL	FALSE
NC_Err	BOOL	FALSE
NC_ErrID	WORD	0
NC_Bys	BOOL	0
NC_Cur	UDINT	0
NC_Px	LREAL	0
NC_Py	LREAL	0
NC_Pz	LREAL	0
 NC_Pa	LREAL	0
NC_Pb	LREAL	0
NC_Pc	LREAL	0
NC_Pp	LREAL	0
NC_Pq	LREAL	0

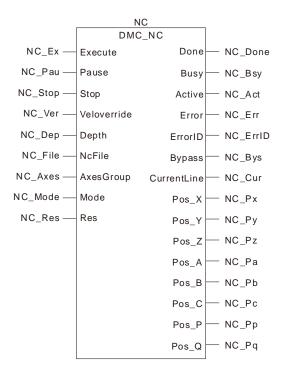



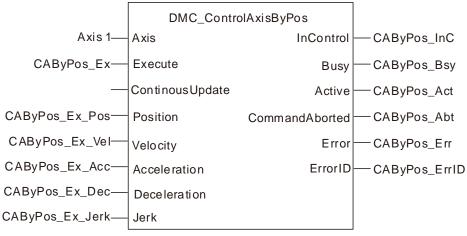

#### 11

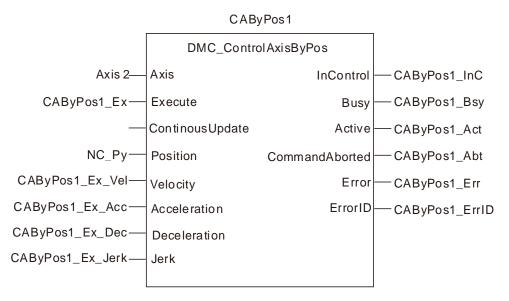


When CAByPos\_Ex and CAByPos1\_Ex are set to TRUE after axis 1 and axis 2 are power on, *Busy* and *Active* of CAByPos and CAByPos1 instructions change to TRUE.

After the NC\_Ex variable changes to TRUE, NC\_Bsy changes to TRUE, NC\_Act changes to TRUE, NC\_Cur displays the number of the row in which the CNC file is being parsed currently. NC\_Px, NC\_Py, NC\_Pz, NC\_Pa, NC\_Pb, NC\_Pc, NC\_Pp and NC\_Pq output the positions of axes respectively after the CNC file is parsed in the current cycle.

CAByPos controls X axis to move according to the value of NC\_Px which is parsed out and CAByPos1 controls Y axis to move according to the value of NC\_Py which is parsed out.

After the program is executed, the Position/Time curve for the whole motion process is shown as below.

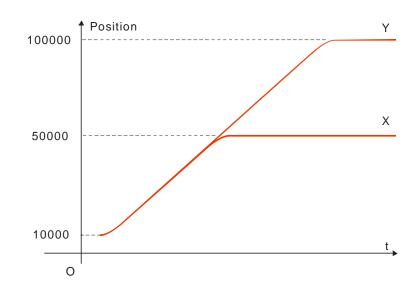

MEMO

11

# 12

# **Chapter 12 Troubleshooting**

# Table of Contents

12.1	Explanation of LED Indicators	12-2
12.2	Table of Error IDs in Motion Instructions	12-8
12.3	System Trouble Diagnosis through System Error Codes 1	2-20

This section mainly introduces the troubleshooting methods when any trouble occurs in the motion controller.

## **12.1 Explanation of LED Indicators**

#### • POWER LED

POWER LED indicates the state of the power supply for the motion controller.

LED state	Explanation	How to deal with
Blue light ON	Supply power is normal	No correction
LED OFF or	Supply power is abnormal	Check if the supply power for the motion
blinking		controller is normal.

#### • RUN LED

12

RUN LED indicates the state of program execution in the motion controller.


LED state	Explanation	How to deal with
Green light ON	The motion controller is in RUN state.	No correction
LED OFF	The motion controller is in STOP state.	Switch PLC to the RUN state according to demand

#### • ERROR LED


ERR LED indicates the error state of the motion controller.

LED state	Explanation	How to deal with
LED OFF	The motion controller is in the state of normal work.	No correction
Red light blinking	Errors in the program or configuration.	Get the detailed error information through the error diagnosis function.
Red light ON	Mistakes in hardware	Contact local technicians.

#### ■ ERROR LED: Red light blinks. (1HZ)

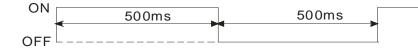

#### ■ ERROR LED: Red light blinks quickly. (10HZ)

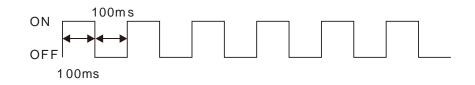

#### • BAT LOW LED

The BAT LOW LED indicates the state of the motion controller's button battery.

LED state	Explanation	How to deal with
OFF	The 3V button battery is supplying power normally.	No correction
Red light ON	The 3V button battery is not installed or in the state of undervoltage.	Replace the button battery with a new one.

#### • SD LED

SD LED is used for displaying the state of the SD card in the motion controller.

LED state	Explanation	How to deal with
OFF	<ol> <li>No SD card is inserted to the motion controller.</li> <li>An error occurs in reading and writing the document</li> </ol>	Insert the SD card or not according to the actual demand
Green light blinks quickly	The SD card in the motion controller is exchanging data	No correction
Green light ON	No data exchange for the SD card in the motion controller.	


#### • CAN1 (Motion) LED

#### RUN LED

LED state	Explanation	How to deal with
LED OFF	No axis is configured for CAN1 (Motion) port in the software.	Configure the slave connected to Motion port to the master in the software.
Green light blinking	Not all of the axes configured for CAN1 (Motion) in the software have been online.	<ol> <li>Check if the bus cable connection in the Motion network is correct.</li> <li>Check if the Motion bus cable is Delta standard CANopen cable.</li> <li>Check if the two ends of Motion bus have connected a terminal resistor respectively</li> <li>Check if the baud rates of Motion port and slaves are same.</li> <li>Check if the slaves configrued in the software have actually been connected to the network.</li> <li>Check if some slave can not make the connection with the master.</li> <li>Check if some slave is offline.</li> </ol>
Green light ON	All of the axes configured for CAN2 (Motion) in the software have been online.	No correction

#### RUN LED


12

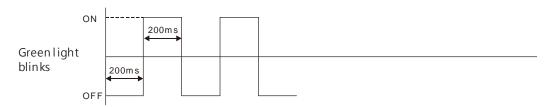

#### ERR LED

LED state	Explanation	How to deal with
LED OFF	PLC module is in the state of normal work.	No correction
Red light double flashes	Some slave is offline	<ol> <li>Check if the Motion bus cable is Delta standard CANopen cable.</li> <li>Check if the two ends of Motion bus have connected a terminal resistor respectively.</li> <li>Check if all slaves configrued in the software have actually been connected to the network.</li> <li>Check if the interference around CANopen bus cable is too strong.</li> </ol>
Red light single flash	The bus error is out of the alert level.	<ol> <li>Check if the bus cable connection in the Motion network is correct.</li> </ol>
Red light ON	Bus-off	<ol> <li>Check if the Motion bus cable is Delta standard CANopen cable.</li> <li>Check if the two ends of Motion bus have connected a terminal resistor respectively.</li> <li>Check if the baud rates of Motion port and slaves are same.</li> <li>Check if the interference around Motion bus cable is too strong.</li> </ol>

**ERR LED:** Red light is in a single flash and double flashes as below.

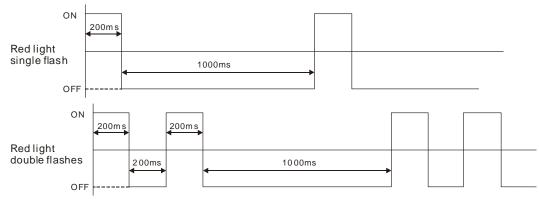


#### • CAN2 (CANopen) LED

#### RUN LED

LED state	Explanation	How to deal with
Green light single flash	CAN2 (CANopen) communication port is in STOP state.	PC is downloading the network configuration data. Wait till downloading is completed.

Green light blinking	CAN2 (CANopen) communication port is in Preoperational state.	<ol> <li>Check if CANopen network bus cable connection is correct.</li> <li>Check if the CANopen bus cable is Delta standard CANopen cable.</li> <li>Check if the two ends of the CANopen bus have connected a terminal resistor respectively.</li> <li>Check if the baud rate of the master is the same as that of other slaves.</li> <li>Check if configured slaves have been actually connected to the network.</li> <li>Check if some slave can not make the connection with the master.</li> <li>Check if some slave is offline.</li> </ol>
Green light ON	CAN2 (CANopen) communication port is in RUN state.	No correction

#### **RUN LED:** Green light is in single flash and blinks as below.

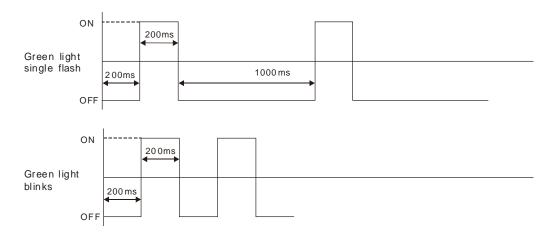


#### ERR LED

LED state	Explanation	How to deal with
LED OFF	PLC module is in the state of normal work.	No correction
Red light double flashes	Some slave is offline.	<ol> <li>Check if the CANopen bus cable is Delta standard cable.</li> <li>Check if the two ends of CANopen bus have connected a terminal resistor respectively.</li> <li>Check if configured slaves have been actually connected to the network.</li> <li>Check if the interference around CANopen bus cable is too strong.</li> </ol>
Red light single flash	The bus error is out of the alert level.	1. Check if the CANopen bus cable connection is correct.
Red light ON	Bus-off	<ol> <li>Check if the CANopen bus cable is Delta standard cable.</li> </ol>

LED state	Explanation	How to deal with
		<ol> <li>Check if each of the two ends of CANopen bus has connected a terminal resistor respectively.</li> <li>Check if the baud rate of CANopen port is the same as that of other slaves.</li> <li>Check if the interference around CANopen bus cable is too strong.</li> </ol>

#### **ERR LED:** Red light is in a single flash and double flashes as below.

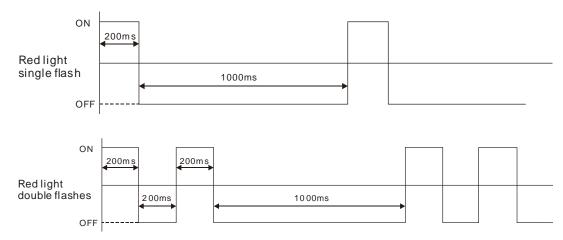

#### • Ethernet 1 LED

Ethernet 1 LED indicates the network state of one Ethernet communication port of the left side of the motion controller. There are two indicators, yellow and green for Ethernet 1. The green one indicates the Ethernet communication state and the yellow one indicates the baud rate of the Ethernet communication.

LED	State	Indication
Green	ON	The baud rate of the Ethernet communication is 100Mbps.
light	OFF	The baud rate of the Ethernet communication is 10Mbps or the controller has not been connected to the Ethernet network.
Yellow light	Blinking	Data are being transmitted or received via the Ethernet port of the controller.
	OFF	No data are being transmitted or received via the Ethernet port of the controller.

#### • Ethernet 2 LED

Ethernet 2 LED indicates the network state of the other Ethernet communication port of the left side of the motion controller. There are two indicators, yellow and green for Ethernet 2. The green one indicates the Ethernet communication state and the yellow one indicates the baud rate of the Ethernet communication.

LED	State	Indication
Green	ON	The baud rate of the Ethernet communication is 100Mbps.
light	OFF	The baud rate of the Ethernet communication is 10Mbps or the controller has not been connected to the Ethernet network.

LED	State	Indication
Yellow light	Blinking	Data are being transmitted or received via the Ethernet port of the controller.
	OFF	No data are being transmitted or received via the Ethernet port of the controller.

#### • RS232 LED

RS232 LED, the RS-232 communication indicator of the motion controller indicates the communication state of RS-232 port of the motion controller.

LED state	Indication
Yellow light blinking	There are response data via RS-232 port.
LED OFF	There are no response data via RS-232 port.

#### • RS485 LED

RS485 LED, the RS-485 communication indicator of the motion controller indicates the communication state of RS-485 port of the motion controller.

LED state	Indication
Yellow light blinking	There are response data via RS-485 port.
LED OFF	There are no response data via RS-485 port.

#### Input point LED

There are 16 input point LED indicators for showing if the motion controller's digital input points are ON or OFF.

LED state	Indication
Red light ON	Input point is ON.
LED OFF	Input point is OFF.

#### Output point LED

There are 8 output point LED indicators for showing if the motion controller's digital output points are ON or OFF.

LED state	Indication
Red light ON	Output point is ON.
LED OFF	Output point is OFF.

## 12.2 Table of Error IDs in Motion Instructions

When an error occurs in the motion instruction, the value of ErrorID can be seen as follows for analysis of the cause and troubleshooting.

Erre	orID	Maaring	
Hex	Decimal	Meaning	How to deal with
1001	4097	The axis No. exceeds the valid range.	Make sure that the value of the input variable, <i>Axis</i> is within the allowed range.
1002	4098	The acceleration exceeds the valid range.	Make sure that the value of the input variable, <i>Acceleration</i> is a positive number.
1003	4099	The deceleration exceeds the valid range.	Make sure that the value of the input variable, <i>Deceleration</i> is a positive number.
1004	4100	The change rate of the acceleration exceeds the valid range.	Make sure that the value of the input variable, <i>Jerk</i> is a positive number.
1005	4101	The velocity exceeds the valid range.	Make sure that the value of the input variable, <i>Velocity</i> is a nonzero value.
1006	4102	The position value exceeds the valid range.	Make sure that the value of the input variable, <i>Position</i> of MC_MoveAbsolute is not greater than the value of Modulo among axis parameters.
1007	4103	The direction value exceeds the valid range.	Modify the value of the input variable, <i>Direction</i> into that which can be set in the instruction.
1008	4104	The buffermode value exceeds the valid range.	Modify the value of the input variable, <i>BufferMode</i> into that which can be set in the instruction.
1009	4105	The input value for reference position type is wrong.	Modify the value of the input variable, <i>ReferenceType</i> into that which can be set in the instruction.
100A	4106	The timing for executing MC_SetPosition is improper.	Change the timing of executing MC_SetPosition. Do not execute MC_SetPosition while MC_Home or MC_Stop is being executed.
100B	4107	The number of e-cam table is incorrect.	Modify the value of the input variable, <i>CamTable</i> into that of CamId set in the software.
100C	4108	The axis No. of the master axis is incorrect.	Make sure that the value of the input variable, <i>Axis</i> is within the allowed range.
100D	4109	The input value of the engagement mode is wrong.	Modify the value of the input variable, <i>StartMode</i> into that which can be set in the instruction.
100E	4110	The value of the master scaling is incorrect.	Make sure that the value of the input variable, <i>MasterScaling</i> is a positive number.
100F	4111	The value of the slave scaling is incorrect.	Make sure that the value of the input variable, <i>SlaveScaling</i> is a nonzero value.
1010	4112	The chosen position source of the master axis is wrong.	Modify the value of the input variable, <i>MasterValueSource</i> into that which can be set for the instruction.
1011	4113	Conflict in the axis No. of the master and slave axes.	Modify the values of the input variables, <i>Master</i> and <i>Slave</i> into different values.

Erro	orID	Magning	How to deal with
Hex	Decimal	Meaning	How to deal with
1012	4114	Wrong e-gear numerator value	Modify the value of the input variable, <i>Numerator</i> into a nonzero value.
1013	4115	Wrong e-gear denominator value	Modify the value of the input variable, <i>Denominator</i> into a nonzero value.
1014	4116	The value of VelFactor is incorrect.	Modify the value of the input variable, <i>VelFactor</i> into that which can be set in the instruction.
1015	4117	SDO Timeout in E network (or Motion network)	<ol> <li>Check if the slave specified in the instruction exists.</li> <li>Check if the connection between the accessed slave and CANopen port or Motion port is normal.</li> <li>Check if the baud rates of CANopen port or Motion port and the accessed slave are same.</li> </ol>
1016	4118	The input parameter error of the SDO instruction	Check if the input parameter settings of the SDO instruction are reasonable. For example, see whether the accessed Index and Subindex exist or not and whether the value of DataType is legal or not.
1017	4119	Other faults in SDO in CANopen network (or Motion network).	Check if slaves are in normal work.
1018	4120	The value of TriggerInput of the position-capture instruction DMC_TouchProbe is wrong.	Modify the value of the input variable, <i>TriggerInput</i> . The value can be set within the range of 0~15 respectively representing I0~I7 and I10~I15.
1019	4121	The input point specified by TriggerInput of the instruction DMC_TouchProbe has been used in another DMC_TouchProbe.	Modify the value of <i>TriggerInput</i> of the instruction into one value which has not been used yet.
101A	4122	Windowonly of DMC_TouchProbe is abnormal.	Modify the values of <i>Firstops</i> and <i>Lastops</i> into those within the valid range.
101B	4123	Two DMC_TouchProbe instructions are performed for capturing the position of the same axis at the same time.	Prevent two DMC_TouchProbe instructions from capturing the position of the same axis at the same time.
101C	4124	The setting value of Mode of DMC_TouchProbe is incorrect.	Modify the value of the input variable, <i>Mode</i> into that which can be set in the instruction.
101D	4125	The axis specified by DMC_TouchProbe is not an encoder axis.	Modify the value of the input variable, <i>Axis</i> into the axis No. of the encoder axis which has been configured.
101E	4126	The value of ActivationPosition of MC_CamIn is incorrect.	Modify the value of the input variable, <i>ActivationPosition</i> into that which can be set in the instruction.
1020	4128	The used axis is not configured to the Motion network in the software.	Modify the value of the input variable, <i>Axis</i> into the axis No. which has been configured in the Motion network.
1021	4129	The radius of the rotary-cut axis is incorrect.	Modify the value of the input variable, <i>RotaryAxisRadius</i> . It should be greater than 0.

Errc	orID	••	
Hex	Decimal	Meaning	How to deal with
1022	4130	The radius of the feed axis is incorrect.	Modify the value of the input variable, <i>FeedAxisRadius</i> . It should be greater than 0.
1023	4131	The cutting length is incorrect.	Modify the value of the input variable, <i>CutLenth</i> of APF_RotaryCut_Init. It should be greater than 0.
1024	4132	The value of SyncStartPos is incorrect.	Modify the value of the input variable, <i>SyncStartPos</i> of APF_RotaryCut_Init. It should be between 0 and the cutting length.
1025	4133	The value of SyncStopPos is incorrect.	Modify the value of the input variable, <i>SyncStopPos</i> of APF_RotaryCut_Init. It should be between 0 and the cutting length.
1026	4134	The settings of SyncStopPos and SyncStartPos are incorrect.	The value of the input variable, <i>SyncStopPos</i> should be less than that of SyncStartPos of the instruction.
1027	4135	The value of RotCutID is incorrect.	The value of the input variable, <i>RotCutID</i> should be in the range of 1~8.
1028	4136	The value of RotaryAxisKnifeNum is incorrect.	The value of the input variable, <i>RotaryAxisKnifeNum</i> should be in the range of 1~16.
1029	4137	The inner state of rotary cut is illegal.	Modify the parameter values for initializing rotary cut.
103A	4154	Rotary cut initializing fails.	Since APF_RotaryCut_Init has not been executed, please execute APF_RotaryCut_Init first and then execute APF_RotaryCut_In.
103B	4155	The axis is offline and the capture function can not be performed	Execute the capture instruction after the axis is connected normally.
103C	4156	The value of <i>MasterOffset</i> of MC_CamIn is greater than the master axis cam cycle range.	Modify the value of <i>MasterOffset</i> into that between the negative number and positive number of the master axis cam cycle range. (The master axis cam cycle range= Maximum master axis cam cycle- Mimimum master axis cam cycle)
103D	4157	The value of <i>SlaveOffset</i> of MC_CamIn is greater than the slave axis cam cycle range.	Modify the value of <i>SlaveOffset</i> into that between the negative number and positive number of the slave axis cam cycle range. (The slave axis cam cycle range= Maximum slave axis cam cycle- Minimum slave axis cam cycle)
103E	4158	The <i>Depth</i> value of the instruction is out of the range.	Modify the value of the input <i>Depth</i> in order not to exceed the range.
103F	4159	The VelOverride value range of the instruction is illegal.	Modify the value of the input <i>VelOverride</i> in order not to exceed the range.
1040	4160	The file code is illegal.	Modify the value of the input <i>NCFile</i> into a proper code value.
1041	4161	DMC_SetTorque is executed when the axis is not in Standstill state.	Make sure that DMC_SetTorque is executed when the axis is in Standstill state.

ErrorID		Mooning	How to deal with
Hex	Decimal	Meaning	How to deal with
1042	4162	The execution of MC_Reset fails.	<ol> <li>Check if the axis specified by MC_Reset exists.</li> <li>MC_Reset is executed after the servo alarm is cleared.</li> </ol>
1043	4163	The execution of an instruction leads to the result that the axis position exceeds the range set in the software.	Modify the instruction to make sure that the final position does not exceed the software limit range.
1044	4164	The cam curve specified by MC_CamIn is not built in the software.	Check if the <i>CamTable</i> value of MC_CamIn can correspond to the cam curve built in the software.
1045	4165	Axis group ID error	Check if the value of <i>GroupID</i> is within the range of 1~8.
1046	4166	Mode input value error	The value of <i>Mode</i> for the instruction can only be set to 0
1047	4167	The number of the From/To instruction is wrong.	Check the value of <i>Station</i> and the number of the instruction are correct.
1048	4168	An error in the number of CR registers which are read and written by From/To.	Check if the value of <i>Num</i> is within the range of 1~64.
1049	4169	The variable is not set for an instruction input pin	Set an variable for the input pin.
104A	4170	No response transmitted to From/To instruction	Check if the connection between modules is proper and if the extension module works normally.
104B	4171	Empty CNC file	Check if the value of NCFile is correct and the corresponding CNC file is empty.
104C	4172	Path resolution error	Ensure that the G codes or axes group instructions settings for the path are correct.
104D	4173	The position capture instruction did not receive the capture signal within the window range and the capture failed.	Ensure that the window range is set properly.
104E	4174	G code identifying error	Ensure that G code file writing is proper.
104F	4175	Incorrect pre-read G code format	Ensure that G code file writing is proper.
1050	4176	G-code pre-reading error	Ensure that G code file writing is proper.
1051	4177	Path writing error	Ensure that path writing is proper.
1052	4178	The setting for Position of the axis drive specified in MC_Home instruction failed. Perhaps the drive does not support the parameter.	
1053	4179	MC_Home instruction does not support the encoder axis which takes data sources as the encoder mode and SSI absolute encoder axis.	
1054	4180	Too many levels of G26 nesting in G codes	Check if the number of levels of G26 nesting exceeds 16.

ErrorID		Magning	How to dool with
Hex	Decimal	Meaning	How to deal with
1400	5120	The module does not support the function.	Modify the value of the input variable <i>Module</i> of the instruction as the number of AS02PU/AS04PU actually connected on the right side of AS500 controller.
1401	5121	Some input values of the PU module related instruction are illegal or out of range.	
1402	5122	Communication timeout occurs between the master and its right-side module.	Ensure that the connection between AS500 controller and its right-side AS02PU/AS04PU module is proper. Please contact local technicians if the error still exists after power on again.
1403	5123	No such an axis number exist in the PU module.	Modify the value of the input variable <i>Axis</i> of the instruction and ensure it is between 1 and 4.
1404	5124	The output speed of the axis of the PU module is illegal.	Modify the value of the output speed in the instruction and ensure it is between -100,000 and 100,000.
1405	5125	While the specified axis is being controlled by a PU module related instruction, another instruction is to control the same axis.	
2001	8193	The axis is disabled by means of MC_Power instruction when it is not in Standstill state.	Make the axis disabled by using MC_Power instruction when the axis is in Standstill state.
2002	8194	The instruction cannot be executed due to the limitation of the motion direction.	Set <i>EnablePositive</i> and <i>EnableNegative</i> of MC_Power to TRUE to cancel the limitation of the motion direction of the axis.
2004	8196	MC_HaltSuperimposed cannot be performed when MC_MoveSuperimposed is not executed yet.	Modify the sequence of execution of MC_HaltSuperimposed. The execution of MC_HaltSuperimposed should be conducted in the process of performing MC_MoveSuperimposed.
2100	8448	The state machine limits that the function cannot be performed.	Modify the timing for execution of the instruction. Refer to the state machine in section 10.4 for the execution of motion instructions.
2101	8449	The buffer register is full.	The <i>BufferMode</i> of a motion control instruction only supports one switch for changing the time to execute current instruction and avoiding the circumstance that another instruction is also waiting to execute ( <i>BufferMode</i> is not 0) while one instruction is waiting to execute ( <i>BufferMode</i> is not 0).
2102	8450	Buffer function cannot be performed in the instruction.	The instruction cannot be operated in BufferMode.
3001	12289	An error in axis type setting	Modify the axis type on the axis configuration window.

Erre	orID	Meaning	How to deal with
Hex	Decimal	meaning	now to deal with
3002	12290	Servo alarm	Have the control over the servo after clearing the servo alarm.
3003	12291	Servo Timeout	Check if the connection between the controller and servo is OK.
3004	12292	The command position exceeds the limit position set in the software.	Check if the set software limit position is proper or disable the software limit position.
3005	12293	The process from RUN to STOP occurs in the controller (during the execution of a motion instruction)	Clear the error with the MC_Reset instruction and then execute other motion instruction.
600D	24589	Connection error	Check if the communication cable is proper.
6200	25088	TCP remote IP error	Check if the TCP remote IP address format is correct.
6201	25089	TCP remote port error	Check if the TCP remote port setting is out of the valid range.
6203	25091	TCP data-sending register address error	Check if the data-sending register address is within the valid range.
6206	25094	TCP data-receiving register address error	Check if the data-receiving register address is within the valid range.
6208	25096	The data that TCP master actually receives exceed the set length.	Modify the specified length of received data.
6209	25097	UDP remote IP address error	Check if the UDP remote IP address format is correct.
620A	25098	UDP communication port error	Modify UDP communication port.
620C	25100	UDP sending register address error	Check if the data-sending register address is within the valid range.
620F	25103	UDP receiving register address error	Check if the data-receiving register address is within the valid range.
6210	25104	The UDP data actually received exceed the set length.	Modify the specified length of data to be received.
6212	25106	Ethernet connection timeout	Modify the timeout time or check if the remote device is connected normally.
6213	25107	The data that TCP slave actually receives exceed the set length.	Modify the specified length of sent data.
6214	25108	The link is disabled due to a connection exception.	Make sure the remote device works.
6215	25109	The connection fails or is not enabled yet.	Check if the instruction operation sequence is correct.
6220	25120	Timeout	Modify timeout time or ensure the remote device is connected normally.
6300	25344	The number of connections exceeds the limit.	Check if the connection number is within the allowed range.
8000	32768	The instruction can be used for the diagnosis only when the controller works as CANopen master.	Modify the local controller as CANopen master before using the instruction.
8800	34816	The priority number of the task is greater than 31.	Set the priority number of the task to a value less than 31.
8801	34817	The watchdog function for the task has not been enabled yet.	Enable the watchdog function before the instruction execution.

Erro	orID		
Hex	Decimal	Meaning	How to deal with
8808	34824	The master has not configured the slave for diagnosis.	Configure the slave before the diagnosis.
8810	34832	Diagnosis type error	Modify diagnosis type
8818	34840	The axis to be diagnosed has not been configured.	Configure the axis before the diagnosis.
8820	34848	Diagnosis type error	Modify diagnosis type
9000	36864	Ethernet Link number exceeds the range of 1~16.	Modify Ethernet link number as 1~16
9001	36865	The written-data length configured for Ethernet link exceeds the maximum.	Modify the written-data length configured for Ethernet link within the allowed range.
9002	36866	The read-data length configured for Ethernet link exceeds the maximum.	Modify the read-data length configured for Ethernet link within the allowed range.
9003	36867	Ethernet physical connection error	Check if the network hardware connection is normal, e.g. the network cable connection.
9004	36868	Socket number exceeds the valid range	Modify Socket number as 1~4.
9005	36869	The length of sent data configured for Socket function exceeds the allowed maximum value.	Modify the length of sent data configured for Socket function as a value within 0~200.
9006	36870	The length of received data configured for Socket function exceeds the allowed maximum value.	Modify the length of received data configured for Socket function as 0~200.
9007	36871	Communication timeout time setting in Ethernet link configuration is improper.	Modify the timeout time as a value greater than 0.
9008	36872	The lengths of sent data and received data configured for the Socket function are both 0.	Modify either of the lengths of sent data and received data configured for the Socket function as a value which is not 0.
9010	36880	RS485 PLC Link number exceeds the range of 1-24.	Modify PLC Link number as a value within the range of 1-24.
9011	36881	The written-data length configured for RS485 PLC link exceeds the allowed maximum value.	Modify written data length configured for RS485 PLC link as a value which is within the allowed range.
9012	36882	The read data length configured for RS485 PLC link exceeds the allowed maximum value.	Modify read data length configured for RS485 PLC link as a value within the allowed range.
9013	36883	The length of sent data configured for RS485 free protocol function exceeds the allowed maximum value.	Modify the length of sent data configured for RS485 free protocol function as a value within the allowed range.
9014	36884	The length of received data configured for RS485 free protocol function exceeds the allowed maximum value.	Modify the length of received data configured for RS485 free protocol function as a value within the allowed range.
9015	36885	The number of the RS232 PLC Link exceeds the range of 1~24.	Modify the number of the RS232 PLC Link as a value within the range of 1-24.

Errc	orID	Meaning	How to deal with
Hex	Decimal	Meaning	
9016	36886	The written-data length configured for RS232 PLC link exceeds the allowed maximum value.	Modify the written-data length configured for RS232 PLC link as a value within the allowed range.
9017	36887	The read-data length configured for RS232 PLC link exceeds the allowed maximum value.	Modify the read-data length configured for RS232 PLC link as a value within the allowed range.
9018	36888	The length of sent data configured for RS232 free protocol function exceeds the allowed maximum value.	Modify the length of sent data configured for RS232 free protocol function as a value within the allowed range.
9019	36889	The length of received data configured for RS232 free protocol function exceeds the allowed maximum value.	Modify the length of received data configured for RS232 free protocol function as a value within the allowed range.
901A	36890	Communication timeout time setting in RS485/RS232 PLC link configuration is improper.	Modify the timeout time as a value greater than 0.
901B	36891	The lengths of read data and written data configured for the Ethernet/RS485/RS232 link are both 0.	Modify either of the lengths of read data and written data configured as a value which is not 0.
901C	36892	The lengths of sent data and received data configured for the RS485/RS232 free protocol function are both 0.	Modify either of the lengths of sent data and received data configured as a value which is not 0.
9020	36896	The local buffer of word type for data writing has no enough space to meet the specified length of data. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer to make it have enough space to meet the specified data length.
9021	36897	The start address of the local buffer of word type for data writing is out of the allowed word register area. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer within the allowed word register area.
9022	36898	The start address of the local buffer of word type for data writing is within the allowed word register area but can not meet the alignment of word register addresses. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer or offset length.
9023	36899	The local buffer of word type for the data reading has no enough space to meet the specified length of data. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer to make it have enough space to meet the specified data length.
9024	36900	The start address of the local buffer of word type for data writing is out of the allowed word register area. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer within the allowed word register area.
9025	36901	The start address of the local buffer of word type for data reading is within the allowed word register	Modify the start address of the local buffer or offset length.

Erre	orID	<u></u> .	
Hex	Decimal	Meaning	How to deal with
		area but can not meet the alignment of word register addresses. (Valid range: %MW0~%MW32767)	
9026	36902	The local buffer of bit type for data writing has no enough space to meet the specified length of data. (Range: %QX0.0~%QX127.7,%MX 0.0~%MX65535.7)	Modify the start address of the local buffer to make it have enough space to meet the specified data length.
9027	36903	The start address of the local buffer of bit type for data writing is out of the allowed area. ( Range: %QX0.0~%QX127.7,%M X0.0~%MX65535.7 )	Modify the start address of the local buffer within the allowed area.
9028	36904	The local buffer of bit type for data reading has no enough space to meet the specified length of data. (%QX0.0~%QX127.7,%MX0.0~%M X65535.7)	Modify the start address of the local buffer to make it have enough space to meet the specified data length.
9029	36905	The start address of the local buffer of bit type for data reading is out of the allowed area. (%QX0.0~%QX127.7,%MX0.0~%M X65535.7)	Modify the start address of the local buffer within the allowed area.
9030	36912	Object type error	Modify the value of the input parameter ObjType.
9031	36913	The specified function code for data reading exceeds the allowed range.	Specify a new function code which is within the allowed range.
9040	36928	The local buffer for data sending has no enough space to meet the specified length of data. (%MW0~%MW32767)	Modify the start address of the local buffer or specified data length.
9042	36930	The start address of the local buffer for data sending is out of the allowed word register area. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer.
9043	36931	The local buffer specified for data receiving has no enough space to meet the specified length of data. (%MW0~%MW32767)	Modify the start address of the local buffer or specified data length.
9045	36933	The start address of the local buffer specified for data receiving is out of the allowed word register area. (Valid range: %MW0~%MW32767)	Modify the start address of the local buffer.
9100	37120	Socket instruction parameter value exceeds the allowed range.	Modify the Socket instruction parameter values within the allowed range.
9101	37121	Ethernet physical connection is disconnected.	Check if the network cable connection is proper.
9102	37122	TCP remote IP address error	Modify the setting for the remote IP address.
9103	37123	TCP port error	Modify the remote port setting.

Erro	rID	Mooning	How to deal with
Hex	Decimal	Meaning	How to deal with
9105	37125	An error occurs in the register addresses for TCP data sending.	Modify register address for sending TCP data.
9106	37126	TCP/UDP data receiving is in process.	The last data receiving has not been completed and thus the new receiving can not be triggered.
9107	37127	TCP receiving register address error	Modify the register address for receiving TCP data.
9108	37128	The length of received data exceeds the set length in TCP server mode.	Set the length of received data to the length which is greater than or equal to the number of bytes of the first received data.
9109	37129	The length of received data exceeds the set length in UDP trasmission.	Set the length of received data to the length which is greater than or equal to the number of bytes of the first piece of received data.
910A	37130	UDP remote IP address error	Modify the remote IP address setting.
910B	37131	UDP port error	Local port and remote port can not be 0 at the same time.
910C	37132	An error occurs in the register addresses for sent UDP data.	Modify the register addresses for sent data.
910D	37133	An error occurs in the register addresses for received UDP data.	Modify the register addresses for storing the received data.
910E	37134	TCP connection timeout	Check if the Socket configuration is proper or the remote device works normally.
910F	37135	The length of received data exceeds the set length in TCP client mode.	Set the length of received data to the length which is greater than or equal to the number of bytes of the first piece of received data.
9110	37136	TCP link is declined by the remote device.	Check if the remote device is normal or retry the link to the remote device.
9111	37137	TCP/UDP link has not been enabled.	Make sure that the link has been enabled.
9112	37138	TCP/UDP link has been triggered.	The link is being built and thus the link building can not be re-triggered.
9113	37139	TCP/UDP data sending has been triggered.	The last data sending has not been completed and thus the sending can not be re-triggered.
9114	37140	TCP/UDP link has been built.	The link has been built and thus the repeated trigger can not build a link.
9115	37141	TCP/UDP link is being disabled.	The link is being disabled and thus the link disabling can not be re-triggered.
9116	37142	TCP/UDP link is not disabled.	The configuration of Socket parameters can be conducted only when the link is disabled.
9117	37143	The parameter value for the length of sent TCP/UDP data exceeds the limit.	Modify the length of sent data within the allowed range.
9118	37144	The parameter value for the length of received TCP/UDP data exceeds the limit.	Modify the length of received data within the allowed range.
A000	40960	Cam point number error	Modify the cam table number.
A001	40961	Tappet point number error	Modify tappet point number.
A008	40968	M code number error	Modify M code number.

Erro	orID		
Hex	Decimal	Meaning	How to deal with
A010	40976	Axes group state machine error	Modify the timing for the instruction execution.
A011	40977	The axes group number exceeds the allowed range.	Modify the axes group number.
A012	40978	The value of the input parameter <i>TransitionMode</i> is incorrect.	Modify the input value.
A013	40979	The value of the input parameter <i>TransitionParameter</i> is incorrect.	Modify the input value.
A014	40980	The setting value of <i>BufferMode</i> does not match that of <i>TransitionMode</i> .	Modify the input value.
A015	40981	The value of <i>CircMode</i> is incorrect.	Modify the input value.
A016	40982	The value of PathChoice is incorrect.	Modify the input value.
A800	43008	The mechanical gear ratio can not be 0 or a negative number.	Modify the mechanical gear ratio.
A801	43009	The <i>UnitsPerRotation</i> value can not be 0 or a negative number.	Modify the UnitsPerRotation value.
A802	43010	Axis type error	Modify the axis type.
A803	43011	The value of the modulo can not be a non-positive number.	Modify the value of the modulo.
A808	43016	<i>Ex_Move</i> is executed again when the instruction execution has not been completed yet.	Modify the timing of the instruction execution.
A809	43017	<i>Ex_Move</i> need be executed first before <i>Ex_Stop</i> is executed.	Modify the timing of the instruction execution.
A80A	43018	The RoundPhase value should be greater than 0.	Modify the <i>RoundPhase</i> value as a value which is greater than 0.
A80B	43019	The <i>StopPhase</i> value should be greater than 0 and less than the RoundPhase value.	Modify the <i>StopPhase</i> value as a value which is greater than 0 and less than the RoundPhase value.
A810	43024	The <i>TorqueRamp</i> value is 0 or a negative number.	Modify the TorqueRamp value.
A818	43032	The <i>Lag</i> value is a negative number.	Modify the <i>Lag</i> value as a non-negative number.
A819	43033	The <i>HoldTime</i> value is a negative number.	Modify the <i>HoldTime</i> value as a non-negative number.
A820	43040	The tappet point count reaches the maximum value.	Make sure that the tappet point count does not exceed the maximum value.
A821	43041	The <i>MasterPos</i> value exceeds the allowable range.	Be sure that the master position of the tappet point is within the range for the master axis set in the software.
A830	43056	The identity number in the axes group has been used.	Modify the identity number.
A831	43057	The axis has been configured as an axis in the current axes group.	Change the axis number.
A838	43064	The operation state of the axes group is interrupted.	Modify the timing for the instruction execution.
A839	43065	When the instruction is executed, <i>Pause</i> and <i>Stop</i> must be FALSE.	Modify the timing for the instruction execution.
A83A	43066	No axes allocated in the axes group.	Modify the timing for the instruction execution.

ErrorID		Meening	
Hex	Decimal	Meaning	How to deal with
A83B	43067	Axes in the axes group are not in Standstill state.	Modify the timing for the instruction execution.

### 12.3 System Trouble Diagnosis through System Error Codes

When the ERR indicator of the motion controller blinks or is always ON, users can get to know the cause of an error and shoot the trouble through selecting menu Device > Diagnosis Information... in the CANopen Builder software of version 6.0 or above.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
1000	4096	Internal RAM detection failed	
1001	4097	Internal Flash detection failed	Contact local technicians if the error still exists
1002	4098	The extension port detection failed	after repower on.
1003	4099	Internal voltage is abnormal (LV)	Adjust input voltage to 24V at the power port.
1004	4100	Flash initializing failed	Contact local technicians if the error still exists
1005	4101	Flash ID detection failed.	after repower on.
1007	4103	The access to flash failed in the Ethernet area.	
1008	4104	The access to flash failed in the extension area.	
1009	4105	The access to flash failed in the program area.	
100A	4106	The access to flash failed in the area for axis configuration.	
100B	4107	The access to flash failed in the area for task configuration.	
100C	4108	The access to flash failed in the area for CANopen configuration.	
100D	4109	The access to flash failed in the area for hardware configuration.	Contact local technicians if the problem still exists after re-downloading the program and
100E	4110	The access to flash failed in the CAM area.	restoring the setting to the factory setting.
100F	4111	The access to flash (the flash management table) failed.	
1010	4112	The access to flash (sheet 1 in the flash management table) failed.	
1011	4113	The access to flash (sheet 2 in the flash management table) fails.	
1012	4114	The reading of flash failed.	
1013	4115	The writing in flash failed.	
1014	4116	The erasing of the content in flash failed.	
1015	4117	CNC file ID is out of the allowed range	Check if the CNC file ID is larger than 64. Update the software and redownload the program if the error still exists after redownloading the program.
1016	4118	The size of CNC file exceeds the range	CNC file is too large in size. Diminish the size and redownload the program.
1017	4119	The position of incremental encoder 1 changes dramatically in short time.	Check if the input of the encoder is too fast or enlarge the resolution of the encoder.

System error code		Funlemation	Correction
Hexadecimal	Decimal	Explanation	Correction
1018	4120	The position of incremental encoder 2 changes dramatically in short time.	Check if the input of the encoder is too fast or enlarge the resolution of the encoder.
1019	4121	System stack is used up.	There are too many intermediate variables in the program. Modify the program.
101A	4122	The Retain file is too large.	There are too many Retain variables. Decrease the number of Retain variables and then redownload the program.
101B	4123	The access to Retain file failed.	Redownload the program after restoring the system to the factory setting.
101C	4124	EIP configuration data upload failed.	Contact local technicians if the problem still exists after re-downloading the program.
101D	4125	Cam table reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
1020	4128	Illegal configuration file type	Contact local technicians if the problem still exists after re-downloading the program.
1021	4129	File storage failure	Contact local technicians if the problem still exists after re-downloading the program.
1022	4130	File reading failed	Contact local technicians if the problem still exists after re-downloading the program.
1023	4131	File check failure	Contact local technicians if the problem still exists after re-downloading the program.
1024	4132	File size exceeds allowed range.	Contact local technicians if the problem still exists after re-downloading the program.
1025	4133	Program file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
1026	4134	CANopen configuration file reading failed	Contact local technicians if the problem still exists after re-downloading the program.
1027	4135	Motion configuration file reading failed	Contact local technicians if the problem still exists after re-downloading the program.
1028	4136	System configuration file reading failed	Contact local technicians if the problem still exists after re-downloading the program.
1029	4137	Task configuration file reading failed	Contact local technicians if the problem still exists after re-downloading the program.
102A	4138	Extension configuration file reading failed	Contact local technicians if the problem still exists after re-downloading the program.
102B	4139	Cam file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
102C	4140	RETAIN file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
102D	4141	ID file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
102E	4142	Encrypted file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
102F	4143	CNC file reading failed.	Contact local technicians if the problem still exists after re-downloading the program.
1030	4144	Hardware does not match.	Contact local technicians.
1031	4145	Position parser processing fault	Contact local technicians.

System erro	or code		
Hexadecimal	Decimal	Explanation	Correction
1401	5121	The initializing of Ethernet LAN1 failed.	
1402	5122	The Ethernet LAN1 buffer overflows	
1403	5123	The data sending failed through the Ethernet LAN1.	Contact local technicians if the error still exists after repower on.
1404	5124	Sending the buffer memory distribution through Ethernet failed.	
1405	5125	The IP address of other device is the same as that of the PLC on the Ethernet network.	Ensure that no identical IP addresses exist on the network by changing the IP address of other device or the controller.
1601	5633	The Ethernet LAN2 initializing failed.	Contact local technicians if the error still exists
1602	5634	The Ethernet LAN2 buffer overflows.	after repower on.
1603	5635	Full buffer area for USB communication	Contact local technicians if the problem still exists after re-downloading the program.
3000	12288	The number of inputs or the number of outputs is greater than the limit 32.	Reset the number of input and output variables in the self-defined POU and make sure the number of input or output variables does not exceed 32.
3001	12289	The capacity for one POU is more than 65535 bytes.	Change the capacity of variables in a POU to reduce the variable occupation in the memory.
3002	12290	The number of POUs is more than 1000.	Reduce the number of POUs called by the task and re-download the program.
3003	12291	The POU type is illegal.	
3004	12292	The types of parameters in the program are illegal.	
3005	12293	Variable's offset address error in the program	
3006	12294	The data types of parameters are illegal in the program.	Update the software if the error still exists after re-compiling and re-downloading the program
3007	12295	The jump range in a program is illegal.	and repowering the product.
3008	12296	Program memory allocation alignment is incorrect.	
3009	12297	Virtual axis encoder memory alignment is incorrect.	
300A	12298	The Bit accessed exceeds the range. (Only Bit0~Bit7 can be accessed.)	Update the software if the error still exists after re-compiling and re-downloading the program and repowering the product.
300B	12299	It is detected that data types are illegal in the program.	Update the software if the error still exists after re-compiling and re-downloading the program and repowering the product.
300C	12300	The length of data type String is too large.	The number of characters in String data type is too large. Update the software if the error

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
			still exists after modifying the program, re- compiling and re-downloading the program.
300D	12301	Illegal addressing method for variables	Update the software if the error still exists after re-compiling and re-downloading the program and repowering the product.
300E	12302	Improper priority setting of the task	Set a proper task priority and cycle time for the task
300F	12303	Exception occurs during accessing the controller's memory	Check whether any index is out of bounds of the array in the program. The pointer is used by not assigning it a value or is used by assigning it an incorrect value. Contact local technicians if the problem still exists after re- downloading the program.
3020	12320	The checksum of the downloaded axis configuration is illegal.	Make sure that the axis configuration is proper and then re-compile and re-download the configuration.
3021	12321	The checksum of the downloaded extension configuration is illegal.	Make sure that the extension configuration is proper and then re-compile and re-download the configuration.
3022	12322	The checksum of the downloaded program is illegal.	Make sure that the program is proper and then re-compile and re-download the program.
3023	12323	The checksum of the downloaded task data is illegal.	Make sure that the task setting is proper and then re-compile and re-download the configuration.
3024	12324	The checksum of the downloaded CANopen configuration is illegal.	Make sure that the CANopen configuration is proper and then re-compile and re-download the configuration.
3025	12325	The checksum of the downloaded hardware configuration is illegal.	Make sure that the hardware configuration is proper and then re-compile and re-download the configuration.
3026	12326	Watchdog timeout	Check if the program is correct or there is a loop of which the program execution can not get out when the program execution timeout occurs.
3027	12327	Calling the axis state machine failed.	Contact local technicians if the error still exists after redownloading the program and restoring to the factory setting.
3028	12328	CNC list analysis error	Check if the CNC file is correct and redownload the program.
3029	12329	CNC file analysis error	Check if the CNC file is correct and redownload the program.
302A	12330	Cam file parsing failed.	Check if the cam file is correct. Contact local technicians if the problem still exists after re- downloading the program.
3031	12337	Source code file parsing failed.	Check if the source code file is correct. Contact local technicians if the problem still exists after re-downloading the program.
3050	12368	The actual time for executing the priority 0 task exceeds the set watchdog timeout time.	Contact local distributors

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
3051	12369	The actual time for executing the priority 1 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3052	12370	The actual time for executing the priority2 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3053	12371	The actual time for executing the priority 3 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3054	12372	The actual time for executing the priority 4 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3055	12373	The actual time for executing the priority 5 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3056	12374	The actual time for executing the priority 6 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Revise the program or re-download the revised program.</li> </ol>
3057	12375	The actual time for executing the priority 7 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Revise the program or re-download the revised program.</li> </ol>
3058	12376	The actual time for executing the priority 8 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3059	12377	The actual time for executing the priority 9 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> </ol>

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
			<ol> <li>Redownload it after modifying the program.</li> </ol>
305A	12378	The actual time for executing the priority 10 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
305B	12379	The actual time for executing the priority 11 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
305C	12380	The actual time for executing the priority 12 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
305D	12381	The actual time for executing the priority 13 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
305E	12382	The actual time for executing the priority 14 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
305F	12383	The actual time for executing the priority 15 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3060	12384	The actual time for executing the priority 16 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3061	12385	The actual time for executing the priority 17 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3062	12386	The actual time for executing the priority 18 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> </ol>

System err	or code	Evolopation	Correction
Hexadecimal	Decimal	Explanation	Correction
			3. Redownload it after modifying the program.
3063	12387	The actual time for executing the priority 19 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3064	12388	The actual time for executing the priority 20 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3065	12389	The actual time for executing the priority 21 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3066	12390	The actual time for executing the priority 22 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3067	12391	The actual time for executing the priority 23 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3068	12392	The actual time for executing the priority 24 task exceeds the set watchdog timeout time.	<ol> <li>Reset the watchdog time to a larger value for the task.</li> <li>Check whether there is any infinite loop in the program which the task calls.</li> <li>Redownload it after modifying the program.</li> </ol>
3069	12393	The actual time for executing the priority 25 task exceeds the set watchdog timeout time.	Contact local technicians.
306A	12394	The actual time for executing the priority 26 task exceeds the set watchdog timeout time.	Contact local technicians.
306B	12395	The actual time for executing the priority 27 task exceeds the set watchdog timeout time.	Contact local technicians.
306C	12396	The actual time for executing the priority 28 task exceeds the set watchdog timeout time.	Contact local technicians.
306D	12397	The actual time for executing the priority 29 task exceeds the set watchdog timeout time.	Contact local technicians.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
306E	12398	The actual time for executing the priority 30 task exceeds the set watchdog timeout time.	Contact local technicians.
306F	12399	The actual time for executing the priority 31 task exceeds the set watchdog timeout time.	Contact local technicians.
4000	16384	The reading and writing of the SD card data by the PLC failed.	<ol> <li>Check if the installation of the SD card is proper.</li> <li>Check if the SD card is damaged.</li> </ol>
4003	16387	The file in the SD card is read- only.	Modify the file in the SD card as the read-write file
4100	16640	The data in the project backup file is modified or the data format is incorrect.	<ol> <li>Ensure that the data in the project backup file is not modified.</li> <li>Ensure that the project backup file is generated by CANopen Builder.</li> </ol>
4101	16641	The data format of the RETAIN variable backup file is incorrect.	<ol> <li>Ensure that the data in the RETAIN variable backup file is not modified.</li> <li>Ensure that the RETAIN variable backup file is generated by CANopen Builder.</li> </ol>
4102	16642	During restoration, the data in the RETAIN variable backup file is partially different from that in the PLC.	Ensure that the data in the RETAIN variable backup file is consistent with that in the PLC.
4103	16643	During restoration, the data in the RETAIN variable backup file is completely different from that in the PLC.	Ensure that the data in the RETAIN variable backup file is consistent with that in the PLC.
4104	16644	During restoration, the controller model in the project backup file is different from that of the actually connected PLC.	Ensure that the controller model in the project backup file is the same as that of the actually connected PLC.
4105	16645	The program ID in the backup file is different from that of the current PLC.	Ensure that the program ID in the backup file is the same as that of the current PLC.
4106	16646	The PLC password in the backup file is different from that of the current PLC.	Ensure that the PLC password in the backup file is the same as that of the current PLC.
5000	20480	Extension communication checking failed.	Contact local technicians if the error still exists
5001	20481	Extension communication timeout	after repower on.
5100	20736	The module actually connected is inconsistent with that configured in the software.	Make sure that the module acutally connected to the right side of the PLC is consistent with that configured in the software and then re- download the configuration.
5200	20992	The buffer for receiving CANopen data is full.	Adjust the CANopen configuration and check
5201	20993	The buffer for sending CANopen data is full.	the task setup.
5300	21248	The buffer for receiving Motion data is full.	Adjust the Motion configuration and check the task setup.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
5301	21249	The buffer for sending Motion data is full.	
C000	49152	Error ID for the 1st right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C001	49153	Error ID for the 1st right-side module, 16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C002	49154	Error ID for the 1st right-side module, 16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C003	49155	Error ID for the 1st right-side module, 16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C004	49156	Error ID for the 1st right-side module, 16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C005	49157	Error ID for the 1st right-side module, 16#1605: Hardware failure	Return the module to the factory for repair.
C007	49159	Error ID for the 1st right-side module, 16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C008	49160	Error ID for the 1st right-side module, 16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C100	49408	Error ID for the 2nd right-side module, 16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C101	49409	Error ID for the 2nd right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C102	49410	Error ID for the 2nd right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C103	49411	Error ID for the 2nd right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C104	49412	Error ID for the 2nd right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C105	49413	Error ID for the 2nd right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C107	49415	Error ID for the 2nd right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
C108	49416	Error ID for the 2nd right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C200	49664	Error ID for the 3rd right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C201	49665	Error ID for the 3rd right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C202	49666	Error ID for the 3rd right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C203	49667	Error ID for the 3rd right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C204	49668	Error ID for the 3rd right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C205	49669	Error ID for the 3rd right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C207	49671	Error ID for the 3rd right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C208	49672	Error ID for the 3rd right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C300	49920	Error ID for the 4th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C301	49921	Error ID for the 4th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C302	49922	Error ID for the 4th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C303	49923	Error ID for the 4th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C304	49924	Error ID for the 4th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C305	49925	Error ID for the 4th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.

System error code			•
Hexadecimal	Decimal	Explanation	Correction
C307	49927	Error ID for the 4th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C308	49928	Error ID for the 4th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C400	50176	Error ID for the 5th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C401	50177	Error ID for the 5th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C402	50178	Error ID for the 5th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C403	50179	Error ID for the 5th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C404	50180	Error ID for the 5th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C405	50181	Error ID for the 5th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C407	50183	Error ID for the 5th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C408	50184	Error ID for the 5th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C500	50432	Error ID for the 6th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C501	50433	Error ID for the 6th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C502	50434	Error ID for the 6th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C503	50435	Error ID for the 6th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C504	50436	Error ID for the 6th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System error code		Evalenction	Correction
Hexadecimal	Decimal	Explanation	Correction
C505	50437	Error ID for the 6th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C507	50439	Error ID for the 6th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C508	50440	Error ID for the 6th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C600	50688	Error ID for the 7th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C601	50689	Error ID for the 7th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C602	50690	Error ID for the 7th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C603	50691	Error ID for the 7th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C604	50692	Error ID for the 7th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C605	50693	Error ID for the 7th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C607	50695	Error ID for the 7th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C608	50696	Error ID for the 7th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C700	50944	Error ID for the 8th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C701	50945	Error ID for the 8th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C702	50946	Error ID for the 8th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C703	50947	Error ID for the 8th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
C704	50948	Error ID for the 8th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C705	50949	Error ID for the 8th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C707	50951	Error ID for the 8th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C708	50952	Error ID for the 8th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C800	51200	Error ID for the 9th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C801	51201	Error ID for the 9th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C802	51202	Error ID for the 9th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C803	51203	Error ID for the 9th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C804	51204	Error ID for the 9th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C805	51205	Error ID for the 9th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C807	51207	Error ID for the 9th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C808	51208	Error ID for the 9th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
C900	51456	Error ID for the 10th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C901	51457	Error ID for the 10th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C902	51458	Error ID for the 10th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
C903	51459	Error ID for the 10th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C904	51460	Error ID for the 10th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
C905	51461	Error ID for the 10th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
C907	51463	Error ID for the 10th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
C908	51464	Error ID for the 10th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
CA00	51712	Error ID for the 11th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CA01	51713	Error ID for the 11th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CA02	51714	Error ID for the 11th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CA03	51715	Error ID for the 11th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CA04	51716	Error ID for the 11th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CA05	51717	Error ID for the 11th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CA07	51719	Error ID for the 11th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CA08	51720	Error ID for the 11th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
CB00	51968	Error ID for the 12th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CB01	51969	Error ID for the 12th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
CB02	51970	Error ID for the 12th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CB03	51971	Error ID for the 12th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CB04	51972	Error ID for the 12th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CB05	51973	Error ID for the 12th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CB07	51975	Error ID for the 12th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CB08	51976	Error ID for the 12th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
CC00	52224	Error ID for the 13th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CC01	52225	Error ID for the 13th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CC02	52226	Error ID for the 13th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CC03	52227	Error ID for the 13th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CC04	52228	Error ID for the 13th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CC05	52229	Error ID for the 13th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CC07	52231	Error ID for the 13th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CC08	52232	Error ID for the 13th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
CD00	52480	Error ID for the 14th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
CD01	52481	Error ID for the 14th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CD02	52482	Error ID for the 14th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CD03	52483	Error ID for the 14th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CD04	52484	Error ID for the 14th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CD05	52485	Error ID for the 14th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CD07	52487	Error ID for the 14th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CD08	52488	Error ID for the 14th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
CE00	52736	Error ID for the 15th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CE01	52737	Error ID for the 15th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CE02	52738	Error ID for the 15th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CE03	52739	Error ID for the 15th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CE04	52740	Error ID for the 15th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CE05	52741	Error ID for the 15th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CE07	52743	Error ID for the 15th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CE08	52744	Error ID for the 15th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.

System error code			
Hexadecimal	Decimal	Explanation	Correction
CF00	52992	Error ID for the 16th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CF01	52993	Error ID for the 16th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CF02	52994	Error ID for the 16th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CF03	52995	Error ID for the 16th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CF04	52996	Error ID for the 16th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
CF05	52997	Error ID for the 16th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
CF07	52999	Error ID for the 16th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
CF08	53000	Error ID for the 16th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D000	53248	Error ID for the 17th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D001	53249	Error ID for the 17th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D002	53250	Error ID for the 17th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D003	53251	Error ID for the 17th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D004	53252	Error ID for the 17th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D005	53253	Error ID for the 17th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D007	53255	Error ID for the 17th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D008	53256	Error ID for the 17th right-side module,16#1608: The	Return the module to the factory for calibration.

System err	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		calibration or the CJC is abnormal.	
D100	53504	Error ID for the 18th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D101	53505	Error ID for the 18th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D102	53506	Error ID for the 18th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D103	53507	Error ID for the 18th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D104	53508	Error ID for the 18th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D105	53509	Error ID for the 18th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D107	53511	Error ID for the 18th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D108	53512	Error ID for the 18th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D200	53760	Error ID for the 19th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D201	53761	Error ID for the 19th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D202	53762	Error ID for the 19th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D203	53763	Error ID for the 19th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D204	53764	Error ID for the 19th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D205	53765	Error ID for the 19th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D207	53767	Error ID for the 19th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
D208	53768	Error ID for the 19th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D300	54016	Error ID for the 20th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D301	54017	Error ID for the 20th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D302	54018	Error ID for the 20th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D303	54019	Error ID for the 20th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D304	54020	Error ID for the 20th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D305	54021	Error ID for the 20th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D307	54023	Error ID for the 20th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D308	54024	Error ID for the 20th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D400	54272	Error ID for the 21st right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D401	54273	Error ID for the 21st right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D402	54274	Error ID for the 21st right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D403	54275	Error ID for the 21st right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D404	54276	Error ID for the 21st right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D405	54277	Error ID for the 21st right-side module,16#1605: Hardware failure	Return the module to the factory for repair.

System error code		Exploration	Correction
Hexadecimal	Decimal	Explanation	Correction
D407	54279	Error ID for the 21st right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D408	54280	Error ID for the 21st right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D500	54528	Error ID for the 22nd right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D501	54529	Error ID for the 22nd right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D502	54530	Error ID for the 22nd right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D503	54531	Error ID for the 22nd right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D504	54532	Error ID for the 22nd right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D505	54533	Error ID for the 22nd right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D507	54535	Error ID for the 22nd right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D508	54536	Error ID for the 22nd right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D600	54784	Error ID for the 23rd right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D601	54785	Error ID for the 23rd right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D602	54786	Error ID for the 23rd right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D603	54787	Error ID for the 23rd right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D604	54788	Error ID for the 23rd right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
D605	54789	Error ID for the 23rd right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D607	54791	Error ID for the 23rd right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D608	54792	Error ID for the 23rd right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D700	55040	Error ID for the 24th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D701	55041	Error ID for the 24th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D702	55042	Error ID for the 24th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D703	55043	Error ID for the 24th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D704	55044	Error ID for the 24th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D705	55045	Error ID for the 24th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D707	55047	Error ID for the 24th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D708	55048	Error ID for the 24th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D800	55296	Error ID for the 25th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D801	55297	Error ID for the 25th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D802	55298	Error ID for the 25th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D803	55299	Error ID for the 25th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
D804	55300	Error ID for the 25th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D805	55301	Error ID for the 25th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D807	55303	Error ID for the 25th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D808	55304	Error ID for the 25th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
D980	55680	Error ID for the 26th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D981	55681	Error ID for the 26th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D982	55682	Error ID for the 26th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D983	55683	Error ID for the 26th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D984	55684	Error ID for the 26th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
D985	55685	Error ID for the 26th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
D987	55687	Error ID for the 26th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
D988	55688	Error ID for the 26th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DA00	55808	Error ID for the 27th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DA01	55809	Error ID for the 27th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DA02	55810	Error ID for the 27th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System error code		Fundametian	Correction
Hexadecimal	Decimal	Explanation	Correction
DA03	55811	Error ID for the 27th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DA04	55812	Error ID for the 27th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DA05	55813	Error ID for the 27th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DA07	55815	Error ID for the 27th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DA08	55816	Error ID for the 27th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DB00	56064	Error ID for the 28th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DB01	56065	Error ID for the 28th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DB02	56066	Error ID for the 28th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DB03	56067	Error ID for the 28th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DB04	56068	Error ID for the 28th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DB05	56069	Error ID for the 28th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DB07	56071	Error ID for the 28th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DB08	56072	Error ID for the 28th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DC00	56320	Error ID for the 29th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DC01	56321	Error ID for the 29th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
DC02	56322	Error ID for the 29th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DC03	56323	Error ID for the 29th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DC04	56324	Error ID for the 29th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DC05	56325	Error ID for the 29th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DC07	56327	Error ID for the 29th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DC08	56328	Error ID for the 29th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DD00	56576	Error ID for the 30th right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DD01	56577	Error ID for the 30th right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DD02	56578	Error ID for the 30th right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DD03	56579	Error ID for the 30th right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DD04	56580	Error ID for the 30th right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DD05	56581	Error ID for the 30th right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DD07	56583	Error ID for the 30th right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DD08	56584	Error ID for the 30th right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DE00	56832	Error ID for the 31st right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
DE01	56833	Error ID for the 31st right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DE02	56834	Error ID for the 31st right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DE03	56835	Error ID for the 31st right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DE04	56836	Error ID for the 31st right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DE05	56837	Error ID for the 31st right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DE07	56839	Error ID for the 31st right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DE08	56840	Error ID for the 31st right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.
DF00	57088	Error ID for the 32nd right-side module,16#1600: The ID of the extension module exceeds the range.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DF01	57089	Error ID for the 32nd right-side module,16#1601: The ID of the extension module cannot be set.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DF02	57090	Error ID for the 32nd right-side module,16#1602: The ID of the extension module is duplicated.	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DF03	57091	Error ID for the 32nd right-side module,16#1603: Failure to enter the RUN mode	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DF04	57092	Error ID for the 32nd right-side module,16#1604: Module communication timeout	Ensure that the module is connected to the CPU module properly and power ON again. If the error still occurs, contact the technicians.
DF05	57093	Error ID for the 32nd right-side module,16#1605: Hardware failure	Return the module to the factory for repair.
DF07	57095	Error ID for the 32nd right-side module,16#1607: External power supply failure	Enusre that the external 24VDC power supply is normal.
DF08	57096	Error ID for the 32nd right-side module,16#1608: The calibration or the CJC is abnormal.	Return the module to the factory for calibration.

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
E001	57345	Error ID for the 1st right-side module, 16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E002	57346	Error ID for the 1st right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E004	57348	Error ID for the 1st right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E007	57351	Error ID for the 1st right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E008	57352	Error ID for the 1st right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E009	57353	Error ID for the 1st right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E00A	57354	Error ID for the 1st right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E00B	57355	Error ID for the 1st right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E00C	57356	Error ID for the 1st right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E00D	57357	Error ID for the 1st right-side module,16#180D: The (temperature) signal received by channel 6 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
E00E	57358	Error ID for the 1st right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E00F	57359	Error ID for the 1st right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E0F1	57585	Error ID for the 1st right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E0F2	57586	Error ID for the 1st right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E0F7	57591	Error ID for the 1st right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E0F8	57592	Error ID for the 1st right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E0F9	57593	Error ID for the 1st right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E0FA	57594	Error ID for the 1st right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E0FB	57595	Error ID for the 1st right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E0FC	57596	Error ID for the 1st right-side module,16#18FC: The weight measured by CH2 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
E0FD	57597	Error ID for the 1st right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E101	57601	Error ID for the 2nd right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E102	57602	Error ID for the 2nd right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E104	57604	Error ID for the 2nd right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E107	57607	Error ID for the 2nd right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E108	57608	Error ID for the 2nd right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E109	57609	Error ID for the 2nd right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E10A	57610	Error ID for the 2nd right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E10B	57611	Error ID for the 2nd right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E10C	57612	Error ID for the 2nd right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E10D	57613	Error ID for the 2nd right-side module,16#180D: The (temperature) signal received by channel 6 exceeds the range of	Check the signal received by channel 6.

System error code		<b>P</b> -mlanatian	O anno attar
Hexadecimal	Decimal	Explanation	Correction
		inputs that the hardware can receive.	
E10E	57614	Error ID for the 2nd right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E10F	57615	Error ID for the 2nd right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E1F1	57841	Error ID for the 2nd right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E1F2	57842	Error ID for the 2nd right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E1F7	57847	Error ID for the 2nd right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E1F8	57848	Error ID for the 2nd right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E1F9	57849	Error ID for the 2nd right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E1FA	57850	Error ID for the 2nd right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E1FB	57851	Error ID for the 2nd right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E1FC	57852	Error ID for the 2nd right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E1FD	57853	Error ID for the 2nd right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E201	57857	Error ID for the 3rd right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E202	57858	Error ID for the 3rd right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E204	57860	Error ID for the 3rd right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E207	57863	Error ID for the 3rd right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E208	57864	Error ID for the 3rd right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E209	57865	Error ID for the 3rd right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E20A	57866	Error ID for the 3rd right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E20B	57867	Error ID for the 3rd right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E20C	57868	Error ID for the 3rd right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E20D	57869	Error ID for the 3rd right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E20E	57870	Error ID for the 3rd right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E20F	57871	Error ID for the 3rd right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E2F1	58097	Error ID for the 3rd right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E2F2	58098	Error ID for the 3rd right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E2F7	58103	Error ID for the 3rd right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E2F8	58104	Error ID for the 3rd right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E2F9	58105	Error ID for the 3rd right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E2FA	58106	Error ID for the 3rd right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E2FB	58107	Error ID for the 3rd right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E2FC	58108	Error ID for the 3rd right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E2FD	58109	Error ID for the 3rd right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E301	58113	Error ID for the 4th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E302	58114	Error ID for the 4th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E304	58116	Error ID for the 4th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E307	58119	Error ID for the 4th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E308	58120	Error ID for the 4th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E309	58121	Error ID for the 4th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E30A	58122	Error ID for the 4th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E30B	58123	Error ID for the 4th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E30C	58124	Error ID for the 4th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E30D	58125	Error ID for the 4th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E30E	58126	Error ID for the 4th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E30F	58127	Error ID for the 4th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E3F1	58353	Error ID for the 4th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E3F2	58354	Error ID for the 4th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E3F7	58359	Error ID for the 4th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E3F8	58360	Error ID for the 4th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E3F9	58361	Error ID for the 4th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E3FA	58362	Error ID for the 4th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E3FB	58363	Error ID for the 4th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E3FC	58364	Error ID for the 4th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E3FD	58365	Error ID for the 4th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E401	58369	Error ID for the 5th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E402	58370	Error ID for the 5th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E404	58372	Error ID for the 5th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E407	58375	Error ID for the 5th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E408	58376	Error ID for the 5th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E409	58377	Error ID for the 5th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E40A	58378	Error ID for the 5th right-side module, 16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E40B	58379	Error ID for the 5th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E40C	58380	Error ID for the 5th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E40D	58381	Error ID for the 5th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System error code			
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E40E	58382	Error ID for the 5th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E40F	58383	Error ID for the 5th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E4F1	58609	Error ID for the 5th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E4F2	58610	Error ID for the 5th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E4F7	58615	Error ID for the 5th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E4F8	58616	Error ID for the 5th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E4F9	58617	Error ID for the 5th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E4FA	58618	Error ID for the 5th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E4FB	58619	Error ID for the 5th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E4FC	58620	Error ID for the 5th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
E4FD	58621	Error ID for the 5th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E501	58625	Error ID for the 6th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E502	58626	Error ID for the 6th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E504	58628	Error ID for the 6th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E507	58631	Error ID for the 6th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E508	58632	Error ID for the 6th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E509	58633	Error ID for the 6th right-side module, 16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E50A	58634	Error ID for the 6th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E50B	58635	Error ID for the 6th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E50C	58636	Error ID for the 6th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E50D	58637	Error ID for the 6th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E50E	58638	Error ID for the 6th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E50F	58639	Error ID for the 6th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E5F1	58865	Error ID for the 6th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E5F2	58866	Error ID for the 6th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E5F7	58871	Error ID for the 6th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E5F8	58872	Error ID for the 6th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E5F9	58873	Error ID for the 6th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E5FA	58874	Error ID for the 6th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E5FB	58875	Error ID for the 6th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E5FC	58876	Error ID for the 6th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E5FD	58877	Error ID for the 6th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E601	58881	Error ID for the 7th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E602	58882	Error ID for the 7th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E604	58884	Error ID for the 7th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E607	58887	Error ID for the 7th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E608	58888	Error ID for the 7th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E609	58889	Error ID for the 7th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E60A	58890	Error ID for the 7th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E60B	58891	Error ID for the 7th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E60C	58892	Error ID for the 7th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E60D	58893	Error ID for the 7th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E60E	58894	Error ID for the 7th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E60F	58895	Error ID for the 7th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E6F1	59121	Error ID for the 7th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E6F2	59122	Error ID for the 7th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E6F7	59127	Error ID for the 7th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E6F8	59128	Error ID for the 7th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E6F9	59129	Error ID for the 7th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E6FA	59130	Error ID for the 7th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E6FB	59131	Error ID for the 7th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E6FC	59132	Error ID for the 7th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
E6FD	59133	Error ID for the 7th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E701	59137	Error ID for the 8th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E702	59138	Error ID for the 8th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E704	59140	Error ID for the 8th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E707	59143	Error ID for the 8th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E708	59144	Error ID for the 8th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E709	59145	Error ID for the 8th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E70A	59146	Error ID for the 8th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E70B	59147	Error ID for the 8th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E70C	59148	Error ID for the 8th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E70D	59149	Error ID for the 8th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code	Family di	0
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E70E	59150	Error ID for the 8th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E70F	59151	Error ID for the 8th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E7F1	59377	Error ID for the 8th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E7F2	59378	Error ID for the 8th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E7F7	59383	Error ID for the 8th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E7F8	59384	Error ID for the 8th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E7F9	59385	Error ID for the 8th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E7FA	59386	Error ID for the 8th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E7FB	59387	Error ID for the 8th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E7FC	59388	Error ID for the 8th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
E7FD	59389	Error ID for the 8th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E801	59393	Error ID for the 9th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E802	59394	Error ID for the 9th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E804	59396	Error ID for the 9th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E807	59399	Error ID for the 9th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E808	59400	Error ID for the 9th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E809	59401	Error ID for the 9th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E80A	59402	Error ID for the 9th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E80B	59403	Error ID for the 9th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E80C	59404	Error ID for the 9th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E80D	59405	Error ID for the 9th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E80E	59406	Error ID for the 9th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E80F	59407	Error ID for the 9th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E8F1	59633	Error ID for the 9th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E8F2	59634	Error ID for the 9th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E8F7	59639	Error ID for the 9th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E8F8	59640	Error ID for the 9th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E8F9	59641	Error ID for the 9th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E8FA	59642	Error ID for the 9th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E8FB	59643	Error ID for the 9th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E8FC	59644	Error ID for the 9th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E8FD	59645	Error ID for the 9th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
E901	59649	Error ID for the 10th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E902	59650	Error ID for the 10th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
E904	59652	Error ID for the 10th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
E907	59655	Error ID for the 10th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
E908	59656	Error ID for the 10th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
E909	59657	Error ID for the 10th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
E90A	59658	Error ID for the 10th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
E90B	59659	Error ID for the 10th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
E90C	59660	Error ID for the 10th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
E90D	59661	Error ID for the 10th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
E90E	59662	Error ID for the 10th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
E90F	59663	Error ID for the 10th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
E9F1	59889	Error ID for the 10th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
E9F2	59890	Error ID for the 10th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
E9F7	59895	Error ID for the 10th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
E9F8	59896	Error ID for the 10th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
E9F9	59897	Error ID for the 10th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
E9FA	59898	Error ID for the 10th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
E9FB	59899	Error ID for the 10th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
E9FC	59900	Error ID for the 10th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
E9FD	59901	Error ID for the 10th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
EA01	59905	Error ID for the 11th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EA02	59906	Error ID for the 11th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
EA04	59908	Error ID for the 11th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
EA07	59911	Error ID for the 11th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
EA08	59912	Error ID for the 11th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
EA09	59913	Error ID for the 11th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
EA0A	59914	Error ID for the 11th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
EA0B	59915	Error ID for the 11th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
EA0C	59916	Error ID for the 11th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
EA0D	59917	Error ID for the 11th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
EA0E	59918	Error ID for the 11th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
EA0F	59919	Error ID for the 11th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
EAF1	60145	Error ID for the 11th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EAF2	60146	Error ID for the 11th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
EAF7	60151	Error ID for the 11th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
EAF8	60152	Error ID for the 11th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
EAF9	60153	Error ID for the 11th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
EAFA	60154	Error ID for the 11th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
EAFB	60155	Error ID for the 11th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
EAFC	60156	Error ID for the 11th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
EAFD	60157	Error ID for the 11th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
EB01	60161	Error ID for the 12th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EB02	60162	Error ID for the 12th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
EB04	60164	Error ID for the 12th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
EB07	60167	Error ID for the 12th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
EB08	60168	Error ID for the 12th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
EB09	60169	Error ID for the 12th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
EB0A	60170	Error ID for the 12th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
EB0B	60171	Error ID for the 12th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
EB0C	60172	Error ID for the 12th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
EB0D	60173	Error ID for the 12th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System error code		<b>F</b>	
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
EB0E	60174	Error ID for the 12th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
EB0F	60175	Error ID for the 12th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
EBF1	60401	Error ID for the 12th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EBF2	60402	Error ID for the 12th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
EBF7	60407	Error ID for the 12th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
EBF8	60408	Error ID for the 12th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
EBF9	60409	Error ID for the 12th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
EBFA	60410	Error ID for the 12th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
EBFB	60411	Error ID for the 12th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
EBFC	60412	Error ID for the 12th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
EBFD	60413	Error ID for the 12th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
EC01	60417	Error ID for the 13th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EC02	60418	Error ID for the 13th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
EC04	60420	Error ID for the 13th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
EC07	60423	Error ID for the 13th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
EC08	60424	Error ID for the 13th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
EC09	60425	Error ID for the 13th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
EC0A	60426	Error ID for the 13th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
EC0B	60427	Error ID for the 13th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
EC0C	60428	Error ID for the 13th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
EC0D	60429	Error ID for the 13th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
EC0E	60430	Error ID for the 13th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
EC0F	60431	Error ID for the 13th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
ECF1	60657	Error ID for the 13th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
ECF2	60658	Error ID for the 13th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
ECF7	60663	Error ID for the 13th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
ECF8	60664	Error ID for the 13th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
ECF9	60665	Error ID for the 13th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
ECFA	60666	Error ID for the 13th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
ECFB	60667	Error ID for the 13th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
ECFC	60668	Error ID for the 13th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
ECFD	60669	Error ID for the 13th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
ED01	60673	Error ID for the 14th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
ED02	60674	Error ID for the 14th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
ED04	60676	Error ID for the 14th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
ED07	60679	Error ID for the 14th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
ED08	60680	Error ID for the 14th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
ED09	60681	Error ID for the 14th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
ED0A	60682	Error ID for the 14th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
ED0B	60683	Error ID for the 14th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
ED0C	60684	Error ID for the 14th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
ED0D	60685	Error ID for the 14th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code	-	
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
ED0E	60686	Error ID for the 14th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
ED0F	60687	Error ID for the 14th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
EDF1	60913	Error ID for the 14th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EDF2	60914	Error ID for the 14th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
EDF7	60919	Error ID for the 14th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
EDF8	60920	Error ID for the 14th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
EDF9	60921	Error ID for the 14th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
EDFA	60922	Error ID for the 14th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
EDFB	60923	Error ID for the 14th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
EDFC	60924	Error ID for the 14th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
EDFD	60925	Error ID for the 14th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
EE01	60929	Error ID for the 15th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EE02	60930	Error ID for the 15th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
EE04	60932	Error ID for the 15th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
EE07	60935	Error ID for the 15th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
EE08	60936	Error ID for the 15th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
EE09	60937	Error ID for the 15th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
EE0A	60938	Error ID for the 15th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
EE0B	60939	Error ID for the 15th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
EE0C	60940	Error ID for the 15th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
EE0D	60941	Error ID for the 15th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
EE0E	60942	Error ID for the 15th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
EE0F	60943	Error ID for the 15th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
EEF1	61169	Error ID for the 15th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EEF2	61170	Error ID for the 15th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
EEF7	61175	Error ID for the 15th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
EEF8	61176	Error ID for the 15th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
EEF9	61177	Error ID for the 15th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
EEFA	61178	Error ID for the 15th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
EEFB	61179	Error ID for the 15th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
EEFC	61180	Error ID for the 15th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
EEFD	61181	Error ID for the 15th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
EF01	61185	Error ID for the 16th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EF02	61186	Error ID for the 16th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
EF04	61188	Error ID for the 16th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
EF07	61191	Error ID for the 16th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
EF08	61192	Error ID for the 16th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
EF09	61193	Error ID for the 16th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
EF0A	61194	Error ID for the 16th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
EF0B	61195	Error ID for the 16th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
EF0C	61196	Error ID for the 16th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
EF0D	61197	Error ID for the 16th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
EF0E	61198	Error ID for the 16th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
EF0F	61199	Error ID for the 16th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
EFF1	61425	Error ID for the 16th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
EFF2	61426	Error ID for the 16th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
EFF7	61431	Error ID for the 16th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
EFF8	61432	Error ID for the 16th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
EFF9	61433	Error ID for the 16th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
EFFA	61434	Error ID for the 16th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
EFFB	61435	Error ID for the 16th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
EFFC	61436	Error ID for the 16th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
EFFD	61437	Error ID for the 16th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F001	61441	Error ID for the 17th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F002	61442	Error ID for the 17th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F004	61444	Error ID for the 17th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F007	61447	Error ID for the 17th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F008	61448	Error ID for the 17th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F009	61449	Error ID for the 17th right-side module, 16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F00A	61450	Error ID for the 17th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F00B	61451	Error ID for the 17th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F00C	61452	Error ID for the 17th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F00D	61453	Error ID for the 17th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F00E	61454	Error ID for the 17th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F00F	61455	Error ID for the 17th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F0F1	61681	Error ID for the 17th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F0F2	61682	Error ID for the 17th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F0F7	61687	Error ID for the 17th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F0F8	61688	Error ID for the 17th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F0F9	61689	Error ID for the 17th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F0FA	61690	Error ID for the 17th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F0FB	61691	Error ID for the 17th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F0FC	61692	Error ID for the 17th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F0FD	61693	Error ID for the 17th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F101	61697	Error ID for the 18th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F102	61698	Error ID for the 18th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F104	61700	Error ID for the 18th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F107	61703	Error ID for the 18th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F108	61704	Error ID for the 18th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F109	61705	Error ID for the 18th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F10A	61706	Error ID for the 18th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F10B	61707	Error ID for the 18th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F10C	61708	Error ID for the 18th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F10D	61709	Error ID for the 18th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F10E	61710	Error ID for the 18th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F10F	61711	Error ID for the 18th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F1F1	61937	Error ID for the 18th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F1F2	61938	Error ID for the 18th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F1F7	61943	Error ID for the 18th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F1F8	61944	Error ID for the 18th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F1F9	61945	Error ID for the 18th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F1FA	61946	Error ID for the 18th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F1FB	61947	Error ID for the 18th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F1FC	61948	Error ID for the 18th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
F1FD	61949	Error ID for the 18th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F201	61953	Error ID for the 19th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F202	61954	Error ID for the 19th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F204	61956	Error ID for the 19th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F207	61959	Error ID for the 19th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F208	61960	Error ID for the 19th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F209	61961	Error ID for the 19th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F20A	61962	Error ID for the 19th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F20B	61963	Error ID for the 19th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F20C	61964	Error ID for the 19th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F20D	61965	Error ID for the 19th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F20E	61966	Error ID for the 19th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F20F	61967	Error ID for the 19th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F2F1	62193	Error ID for the 19th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F2F2	62194	Error ID for the 19th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F2F7	62199	Error ID for the 19th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F2F8	62200	Error ID for the 19th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F2F9	62201	Error ID for the 19th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F2FA	62202	Error ID for the 19th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F2FB	62203	Error ID for the 19th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F2FC	62204	Error ID for the 19th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F2FD	62205	Error ID for the 19th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F301	62209	Error ID for the 20th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F302	62210	Error ID for the 20th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F304	62212	Error ID for the 20th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F307	62215	Error ID for the 20th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F308	62216	Error ID for the 20th right-side module, 16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F309	62217	Error ID for the 20th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F30A	62218	Error ID for the 20th right-side module, 16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F30B	62219	Error ID for the 20th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F30C	62220	Error ID for the 20th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F30D	62221	Error ID for the 20th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System error code		Evaluation	Correction
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F30E	62222	Error ID for the 20th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F30F	62223	Error ID for the 20th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F3F1	62449	Error ID for the 20th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F3F2	62450	Error ID for the 20th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F3F7	62455	Error ID for the 20th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F3F8	62456	Error ID for the 20th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F3F9	62457	Error ID for the 20th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F3FA	62458	Error ID for the 20th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F3FB	62459	Error ID for the 20th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F3FC	62460	Error ID for the 20th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F3FD	62461	Error ID for the 20th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F401	62465	Error ID for the 21st right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F402	62466	Error ID for the 21st right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F404	62468	Error ID for the 21st right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F407	62471	Error ID for the 21st right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F408	62472	Error ID for the 21st right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F409	62473	Error ID for the 21st right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F40A	62474	Error ID for the 21st right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F40B	62475	Error ID for the 21st right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F40C	62476	Error ID for the 21st right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F40D	62477	Error ID for the 21st right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code	<b>-</b>	
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F40E	62478	Error ID for the 21st right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F40F	62479	Error ID for the 21st right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F4F1	62705	Error ID for the 21st right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F4F2	62706	Error ID for the 21st right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F4F7	62711	Error ID for the 21st right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F4F8	62712	Error ID for the 21st right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F4F9	62713	Error ID for the 21st right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F4FA	62714	Error ID for the 21st right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F4FB	62715	Error ID for the 21st right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F4FC	62716	Error ID for the 21st right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F4FD	62717	Error ID for the 21st right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F501	62721	Error ID for the 22nd right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F502	62722	Error ID for the 22nd right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F504	62724	Error ID for the 22nd right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F507	62727	Error ID for the 22nd right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F508	62728	Error ID for the 22nd right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F509	62729	Error ID for the 22nd right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F50A	62730	Error ID for the 22nd right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F50B	62731	Error ID for the 22nd right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F50C	62732	Error ID for the 22nd right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F50D	62733	Error ID for the 22nd right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F50E	62734	Error ID for the 22nd right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F50F	62735	Error ID for the 22nd right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F5F1	62961	Error ID for the 22nd right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F5F2	62962	Error ID for the 22nd right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F5F7	62967	Error ID for the 22nd right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F5F8	62968	Error ID for the 22nd right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F5F9	62969	Error ID for the 22nd right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F5FA	62970	Error ID for the 22nd right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F5FB	62971	Error ID for the 22nd right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F5FC	62972	Error ID for the 22nd right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F5FD	62973	Error ID for the 22nd right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F601	62977	Error ID for the 23rd right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F602	62978	Error ID for the 23rd right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F604	62980	Error ID for the 23rd right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F607	62983	Error ID for the 23rd right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F608	62984	Error ID for the 23rd right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F609	62985	Error ID for the 23rd right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F60A	62986	Error ID for the 23rd right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F60B	62987	Error ID for the 23rd right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F60C	62988	Error ID for the 23rd right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F60D	62989	Error ID for the 23rd right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F60E	62990	Error ID for the 23rd right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F60F	62991	Error ID for the 23rd right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F6F1	63217	Error ID for the 23rd right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F6F2	63218	Error ID for the 23rd right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F6F7	63223	Error ID for the 23rd right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F6F8	63224	Error ID for the 23rd right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F6F9	63225	Error ID for the 23rd right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F6FA	63226	Error ID for the 23rd right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F6FB	63227	Error ID for the 23rd right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F6FC	63228	Error ID for the 23rd right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F6FD	63229	Error ID for the 23rd right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F701	63233	Error ID for the 24th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F702	63234	Error ID for the 24th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F704	63236	Error ID for the 24th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F707	63239	Error ID for the 24th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F708	63240	Error ID for the 24th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F709	63241	Error ID for the 24th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F70A	63242	Error ID for the 24th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F70B	63243	Error ID for the 24th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F70C	63244	Error ID for the 24th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F70D	63245	Error ID for the 24th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System error code			
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F70E	63246	Error ID for the 24th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F70F	63247	Error ID for the 24th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F7F1	63473	Error ID for the 24th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F7F2	63474	Error ID for the 24th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F7F7	63479	Error ID for the 24th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F7F8	63480	Error ID for the 24th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F7F9	63481	Error ID for the 24th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F7FA	63482	Error ID for the 24th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F7FB	63483	Error ID for the 24th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F7FC	63484	Error ID for the 24th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F7FD	63485	Error ID for the 24th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F801	63489	Error ID for the 25th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F802	63490	Error ID for the 25th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F804	63492	Error ID for the 25th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F807	63495	Error ID for the 25th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F808	63496	Error ID for the 25th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F809	63497	Error ID for the 25th right-side module, 16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F80A	63498	Error ID for the 25th right-side module, 16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F80B	63499	Error ID for the 25th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F80C	63500	Error ID for the 25th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F80D	63501	Error ID for the 25th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code	E-mlana()	0
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F80E	63502	Error ID for the 25th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F80F	63503	Error ID for the 25th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F8F1	63729	Error ID for the 25th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F8F2	63730	Error ID for the 25th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F8F7	63735	Error ID for the 25th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F8F8	63736	Error ID for the 25th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F8F9	63737	Error ID for the 25th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F8FA	63738	Error ID for the 25th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F8FB	63739	Error ID for the 25th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F8FC	63740	Error ID for the 25th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
F8FD	63741	Error ID for the 25th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
F901	63745	Error ID for the 26th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F902	63746	Error ID for the 26th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
F904	63748	Error ID for the 26th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
F907	63751	Error ID for the 26th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
F908	63752	Error ID for the 26th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
F909	63753	Error ID for the 26th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
F90A	63754	Error ID for the 26th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
F90B	63755	Error ID for the 26th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
F90C	63756	Error ID for the 26th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
F90D	63757	Error ID for the 26th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
F90E	63758	Error ID for the 26th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
F90F	63759	Error ID for the 26th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
F9F1	63985	Error ID for the 26th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
F9F2	63986	Error ID for the 26th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
F9F7	63991	Error ID for the 26th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
F9F8	63992	Error ID for the 26th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
F9F9	63993	Error ID for the 26th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
F9FA	63994	Error ID for the 26th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
F9FB	63995	Error ID for the 26th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
F9FC	63996	Error ID for the 26th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
F9FD	63997	Error ID for the 26th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
FA01	64001	Error ID for the 27th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FA02	64002	Error ID for the 27th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
FA04	64004	Error ID for the 27th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
FA07	64007	Error ID for the 27th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
FA08	64008	Error ID for the 27th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
FA09	64009	Error ID for the 27th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
FA0A	64010	Error ID for the 27th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
FA0B	64011	Error ID for the 27th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
FA0C	64012	Error ID for the 27th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
FA0D	64013	Error ID for the 27th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
FA0E	64014	Error ID for the 27th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
FA0F	64015	Error ID for the 27th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
FAF1	64241	Error ID for the 27th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FAF2	64242	Error ID for the 27th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
FAF7	64247	Error ID for the 27th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
FAF8	64248	Error ID for the 27th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
FAF9	64249	Error ID for the 27th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
FAFA	64250	Error ID for the 27th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
FAFB	64251	Error ID for the 27th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
FAFC	64252	Error ID for the 27th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System erro	or code	Explanation	Correction
Hexadecimal	Decimal	Explanation	Conection
		maximum weight that can be measured.	
FAFD	64253	Error ID for the 27th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
FB01	64257	Error ID for the 28th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FB02	64258	Error ID for the 28th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
FB04	64260	Error ID for the 28th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
FB07	64263	Error ID for the 28th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
FB08	64264	Error ID for the 28th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
FB09	64265	Error ID for the 28th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
FB0A	64266	Error ID for the 28th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
FB0B	64267	Error ID for the 28th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
FB0C	64268	Error ID for the 28th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
FB0D	64269	Error ID for the 28th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System err	or code		
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
FB0E	64270	Error ID for the 28th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
FB0F	64271	Error ID for the 28th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
FBF1	64497	Error ID for the 28th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FBF2	64498	Error ID for the 28th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
FBF7	64503	Error ID for the 28th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
FBF8	64504	Error ID for the 28th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
FBF9	64505	Error ID for the 28th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.
FBFA	64506	Error ID for the 28th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
FBFB	64507	Error ID for the 28th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 2 and its wiring.
FBFC	64508	Error ID for the 28th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System error code		Explanation	Correction
Hexadecimal	Decimal	Explanation	Correction
		maximum weight that can be measured.	
FBFD	64509	Error ID for the 28th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.
FC01	64513	Error ID for the 29th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FC02	64514	Error ID for the 29th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.
FC04	64516	Error ID for the 29th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.
FC07	64519	Error ID for the 29th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.
FC08	64520	Error ID for the 29th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.
FC09	64521	Error ID for the 29th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.
FC0A	64522	Error ID for the 29th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 3.
FC0B	64523	Error ID for the 29th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 4.
FC0C	64524	Error ID for the 29th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.
FC0D	64525	Error ID for the 29th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.

System error code			
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
FC0E	64526	Error ID for the 29th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
FC0F	64527	Error ID for the 29th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
FCF1	64753	Error ID for the 29th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FCF2	64754	Error ID for the 29th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
FCF7	64759	Error ID for the 29th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
FCF8	64760	Error ID for the 29th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
FCF9	64761	Error ID for the 29th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	
FCFA	64762	Error ID for the 29th right-side module,16#18FA: CH1 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 1.
FCFB	64763	Error ID for the 29th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	
FCFC	64764	Error ID for the 29th right-side module,16#18FC: The weight measured by CH2 exceeds the	

System erro	or code	Explanation	Correction	
Hexadecimal	Decimal	Explanation	Correction	
		maximum weight that can be measured.		
FCFD	64765	Error ID for the 29th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.	
FD01	64769	Error ID for the 30th right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.	
FD02	64770	Error ID for the 30th right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.	
FD04	64772	Error ID for the 30th right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.	
FD07	64775	Error ID for the 30th right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.	
FD08	64776	Error ID for the 30th right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.	
FD09	64777	Error ID for the 30th right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.	
FD0A	64778	Error ID for the 30th right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.		
FD0B	64779	Error ID for the 30th right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.		
FD0C	64780	Error ID for the 30th right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.	
FD0D	64781	Error ID for the 30th right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.	

System error code			O	
Hexadecimal	Decimal	Explanation	Correction	
		channel 6 exceeds the range of inputs that the hardware can receive.		
FD0E	64782	Error ID for the 30th right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.	
FD0F	64783	Error ID for the 30th right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.	
FDF1	65009	Error ID for the 30th right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.	
FDF2	65010	Error ID for the 30th right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.	
FDF7	65015	Error ID for the 30th right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.	
FDF8	65016	Error ID for the 30th right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.	
FDF9	65017	Error ID for the 30th right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured. Check the parameters of the related values for channel 1.		
FDFA	65018	Error ID for the 30th right-side module,16#18FA: CH1 is adjusted incorrectly.		
FDFB	65019	Error ID for the 30th right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.		
FDFC	65020	Error ID for the 30th right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.	

System erre	or code	Explanation	Correction	
Hexadecimal	Decimal	Explanation	Conection	
		maximum weight that can be measured.		
FDFD	65021	Error ID for the 30th right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.	
FE01	65025	Error ID for the 31st right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.	
FE02	65026	Error ID for the 31st right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.	
FE04	65028	Error ID for the 31st right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.	
FE07	65031	Error ID for the 31st right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.	
FE08	65032	Error ID for the 31st right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 1.	
FE09	65033	Error ID for the 31st right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.	
FE0A	65034	Error ID for the 31st right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.		
FE0B	65035	Error ID for the 31st right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.		
FE0C	65036	Error ID for the 31st right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 5.	
FE0D	65037	Error ID for the 31st right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.	

System error code		<b>F</b>	O a manufactoria	
Hexadecimal	Decimal	Explanation	Correction	
		channel 6 exceeds the range of inputs that the hardware can receive.		
FE0E	65038	Error ID for the 31st right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.	
FE0F	65039	Error ID for the 31st right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.	
FEF1	65265	Error ID for the 31st right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.	
FEF2	65266	Error ID for the 31st right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.	
FEF7	65271	Error ID for the 31st right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.	
FEF8	65272	Error ID for the 31st right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.	
FEF9	65273	Error ID for the 31st right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured.	Check the parameters of the related weight values for channel 1.	
FEFA	65274	Error ID for the 31st right-side module,16#18FA: CH1 is adjusted incorrectly.		
FEFB	65275	Error ID for the 31st right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.		
FEFC	65276	Error ID for the 31st right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.	

System erre	or code	Explanation	Correction	
Hexadecimal	Decimal	Explanation	Correction	
		maximum weight that can be measured.		
FEFD	65277	Error ID for the 31st right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.	
FF01	65281	Error ID for the 32nd right-side module,16#1801: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.	
FF02	65282	Error ID for the 32nd right-side module,16#1802: Module hardware failure	Return the module to the factory for repair.	
FF04	65284	Error ID for the 32nd right-side module,16#1804: Internal error. The factory calibration is abnormal.	Contact the factory.	
FF07	65287	Error ID for the 32nd right-side module,16#1807: Error in CJC temperature	Return the module to the factory for repair.	
FF08	65288	Error ID for the 32nd right-side module,16#1808: The (temperature) signal received by channel 1 exceeds the range of inputs that the hardware can receive.		
FF09	65289	Error ID for the 32nd right-side module,16#1809: The (temperature) signal received by channel 2 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 2.	
FF0A	65290	Error ID for the 32nd right-side module,16#180A: The (temperature) signal received by channel 3 exceeds the range of inputs that the hardware can receive.		
FF0B	65291	Error ID for the 32nd right-side module,16#180B: The (temperature) signal received by channel 4 exceeds the range of inputs that the hardware can receive.		
FF0C	65292	Error ID for the 32nd right-side module,16#180C: The (temperature) signal received by channel 5 exceeds the range of inputs that the hardware can receive.		
FF0D	65293	Error ID for the 32nd right-side module,16#180D: The (temperature) signal received by	Check the signal received by channel 6.	

12

System error code			
Hexadecimal	Decimal	Explanation	Correction
		channel 6 exceeds the range of inputs that the hardware can receive.	
FF0E	65294	Error ID for the 32nd right-side module,16#180E: The (temperature) signal received by channel 7 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 7.
FF0F	65295	Error ID for the 32nd right-side module,16#180F: The (temperature) signal received by channel 8 exceeds the range of inputs that the hardware can receive.	Check the signal received by channel 8.
FFF1	65521	Error ID for the 32nd right-side module,16#18F1: External power supply failure	Ensure the external 24 VDC power supply to the module is functioning normally.
FFF2	65522	Error ID for the 32nd right-side module,16#18F2: Module hardware failure	Return the module to the factory for repair.
FFF7	65527	Error ID for the 32nd right-side module,16#18F7: Error in the driver board	Return the module to the factory for repair.
FFF8	65528	Error ID for the 32nd right-side module,16#18F8: The weight measured by CH1 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	Check the signal received by channel 1 and its wiring.
FFF9	65529	Error ID for the 32nd right-side module,16#18F9: The weight measured by CH1 exceeds the maximum weight that can be measured. Check the parameters of the related values for channel 1.	
FFFA	65530	Error ID for the 32nd right-side module,16#18FA: CH1 is adjusted incorrectly.	
FFFB	65531	Error ID for the 32nd right-side module,16#18FB: The weight measured by CH2 exceeds the maximum weight that can be measured, or the voltage of SEN is incorrect.	
FFFC	65532	Error ID for the 32nd right-side module,16#18FC: The weight measured by CH2 exceeds the	Check the parameters of the related weight values for channel 2.

System erre	or code	<b>E</b> velopetion	Connection		
Hexadecimal	Decimal	Explanation	Correction		
		maximum weight that can be measured.			
FFFD	65533	Error ID for the 32nd right-side module,16#18FD: CH2 is adjusted incorrectly.	Check the adjusted weight value and the adjustment steps for channel 2.		

MEMO

### 12



# Appendix A Modbus Communication

# Table of Contents

<b>A</b> .1	Message Format in ASCII Mode	. <b>A-2</b>
A.2	Message Format in RTU Mode	. <b>A-</b> 5
A.3	Modbus Function Codes Supported	. A-7
A.4	Modbus Exception Response Code Supported	. <b>A-7</b>
A.5	Introduction to Modbus Function Codes	. <b>A-</b> 8
A.6	Table of Registers and Corresponding Modbus addresses	<b>A-15</b>

# A.1 Message Format in ASCII Mode

• Communication data structure

Field name	Components	Explanation			
Start character	STX	Start character ":", the corresponding ASCII code: 16#3A			
Communication	ADR 1	Communication address consists of two ASCII codes.			
address	ADR 0	Communication address consists of two ASCII codes.			
Function and	CMD 1	Europian and a consists of two ASCII and a			
Function code	CMD 0	Function code consists of two ASCII codes.			
	DATA (0)				
Data	DATA (1)	Data content consists of 2n ASCII codes, p<205			
Dala		Data content consists of 2n ASCII codes, n≤205.			
	DATA (n-1)				
LDC Check	LRC CHK 1	LDC shark consists of two ACCII codes			
LRC Check	LRC CHK 0	LRC check consists of two ASCII codes.			
	END1	End character consists of two ASCII codes.			
End character	END0	END1 = CR (16#0D),			
		END0 = LF (16#0A)			

The corresponding relation between hexadecimal character and ASCII code:

Hexadecimal character	"0"	"1"	"2"	"3"	"4"	"5"	"6"	"7"
ASCII code	16#30	16#31	16#32	16#33	16#34	16#35	16#36	16#37
Hexadecimal character	"8"	"9"	"A"	"B"	"C"	"D"	"E"	"F"
ASCII code	16#38	16#39	16#41	16#42	16#43	16#44	16#45	16#46

### • ADR (Communication address)

The valid range of communication address:  $0\sim$ 254.

Communication address: 0 means the broadcast message is sent to all slaves and the slaves which have received the message will not make any response. If communication address is not 0, slaves will respond to master after receiving the message normally. For instance, ASCII codes for the communication address of 16 are denoted below.

Decimal 16 is equal to hexadecimal 10. (ADR 1, ADR 0) = '10', '1'=31H, '0' = 30H

• Function code and data

The data format is determined by function codes. For example, to read the two continuous address data with hexadecimal 16#0000 as the start address in the motion controller. The communication address of the motion controller is 1, 16#0000 is the Modbus address of %MW0 in the controller. The data explanation is shown as below:

PC→the motion controller

3A 30 31 30 33 30 30 30 30 30 30 30 30 32 46 41 0D 0A

The motion controller→PC

3A 30 31 30 33 30 34 30 30 30 31 30 30 30 32 46 35 0D 0A

### Request message:

Field name	Field character	ASCII code corresponding to field character
Start character	"."	3A
Communication address:	"0"	30
01	"1"	31
Function code: 02	"0"	30
Function code: 03	"3"	33
	"0"	30
Otart address 40//0000	"0"	30
Start address: 16#0000	"0"	30
_	"0"	30
	"0"	30
Data number	"0"	30
(Counted by word): 2	"0"	30
_	"2"	32
LDC abook and a 16#FA	"F"	46
LRC check code: 16#FA	"A"	41
End character 1	CR	0D
End character 0	LF	0A

### Response message:

Field name	Field character	ASCII code corresponding to field character
Start character	"."	3A
Communication address: 01	"0"	30
Communication address: 01	"1"	31
Function code: 02	"0"	30
Function code: 03	"3"	33
Data number	"0"	30
(Counted by byte):	"4"	34
	"0"	30
Read content of 16#1000	"0"	30
address	"0"	30
	"1"	31
	"0"	30
Read content of 16#1001	"0"	30
address	"0"	30
	"2"	32

Field name	Field character	ASCII code corresponding to field character	
LRC check code: 16#F5	"F"	"F" 46	
	"5"	35	
End character 1	CR	0D	
End character 0	LF	0A	

• LRC check (Check sum)

LRC check code is the value by firstly getting the inverse values of every bit of the result value of addition operation of the data from communication ID to the last data content (Hex.) and then adding 1 to the final inverse value.

For instance, LRC check code value: 16#FA. The method of calculating LRC check code value: 16#01 + 16#03 + 16#00 + 16#00 + 16#02 = 16#06, the result 16#FA is got by getting the inverse values of every bit of 16#06 and then adding 1 to the final inverse value.

Field name	Field character	ield character ASCII code corresponding to field character	
Start character	". "	3A	
Communication address:	"O"	30	
01	"1"	31	
Eurotian and a 02	"O"	30	
Function code: 03	"3"	33	
	"O"	30	
Start data address: 16#0000	"O"	30	
10#0000	"O"	30	
	"O"	30	
	"O"	30	
Data number (Counted	"O"	30	
by word):2	"O"	30	
	"2"	32	
	"F"	46	
LRC check code: 16#FA	"A"	41	
End character 1: CR	CR	0D	
End character 0: LF	LF	OA	

# A.2 Message Format in RTU Mode

Communication data structure

Start	No input data for more than 10ms
Communication address	Slave address: 8-bit binary address
Function code	Function code: 8-bit binary address
Data (n-1)	Data content
	n × 8 bit binary data, n<=202
Data 0	
Low byte of CRC check	
High byte of CRC check	CRC check sum
End	CRC check sum is composed of two 8-bit binary data

Communication address

The range of a valid communication address is  $0 \sim 254$ . The communication address 0 indicates to broadcast the message to all slaves and the slaves which have received the broadcast message do not make any response. If the communication address is not 0, slaves will reply to master as normal. For example, to communication with the slave with the communication address of 16, the address of the slave is set as 16#10 since decimal 16 is equal to hexadecimal 10.

Function code and data

The data format is determined by function codes.

For example, to read the data of two continuous addresses with 16#0000 as start address in the motion controller, the address of AS524C-B is 1, 16#0000 is the Modbus address of %MW0 in the controller.

The data in the communication cable and the explanation on them are shown below:

PC→the motion controller: "01 03 00 00 00 02 C4 0B"

The motion controller→PC: "01 03 04 00 01 02 00 2A 32"

Request message:

Field name	Character	
Start	No input data for more than 10ms	
Communication address	01	
Function code	03	
High byte of Modbus address	00	
ow byte of Modbus address 00		
Read high byte of data number	00	
Read low byte of data number	r 02	
Low byte of CRC check sum C4		
High byte of CRC check sum	0B	
End	No input data for more than 10ms	

#### Response message:

Field name	Character	
Start	No input data for more than 10ms	
Communication address	01	
Function code	03	
Read data number (Counted by bytes)	04	
Read high byte of data content	00	
Read low byte of data content	01	
Read high byte of data content	00	
Read low byte of data content	02	
Low byte of CRC check sum	2A	
High byte of CRC check sum	32	
End	No input data for more than 10ms	

CRC check (check sum)

CRC check starts from "Communication address" to the last "Data content". The calculation method is shown below.

Step 1: Download a 16-bit hex register (CRC register) with the content value FFFF.

**Step 2:** Make the XOR operation between the 8-bit data of the first byte in the command and the 8-bit data of the low byte in CRC register and then store the operation result in CRC register. **Step 3:** Move the content value of CRC register by one bit towards the right and fill 0 in the highest bit.

**Step 4:** Check the value of the lowest bit in CRC register. If the value is 0, repeat the action of step 3; if 1, make XOR operation between the content in CRC register and hex. A001 and then store the result in CRC register.

**Step 5:** Repeat step 3 and step 4 till the content in CRC register is moved by 8 bits towards the right. At this moment, the processing of the first byte of the command message is finished.

**Step 6:** Repeat the action of step 2 to step 5 for the next byte in the command message till the processing of all bytes is finished. The last content in CRC register is CRC check value. When CRC check value in command message is transmitted, the high and low bytes in calculated CRC check value must exchange with each other, i.e. the low byte is transmitted first.

#### Example on calculation of CRC check value with C language

```
unsigned char* data  ← // Pointer of command message content
unsigned char length  ← // Length of command message content
unsigned int crc_chk ( unsigned char* data, unsigned char length )
{
    int j;
    unsigned int reg_crc=0Xffff;
    while ( length-- )
    {
        reg_crc ^= *data++;
        for ( j=0;j<8;j++ )
        {
        If ( reg_crc & 0x01 ) reg_crc= ( reg_crc>>1 ) ^ 0Xa001; /* LSB ( b0 ) =1 */
        else reg_crc=reg_crc >>1;
    }
}
```

```
} return reg_crc; // the value that sent back to the CRC register finally
}
```

## A.3 Modbus Function Codes Supported

• The function codes which are supported by the motion controller are listed in the following table when COM2 port is possessed by the motion control module.

Function code	Explanation	Available register
16#01	Read output bit register values; the data of 256 bits at most can be read at a time	%QX
16#02	Read bit register values; the data of 256 bits at most can be read at a time	%IX,%QX
16#03	Read one single or multiple word register value; the data of 100 words at most can be read at a time.	%MW,%QW,%IW
16#05	Write one single bit register value.	%QX
16#06	Write one single word register value.	%MW,%QW
16#0F	Write multiple bit register value; the data of 256 bits at most can be written at a time.	%QX
16#10	Write multiple word register value; the data of 100 words at most can be written at a time.	%MW,%QW

### A.4 Modbus Exception Response Code Supported

• Exception response codes supported by the motion controller are listed in the following table.

Exception response code	Explanation
16#01	Illegal command codes: the command codes in the command message which PLC receives are invalid.
16#02	Illegal register address: the address in the command message received is invalid.
16#03	Illegal register value: the data in the command message received by PLC are invalid.
16#07	<ul> <li>♦ Check sum fault</li> <li>✓ Check if the check sum is correct.</li> <li>♦ Illegal command message</li> <li>✓ Too short command message</li> <li>✓ The length of the command message exceeds the valid range.</li> </ul>

# A.5 Introduction to Modbus Function Codes

- Function code 03 reads one single or multi word register values
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Read the start address of word registers in the	High byte
Byte3	motion controller	Low byte
Byte4	Read the number of addresses of word registers	High byte
Byte5	in the motion controller (Counted by Word)	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Read the number of addresses of word registers in the motion controller (Counted by Byte)	Single byte
Byte3	The address content of the word register in the motion controller	High byte
Byte4		Low byte
	The address content of the word register in the motion controller	High byte
		Low byte
Byte n	The address content of the word register in the motion controller	High byte
Byte n+1		Low byte
Byte n+2	Low byte of CRC check sum	Low byte
Byte n+3	High byte of CRC check sum	High byte

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ function code	Single byte
Byte2	Exception response code	Single byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

### Example

To read the contents of address 16#0000 and 16#0001 in the motion controller via function code 03.

16#0000 and 16#0001 are the Modbus addresses of %MW0 and %MW1 in the motion controller respectively.

Suppose the value of %MW0 is 16#0001 and %MW1 is 16#0002: Request message: 01 03 00 00 00 02 C4 0B Response message: 01 03 04 00 01 00 02 2A 32

- Function code 06 writes one single word register value
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Controller's register address where to write	High byte
Byte3	the value	Low byte
Byte4	The written value	High byte
Byte5		Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Controller's word register address where to write the value	High byte
Byte3		Low byte
Byte4	<b>-</b>	High byte
Byte5	The written value	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of an exception response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ function code	Single byte
Byte2	Exception response code	Single byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

### Example

Write 16#0100 to the address 16#0000 in the motion controller via function code 06. Request message: 01 06 00 00 01 00 88 5A Response message: 01 06 00 00 01 00 88 5A

- Function code 16#10 writes multiple word register values
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	The start address of controller's word registers	High byte
Byte3	where to write the value	Low byte
Byte4	The number of addresses of controller's word	High byte
Byte5	registers where to write the value. (Counted by word)	Low byte
Byte6	The number of addresses of controller's word registers where to write the value. (Counted by byte)	Single byte
Byte7	The address value written into controller's word	High byte
Byte8	register	Low byte
	The address value written into controller's word	High byte
	register	Low byte
Byte n	The address value written into controller's word	High byte
Byte n+1	register	Low byte
Byte n+2	Low byte of CRC check sum	Low byte
Byte n+3	High byte of CRC check sum	High byte

■ Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	The start address of controller's word registers	High byte
Byte3	where to write the value	Low byte
Byte4	The number of controller's word registers where to	High byte
Byte5	write the value. (Counted by Word)	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ function code	Single byte
Byte2	Exception response code	Single byte

Byte NO.	Name	Byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

### Example

Write 16#0100 and 16#0200 to the addresses 16#0000 and 16#0001 in the motion controller respectively via function code 16#10. 16#0000 and 16#0001 are Modbus addresses of %MW0 and %MW1 in the motion controller respectively.

Request message: 01 10 00 00 00 02 04 01 00 02 00 F3 33 Response message: 01 10 00 00 00 02 41 C8

- Function code 16#01 reads multiple output bit register values
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	The start address of controller's bit registers to be	High byte
Byte3	read	Low byte
Byte4	The number of controller's bit registers to be read	High byte
Byte5		Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

■ Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Read the number of bytes of bit registers.	Single byte
Byte3	Read the state value of the bit register.	Single byte
	Read the state value of the bit register.	Single byte
Byte n	Read the state value of the bit register.	Single byte
Byte n+1	Low byte of CRC check sum	Low byte
Byte n+2	High byte of CRC check sum	High byte

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ function code	Single byte
Byte2	Exception response message	Single byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

### Note:

The value of Byte 2 in the response message is determined by the values of Byte 4 and Byte 5 in the request message. For example, the number of the read bit registers in the request message is A. Dividing A by 8 produces B. If the quotient is an integer, the number of bytes of bit registers in the response message is B. Otherwise the number of bytes will be B + 1. See the example below for details.

### Example

Read the state value of %QX2.0~%QX3.4 in the motion controller via function code 01. The address of %QX2.0 is 16#A010. Suppose the value of %QX2.0~%QX2.7 is 1000 0001 and %QX3.0~%QX3.4 is 1 0001.

Request message: 01 01 A0 10 00 0D DE 0A Response message: 01 01 02 81 11 19 A0

- Function code 16#02 reads multiple bit register values
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	The start address of controller's bit registers where	High byte
Byte3	to read the state	Low byte
Byte4	Read the number of bit registers.	High byte
Byte5		Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Read the number of bytes of bit registers.	Single byte
Byte3	Read the state value of the bit register.	Single byte
	Read the state value of the bit register.	Single byte
Byte n	Read the state value of the bit register.	Single byte
Byte n+1	Low byte of CRC check sum	Low byte
Byte n+2	High byte of CRC check sum	High byte

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ Function code	Single byte
Byte2	Exception response code	Single byte

Byte NO.	Name	Byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

Note:

The value of Byte 2 in the response message is determined by the values of Byte 4 and Byte 5 in the request message. For example, the number of the read bit registers in request message is A. Dividing A by 8 produces B. If the quotient is an integer, the number of bytes of bit registers in the response message is B. Otherwise the number of bytes will be B+ 1. See the example below for details.

Example

Read the state value of %QX2.0~%QX3.4 in the motion controller via function code 02. The address of %QX2.0 is 16#A010. Suppose %QX2.0~%QX2.7=1000 0001, %QX3.0~%QX3.4=1 0001.

Request message: 01 02 A0 10 00 0D 9A 0A Response message: 01 02 02 81 11 19 E4

- Function code 16#05 writes one single bit register value
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2		High byte
Byte3	Modbus address of the bit register	Low byte
Byte4	The volue written in the bit register	High byte
Byte5	The value written in the bit register	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	Madhua address of the hit register	High byte
Byte3	Modbus address of the bit register	Low byte
Byte4	The value written in the hit register	High byte
Byte5	The value written in the bit register	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ Function code	Single byte
Byte2	Exception response code	Single byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

Data structure of an exception response message:

**Note:** The written value 16#0000 for the bit register in request message or response message indicates the value FALSE is written in the bit register; the written value 16#FF00 for the bit register indicates the value TRUE is written in the bit register.

### Example

The value of %QX0.0 in the motion controller is set to TRUE and the address of %QX0.0 is set to 16#A000 via function code 05.

Request message: 01 05 A0 00 FF 00 AE 3A Response message: 01 05 A0 00 FF 00 AE 3A

- Function code 16#0F writes multiple bit register values
  - Data structure of a request message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2	The start address of the bit registers where to write	High byte
Byte3	values	Low byte
Byte4	The number of hit registers where to units values	High byte
Byte5	The number of bit registers where to write values	Low byte
Byte6	The number of bytes of bit registers where to write values	Single byte
Byte7	The value written to the bit register	Single byte
	The value written to the bit register	Single byte
Byte n	The value written to the bit register	Single byte
Byte n+1	Low byte of CRC check sum	Low byte
Byte n+2	High byte of CRC check sum	High byte

Data structure of a response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	Function code	Single byte
Byte2		High byte
Byte3	The start address of bit registers where to write values	Low byte
Byte4		High byte
Byte5	The number of bit registers where to write values	Low byte
Byte6	Low byte of CRC check sum	Low byte
Byte7	High byte of CRC check sum	High byte

Data structure of an exception response message:

Byte NO.	Name	Byte
Byte0	Modbus ID	Single byte
Byte1	16#80+ Function code	Single byte
Byte2	Exception response code	High byte
Byte3	Low byte of CRC check sum	Low byte
Byte4	High byte of CRC check sum	High byte

Note: How many bytes of data in the request message depend on the number of bit registers in the request message.

### Example

The value of  $QX0.0 \sim QX0.7$  is set to 1000 0001 and the address of QX0.0 is 16#A000 via function code 0F in the motion controller.

Request message: 01 0F A0 00 00 08 01 81 26 55 Response message: 01 0F A0 00 00 08 76 0D

### A.6 Table of Registers and Corresponding Modbus addresses

 Register numbers in the motion control module of AS524C-B and corresponding addresses are listed below:

Register name	Register number	Explanation	Address (hex)	Attribute
I	%IX0.0~%IX127.7		6000 ~ 63FF	Read only
Q	%QX0.0~%QX127.7	Bit registers	A000 ~ A3FF	Read/write
I	%IW0~%IW63		8000 ~ 803F	Read only
Q	%QW0~%QW63	Word registers	A000 ~ A03F	Read/write
М	%MW0~%MW32767		0000 ~ 7FFF	Read/write

MEMO





# Appendix B Modbus TCP Communication

# Table of Contents

B.1	Modbus TCP Message Structure	. <b>B-2</b>
B.2	Modbus Function Codes Supported in Modbus TCP	. <b>B-2</b>
B.3	Exception Response Code in Modbus TCP	. B-3
<b>B.4</b>	Modbus Function Codes in Modbus TCP	. <b>B-3</b>
B.5	Registers and Corresponding Modbus Addresses	B-12

## B.1 Modbus TCP Message Structure

### • Modbus TCP message structure

Byte NO.	Name		Explanation
Byte0	- Transaction identifier	High byte	0
Byte1		Low byte	0
Byte2	Protocol identifier	High byte	0
Byte3	FICIOCOLIGENTINEL	Low byte	- 0
Byte4		High byte	The number of bytes of
Byte5	Modbus data length	Low byte	Modbus address and the data after it.
Byte6	Modbus ID	Single byte	0~16#FF
Byte7	Function code	Single byte	
Byte8	Register address in the	High byte	
Byte9	controller	Low byte	- 0~16#FFFF
Byte10	Modbus data	High byte	The number of bytes of Modbus data is determined by function code.

# **B.2 Modbus Function Codes Supported in Modbus TCP**

• Modbus function codes which the motion controller supports

Function code	Function	Register
16#02	Read bit register value; maximum 256 bits of data could be read at a time.	%IX and %QX
16#03	Read one single or multiple word register values; maximum 100 words of data could be read at a time.	%IW, %QW and %MW
16#05	Write one single bit register value.	% QX
16#06	Write one single word register value.	%QW and %MW
16#0F	Write multiple bit register values; maximum 256 bits of data could be written at a time.	% QX
16#10	Write multiple word register values; maximum 100 words of data could be written at a time.	%QW and %MW

# B.3 Exception Response Code in Modbus TCP

• Modbus exception response codes that the motion controller supports are shown in the table below.

Exception response code	Indication
16#01	Unsupportive function code
16#02	Unsupportive Modbus address
16#03	Data length exceeds the range

### **B.4 Modbus Function Codes in Modbus TCP**

- Function code: 03 to read one single or multiple word register values
  - Request message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1	Transaction identifier	Low byte
Byte2	Drotocol identifier	High byte
Byte3	Protocol identifier	Low byte
Byte4		High byte
Byte5	Modbus data length	Low byte
Byte6	Modbus ID	Low byte
Byte7	Function code	Single byte
Byte8	The start address of word registers to be	High byte
Byte9	read	Low byte
Byte10	The number of word registers (Counted by Word)	High byte
Byte11		Low byte

### Response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte

Byte NO.	Name	Byte
Byte7	Function code	Single byte
Byte8	The number of read word registers. (Counted by Byte)	Single byte
Byte9	The content value in a word register	High byte
Byte10		Low byte
	The content value in a word register	High byte
Byte n		Low byte

### Exception response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Drate og kiden tillen	High byte
Byte3	Protocol identifier	Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

### Example

To read the content value in the addresses 16#0000 and 16#0001 inside the motion controller via function code 03. 16#0000 and 16#0001 are the Modbus address of %MW0 and %MW1 inside the motion controller respectively. Suppose that the value of %MW0 is 16#0100 and the value of %MW1 is 16#0200.

Request message: 00 00 00 00 00 00 06 01 03 00 00 00 02

Response message: 00 00 00 00 00 07 01 03 04 01 00 02 00

### • Function code: 06 to write one single word register value

### Request message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte

Byte NO.	Name	Byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The address of a word register where to write value	High byte
Byte9		Low byte
Byte10	The value written in the word register	High byte
Byte11		Low byte

### Response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1	Transaction identifier	Low byte
Byte2	Desta sel i destifica	High byte
Byte3	Protocol identifier	Low byte
Byte4		High byte
Byte5	Modbus data length	Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The address of a word register where to write a	High byte
Byte9	value	Low byte
Byte10	The value written in a word register	High byte
Byte11		Low byte

### Exception response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1	- Transaction identifier	Low byte
Byte2	Drotocol identifier	High byte
Byte3	Protocol identifier	Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

B

### Example:

To write the value 16#0100 to the address 16#0000 in the motion controller via function code 06

Request message: 00 00 00 00 00 06 01 06 00 00 01 00

Response message: 00 00 00 00 00 00 06 01 06 00 00 01 00

### • Function code: 16#10 to write multiple word register values

### Request message data structure:

Byte NO.	Name	Byte
Byte0	<b>T</b>	High byte
Byte1	Transaction identifier	Low byte
Byte2		High byte
Byte3	Protocol identifier	Low byte
Byte4		High byte
Byte5	<ul> <li>Modbus data length</li> </ul>	Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The start address of word registers where to write	High byte
Byte9	values	Low byte
Byte10	The number of word registers where to write values	High byte
Byte11	(Counted by Word)	Low byte
Byte12	The number of word registers where to write values (Counted by Byte)	Single byte
Byte13		High byte
Byte14	The value written in a word register	Low byte
	The value written in a word register	High byte
Byte n		Low byte

### Response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1	Transaction identifier	Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte

Byte NO.	Name	Byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The start address of word registers where to write values	High byte
Byte9		Low byte
Byte10	The number of word registers where to write values. (Counted by Word)	High byte
Byte11		Low byte

### Exception response message data structure:

Byte NO.	Name	Byte
Byte0	<b>—</b>	High byte
Byte1	Transaction identifier	Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

#### Note:

How many bytes of data in a response message depend on the number of read register addresses in the motion controller in the request message. So the value of n in Byte n in the response message can be calculated through reading the number of register addresses in the motion controller.

### Example

To write 16#0100 and 16#0200 to the addresses 16#0000 and 16#0001 in the motion controller via function code 06.

16#0000 and 16#0001 are the Modbus addresses of %MW0 and %MW1 in the motion controller respectively.

Request message: 00 00 00 00 00 0B 01 10 00 00 02 04 01 00 02 00

Response message: 00 00 00 00 00 06 01 10 00 00 00 02

### • Function code: 16#02 to read multiple bit register values

Request message data structure:

Byte NO.	Name	Byte
Byte0		High byte
Byte1	- Transaction identifier	Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The start address of the read bit registers	High byte
Byte9		Low byte
Byte10	The number of read bit registers	High byte
Byte11		Low byte

### Response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	How many bytes for the read bit registers	Single byte
Byte9	The status value of a bit register which is read	Single byte
	The status value of a bit register which is read	Single byte
Byte n	The status value of a bit register which is read	Single byte

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

Exception response message data structure:

### Example

To read the state value of %QX2.0~%QX3.4 in the motion controller via function code 02. 16#A010 is the address of %QX2.0. Suppose that %QX2.0~%QX2.7=1000 0001 and %QX3.0~%QX3.4=10001.

Request message: 00 00 00 00 00 06 01 02 A0 10 00 0D

Response message: 00 00 00 00 00 00 06 01 02 02 81 11

### • Function code: 16#05 to write one single bit register value

### Request message data structure:

Byte NO.	Name	Byte
Byte0	-	High byte
Byte1	<ul> <li>Transaction identifier</li> </ul>	Low byte
Byte2	Destand identifier	High byte
Byte3	Protocol identifier	Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	Modbus address of a bit register	High byte
Byte9		Low byte
Byte10	The value written in the bit register	High byte
Byte11		Low byte

Byte NO.	Name	Byte
Byte0		High byte
Byte1	Transaction identifier	Low byte
Byte2	Desta sel iden <i>tifica</i>	High byte
Byte3	Protocol identifier	Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	Modbus address of a bit register	High byte
Byte9		Low byte
Byte10	The value written in the bit register	High byte
Byte11		Low byte

### ■ Response message data structure:

### Exception response message data structure:

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1		Low byte
Byte2	Protocol identifier	High byte
Byte3		Low byte
Byte4	Modbus data length	High byte
Byte5		Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

Note: The written value 16#0000 means that 0 is written to the bit register and 16#FF00 means that 1 is written to the bit register.

### Example

Set the value of %QX0.0 in the motion controller to 1 via function code 05; the address of %QX0.0 is 16#A000.

Request message: 00 00 00 00 00 00 06 01 05 A0 00 FF 00

Response message: 00 00 00 00 00 06 01 05 A0 00 FF 00

- Function code: 16#0F to write multiple bit register values.
  - Request message data structure:

Byte NO.	Name	Byte
Byte0		High byte
Byte1	Transaction identifier	Low byte
Byte2	Drotocol identifier	High byte
Byte3	Protocol identifier	Low byte
Byte4		High byte
Byte5	Modbus data length	Low byte
Byte6	Modbus ID	Single byte
Byte7	Function code	Single byte
Byte8	The start address of the bit registers where to write values	High byte
Byte9	The start address of the bit registers where to write values	Low byte
Byte10	The number of bit registers where to write values	High byte
Byte11		Low byte
Byte12	How many bytes occupied by bit registers where to write values	Single byte
Byte13	The value written in a bit register	Single byte
Byte n	The value written in a bit register	Single byte

### Response message data structure

Byte NO.	Name	Byte
Byte0		High byte
Byte1	Transaction identifier	Low byte
Byte2		High byte
Byte3	Protocol identifier	Low byte
Byte4	Modbus data length	Single byte
Byte5	Modbus ID	High byte
Byte6		Low byte
Byte7	Function code	Single byte
Byte8	<b>-</b>	High byte
Byte9	The start address of bit registers where to read status	Low byte
Byte10		High byte
Byte 11	The number of bit registers where to write values	Low byte

Byte NO.	Name	Byte
Byte0	Transaction identifier	High byte
Byte1	Transaction identifier	Low byte
Byte2	Drotocolidentifier	High byte
Byte3	Protocol identifier	Low byte
Byte4	Madhua data langth	High byte
Byte5	<ul> <li>Modbus data length</li> </ul>	Low byte
Byte6	Modbus ID	Single byte
Byte7	16#80+ function code	Single byte
Byte8	Exception response code	Single byte

#### Exception response message data structure

#### Example

Set %QX0.0~%QX0.7=1000 0001 via function code 0F and set the address of %QX0.0 to 16#A000 in the motion controller.

Request message: 00 00 00 00 00 00 01 0F A0 00 00 08 01 81 Response message: 00 00 00 00 00 06 01 0F A0 00 00 08

## B.5 Registers in AS524C-B and Corresponding Modbus Addresses

Register name	Register no.	Explanation	Address (hex)	Attribute
I	%IX0.0~%IX127.7		6000 ~ 63FF	Read only
Q	%QX0.0~%QX127.7	Bit register	A000 ~ A3FF	Read/write
I	%IW0~%IW63		8000 ~ 803F	Read only
Q	%QW0~%QW63	Word register	A000 ~ A03F	Read/write
М	%MW0~%MW32767		0000 ~ 7FFF	Read/write



# Appendix C CANopen Protocol

# Table of Contents

C.1	Node States	C-4
C.2	Network Management (NMT)	C-6
C.3	PDO (Process Data Object)	C-6
C.4	SDO (Service Data Object)	C-8


#### About CANopen protocol

The CAN (controller area network) fieldbus only defines the physical layer and data link layer. (See ISO11898 standard.) It does not define the application layer. In the practical design, the physical layer and the data link layer are realized by the hardware. The CAN fieldbus itself is not complete. It needs the superior protocol to define the use of 11/29-bit identifier and 8-byte data.

The CANopen protocol is the CAN-based superior protocol. It is one of the protocols defined and maintained by CiA (CAN-in-Automation). It is developed on the basis of the CAL (CAN application layer) protocol, using a subset of the CAL communication and service protocols.


The CANopen protocol covers the application layer and the communication profile (CiA DS301). It also covers a framework for programmable registers (CiA 302), the recommendations for cables and connectors (CiA 303-1), and SI units and prefix representations (CiA 303-2).

In the OSI model, the relation between the CAN standard and the CANopen protocol is as follows.

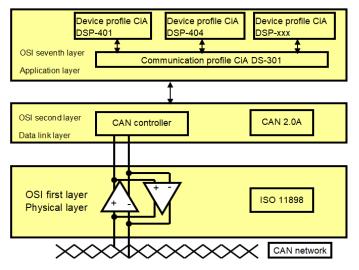

The object dictionary

- CANopen uses an object-based way to define a standard device. Every device is represented by a set of objects, and can be visited by the network. The model of the CANopen device is illustrated below. As the figure below shows, the object dictionary is the interface between the communication program and the superior application program.
- The core concept of CANopen is the device object dictionary (OD). It is an orderly object set. Every object adopts a 16-bit index for addressing. In order to allow the visit to the single element in the data structure, it also defines an 8-bit subindex. Every node in the CANopen network has an object dictionary. The object dictionary includes the parameters which describe the device and the network behavior. The object dictionary of a node is described in the electronic data sheet.

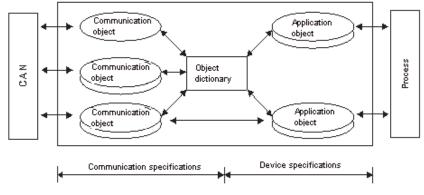

#### • The CANopen Communication Object

The CANopen communication protocol contains PDO, SDO, NMT and other predefined CANopen communication object.

Refer to section C.3 for PDO introduction. Refer to section C.4 for SDO introduction. Refer to section C.2 for NMT introduction.


Refer to section C.2 for Night Introduction.

#### • Other predefined CANopen communication objects (SYNC and EMCY)

#### SYNC Object (Synchronous object)

The synchronous object is the message broadcasted periodically by the master node in the CANopen network. This object is used to realize the network clock signal. Every device decides whether to use the event and undertake the synchronous communication with other network devices according to its configuration. For example, when controlling the driving device, the devices do not act immediately after they receive the command sent by the master. They do act until they receive the synchronous message. In this way, many devices can act synchronously.

The format of the SYNC message:

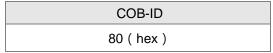

#### Emergency Object

The emergency object is used by the CANopen device to indicate an internal error. When an emergency error occurs in the device, the device sent the emergency message (including the emergency error code), and the device enters the error state. After the error is eliminated, the device sends the emergency message, the emergency error code is 0, and the device enters the normal state.

The format of the emergency message:

COB-ID	Byte 0	Byte 1	Byte 2	Byte 3	Byte 4	Byte 5	Byte 6	Byte 7
80 ( hex )	Emergency error code		Error	Factory-defined error code				
+Node-ID	LSB	MSB	register		,			


Note: The value in the error register is mapped to index 1001 (hex) in the object dictionary. If the value is 0, no error occurs. If the value is 1, a general error occurs. If the value is H'80, an internal error occurs in the device.

### C.1 Node States

#### Module control services

The master node in the CANopen network controls the slave by sending the command. The slave executes the command after it receives the command and it does not need to reply. All CANopen nodes have internal NMT states. The slave node has four states, Initializing, Pre-operational, Operational, and Stop state.

The state of the device is illustrated below.

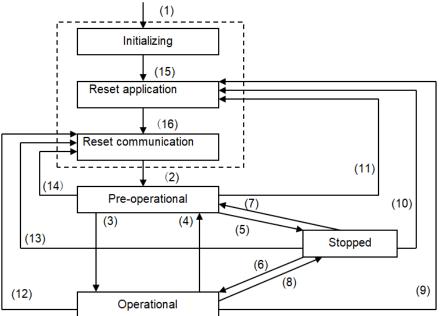

(1) After the power is supplied, the device automatically enters the initialization state.

(2) After the initialization is complete, the device automatically enters the Pre-operational state.

(3)(6) The remote node is started.

(4)(7) The device enters the Pre-operational state.

- (5)(8) The remote node is stopped.
- (9)(10)(11) The application layer is reset.
- (12)(13)(14) The communication is reset.
- (15) After the initializing is complete, the device automatically enters the "reset application" state.
- (16) After the "reset application" state is complete, the device automatically enters the "reset communication" state.

The relation between the communication object and the state is shown below. The communication object service can be executed only in a proper state. For example, SDO can be executed only in the operational state and in the pre-operational state.

	Initialization	Pre-operational	Operational	Stopped
PDO			Х	
SDO		X	Х	
SYNC		X	Х	
Time Stamp		X	Х	
EMCY		X	Х	
Boot-up	Х			
NMT		X	Х	Х

The format of the control message for the node state:

COB-ID	Byte 0	Byte 1
0	Command specifier (CS)	Slave address (0: Broadcast)


The command specifiers are listed below.

Command specifier (hex)	Function
01	Start the remote node
02	Stop the remote node
80	Enter the pre-operational state
81	Reset the application layer
82	Reset the communication

#### Error Control services

The error control service is used to detect the disconnection of the node in the network. The error control services can be classified into two types, Heartbeat and Node Guarding. The PLC only supports Heartbeat. For example, the master can detect the disconnection of the slave only after the slave enables the Heartbeat service.

The Heartbeat principle is illustrated as follows. The Heartbeat producer transmits the Heartbeat message according to the Heartbeat producing time which is set. One or more Heartbeat consumers detect the message transmitted by the Heartbeat producer. If the consumer does not receive the message transmitted by the producer within the timeout period, the heartbeat event generated indicates that the CANopen communication is abnormal.

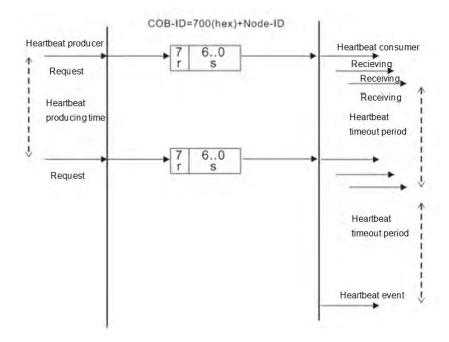

#### Boot-up services

After the slave completes entering the pre-operational state, it will transmit a Boot-up message, which indicates the initializing is completed.

### C.2 Network Management (NMT)

The CANopen network management complies with the Master/Slave mode. Only one NMT master can exist and other nodes are considered as slaves in a CANopen network. NMT contains three types of services, Module control services, Error Control services and Boot-up services. Please refer to section C.1 of the manual for more details.

## C.3 PDO (Process Data Object)

#### • PDO

- The PDO provides the direct visit channel for the device application object, is used to transmit the real-time data, and has high priority. Every byte in the PDO CAN message data list is used to transmit the data. The rate of making use of the message is high.
- The PDO is described by means of the "producer/consumer mode". The data is transmitted from one producer to one or many consumers. The data which can be transmitted are limited to 1-byte data to 8-byte data. After the data is transmitted by the producer, the consumer does not need to reply to the data. Every node in the network will detect the data information transmitted by the transmission node, and decides whether to process the data which is received.
- There are two kinds of PDO services for every PDO: TxPDO and RxPDO. The PDO sent by the producer is called PDO (TxPDO) sent by the producer device. And the PDO the consumer receives is called PDO (RxPDO) which the consumer device receives.
- Every PDO is described with two objects in the object dictionary: The PDO communication parameters and the PDO mapping parameters.

The PDO communication parameters:

Include the COB-ID which will be used by PDO, transmission type, prohibition time and the cycle of the counter.

The PDO mapping parameters:

Contain the object list in an object dictionary. These objects are mapped into the PDO, including the data length (in bits). To explain the contents of the PDO, the producer and the consumer have to understand the mapping.

The PDO transmission modes: synchronous and asynchronous Synchronous: Synchronous periodic and synchronous non-periodic Asynchronous: The PDO is transmitted when the data is changed, or it is transmitted after an event trigger.

	Туре		PDO transmission			
	Periodic	Non-periodic	Synchronous	Asynchronous	RTR	
0		Х	Х			
1 – 240	Х		Х			
254				Х		
255				Х		

> The transmission modes supported by PDO are as follows.

Mode 0: The PDO information is transmitted only when the PDO data is changed and the synchronous signal comes.

Modes 1~240: One piece of PDO information is transmitted every 1~240 synchronous signals. Mode 254: The event trigger transmission is defined by the manufacturer. For the motion controller, the definition is the same as mode 255.

Mode 255: PDO is transmitted when the data is changed, or it is transmitted after an event trigger.

All the data in the PDO has to be mapped from the object dictionary. The following is an example of the PDO mapping.

Object dictionary					PDO_1	mapping	3	
xxxxh	xxh	Application	object A		0		3	
					▶ 1	yyyyh	yyh	8
yyyyh	yyh	Application of	object B		2	zzzzh	zzh	16
					3	xxxxh	xxh	8
zzzzh	zzh	Application of	object C					
				$\mathbf{\hat{b}}$				
PDO_1	Appli	cation object B		Application object	С	А	pplication	object A

> The data format for RxPDO and TxPDO is as follows.

COB-ID	Byte 0	Byte 1	Byte 2	Byte 3	Byte 4	Byte 5	Byte 6	Byte 7
Object identifier		Data						

## C.4 SDO (Service Data Object)

- SDO
  - The SDO is used to build the client/server relation between two CANopen devices. The client device can read the data from the object dictionary of the server device, and write the data into the object dictionary of the server device. The access mode of the SDO is "client/server" mode. The mode which is accessed is the SDO server. Every CANopen device has at least one service data object which provides the access channel to the object dictionary of the device. SDO can read all objects in the object dictionary, and write all objects into the object dictionary.
  - The SDO message contains the index information and the subindex information which can be used to position the objects in the object dictionary, and the composite data structure can easily pass the SDO access. The trigger method of SDO belongs to the type of command response. In other words, the SDO server must reply after the SDO client sends a read/write request. The client and the server can stop the transmission of the SDO. The request message and response message can be differentiated according to their different COB-IDs.
  - The SDO can transmit the data in any length. If the data length is more than 4 bytes, the data has to be transmitted by segment. The last segment of the data contains an end flag. The structures of the SDO requested message and reply message are as follows. The formats of the request message and response message:

COB-ID	Byte 0	Byte 1	Byte 2	Byte 3	Byte 4	Byte 5	Byte 6	Byte 7
600 ( hex )	Request	Object index		Object index	Requested data			
+Node-ID	code	LSB	MSB	Object index	bit7-0	bit15-8	bit23-16	bit31-24

> The format of the request message

Request code (hex)	Description
23	Writing the 4-byte data
2B	Writing the 2-byte data
2F	Writing the 1-byte data
40	Reading the data
80	Stopping current SDO function

The definition of the request code in the request message:

#### > The format of the response message

COB-ID	Byte 0	Byte 1	Byte 2	Byte 3	Byte 4	Byte 5	Byte 6	Byte 7
580 ( hex )	Response	Objec	t index	Object		Respor	nse data	
+Node-ID	code	LSB	MSB	subindex	bit7-0	bit15-8	bit23-16	bit31-24

> The definition of the response code in the response message:

Response code (hex)	Description			
43	Reading the 4-byte data			
4B	Reading the 2-byte data			
4F	Reading the 1-byte data			
60	Writing the 1/2/4-byte data			
80	Stopping the SDO function			



# Appendix D Explanation of Homing Modes


## Table of Contents

D.1	<b>Explanation of Homing</b>	Modes	D-2

## D.1 Explanation of Homing Modes


The motion controller provides many homing modes from which user can choose the appropriate one in accordance with the field condition and technical requirement.

- Mode 1 Homing which depends on the negative limit switch and Z pulse.
  - **Circumstance 1**: MC\_Home instruction is executed when the negative limit switch is OFF and the axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the axis encounters that the negative limit switch is ON. Where the first Z pulse is met is the home position when the negative limit switch is OFF.
  - **Circumstance 2**: MC\_Home instruction is executed when the negative limit switch is ON and the axis moves in the positive direction at the second-phase speed. Where the first Z pulse is met is the home position when the negative limit switch is OFF.

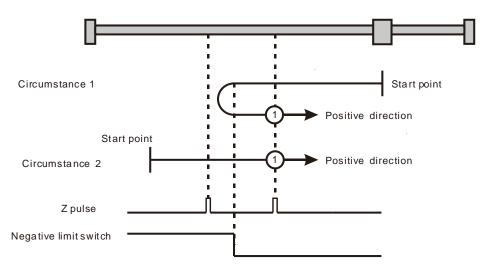

Homing depending on the negative limit switch and Z pulse (①: mode 1)

- Mode 2 Homing which depends on the positive limit switch and Z pulse
  - **Circumstance 1**: MC\_Home instruction is executed when the positive limit switch is OFF and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the axis encounters that the positive limit switch is ON. Where the first Z pulse is met is the home position while the positive limit switch is OFF.
  - **Circumstance 2**: MC\_Home instruction is executed when the positive limit switch is ON and the axis moves in the negative direction at the second-phase speed. Where the first Z pulse is met is the home position while the positive limit switch is OFF.

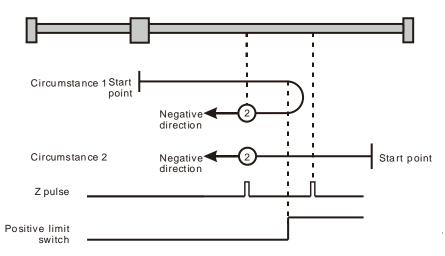

Homing depending on the positive limit switch and Z pulse (2: mode 2)


Mode 3 and mode 4 Homing which depends on the home switch and Z pulse

Mode 3

- **Circumstance 1**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. When the axis encounters that the home switch is ON, the motion direction changes and the axis moves at the secondphase speed. Where the first Z pulse is met is the home position when the home switch is OFF.
- **Circumstance 2**: When the home switch is ON, MC\_Home instruction is executed and the axis directly moves in the negative direction at the second-phase speed. Where the first Z pulse is met is the home position while the home switch is OFF.

#### Mode 4

- **Circumstance 1**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. The axis moves at the second-phase speed when the axis encounters that the home switch is ON. Where the first Z pulse is met is the home position.
- **Circumstance 2**: When the home switch is ON, MC\_Home instruction is executed and the axis moves in the negative direction at the second-phase speed. When the axis encounters that the home switch is OFF, the motion direction changes and the axis moves at the second-phase speed. Where the first Z pulse is met is the home position.

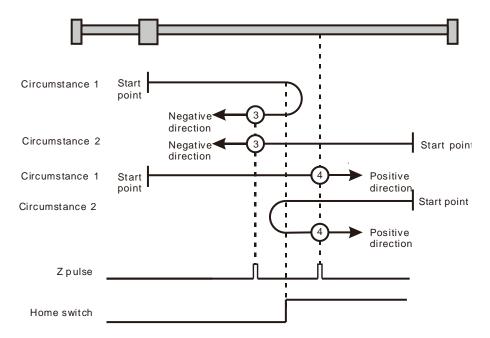


Homing depending on the home switch and Z pulse (3: mode 3; 4: mode 4)

Mode 5 and mode 6 Homing which depends on the home switch and Z pulse

- Mode 5
  - **Circumstance 1**: When the home switch is ON, MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed. Where the first Z pulse is met is the home position while the home switch is OFF.
  - **Circumstance 2**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed. When the home switch is ON, the motion direction changes and the axis moves at the second-phase speed. Where the first Z pulse is met is the home position when the home switch is OFF.

#### Mode 6


- **Circumstance 1**: When the home switch is ON, MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed. When the home switch is OFF, the motion direction changes and the axis moves at the second-phase speed. Where the first Z pulse is met is the home position.
- **Circumstance 2**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed. While the home switch is ON, the axis moves at the second-phase speed and where the first Z pulse is met is the home position.

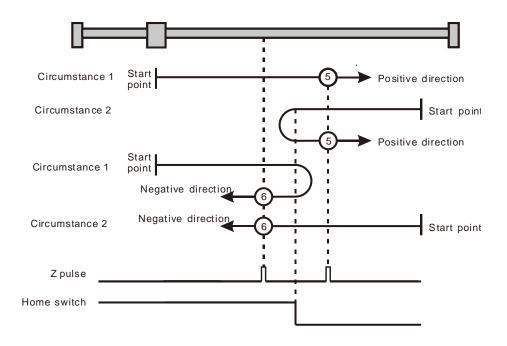

Homing depending on the home switch and Z pulse (⑤: mode 5, ⑥: mode 6)

Mode 7~ mode 10 Homing which depending on the home switch, positive limit switch and Z pulse


- Mode 7
  - **Circumstance 1**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is ON. Where the first Z pulse is met is the home position when the home switch is OFF.
  - **Circumstance 2**: When the home switch is ON, MC\_Home instruction is executed and the axis moves in the negative direction at the second-phase speed. Where the first Z pulse is met is the home position when the home switch is OFF.
  - **Circumstance 3**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. The axis starts to move at the second-phase speed when the home switch is ON. Where the first Z pulse is met is the home position when the home switch is OFF.

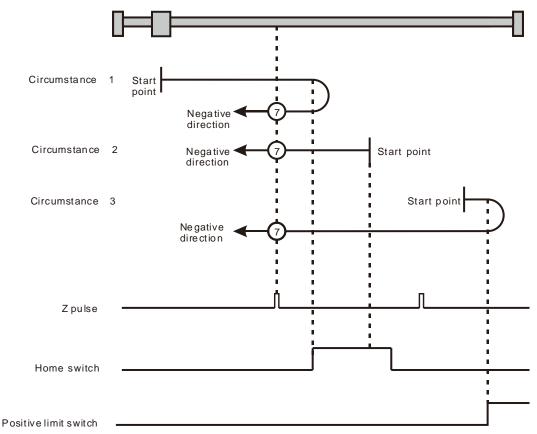

Homing depending on the home switch, positive limit switch and Z pulse (⑦: mode 7)


**Circumstance 1**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. The axis moves at the second-phase speed when the home switch is ON and where the first Z pulse is met is the home position.

- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the negative direction at the second-phase speed when the home switch is ON. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 3**: When the home switch is OFF, MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. The axis still moves at the first-phase speed when the home switch is ON. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF. The axis moves at the second-phase speed and where the first Z pulse is met is the home position when the home switch is ON.

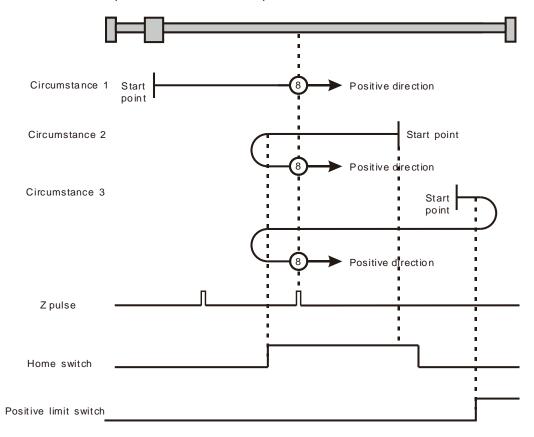

Homing depending on the home switch, positive limit switch and Z pulse ((1): mode 8)


- **Circumstance 1**: MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed when the home switch is OFF. The axis moves at the second-phase speed when the home switch is ON. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 2**: When the home switch is ON MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed when the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. The axis moves at the second-phase speed and where the first Z pulse is met is the home position when the home switch is ON.

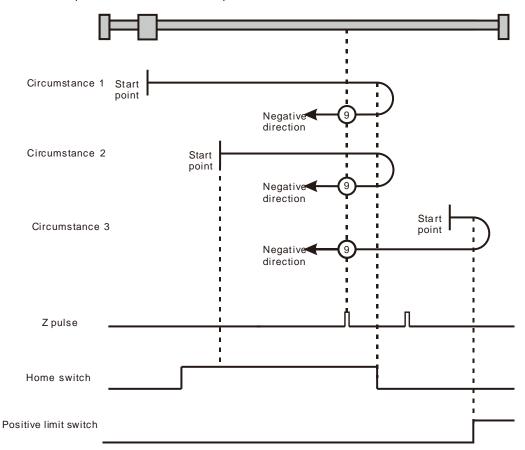



Homing depending on the home switch, positive limit switch and Z pulse (9: mode 9)

**Circumstance 1**: MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed when the home switch is OFF. The axis moves at the second-phase speed when the home switch is ON. And where the first Z pulse is met is the home position while the home switch is OFF.


- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed when the home switch is ON. And where the first Z pulse is met is the home position while the home switch is OFF.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed when the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. The motion direction changes again and the axis moves at the second-phase speed when the home switch is ON. Where the first Z pulse is met is the home position while the home switch is OFF.

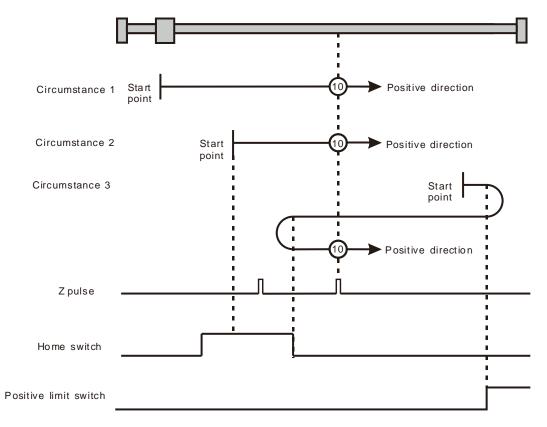

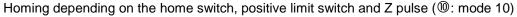

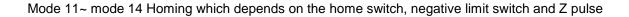


- **Circumstance 1**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed when the home switch is OFF. The motion direction changes and the axis moves at the second-phase speed when the home switch is ON. And where the first Z pulse is met is the home position while the home switch is OFF.
- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed while the home switch is ON. And where the first Z pulse is met is the home position while the home switch is OFF.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed while the home switch is OFF and the negative limit switch is ON. The axis moves at the second-phase speed when the home switch is ON. Where the first Z pulse is met is the home position while the home switch is OFF.

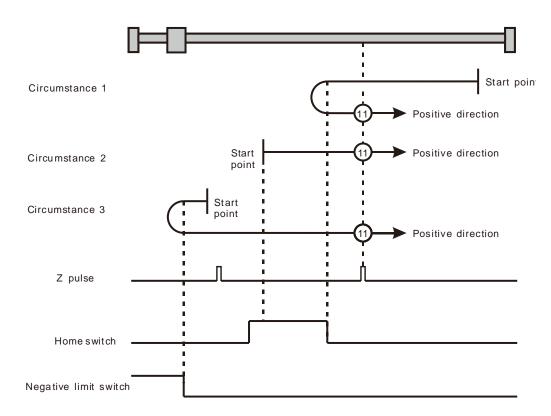

Homing depending on the home switch, negative limit switch and Z pulse (1): mode 11)


**Circumstance 1**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed when the home switch is OFF. The axis moves at the second-phase speed when the home switch is ON. And where the first Z pulse is met is the home position.

- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed while the home switch is ON. The motion direction changes and the axis moves at the second-phase speed while the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed while the home switch is OFF and the negative limit switch is ON. The axis still moves at the first-phase speed when the home switch is ON. The motion direction changes and the axis moves at the first-phase speed while the home switch is ON. The motion direction changes and the axis moves at the first-phase speed while the home switch is OFF. The axis moves at the second-phase speed while the home switch is ON. And where the first Z pulse is met is the home position.

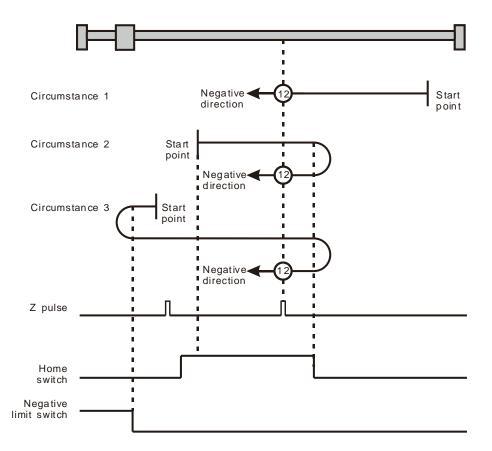

Homing depending on the home switch, negative limit switch and Z pulse (12): mode 12)


- **Circumstance 1**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The axis moves at the second-phase speed while the home switch is ON. The motion direction changes and the axis moves at the second-phase speed while the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the negative direction at the second-phase speed while the home switch is ON. The motion direction changes and the axis moves at the second-phase speed while the home switch is OFF. And where the first Z pulse is met is the home position.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed while the home switch is OFF and the negative limit switch is ON. The axis moves at the second-phase speed and where the first Z pulse is met is the home position when the home switch is ON.

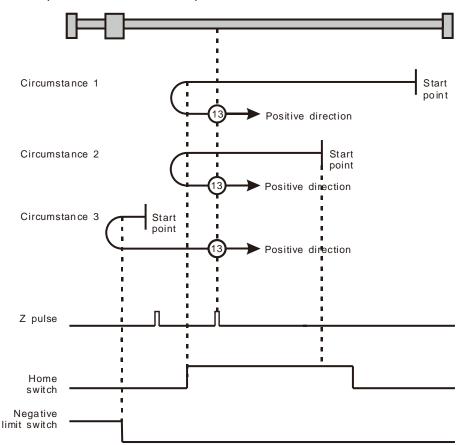

Homing depending on the home switch, negative limit switch and Z pulse (13: mode 13)

**Circumstance 1**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The axis moves at the second-phase speed once the home switch is ON. And where the first Z pulse is met is the home position while the home switch is OFF.

- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the negative direction at the second-phase speed while the home switch is ON. Where the first Z pulse is met is the home position while the home switch is OFF.
- **Circumstance 3**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the first-phase speed while the home switch is OFF and the negative limit switch is ON. The motion direction changes again and the axis moves at the second-phase speed when the home switch is ON. Where the first Z pulse is met is the home position while the home switch is OFF.

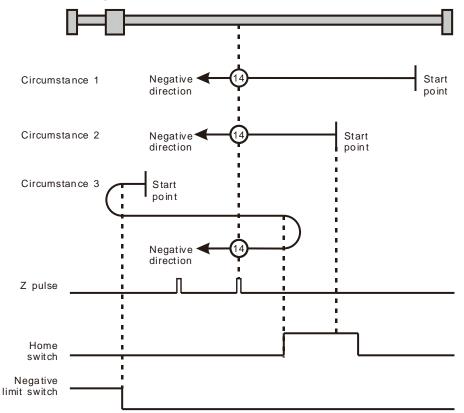


Homing depending on the home switch, negative limit switch and Z pulse ((14): mode 14)

Mode 15 and mode 16 are reserved for future development.

Mode 17~mode 30 Homing which has nothing to do with Z pulse


In mode 17~mode 30 which are respectively similar to mode1~mode 14 mentioned previously, the axis has nothing to do with Z pulse but the relevant home switch and limit switch status while returning to the home position. Mode 17 is similar to mode 1, mode 18 is similar to mode 2, mode 19 & mode 20 is similar to mode 3, mode 21 & mode 22 is similar to mode 5, mode 23 & mode 24 is similar to mode 7, mode 25 & mode 26 is similar to mode 9, mode 27 & mode 28 is similar to mode 11, and mode 29 & mode 30 are similar to 13.

- Mode 17 Homing which depends on the negative limit switch
  - **Circumstance 1**: MC\_Home instruction is executed when the negative limit switch is OFF and the axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the axis encounters that the negative limit switch is ON. Where the servo is when the negative limit switch is OFF is the home position.
  - **Circumstance 2**: MC\_Home instruction is executed when the negative limit switch is ON and the axis moves in the positive direction at the second-phase speed. Where the servo is is the home position when the negative limit switch is OFF.

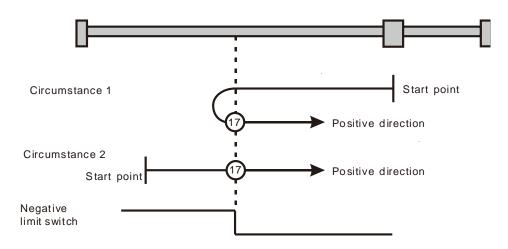


Homing depending on the negative limit switch ( $\bigcirc$ : mode 17)

- > Mode 18 Homing which depends on the positive limit switch
  - **Circumstance 1**: MC\_Home instruction is executed when the positive limit switch is OFF and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the axis encounters that the positive limit switch is ON. Where the servo is is the home position while the positive limit switch is OFF.
  - **Circumstance 2**: MC\_Home instruction is executed when the positive limit switch is ON and the axis moves in the negative direction at the second-phase speed. Where the servo is is the home position while the positive limit switch is OFF.

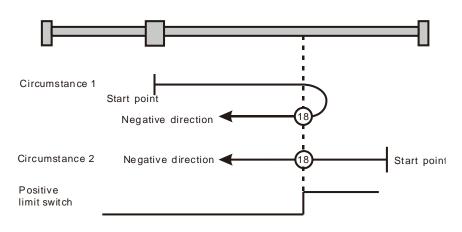


Homing depending on the positive limit switch (1: mode 18)

- **Circumstance 1**: MC\_Home instruction is executed and the axis moves in the positive direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the second-phase speed once the home switch becomes ON. And where the axis stands is the home position at the moment the home switch becomes OFF.
- **Circumstance 2**: MC\_Home instruction is executed and the axis directly moves in the negative direction at the second-phase speed while the home switch is ON. And where the axis stands is the home position at the moment when the home switch becomes OFF.

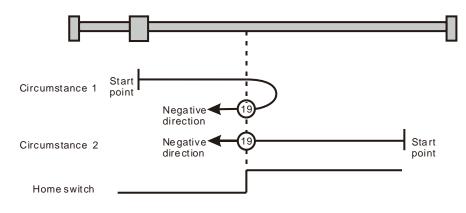


Homing depending on the home switch ((19): mode 19)

- Mode 20
  - **Circumstance 1**: MC\_Home instruction is executed when the home switch is OFF and the axis moves in the positive direction at the first-phase speed. Where the servo is is the home position when the home switch is ON.
  - **Circumstance 2**: MC\_Home instruction is executed when the home switch is ON and the axis moves in the negative direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch becomes OFF. Where the servo is is the home position when the home switch is ON.

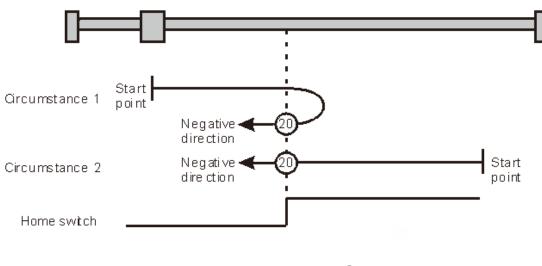


- **Circumstance 1**: MC\_Home instruction is executed and the axis moves in the negative direction at the first-phase speed while the home switch is OFF. The motion direction changes and the axis moves at the second-phase speed once the home switch becomes ON. And where the axis stands is the home position at the moment the home switch becomes OFF.
- **Circumstance 2**: MC\_Home instruction is executed and the axis moves in the positive direction at the second-phase speed while the home switch is ON. And where the axis stands is the home position at the moment the home switch becomes OFF.

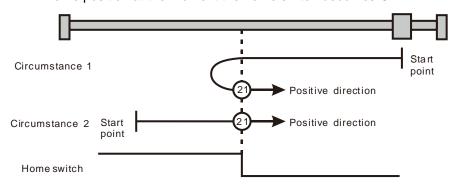

Homing depending on the home switch (2): mode 21)

#### Mode 22


- **Circumstance 1**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the positive direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed once the home switch becomes OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is OFF and the axis moves in the negative direction at the first-phase speed. Where the axis stands is the home position when the home switch becomes ON.

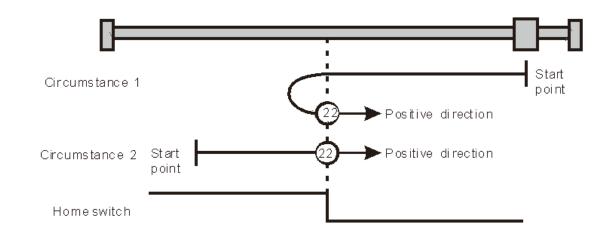

Homing depending on the home switch (  $\mathfrak{Q}$  : mode 22).


Homing depending on the home switch (2: mode 22)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed once the home switch becomes ON. Where the axis stands is the home position when the home switch is OFF.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the negative direction at the second-phase speed. And where the axis stands is the home position when the home switch becomes OFF.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. When the home switch is ON, the axis starts to move at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.

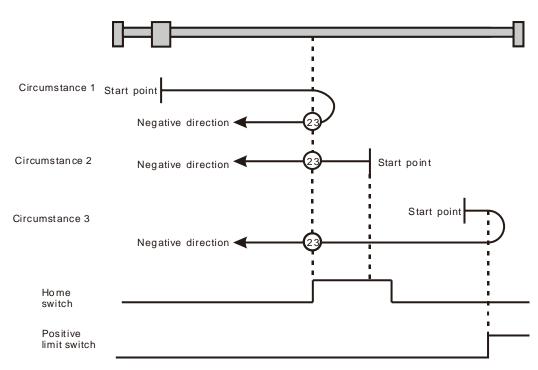


Homing depending on the home switch and positive limit switch (23: mode 23)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the positive direction at the first-phase speed. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the negative direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. When the home switch is ON, the axis still moves at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the axis moves at the first-phase speed when the axis moves at the first-phase speed when the switch is ON. When the home switch is ON, the axis still moves at the first-phase speed when the axis moves at the first-phase speed when the axis moves at the first-phase speed when the axis moves at the first-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.

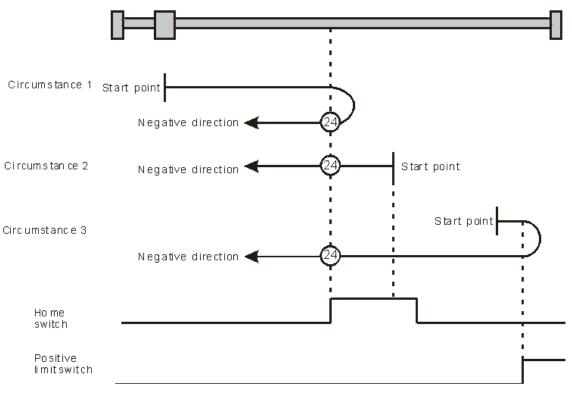


Homing depending on the home switch and positive limit switch (24: mode 24)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the positive direction at the first-phase speed. The axis moves at the second-phase speed when the home switch is ON. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the positive direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. Where the axis stands is the home position when the home switch is ON.

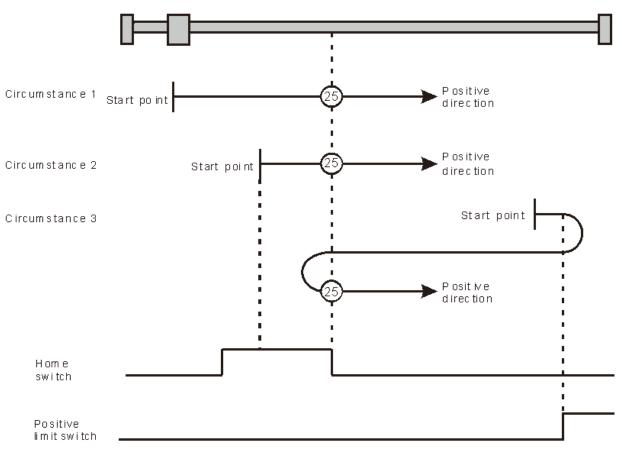


#### Homing depending on the home switch and positive limit switch (25: mode 25)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the positive direction at the first-phase speed. The axis moves at the second-phase speed when the home switch is ON. Where the axis stands is the home position when the home switch is OFF.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the positive direction at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the positive direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the positive limit switch is ON. The motion direction changes again and the axis moves at the second-phase speed when the home switch is ON. Where the axis stands is the home position when the home switch is OFF.

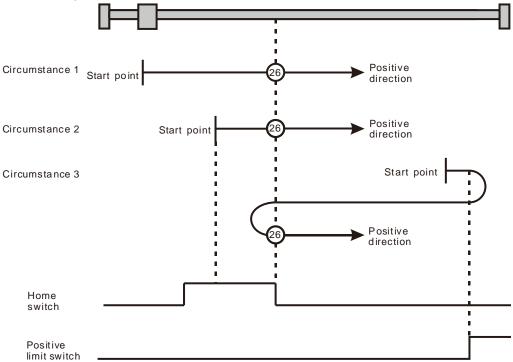


Homing depending on the home switch and positive limit switch (26): mode 26)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is ON. Where the axis stands is the home position when the home switch is OFF.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the positive direction at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the negative limit switch is ON. When the home switch is ON, the axis starts to move at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.

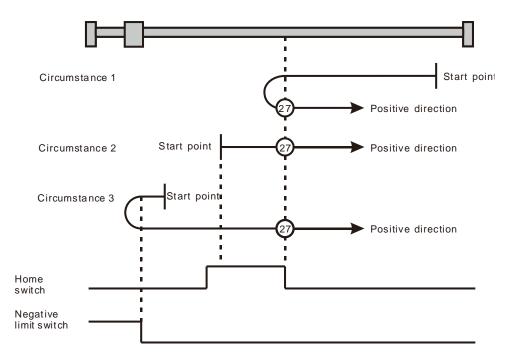


Homing depending on the home switch and negative limit switch ( $\overline{Q}$ ): mode 27)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the negative direction at the first-phase speed. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the positive direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the negative limit switch is ON. When the home switch is ON, the axis still moves at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the axis moves at the first-phase speed when the axis moves at the first-phase speed when the axis still moves at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.

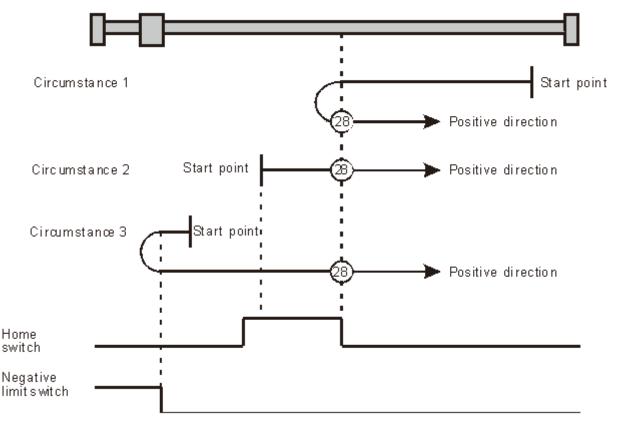


Homing depending on the home switch and negative limit switch (28: mode 28)

- **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the negative direction at the first-phase speed. When the home switch is ON, the axis starts to move at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the negative direction at the second-phase speed. The motion direction changes and the axis moves at the second-phase speed when the home switch is OFF. Where the axis stands is the home position when the home switch is ON.
- **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the negative limit switch is ON. Where the axis stands is the home position when the home switch is ON.

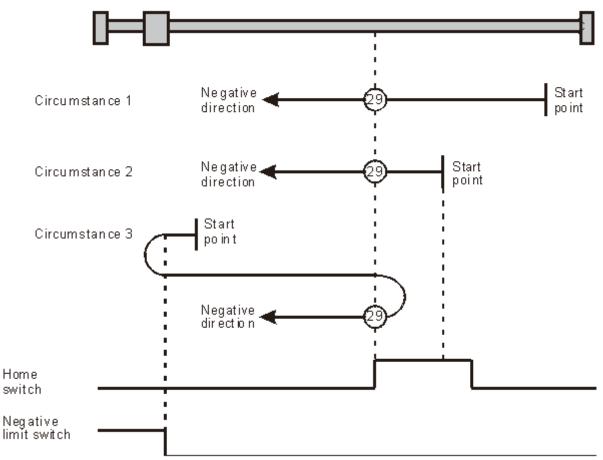

Homing depending on the home switch and negative limit switch (29: mode 29)

- Mode 30
  - **Circumstance 1**: MC\_Home instruction is executed while the home switch is OFF and the axis starts to move in the negative direction at the first-phase speed. When the home switch is ON, the axis starts to move at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.
  - **Circumstance 2**: MC\_Home instruction is executed while the home switch is ON and the axis moves in the negative direction at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.
  - **Circumstance 3**: MC\_Home instruction is executed while the home switch is OFF. The axis moves in the negative direction at the first-phase speed. The motion direction changes and the axis moves at the first-phase speed when the home switch is OFF and the negative limit switch is ON. When the home switch is ON, the motion direction changes again and the axis moves at the second-phase speed. Where the axis stands is the home position when the home switch is OFF.

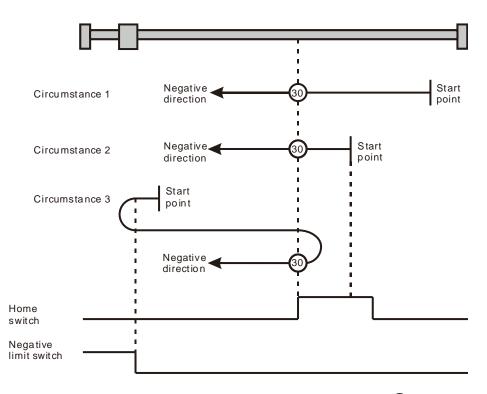

Homing depending on the home switch and negative limit switch ( $\mathfrak{Y}$ : mode 30)


Mode 31 and mode 32 Reserved for future development.

Mode 33 ~ mode 34 Homing which depends on Z pulse

#### Mode 33

In mode 33, MC\_Home instruction is executed and the axis moves at the second-phase speed in the negative direction. And the place where the axis stands is the home position once the first Z pulse is met. Mode 34

In mode 34, MC\_Home instruction is executed and the axis moves at the second-phase speed in the positive direction. And the place where the axis stands is the home position once the first Z pulse is met.

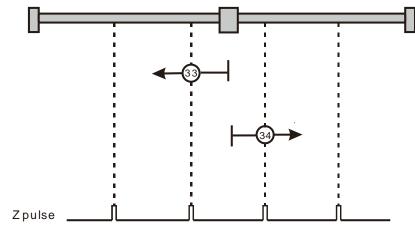

Homing depending on Z pulse (33: mode 33, 34: mode 34)

Mode 35 Homing which depends on the current position

In mode 35, MC\_Home instruction is executed, the axis does not move and its current position is regarded as the home position.

MEMO



# Appendix E List of Accessories

## Table of Contents

E.1	Accessories for CANopen Communication	E-2
E.2	Accessories for DeviceNet Communication	E-4

## E.1 Accessories for CANopen Communication

• Cables

Figure	Model	Length	Diameter ( AWG )
	UC-DN01Z-01A	305M	2#15 $\cdot$ 2#18 SHLD PVC ( Thick cable )
	UC-DN01Z-02A	305M	2#22 $\cdot$ 2#24 SHLD PVC ( Thin cable )
	UC-CMC003-01A	0.3M	4#26 · 1#24 PVC(Thin cable)
	UC-CMC005-01A	0.5M	4#26 · 1#24 PVC(Thin cable)
	UC-CMC010-01A	1.0M	4#26 · 1#24 PVC(Thin cable)
	UC-CMC015-01A	1.5M	4#26 · 1#24 PVC(Thin cable)
	UC-CMC020-01A	2.0M	4#26 · 1#24 PVC(Thin cable)
	UC-CMC030-01A	3.0M	4#26 · 1#24 PVC ( Thin cable )
	UC-CMC050-01A	5.0M	4#26 $\cdot$ 1#24 PVC ( Thin cable )
	UC-CMC100-01A	10.0M	4#26 · 1#24 PVC ( Thin cable )
	UC-CMC200-01A	20.0M	4#26 · 1#24 PVC ( Thin cable )

#### Notes:


- 1. The maximum cable length for purchase is 305M per reel and mimimum length is 1M with metre as the unit.
- 2. UC-DN01Z-01A and UC-DN01Z-02A can be used as the main-line cable as well as the branch-line cable. The maximum communication distances that they support are different. The maximum communication distances the two cables support at different CANopen transmission speed are displayed as follows.

CANopen transmission speed ( bit/s )	125K	250K	500K	1M
Max. communication distance for UC- DN01Z-01A (m)	500	250	100	40
Max. communication distance for UC- DN01Z-02A (m)	100	100	100	40

3. The maximum communication distance at a transmission speed is regulated in the CANopen protocol. The relationships between maximum communication distances and transmission speeds are shown in the following table.

Transmission speed ( bit/s )	10K	20K	50K	125K	250K	500K	800K	1M
Max. communication distance (m)	5000	2500	1000	500	250	100	50	40

#### • Distribution box

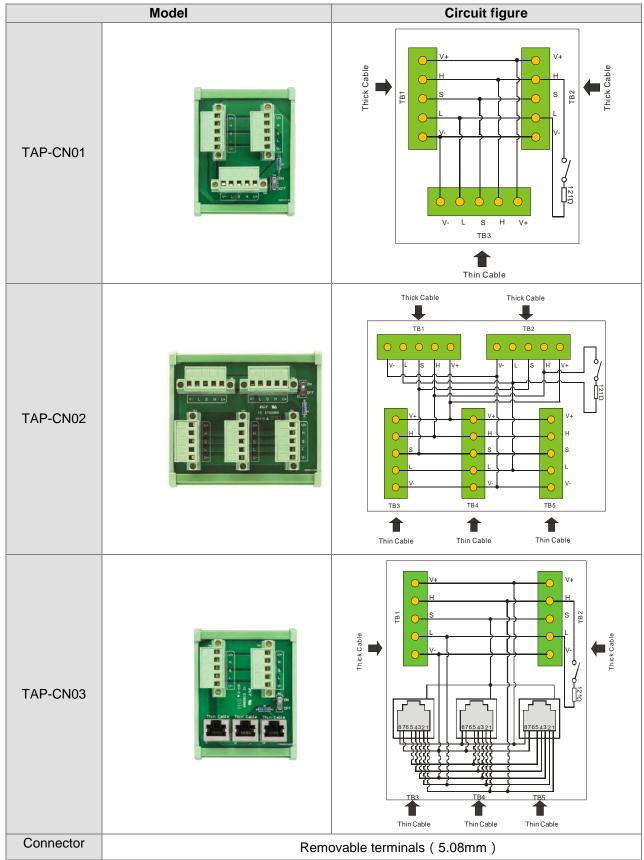

Е

Model		Circuit figure
Terminal resistor		120Ω

#### Terminal resistor

As suggested in the CANopen protocol, the two ends of the CANopen communication cable should connect a terminal resistor of  $120\Omega$  (1/4W) respectively in order to match the impedance of the communication signal and reduce the signal reflection interference in normal signal transmission.

- The terminal resistor connected to the start of the cable: The terminal resistor on the distribution box can be used just by setting the terminal resistor switch to ON.
- The terminal resistor connected to the terminal end of the cable: A terminal resistor TAP-TR01 is needed for connecting to the other end of the cable.
- The model of a terminal resistor: TAP-TR01, resistance value: 120Ω (1/4W) as shown below



## E.2 Accessories for DeviceNet Communication

• Cable

Figure	Model	Length	Diameter ( AWG )
	UC-DN01Z-01A	305M	2#15 · 2#18 SHLD PVC (Thick)
	UC-DN01Z-02A	305M	2#22 · 2#24 SHLD PVC (Thin)

#### Notes:

- 1. The maximum cable length for purchase is 305M per reel and mimimum length is 1M with metre as the unit.
- 2. UC-DN01Z-01A and UC-DN01Z-02A can be used as the main-line cable as well as the branch-line cable. The maximum communication distances that they support are different.

The maximum communication distances the two cables support at different DeviceNet transmission speed are displayed as follows.

DeviceNet transmission speed ( bit/s )	125K	250K	500K
Max. communication distance for UC- DN01Z-01A (m)	500	250	100
Max. communication distance for UC- DN01Z-02A (m)	100	100	100

3. The maximum communication distance at a transmission speed is regulated in the DeviceNet protocol. The relationships between maximum communication distances and transmission speeds are shown in the following table.

Transmission speed (bit/s)	10K	20K	50K	125K	250K	500K
Max. communication distance (m)	5000	2500	1000	500	250	100

#### • Distribution box

	Model	Circuit figure
TAP-CN01		Thin Cable
TAP-CN02		Thick Cable TB1 TB1 TB1 TB2 TB1 TB2 TB2 TB2 TB2 TB2 TB2 TB2 TB2
TAP-CP01 (Power distribution box )		Thick/Trin Cable
Connector	Re	emovable terminals ( 5.08mm )
Terminal resistor		120Ω

Ε

#### • Terminal resistor

As required in the DeviceNet protocol, the two ends of the DeviceNet communication cable should connect a terminal resistor of  $120\Omega$  (1/4W) respectively.

- The terminal resistor connected to the start of the cable: The terminal resistor on the distribution box can be used by setting the terminal resistor switch to ON.
- 2. The terminal resistor connected to the terminal end of the cable: A terminal resistor of  $120\Omega$  (1/4W) is needed for connecting to the terminal end of the cable.